

July 15, 2025

File: PE5304-LET.01

**Double Deck Regional Inc. c/o Regional Group**1737 Woodward Drive, 2<sup>nd</sup> Floor
Ottawa, Ontario
K2C 0P9

Attention: Ms. Stefanie Kaminski

Subject: Phase I - Environmental Site Assessment Update Noise and Vibration Studies

560 Hazeldean Road

Ottawa, Ontario

Consulting Engineers

9 Auriga Drive Ottawa, Ontario K2E 7T9 Tel: (613) 226-7381

Geotechnical Engineering
Environmental Engineering
Hydrogeology
Materials Testing
Building Science
Rural Development Design
Retaining Wall Design

patersongroup.ca

Dear Madam.

Further to your request and authorization, Paterson Group (Paterson) carried out a Phase I – Environmental Site Assessment (Phase I ESA) Update for the aforementioned site (Phase I Property). This report updates a previous Phase I ESA, completed by Paterson in May 2021.

This letter report is intended to meet the requirements for an updated Phase I ESA, as per Ontario Regulation 153/04, and is to be read in conjunction with the previous 2021 Phase I ESA report.

## 1.0 Site Information


The Phase I Property is located on the south side of Hazeldean Road, approximately 150 metres east of Mantra Street, in the City of Ottawa, Ontario. The site is currently occupied by a golf driving range, with a small pro shop structure and associated parking lot. The Phase I Property is situated within a suburban setting consisting of residential and commercial properties.

## 2.0 Previous Engineering Reports

A summary of the previous engineering reports is provided below:

"Phase I - Environmental Site Assessment, 560 Hazeldean Road, Ottawa, Ontario" prepared by Paterson Group Inc. (Report No. PE5304-1, dated May 25, 2021).

Toronto Ottawa North Bay



File: PE5304-LET.01

According to historical research conducted as part of the 2021 Phase I ESA, the Phase I Property was historically utilized for agricultural purposes until initially developed with a golf driving range and pro shop circa 2001. The surrounding lands were similarly utilized for agricultural purposes until developed for residential and commercial use in the early 2000's.

Based on the historical research, in conjunction with the findings of the site inspection, two (2) potentially contaminating activities (PCAs) were identified on the Phase I Property, resulting in areas of potential environmental concern (APECs). These APECs are listed as follows:

APEC #1 – The presence of two (2) aboveground fuel storage tanks, located in the northwestern portion of the Phase I Property, adjacent to the south side of the subject building.

APEC #2 – The presence of a pole-mounted electrical transformer, located in the northwestern portion of the Phase I Property, adjacent to the main vehicle parking lot.

The findings of the assessment concluded that a Phase II ESA was recommended to address these APECs on the Phase I Property.

## 3.0 Historical Records Review

## **Phase I ESA Study Area Determination**


A radius of approximately 250 m was deemed appropriate for defining the study area for this assignment (Phase I Study Area). Properties located outside of the Phase I Study Area are not considered to have had the potential to impact the Phase I Property, based on their significant distances away from the site.

## **First Developed Use Determination**

Based on a review of available historical information, the Phase I Property was historically vacant and used for agricultural purposes until first developed for commercial purposes with the existing golf driving range circa 2001.

## **National Pollutant Release Inventory**

A search of the National Pollutant Release Inventory (NPRI) database was conducted as part of this assessment. This federally managed database provides various reports and tracking information relating to the release of solid, liquid, or gaseous pollutants from industrial facilities into the natural environment.



A search of this database did not identify any pollutant release records pertaining to the Phase I Property or any properties situated within the Phase I Study Area.

## **Ontario PCB Waste Storage Site Inventory**

The Ontario Ministry of Environment, Conservation and Parks document entitled, "Ontario Inventory of PCB Storage Sites, April 1995" was reviewed as part of this assessment. This document identifies all recorded active and closed PCB waste storage sites situated in the Province of Ontario.

A review of this document did not identify any former PCB waste storage sites situated on the Phase I Property or within the Phase I Study Area.

## **MECP Waste Disposal Site Inventory**

The Ontario Ministry of Environment, Conservation and Parks document entitled, "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of this assessment. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants, and coal tar distillation plants situated in the Province of Ontario.

A review of this document did not identify any such sites situated on the Phase I Property or within the Phase I Study Area.

## **MECP Coal Gasification Plant Inventory**

The Ontario Ministry of Environment, Conservation and Parks document entitled, "Municipal Coal Gasification Plant Site Inventory, 1991" was reviewed as part of this assessment. This document provides a reference to the locations of former plants with respect to the Phase I Property.

A review of this document did not identify any former coal gasification plants located on the Phase I Property or within the Phase I Study Area.

#### **MECP Instruments**

As part of this assessment, a request was submitted to the MECP Freedom of Information office for information with respect to certificates of approval, permits to take water, certificates of property use, or any other similar MECP issued instruments for the Phase I Property. The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.



Ms. Stefanie Kaminski

File: PE5304-LET.01

#### **MECP Submissions**

As part of this assessment, a request was submitted to the MECP Freedom of Information office for information with respect to reports related to environmental conditions for the Phase I Property. The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.

## **MECP Waste Management Records**

As part of this assessment, a request was submitted to the MECP Freedom of Information office for information with respect to waste management records for the Phase I Property. The response from the MECP indicated that no relevant records were identified pertaining to the Phase I Property.

## **MECP Incident Reports**

As part of this assessment, a request was submitted to the MECP Freedom of Information office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, or inspections maintained by the MECP for the Phase I Property or any of the neighbouring properties. The response from the MECP indicated that one incident record was available for the Phase I Property. The record describes a water main break which occurred on July 22, 2008 and discharged water into a tributary of the Carp River immediately to the north of the Phase I Property. The record indicates that no environmental impact was anticipated and that no remedial work would be required.


## **MECP Brownfields Environmental Site Registry**

A search of the MECP Brownfields Environmental Site Registry was conducted as part of this assessment. This database contains publicly available information on Records of Site Condition (RSCs) filed in the Province of Ontario since 2004.

A review of the registry did not identify any Records of Site Condition (RSCs) filed for the Phase I Property or for any properties situated within the Phase I Study Area.

#### **OMNRF Areas of Natural and Scientific Interest**

A search for areas of natural and scientific interest situated within the Phase I Study Area was conducted electronically via the Ontario Ministry of Natural Resources and Forestry (OMNRF) website. The search did not identify any natural features of areas of natural significance within the Phase I Study Area.



## Technical Standards and Safety Authority (TSSA)

The TSSA Fuels Safety Branch in Toronto was contacted electronically, as part of this assessment, to inquire about current and former fuel storage tanks, spills, and historical incidents for the Phase I Property as well as the neighbouring properties.

The response from the TSSA indicated that no relevant records were identified pertaining to the Phase I Property. One record was returned identifying a propane cylinder exchange program for the Rona+ hardware store approximately 240 m west of the Phase I Property. Given the volatile nature of propane fuel, as well as its separation distance, this activity is not considered to pose an environmental concern to the Phase I Property. A copy of the correspondence with the TSSA has been appended to this letter.

## City of Ottawa Historical Land Use Inventory (HLUI) Database

As part of this assessment, a requisition form was submitted to the City of Ottawa to request information from the City's Historical Land Use Inventory (HLUI) database for any environmental records pertaining to the Phase I Property as well as any properties situated within the Phase I Study Area.

The response from the City indicated that no records were identified pertaining to the Phase I Property.

## **City of Ottawa Former Landfill Sites**

The document prepared by Golder Associates entitled, "Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa", was reviewed as part of this assessment. This document identifies the details and locations of all recorded former landfill sites situated in the City of Ottawa.

A review of this document did not identify any former landfill sites situated on the Phase I Property or within the Phase I Study Area.

## **Aerial Photographs**

The most recent aerial photograph reviewed in the 2021 Phase I ESA report was taken in 2019. For this update, a more recent aerial photograph, taken in 2024, was reviewed as part of this assessment.

In the 2024 aerial photograph, no significant changes were apparent with respect to the Phase I Property since the time of the previous 2019 aerial photograph, though much of the neighbouring lands to the south appear to have been developed with low-density residential housing.



Ms. Stefanie Kaminski

Page 6

File: PE5304-LET.01

The Phase I Property and the surrounding lands appear in this photograph as they exist today. A copy of the 2024 aerial photograph has been appended to this letter.

#### **Water Bodies**

No water bodies are present on the Phase I Property. The nearest named water body with respect to the Phase I Property is the Carp River, located approximately 20 m to the east.

## **Geological Maps**

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment.

Based on the available geological mapping information, the bedrock within the area of the Phase I Property consists of interbedded limestone and dolomite of the Gull River Formation, whereas the surficial geology consists of offshore marine sediments (clay and silt) with an overburden thickness ranging from approximately 5 m to 10 m.

## **Topographic Maps**

A topographic map of the Phase I Property was obtained from the Natural Resources Canada – The Atlas of Canada website and reviewed as part of this assessment.


The topographic map indicates that the general elevation of the Phase I Property is approximately 95 m above sea level, while the regional topography within the greater area is depicted as sloping downwards to the north, in the general direction of the Carp River.

An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this letter.

## **Physiographic Maps**

A physiographic map was obtained from the Natural Resources Canada – The Atlas of Canada website and reviewed as a part of this assessment.

According to the publication and available mapping information, the Phase I Property is situated within the St. Lawrence Lowlands. According to the description provided: "...the lowlands are plain-like areas that were affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets." The Phase I Property is specifically located within the Central St. Lawrence Lowland area, which is rarely more than 150 m above sea level.



#### **MECP Water Well Records**

A search of the MECP Well Records website was conducted as part of this assessment. This database provides information for all recorded water wells installed within the Province of Ontario.

A search of the database identified 4 well records situated within the Phase I Study Area. One of the records pertains to wells installed on the Phase I Property in October 2021 as part of a preliminary Phase II ESA program completed by Paterson Group. The remaining records pertain to wells installed between 1960 and 2020 and used for either commercial or domestic household purposes. Given the presence of municipal services, no potable water wells are anticipated to remain in use within the Phase I Study Area.

According to the well records, the overburden stratigraphy in the general area of the Phase I Property consists of topsoil underlain by clay. Bedrock, consisting of limestone, was typically encountered at depths ranging from approximately 7 m to 10 m below ground surface.

### **Personal Interview**


Ms. Lisa Haime, the current property owner, was available at the time of the site inspection to respond to questions regarding the history of the Phase I Property.

According to Ms. Haime, the Phase I Property has been owned by her family since 2000 and was initially developed with the existing golf driving range in 2001. Ms. Haime stated that two aboveground fuel storage tanks are maintained on-site, though there have been no reported spills or leaks since their installation on-site in 2005.

Ms. Haime stated that she was unaware of any potential environmental concerns associated with the historical or current use of the Phase I Property.

## 4.0 Site Reconnaissance

The site inspection was conducted on April 15, 2025, between 8:00 AM and 9:00 AM, by personnel from Paterson's environmental department. In addition to the Phase I Property, the present-day uses of the neighbouring properties within the Phase I Study Area were also assessed at the time of the site inspection.



#### **Exterior Assessment**

## **Site Description**

At the time of the site inspection, the Phase I Property was observed to be occupied by a one-storey commercial retail building, currently utilized as a golf driving range pro shop. The remainder of the Phase I Property is largely landscaped with grass lawns, a golf driving range, and occasional mature trees.

The Phase I Property is considered to be slightly below grade with respect to Hazeldean Road, as well as the adjacent properties. The site topography is relatively flat, whereas the regional topography slopes very gently down towards the northeast, in the general direction of the Carp River.

Water drainage on the subject site occurs primarily via infiltration throughout the property, as well as via surface run-off towards a drainage ditch present along Hazeldean Road. No ponded water, stressed vegetation, or any other indications of potential sub-surface contamination were observed on-site at the time of the site inspection.

## **Buildings and Structures**


At the time of the site inspection, the Phase I Property was occupied by a one-storey commercial retail building, currently utilized as a golf driving range pro shop. Built circa 2001, the building is constructed with wood framing, a poured slab-on-grade concrete foundation, and is finished on the exterior with vinyl siding and a sloped shingled roof. The building is currently heated via a natural gas-fired furnace, located inside a utility room.

### **Potential Environmental Concerns**

## ☐ Fuels and Chemical Storage

At the time of the site inspection, two aboveground fuel storage tanks were identified adjacent to the south side of the subject building. The tanks were each noted to be constructed and vacuum sealed with double-steel walls and contain a capacity for 1,360 litres of gasoline and coloured diesel fuel. The tanks were observed to be in good condition, with no signs of fuel leakage or corrosion visible on the exterior shell or underlying ground surface. In addition, the pressure gauges on the tanks were noted to display negative pressures, indicating that the interior vacuum seals were intact. Due to the potential for soil and/or groundwater impacts resulting from fuel leaks and/or spillages, these fuel tanks are considered to represent an APEC on the Phase I Property.

No other aboveground fuel storage tanks, or signs of underground fuel storage tanks were observed elsewhere on the exterior of the Phase I Property.



#### ☐ Hazardous Materials and Unidentified Substances

At the time of the site inspection, no hazardous materials, unidentified substances, spills, surficial staining, abnormal odours, stressed vegetation, or any other indications of potential sub-surface contamination were observed on the exterior of the Phase I Property.

## ☐ Polychlorinated Biphenyls (PCBs) and Transformer Oil

At the time of the site inspection, a pole mounted electrical transformer was identified in the northern portion of the main parking lot. The transformer was observed to be in good condition, with no signs of any cooling oil leakage or corrosion noted on the exterior shell.

Due to the potential for soil and/or groundwater impacts resulting from cooling oil leaks, this transformer is considered to represent an APEC on the Phase I Property.

## ☐ Waste Management

Solid, non-hazardous domestic waste and recyclable products are stored in plastic and metal bins on the exterior of the pro shop building and are collected by a licensed contractor on a regular basis. No environmental concerns were identified with respect to waste management practices on the Phase I Property.


#### **Interior Assessment**

A ge	eneral description of the interior of the pro shop building is as follows:
	The floors consist of poured concrete;
	The walls consist of drywall;
	The ceilings consist of drywall;
	Lighting throughout the building is provided by LED, incandescent, and fluorescentight fixtures.

## **Potentially Hazardous Building Materials**

## ☐ Asbestos Containing Materials (ACMs)

Based on the age of the subject building (c.2001), no asbestos containing building materials are suspected to be present within the structure.



#### □ Lead-Based Paints

Based on the age of the subject building (c.2001), lead-based paints are not suspected to be present within the structure.

## □ Polychlorinated Biphenyls (PCBs)

At the time of the site inspection, no potential sources of PCBs were identified inside the subject building.

## ☐ Urea Formaldehyde Foam Insulation (UFFI)

Based on the age of the subject building (c.2001), UFFI is not suspected to be present within the structure.

#### Other Potential Environmental Concerns

## ☐ Fuels and Chemical Storage

At the time of the site inspection, no aboveground fuel storage tanks, or signs of underground fuel storage tanks were observed inside the subject building.

Chemical products stored within the subject building were observed to be limited to domestically available cleaning products, stored in their original containers. No environmental concerns were identified with respect to chemical storage practices on the Phase I Property.


## □ Ozone Depleting Substances (ODSs)

Potential sources of ODSs observed on-site include fire extinguishers, a refrigerator, and an exterior wall-mounted air conditioner unit. These appliances appeared to be in good condition at the time of the site inspection and should be regularly maintained by a licensed contractor.

## ☐ Wastewater Drainage

At the time of the inspection, no sump pits or floor drains were identified inside the subject building.

Wastewater (wash water and sewage) generated from the subject building is discharged into the City of Ottawa sanitary sewer system. Roof drainage is discharged via infiltration into the landscaped areas on the Phase I Property or via surface runoff towards catch basins located on the adjacent street. No concerns were noted with respect to any wastewater discharges on the Phase I Property.



## **Neighbouring Properties**

An inspection of the neighbouring properties was conducted from publicly accessible roadways at the time of the site inspection. Land use adjacent to the Phase I Property was observed as follows:

	North:	parkland;
	East:	The Carp River, followed by residential dwellings.
	South	Residential dwellings;
	West:	Residential dwellings (under construction), followed by vacant land.
٦	a ma dina m	montal apparent ware identified with respect to the surrent was of the

No environmental concerns were identified with respect to the current use of the neighbouring properties. Current land use within the Phase I Study Area is illustrated on Drawing PE5304-2R – Surrounding Land Use Plan, appended to this letter.

## 5.0 Review and Evaluation of Information

## **Land Use History**

Based on a review of available historical information, the Phase I Property was historically utilized as agricultural land until first developed with the existing golf driving range circa 2001. The Phase I Property has not changed significantly since that time.


## Potentially Contaminating Activities (PCAs)

Based on the findings of the Phase I ESA, two potentially contaminating activities (PCAs), resulting in areas of potential environmental concern (APECs), were identified on the Phase I Property.

As per Table 2 – Column A of O. Reg. 153/04, as amended, the PCAs resulting in APECs on the Phase I Property are described as follows:

Item 28: Gasoline and Associated Products Storage in Fixed Tanks; associated with
the presence of two (2) aboveground fuel storage tanks, located in the western portion
of the Phase I Property, adjacent to the south side of the subject building.

Item	<i>55:</i>	Transformer	Manufacturing,	Processing,	and	Use;	associated	with	the
prese	ence	of a pole-mou	nted electrical tr	ansformer loc	ated	in the	western port	ion of	the
Phas	еIР	roperty, adjac	ent to the main v	ehicle parkin	g lot.				



## **Areas of Potential Environmental Concern (APECs)**

The areas of potential environmental concern identified in this Phase I ESA are summarized below in Table 1:

Table 1 Areas of Potential	Environme	ental Concern			
Area of Potential Environmental Concern	Location of APEC on Phase I Property	Potentially Contaminating Activity (Table 2 – O. Reg. 153/04)	Location of PCA (On-Site or Off-Site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1  Existing Aboveground Fuel Storage Tanks	Western Portion of Phase I Property	"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"	On-Site	BTEX PHCs F <sub>1</sub> -F <sub>4</sub>	Soil and Groundwater
APEC 2  Existing Pole-Mounted Electrical Transformer	Western Portion of Phase I Property	"Item 55: Transformer Manufacturing, Processing, and Use"	On-Site	PHCs (F <sub>1</sub> -F <sub>4</sub> ) PAHs PCBs	Soil and Groundwater

## **Contaminants of Potential Concern (CPC)**

The contaminants of potential concern (CPCs) associated with the aforementioned APECs are considered to be:

Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX)
Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F <sub>1</sub> -F <sub>4</sub> ).
Polycyclic Aromatic Hydrocarbons (PAHs).
Polychlorinated Biphenyls (PCBs).

These CPCs have the potential to be present in the soil matrix (and/or the groundwater situated beneath the Phase I Property.

## 6.0 Conceptual Site Model

## **Geological and Hydrogeological Setting**

Based on the available geological mapping information, the bedrock within the area of the Phase I Property consists of interbedded limestone and dolomite of the Gull River Formation, whereas the surficial geology consists of offshore marine sediments (clay and silt) with an overburden thickness ranging from approximately 5 m to 10 m.



Ms. Stefanie Kaminski

Page 13

File: PE5304-LET.01

Groundwater is known to be encountered within the overburden and flow in an easterly direction towards the Carp River.

## **Existing Buildings and Structures**

The Phase I Property is currently occupied by a one-storey commercial building, currently utilized as a golf driving range pro shop. The building was constructed circa 2001 and has not changed significantly since that time.

#### Water Bodies and Areas of Natural and Scientific Interest

No water bodies are present on the Phase I Property.

The nearest named water body with respect to the Phase I Property is the Carp River, located approximately 20 m to the east.

## **Drinking Water Wells**

Based on the availability of municipal services, no potable groundwater wells are anticipated to be present within the Phase I Study Area.

## **Neighbouring Land Use**

The surrounding lands within the Phase I Study Area consist largely of residential and commercial properties. Current land use is depicted on Drawing PE5304-2R – Surrounding Land Use Plan, in the Figures section of this report.


## Potentially Contaminating Activities and Areas of Potential Environmental Concerns

Based on the findings of this Phase I ESA Update, two potentially contaminating activities (PCAs), considered to result in areas of potential environmental concern (APECs), were identified on the Phase I Property.

APEC #1 - The presence of two (2) aboveground fuel storage tanks, located in the northwestern portion of the Phase I Property, adjacent to the south side of the subject building.

APEC #2 - The presence of a pole-mounted electrical transformer, located in the northwestern portion of the Phase I Property, adjacent to the main vehicle parking lot.

No other existing or historical off-site PCAs were identified on properties situated within the Phase I Study Area.



#### **Contaminants of Potential Concern**

The contaminants of potential concern (CPCs) associated with the aforementioned APECs are considered to be:

Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX).

Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F<sub>1</sub>-F<sub>4</sub>).

Polycyclic Aromatic Hydrocarbons (PAHs).

Polychlorinated Biphenyls (PCBs).

These CPCs have the potential to be present in the soil matrix (and/or the groundwater situated beneath the Phase I Property.

## Assessment of Uncertainty and/or Absence of Information


The information available for review as part of the preparation of this Phase I ESA Update is considered to be sufficient to conclude that there are PCAs and APECs associated with the Phase I Property.

The presence of these PCAs was confirmed by a variety of independent sources, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

## 7.0 Conclusions and Recommendations

A review of more recent historical information, in combination with observations made during the site inspection, generally confirmed the findings presented in the 2021 and Phase I ESA report. Since that time, no significant changes have been made to the Phase I Property and no new potential environmental concerns were identified.

Based on the findings of the original 2021 Phase I ESA, in addition to this Phase I ESA Update, it is our opinion that a Phase II ESA will be required for the Phase I Property to address the APECs identified on-site.



## 8.0 Statement of Limitations

This Phase I - Environmental Site Assessment (Phase I ESA) Update report has been prepared in general accordance with Ontario Regulation 153/04, as amended, under the Environmental Protection Act. The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of this Phase I ESA Update are based on a review of readily available geological, historical, and regulatory information and a cursory review made at the time of the field assessment.

Should any conditions be encountered at the Phase I Property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of Double Deck Regional Inc. (c/o Regional Group). Permission and notification from Double Deck Regional Inc. (c/o Regional Group) and Paterson Group will be required prior to the release of this report to any other party.

## Paterson Group Inc.

N. Gullin

Nick Sullivan, B.Sc.



July 15, 2025

M.S. D'ARCY
90377839


Mark D'Arcy, P.Eng., QPESA

#### **Report Distribution**

- ☐ Double Deck Regional Inc. (c/o Regional Group)
- ☐ Paterson Group Inc.

#### **Attachments**

- ☐ Aerial Photograph (2024)
- ☐ Site Photographs (April 2025)
- ☐ MECP FOI Response Package
- ☐ HLUI Response Package
- ☐ TSSA Correspondence
- ☐ Figure 1 Key Plan
- ☐ Figure 2 Topographic Plan
- ☐ Drawing PE5304-1R Site Plan
- Drawing PE5304-2R Surrounding Land Use Plan

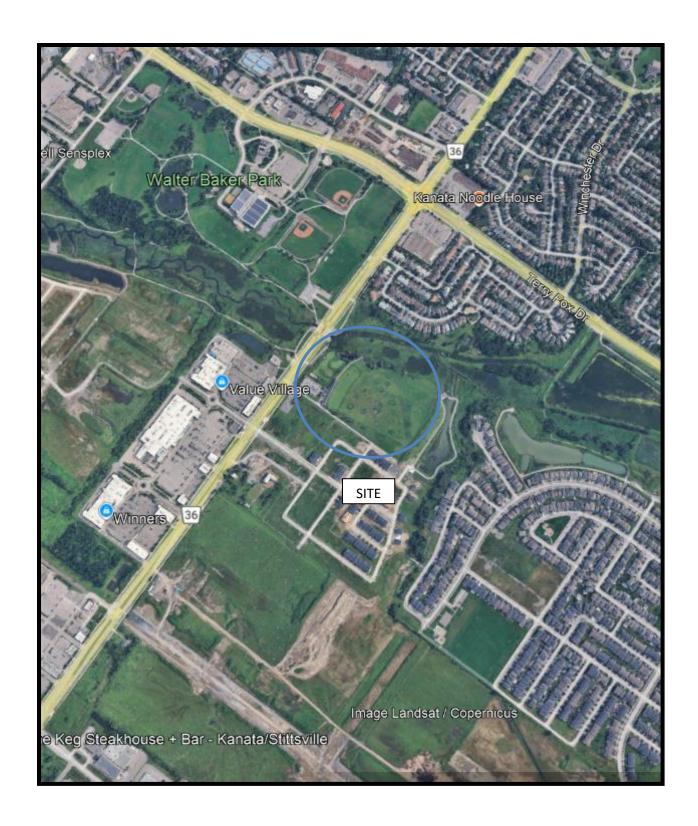

## AERIAL PHOTOGRAPH 2024





Photograph 1: View of the southeastern portion of the Phase I Property, facing northwest.



Photograph 2: View of the central portion of the Phase I Property, facing east.



560 Hazeldean Road, Ottawa, Ontario

April 15, 2025



**Photograph 3:** View of the gold driving range pro shop building, facing north.



**Photograph 4:** View of the aboveground fuel storage tanks, located within the southwestern portion of the Phase I Property, adjacent to the south side of the golf driving range pro shop building.



## Ministry of the Environment, Conservation and Parks

Corporate Services Branch 40 St. Clair Avenue West Toronto ON M4V 1M2

#### Ministère de l'Environnement, de la Protection de la nature et des Parcs

Direction des services ministériels 40, avenue St. Clair Ouest Toronto ON M4V 1M2



June 3, 2025

Nick Sullivan
Paterson Group
9 Auriga Drive
Ottawa, Alberta K2E 7T9
nsullivan@patersongroup.ca

Dear Nick Sullivan:

RE: MECP FOI A-2025-02736, Your Reference #: PE5304 – Record Release Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to:

560 Hazeldean Road, Ottawa

Time Period: 1986/01/01 to 2025/04/24

Your final fee payment was received by this office. If payment was not in Canadian dollars, please contact our office immediately.

Attached is a copy of the records.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at http://www.ipc.on.ca. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Christian Brodersen at christian.brodersen@ontario.ca.

Yours truly,

Christian Brodersen

for Josephine DeSouza Manager, Access and Privacy Office

Attachment



## **INCIDENT REPORT**

4330-7GTML5	File Storage Number:	SLOC KA HA 100
Incident Reporting	Module Type:	Other
(doc link)	Task Link:	4438-7GTN34 🖺
	Created by:	Tabatha Baker
e Number:	4330-7GTML5	
2008/07/23	Date Completed:	2008/11/26
	Bring Forward Reason:	
Closed		
Water - Ground & Surface	Activity:	Notifications
	Incident Reporting (doc link)  e Number:  2008/07/23  Closed	Incident Reporting   Module Type:

Environmental Compliance Report?  (legislation, certificate of approval, order, or guideline)  O Yes  O To be determined  Click here for Guidance	Ī	ls	th	İS	ş ;	aı	1	ai	r	е	n	ıİs	S	ic	n	(1	n	35	S	ur	e	d	٦r	n	10	de	lle	ed	)	or	٧	va	ıs	te	W	a	tε	r	(	se	٩V	/a	ge	e)	C	fis	sc	h	aı	rg	e	е	ΧC	е	eı	da	ın	C	е	th	а	ŧ١	۷i	Ü	06	ec	OI	m	е	рŧ	ırt	(	ρf	th	е			П							Ē
		Er	١V	ir	OI	٦r	n	er	ηt	a	(	20	'n	p	lia	n	¢e	F	₹	P	or	t?																																																															3
		//-			i.	<b>.</b>	~	<u>.</u>			rí	ifi		٠.		æ	٠.				പ		\r	ماد		_			id	ام	in																																																						3
		(ic	y				اب	!!,			1 6				1	/! 	91	1		,,,	aı		/!!	JC		Ü		ju	ıu	C!	HH	Ε,	!																																																				3
	K	0	Υ	e	s											)	N	o									(	)	T	0	b	е	d	et	er	'n	iir	ne	d																									C	1	îc	k	(	ל	2/	e	1	б	r	(	3	u	ic	le	71	7(	Cſ	e		3

### **Caller or PO Information**

Reported By:		Name of Company:	
First Name Chris	Last Name Hamilton	City of Ottawa	
Contact Mailing Address			
Civic Address:			Unit Identifier:
Delivery Designator:			Delivery Identifier:
Municipality:	Postal Station:	Province/State:	Postal Code:
Ottawa		Ontario	
Telephone Number:	Extension:	Other Number:	Email Address:
(613)580-2424	22280		
Reported By:			

### **MOE** Information

Date & Time Reported to MOE:	2008/07/23 11:08		
Office Receiving Incident Report:	Spills Action Centre		
Incident Info Received By:	Tabatha Baker		
MOE Response:	No Field Response	Site Region:	Eastern
Date & Time of MOE Arrival at Scene:			
Master Incident Report Number:			

SAC Action Class:	Notifications	
Non-Standard Procedure:	No	
ERP Call-out Initiated:	No	

## Client(s)

### Client Details

City of Ottawa

Mailing Address: 101 Centrepointe Dr, Nepean, Ontario, Canada, K2G 5K7
Physical Address: 101 Centrepointe Dr, Ottawa, City, Ontario, Canada, K2G 5K7
Telephone: (613)580-2424, Extension: 41305, FAX: (613)580-2718, email: raymond.duffy@ottawa.ca

Client #: 6737-4XLK2Z, Client Type: Municipal Government

### Site(s)

## Site Details 560 Hazeldean Road, Kanata<UNOFFICIAL> Address: Lot: , Part: , 560 Hazeldean Road, Kanata, Ottawa, City, District Office: Ottawa

#### **Incident Information**

caller is reporting a watermain break that occurred 2008/07/22 at approx. 19:00. Caller advises that the water is going into the Carp Ditch which is the end of the Carp River system. The watermain broke between the road and the ditch. At 19:30 they started to dechlorinate the water with sodium thiosulfate pucks. This discharge is still ongoing but they have throttled down (decreased the flow) so that the flow was not as night. Caller reports that last night the initial flow was approx. at 10sec/5 gal on a 24in watermain. Caller advises that there is no chance of infiltration or loss of pressure. Caller advises there is a marsh/meadow area beside the ditch. Silt management is taking place as they have made a dam out of clear stone and will have 10 strawbails delivered to the site. Chlorination was at 2mg/L and the residuals at the site were unknown at this time.	Incident Summary:	Ottawa: Water main break to Carp Ditch cannot be longer than 60 characters
	Incident Description:	going into the Carp Ditch which is the end of the Carp River system. The watermain broke between the road and the ditch. At 19:30 they started to dechlorinate the water with sodium thiosulfate pucks. This discharge is still ongoing but they have throttled down (decreased the flow) so that the flow was not as night. Caller reports that last night the initial flow was approx. at 10sec/5 gal on a 24in watermain. Caller advises that there is no chance of infiltration or loss of pressure. Caller advises there is a marsh/meadow area beside the ditch. Silt management is taking place as they have made a dam out of clear stone and will have 10 strawbails delivered to

Attachments, Links &	
Attachments, Links &	
Comments:	
CUMMITERIES.	

Date & Time of Incident	Incident Date Confirm 2008/07/22 19:00	ation? Actual						
Source Type:	Other		Se	ector Type:				
Nearest Watercourse:				atershed Cate	gory			
Environmental Impact:	Not Anticipated							
Nature of Impact:	Other Impact(s)							
Incident Cause:	Other Discharges		Inc	cident Reason	:			
Damaged Party:	No							
	(	Contaminant	s Table					
Contaminant	Name	Code	IIN#	Limit	Quantity	[units]	[fred]	1

WATER		99						
Controller of Material:	City of Ottawa		O	wner of Mate	rial:	City of Ottawa		
Estimated Clean Up Cost:		Who Cleaned Up:						
% Clean Up:	0 %		A	gencies Invol	lved:			
oluntary / Mandatory Ab								
s there Voluntary Abatem	nent Activity?	○ Yes		● No		○ To be de	termined	
oluntary / Mandatory Com	npliance Items		D-4-	844-1-	-1!-4			
Type Parent RefNo Work S	ummary (may be truncated)		Date	Attair	nList			
ffence(s)								
Suspected Violation (s)/Offence	ə(s):							
Act - Regulation - Section,								
Description General Offence}								
		***************************************	************		***************************************			
Provincial Officer:								
Name:	Bryan Dickman							
Badge No:	580							
Work Unit:								
District/Area Office: Date:	Ottawa District Off 2008/11/18	ic <del>e</del>						
Signature:	2000/11/10	O m						
Signature:	29 A	*/						
			ege et etter et e etteretetet					
		Santi Maria						
Area Supervisor:								
Name:	Paul Kehoe							
Work Unit:								
District/Area Office:								
Date:	2008/11/26							
Signature:								

Paul Kehol.



File Number: D06-03-25-0038

June 9th, 2025

Nick Sullivan
Paterson Group

Sent via email: nsullivan@patersongroup.ca

Dear Nick Sullivan,

Re: Information Request

560 Hazeldean Ottawa, Ontario ("Subject Property")

## **Internal Department Circulation:**

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

- **Environmental Remediation Unit:** The City's Environmental Remediation Unit (ERU) does not have any environmental records for this property.
- Ottawa Public Health Environmental Health: all public inspection results are publicly available on the Ottawa Public Health website: <a href="https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx">https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx</a>
- Sewer Use Program: No records found for this property.
- Solid Waste Services: No records found for this property.

### **Documents Provided:**

## **HLUI Summary Report and HLUI Map**

The HLUI Summary Report Excel spreadsheet identifies HLUI area, point and line features within 250 metres of the Subject Property, as shown on the provided HLUI Map PDF. Within 500 metres of the Subject Property, landfills and Environmental Risk Management Area (ERMA) are also identified if applicable.

For more information on how to interpret the HLUI data identified in the attached excel sheet ('ADDRESS – HLUI Summary report.xlsx'), please refer to the <u>Overview and User Guide</u>."

## Additional information may be obtained by contacting:

## **Ontario's Environmental Registry**

The Environmental Registry found at <a href="https://ero.ontario.ca/">https://ero.ontario.ca/</a> contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using keys words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

## The Ontario Land Registry Office

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House 161 Elgin Street 4th Floor Ottawa ON K2P 2K1 Tel: (613) 239-1230

Fax: (613) 239-1422

#### **Ottawa Public Health**

Ottawa Public Health inspects many different types of establishments. To view inspection results, please visit the Ottawa Public Health website: <a href="Public Health Inspections - Ottawa">Public Health</a> Public Health

Please note that Ottawa Public Health is not the lead agency on land use contamination in the City of Ottawa – contact the Ministry of Environment Conservation and Parks (MECP) for further information.

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the HLUI database is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact HLUI@ottawa.ca.

Sincerely,


#### **Liam White**

Planning Student
Development Review South
Planning, Development and Building Services Department

Enclosures: (2)

- 1. HLUI Map
- 2. HLUI Summary Report

cc: File no. D06-03-25-0038

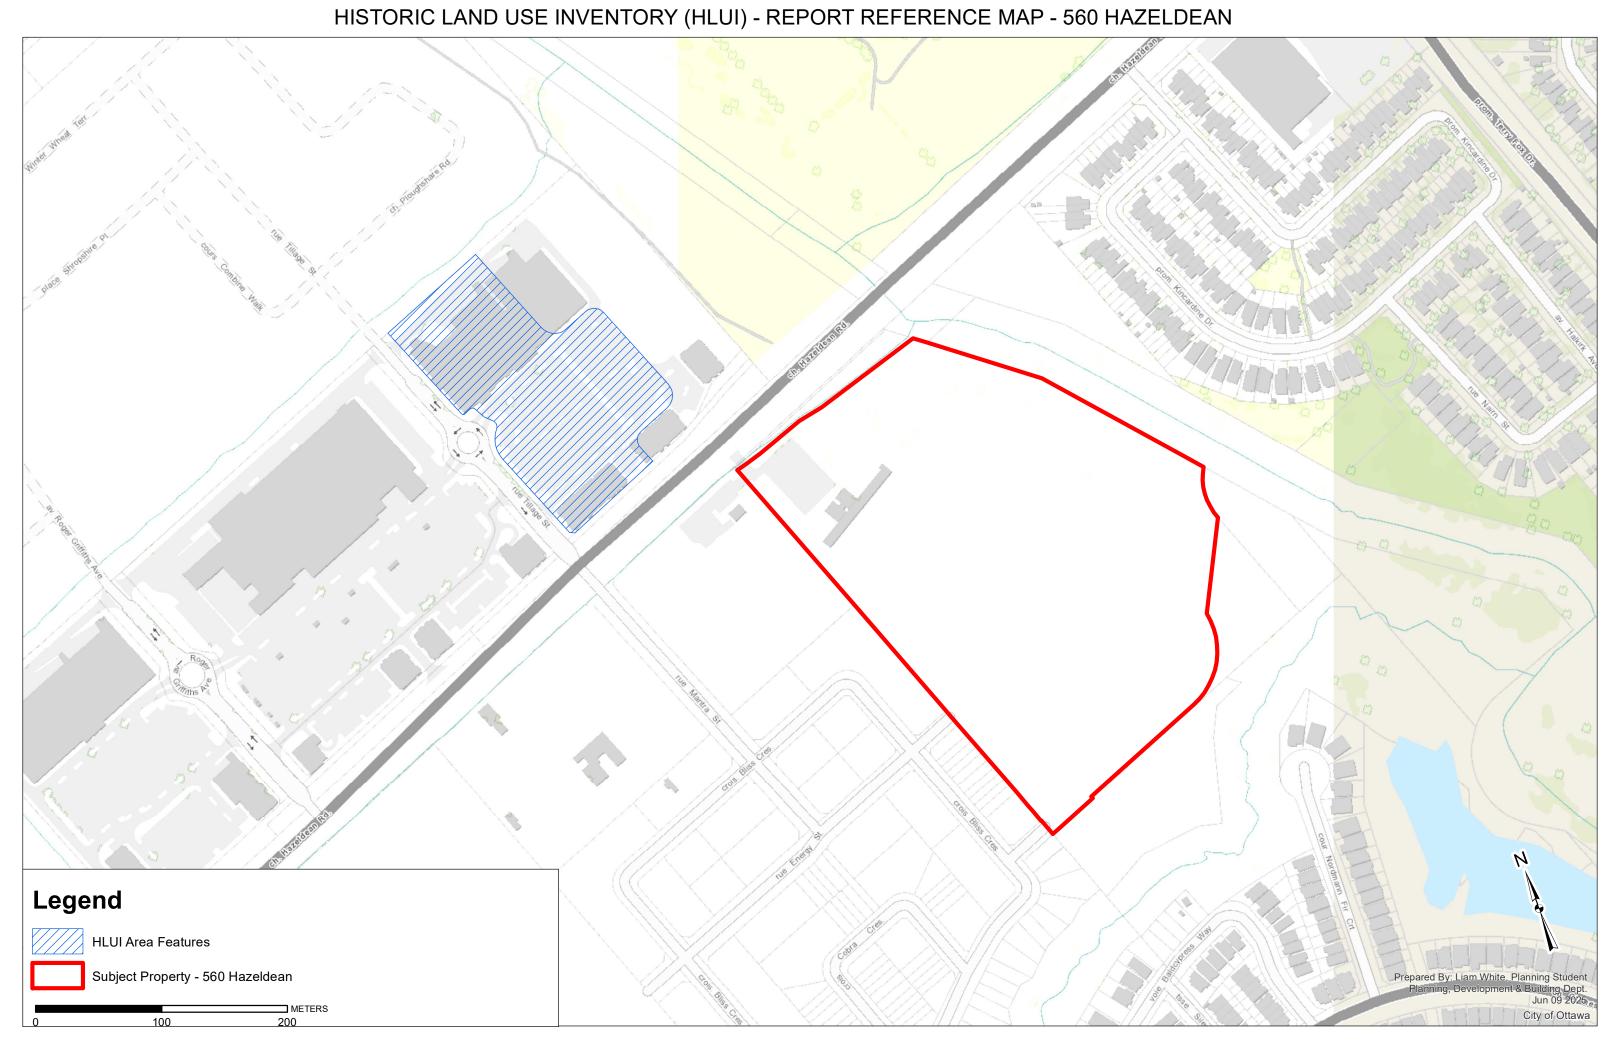

	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALI	ST_NUM201 7	ST_NAME2017	ST_SUFFIX 2017	ST_DIR2017	POSTAL_C ODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	SHAPE_AREA	SHAPE_LEN
8950 VA	VALUE VILLAGE STORES	Retail trade	2016-PID	1	2016		5487.00000 000000000 0	HAZELDEAN	RD		STITTSVILL E	5487	HAZELDEAN	RD		K2S0P5	044660918	KANATA	452999		Unit 1		24082.843432738998672	701.925763762531005

From: Public Information Services <publicinformationservices@tssa.org>

Sent: Wednesday, April 2, 2025 7:41 AM

**To:** Katharina Barley

**Subject:** RE: PE5304 - 560 Hazeldean Road

**External Email:** Do not click on links or open attachments unless you trust the sender.

#### **RECORD FOUND IN CURRENT DATABASE**

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

 We confirm that there are records in our current database of any fuel storage tanks at the subject address(es).

Inventory Number	Address	City	Province	Postal Code	Reason Code	Asset Type / Inve
	5577 HAZELDEAN					
64501471	RD	OTTAWA	ON	K2S 0P5	Active	FS CYLINDER EXCH

<u>This is not a confirmation that there are no records in the archives</u>. For a further search in our archives, please go to the <u>TSSA Client Portal</u> to complete an Application for Release of Public Information.

Please refer to How to Submit a Public Information Request (tssa.org) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at <u>publicinformationservices@tssa.org</u>.

Kind regards,



#### Kimberly Gage | Public Information & Records Agent

Public Information 345 Carlingview Drive Toronto, Ontario M9W 6N9

Tel: +1 416-734-3581 | Fax: +1 416-734-3568 | E-Mail: kgage@tssa.org

www.tssa.org









#### Winner of 2024 5-Star Safety Cultures Award

From: Katharina Barley < kbarley@patersongroup.ca>

**Sent:** April 1, 2025 4:33 PM

To: Public Information Services <publicinformationservices@tssa.org>

Subject: PE5304 - 560 Hazeldean Road

**[CAUTION]:** This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content

is safe.

Hello,

Could a search of your records please be completed for underground/aboveground storage tanks, historical spills, or other incidents/infractions on the addresses listed below of which are in Ottawa, Ontario.

560 Hazeldean Road 5487 Hazeldean Road 5577 Hazeldean Road 590 Hazeldean Road 5497 Hazeldean Road 5507 Hazeldean Road 5517 Hazeldean Road 192 Bliss Crescent 519 Nordmann Fir Ct 166 Bliss Crescent

### Thank you,



#### KATHARINA BARLEY

Environmental Student Environmental Division


TEL: (613) 226-7381

9 AURIGA DRIVE OTTAWA ON K2E 7T9 patersongroup.ca

#### TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!


#### NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

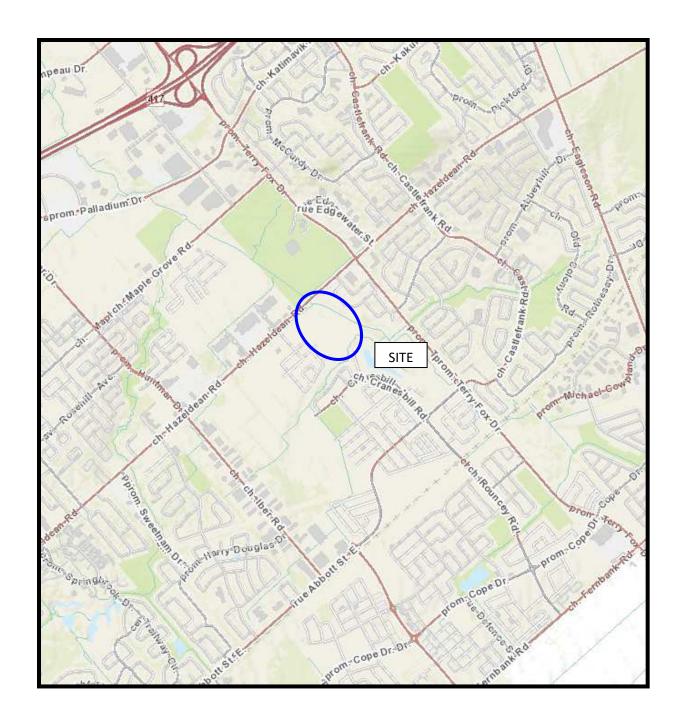

# FIGURE 1 KEY PLAN



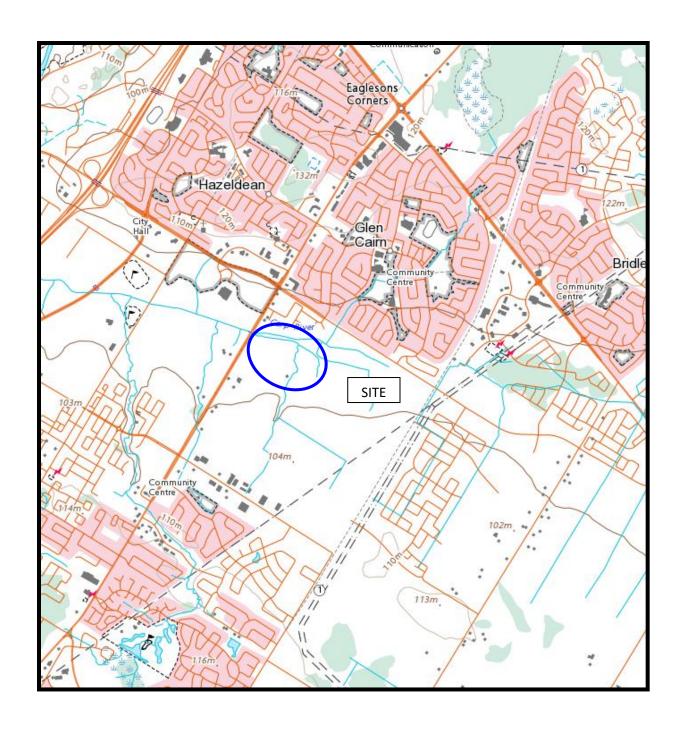

# FIGURE 2 TOPOGRAPHIC MAP



