



**Servicing and Stormwater
Management Report – 2829
Dumaurier Avenue**

Stantec Project No. 160401596

September 19, 2024

Prepared for:

Brigil Homes

Prepared by:

Stantec Consulting Ltd.

| Revision | Description | Author | | Quality Check | | Independent Review | |
|----------|--------------------------------|-----------|------------|---------------|------------|--------------------|------------|
| 0 | 1 st Submission SPA | NN, DC | 2021-02-17 | AP | 2021-02-18 | KK | 2021-02-18 |
| 1 | Revised per City Comments#1 | MF | 2023-03-15 | PM | 2023-03-17 | KK | 2023-03-17 |
| 2 | Revised per City Comments#2 | WJ | 2024-05-17 | DT | 2024-07-05 | KK | 2024-07-05 |
| 3 | Revised per New Site Plan | MW | 2024-09-19 | DT | 2024-09-19 | KK | 2024-09-19 |



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

The conclusions in the Report titled Servicing and Stormwater Management Report – 2829 Dumaourier Avenue are Stantec’s professional opinion, as of the time of the Report, and concerning the scope described in the Report. The opinions in the document are based on conditions and information existing at the time the scope of work was conducted and do not take into account any subsequent changes. The Report relates solely to the specific project for which Stantec was retained and the stated purpose for which the Report was prepared. The Report is not to be used or relied on for any variation or extension of the project, or for any other project or purpose, and any unauthorized use or reliance is at the recipient’s own risk.

Stantec has assumed all information received from Brigil Homes (the “Client”) and third parties in the preparation of the Report to be correct. While Stantec has exercised a customary level of judgment or due diligence in the use of such information, Stantec assumes no responsibility for the consequences of any error or omission contained therein.

This Report is intended solely for use by the Client in accordance with Stantec’s contract with the Client. While the Report may be provided by the Client to applicable authorities having jurisdiction and to other third parties in connection with the project, Stantec disclaims any legal duty based upon warranty, reliance or any other theory to any third party, and will not be liable to such third party for any damages or losses of any kind that may result.

Prepared by Michael Wu

Michael Wu, E.I.T.

Reviewed by Kris Kilborn

Kris Kilborn

Approved by Dustin Thiffault

Dustin Thiffault, P.Eng.



Table of Contents

| | | |
|-------------|---|-------------|
| 1.0 | INTRODUCTION | 1.1 |
| 1.1 | OBJECTIVE | 1.2 |
| 2.0 | REFERENCES | 2.1 |
| 3.0 | POTABLE WATER SERVICING | 3.2 |
| 3.1 | RELOCATION OF EXISTING WATERMAIN | 3.4 |
| 4.0 | WASTEWATER SERVICING | 4.1 |
| 4.1 | RELOCATION OF EXISTING SANITARY SEWER | 4.2 |
| 5.0 | STORMWATER MANAGEMENT | 5.3 |
| 5.1 | OBJECTIVES | 5.3 |
| 5.2 | EXISTING CONDITIONS AND SWM CRITERIA | 5.3 |
| 5.3 | STORMWATER MANAGEMENT DESIGN..... | 5.4 |
| 5.3.1 | Water Quantity Control..... | 5.5 |
| 5.3.2 | Results | 5.6 |
| 5.3.3 | Water Quality Control..... | 5.6 |
| 6.0 | GRADING AND DRAINAGE | 6.1 |
| 7.0 | UTILITIES | 7.1 |
| 8.0 | EROSION CONTROL DURING CONSTRUCTION | 8.1 |
| 9.0 | GEOTECHNICAL INVESTIGATION AND PHASE I ESA | 9.1 |
| 9.1 | GEOTECHNICAL INVESTIGATION | 9.1 |
| 9.1.1 | Foundation Drain..... | 9.2 |
| 9.2 | 2018 PHASE I ENVIRONMENTAL SITE ASSESSMENT (ESA)..... | 9.3 |
| 9.3 | 2019 PHASE II ENVIRONMENTAL SITE ASSESSMENT (ESA)..... | 9.3 |
| 9.4 | 2021 PHASE I ENVIRONMENTAL SITE ASSESSMENT (ESA)..... | 9.5 |
| 10.0 | APPROVALS/PERMITS | 10.6 |
| 11.0 | CONCLUSIONS | 11.1 |
| 11.1 | POTABLE WATER SERVICING..... | 11.1 |
| 11.2 | WASTEWATER SERVICING | 11.1 |
| 11.3 | STORMWATER MANAGEMENT AND SERVICING | 11.2 |
| 11.4 | SITE GRADING AND DRAINAGE..... | 11.2 |
| 11.5 | UTILITIES | 11.3 |
| 11.6 | APPROVALS/PERMITS | 11.3 |

LIST OF TABLES

| | |
|--|-----|
| Table 3-1: Estimated Water Demands | 3.2 |
|--|-----|



Table 3-2: Boundary Conditions3.3
 Table 4-1: Estimated Wastewater Peak Flow4.1
 Table 5-1 Peak Uncontrolled 5- and 100- Year run-off5.5
 Table 5-2: Proposed Cistern 5 and 100-Year Release Rates5.6
 Table 5-3: Estimated Post-Development Discharge (5-Year)5.6
 Table 5-4: Estimated Post-Development Discharge (100-Year)5.6
 Table 9-1: Recommended Pavement Structure.....9.2

LIST OF FIGURES

Figure 1: Key Plan (2829 Dumaaurier Ave. Site highlighted in Orange)1.1

LIST OF APPENDICES

APPENDIX A POTABLE WATER SERVICINGA.1
 A.1 Water Demand Calculations A.1
 A.2 Fire Flow Requirements per FUS Guidelines (2020)..... A.2
 A.3 Boundary Conditions A.3

APPENDIX B SANITARY SERVICINGB.1
 C.1 Sanitary Sewer Design Sheet B.1
 C.2 Correspondence with MECP B.2
 C.3 Correspondence with City on Sanitary Sewer Capacity B.3

APPENDIX C STORMWATER SERVICING AND MANAGEMENTC.1
 D.1 Preconsultation Notes with City of Ottawa C.1
 D.2 Modified Rational Method Calculations..... C.2
 D.3 Correspondence with Rideau Valley Conservation Authority (RVCA) C.3
 D.4 Stormceptor Sizing Sheet and Standard Detail..... C.4
 D.5 Storm Design Sheet C.5

APPENDIX D EXTERNAL REPORTS.....D.1
 E.1 Geotechnical Investigation (Paterson, 2019) D.1
 E.2 Phase I Environmental Site Assessment (GHD 2018) D.2
 E.3 Phase II Environmental Site Assessment (GHD 2019) D.3
 E.4 Phase I Environmental Site Assessment (Lopers & Associates 2021)..... D.4

APPENDIX E DRAWINGSE.1



Introduction

1.0 INTRODUCTION

Stantec Consulting Ltd. has been commissioned by Brigil Homes to prepare the following site servicing and stormwater management (SWM) report in support of an application for rezoning and site plan control approval for a proposed development located at 2829 Dumaური Avenue situated off Pincrest Road in the City of Ottawa. There is an existing commercial building on the southern end of the property which will be torn down to allow for the proposed development (see key plan in **Figure 1**).

The proposed development area (0.42 ha) consists of a 40-storey residential high-rise building with commercial space on the first floor. The building is to contain 407 units in total consisting of 240 one-bedroom units (@1.4ppu), 161 two-bedroom units (@ 2.1ppu), 6 three-bedroom units (@ 3.1ppu), and 200m² of commercial area. Parking is to be provided via 6 surface parking spots and two underground parking levels (P1 and P2).

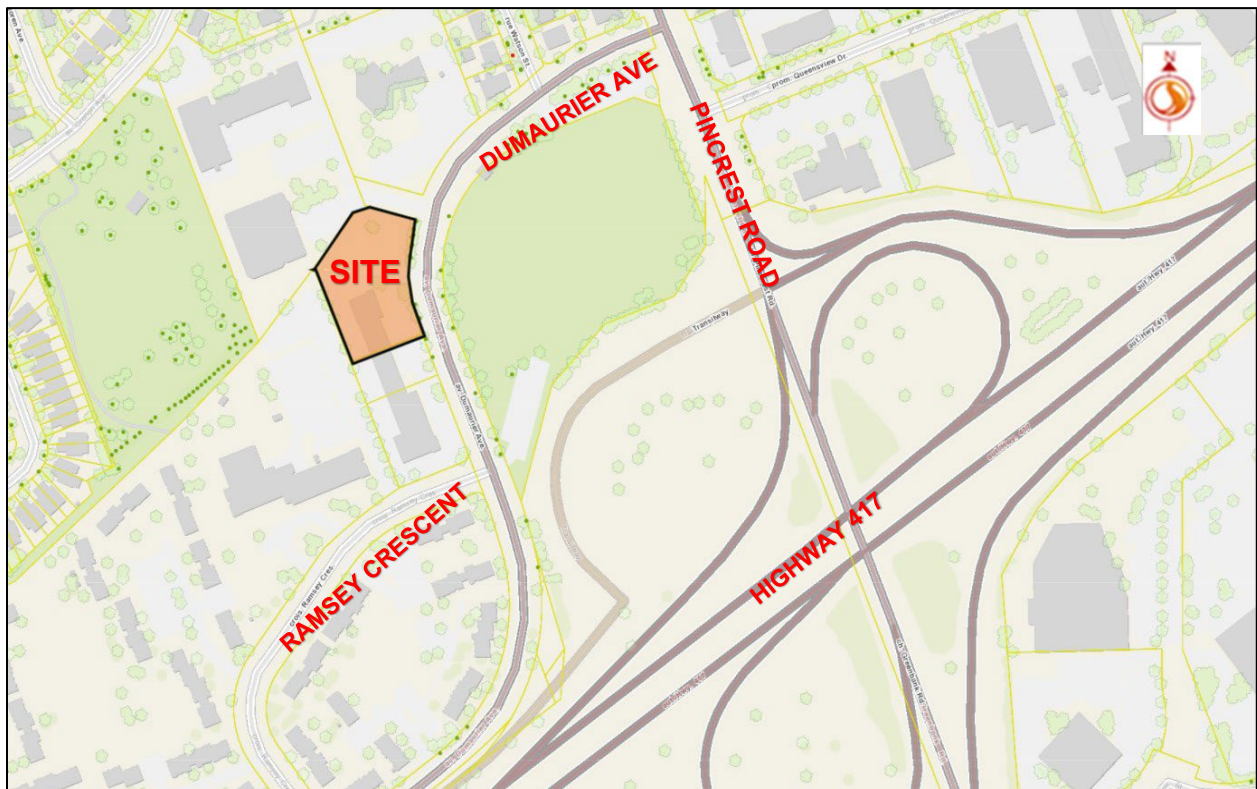


Figure 1: Key Plan (2829 Dumaური Ave. Site highlighted in Orange)



Introduction

1.1 OBJECTIVE

This Site Servicing and Stormwater Management Report has been prepared to present a servicing scheme that is free of conflicts and presents the most suitable servicing approach that complies with the relevant City of Ottawa design guidelines. The use of the existing infrastructure as obtained from available as-built drawings has been determined in consultation with RLA Architecture, Brigil Homes, City of Ottawa staff, and the adjoining property owners. Infrastructure requirements for water supply, sanitary sewer, and storm sewer services are presented in this report.

Criteria and constraints provided by the City of Ottawa have been used as a basis for the servicing design of the proposed development. Specific elements and potential development constraints to be addressed are as follows:

- Potable Water Servicing
 - Estimate water demands to characterize the feed for the proposed development which will be serviced by an existing 305mm diameter ductile iron watermain fronting the site along Dumaurier Avenue.
 - Watermain servicing for the development is to be able to provide average day and maximum day and peak hour demands (i.e., non-emergency conditions) at pressures within the allowable range of 40 to 80 psi (276 to 552 kPa).
 - Under fire flow (emergency) conditions with maximum day demands, the water distribution system is to maintain a minimum pressure greater than 20 psi (140 kPa).
 - Relocation of the existing 150 mm private watermain running through the north end of the site, servicing 1085 Grenon Ave as well as Ruth Wildgen Park (1099 Grenon Ave) is required as part of the site development.
- Prepare a grading plan in accordance with the proposed site plan and existing grades.
- Stormwater Management and Servicing
 - Define major and minor conveyance systems in conjunction with the proposed grading plan.
 - Post development 100-year peak flow will be controlled to the predevelopment peak 5-year release rate with a runoff coefficient of $C=0.5$ and a time of concentration of 10 minutes as estimated based on the existing storm sewer infrastructure servicing the existing site.
 - Excess stormwater to be detained on-site via underground cistern to meet the 5-year target release rate during 100yr rainfall events.
 - Coordinate with the Mechanical Engineer to convey drainage from roof tops, parking areas, amenity areas, private terrace areas, and the canopy to the internal stormwater cistern and discharge to the proposed storm service lateral at the allowable release rate.



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Introduction

- Connect to the existing 375mm diameter concrete storm sewer within the Dumaaurier Ave right-of-way.
- Provide an oil/grit separator unit to intercept and treat storm run-off from the site to meet RVCA water quality control requirements (80% TSS removal).
- Define and size the proposed storm sewer system that will be connected to the existing 375 mm diameter storm sewer on Dumaaurier Avenue.
- Wastewater Servicing
 - Estimate wastewater flows generated by the development and size sanitary sewers which will outlet to the existing 250mm diameter sanitary sewer located on Dumaaurier Avenue.
 - Design the sanitary sewer extension within the Dumaaurier Avenue right-of-way.

The accompanying **Drawing SSP-1** included in **Appendix E** illustrates the proposed internal servicing scheme for the site.



References

2.0 REFERENCES

Documents referenced in preparation of this Servicing and Stormwater Management Report include:

- *2829 Dumaaurier Ave Engineering comments*, City of Ottawa, dated October 22, 2021
- *2829 Dumaaurier Ave. pre-consultation comments*, City of Ottawa, May 2020
- *2858 Dumaaurier Ave. Site plan*, RLA Architecture, April 2024
- *City of Ottawa Design Guidelines - Water Distribution*, City of Ottawa, July 2010 (including all subsequent technical bulletins).
- *City of Ottawa Sewer Design Guidelines (SDG)*, City of Ottawa, October 2012 (including all subsequent technical bulletins).
- *Geotechnical Investigation Proposed Hi-rise Building 2929 DuMaurier Avenue Ottawa Ontario*, Paterson Group Inc., December 2019
- *Phase I Environmental Site Assessment*, GHD, August 2018
- *Phase One Environmental Site Assessment*, Lopers & Associates, January 2021
- *Phase Two Environmental Site Assessment*, GHD, April 2019



3.0 POTABLE WATER SERVICING

The proposed site is located within Pressure Zone 1W of the City of Ottawa’s water distribution system. The proposed development will be serviced by the existing 300mm diameter watermain on DumaURIer Avenue. In order to create a suitable water service connection for the property, a section of the existing 300 mm dia. watermain will be modified to include: replacement of about 9 m of pipe length with new deflected 9 m 300 mm diameter pipe, new valves, tees, bends and two 150 mm watermain stubs to provide potable water and fire flow water supply to the development as shown on **Drawings SSP-1 & PP-1** in **Appendix E** respectively. The location of the water services has been coordinated with the building’s architect to accommodate the underground parking structure on Level P1 and P2.

The proposed 40-storey residential high-rise building includes commercial space on the first floor. The building is to contain 407 units in total consisting of 240 one-bedroom units, 161 two-bedroom units, 6 three-room units, and 200 m² of commercial area. Parking is to be provided via 6 surface parking spots and two underground parking levels (P1 and P2).

Water demands were calculated using the City of Ottawa Water Distribution Guidelines (2010) to determine the typical operating pressures to be expected at the building (see detailed calculations in **Appendix A.1**). A demand rate of 280 L/cap/day was applied for the residential population of the proposed site. The average daily (AVDY) residential demand was estimated with population densities as per City of Ottawa Guidelines; 1.4 persons per one-bedroom apartments, 2.1 persons per two-bedroom apartment, and 3.1 persons per three-bedroom apartments.

An estimated demand of 28,000 L/ha/day was applied to the communal amenities and commercial space. Maximum day (MXDY) demands were determined by multiplying the AVDY demands by a factor of 2.5 for residential areas and by a factor of 1.5 for commercial/amenity/lobby areas. Peak hourly (PKHR) demands were determined by multiplying the MXDY demands by a factor of 2.2 for residential areas and by a factor of 1.8 for commercial areas. The estimated demands are summarized in **Table 3-1** below.

Table 3-1: Estimated Water Demands

| | Population or Area | AVDY (L/s) | MXDY (L/s) | PKHR (L/s) |
|------------------------|---------------------------|-------------------|-------------------|-------------------|
| Residential | 693 persons | 2.25 | 5.61 | 12.35 |
| Commercial space | 200 m ² | 0.01 | 0.01 | 0.02 |
| Communal Amenity space | 3,338 m ² | 0.11 | 0.16 | 0.29 |
| Total Site: | | 2.36 | 5.79 | 12.66 |

The fire flow requirement was calculated in accordance with Fire Underwriters Survey (FUS) and determined to be approximately 5,000 L/min (83.3 L/s). The FUS estimate is based on a building of non-combustible construction with a two-hour fire separation provided between each floor per Ontario Building Code (OBC) requirements for buildings over six storeys, and all vertical openings and external vertical communications properly protected in accordance with the National Building Code. As a result, the 'gross



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Potable Water Servicing

construction area' of the second floor (floor with the largest footprint, 1,455.2 m²) + 25 % of the gross construction area of the two immediately adjoining floors (the ground floor and third floor) were used for the purpose of the FUS calculation, as per Page 22 of the Fire Underwriters Survey's Water Supply for Public Fire Protection, 2020.

Additionally, it is anticipated that the building will be sprinklered, with final sprinkler design to conform to the NFPA 13 standard. Detailed fire flow calculations per the FUS methodology are provided in **Appendix A.2**.

Table 3-2 shows the hydraulic boundary conditions provided by the City of Ottawa on September 12, 2023, based on the estimated domestic and fire flow demands described above. The boundary conditions are also included in **Appendix A.2**.

Table 3-2: Boundary Conditions

| | Connection @ 2829 Dumaaurier Ave |
|--|---|
| Min. HGL (m) | 107.5 |
| Max. HGL (m) | 115.7 |
| Max. Day + Fire Flow (83.3 L/s) (m) | 107.3 |

The desired normal operating objective pressure range as per the City of Ottawa 2010 Water Distribution Design Guidelines is 345 kPa (50 psi) to 552 kPa (80 psi) and no less than 276 kPa (40 psi) at ground elevation. Furthermore, the maximum pressure at any point in the water distribution should not exceed 100 psi as per the Ontario Building/Plumbing Code; pressure reducing measures are required to service areas where pressures greater than 552 kPa (80 psi) are anticipated.

The building's proposed finished floor elevation of 73.85 m will serve as the ground elevation for the calculation of residual pressures at ground level. At the peak hour flow conditions (i.e., minimum HGL), the resulting boundary condition HGL of 107.5 m corresponds to a peak hour pressure of 329.9 kPa (47.8 psi). Since the proposed building is a 40-storey building with an average storey height of 3.15 m, an additional 30 kPa (4.3 psi) of head loss is incurred for every additional storey over ground level. Given that the lowest pressure is expected to be 329.9 kPa (47.8 psi) at ground level, there will be insufficient pressure to reach the top floors. Therefore, a booster pump inside the building will be required to maintain an acceptable level of service on the higher floors. This booster pump is to be sized and designed by the building's mechanical engineer.

A maximum pressure check can be conducted using the building's finished floor elevation (73.85 m) and the maximum boundary condition HGL of 115.7 m. This results in a pressure of 410.3 kPa (59.5 psi). Since this value is below 80 psi, pressure reducing valves will not be required.

Regarding available fire flow, boundary conditions provided by the City confirm that a fire flow rate of 5,000 L/min (83.3 L/s) would have a residual pressure of 327.9 kPa (47.6 psi) on Dumaaurier Avenue.

The proposed development has a basic day demand of 141.6 L/min (203.9 m³/day), which exceeds 50 m³/day. Therefore, the site will be serviced by the existing 300 mm diameter watermain on Dumaaurier Avenue via two 150 mm diameter water service laterals and separated by a new isolation valve on the



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Potable Water Servicing

main, per the City's Water Distribution Guidelines. The building's mechanical engineer is to ensure that the 150 mm diameter service size is sufficient for the proposed sprinkler system.

A fire department connection has been provided on the eastern face of the building (main entry); this fire department connection is located approximately 33.8 m from the existing fire hydrant on Dumaaurier Avenue.

In conclusion, based on the boundary conditions available, the 300 mm diameter watermain on Dumaaurier Avenue provides adequate fire flow capacity as per the requirements of the Fire Underwriters Survey while respecting City of Ottawa design guidelines. Two 150 mm diameter service laterals connected to the 300 mm diameter watermain on Dumaaurier Avenue will be capable of providing the anticipated water demands to the lower storeys. A booster pump, to be designed by the building's mechanical consultant, will be required to maintain minimum required pressures for the upper storeys.

3.1 RELOCATION OF EXISTING WATERMAIN

As shown on **Drawing EX-1** and **Drawing SSP-1**, the existing 150 mm diameter private watermain running through the north end of the site, currently servicing the Ottawa Boys & Girls club (1085 Grenon Avenue), as well as the Ruth Wildgen Park (1099 Grenon Avenue) will be relocated outside the proposed site's property line to allow for the development of structures and services within the subject site.

A 150 mm diameter watermain, 45° horizontal bends, tees and isolation valves will be introduced to achieve the level of service required by the adjoining properties. The existing fire hydrant will be reconnected to the proposed relocated watermain. The relocation will be coordinated with the property owners and City staff.



Wastewater Servicing

4.0 WASTEWATER SERVICING

As illustrated on **Drawing SSP-1**, sanitary servicing for the proposed development will be provided through a single proposed 200 mm diameter service lateral connecting to a new 250mm sanitary sewer that will discharge into an extension of the existing 250 mm diameter concrete sanitary sewer flowing southwards on Dumaaurier Avenue. The existing as-built sanitary sewer drawings indicate that the location of the most suitable connection for the site sanitary sewer system is about 40m south from the site on Dumaaurier Avenue. As a result, an extension of the sanitary sewer network along Dumaaurier Avenue will be required.

Due to the municipal sanitary sewer extension, a Ministry of Environment, Conservation and Parks Environmental Compliance Approval (MECP ECA) will be required. Consultation with the MECP Ottawa District Office confirmed that this sanitary sewer extension within the Dumaaurier Avenue right-of-way is eligible for the standard Transfer of Review program with the City of Ottawa. Refer to **Appendix B.2** for a record of correspondence with the MECP.

The proposed 40-storey residential high-rise building is to contain 407 units in total consisting of 240 one-bedroom units, 161 two-bedroom units, 6 three-bedroom units, 200m² of commercial area and 3,338 m² of communal amenity areas with a total estimated population of 693 people using the City of Ottawa’s recommended population densities. The anticipated wastewater peak flow generated from the proposed development is summarized in **Table 4-1** while the sanitary sewer design sheet is included in **Appendix B**.

Table 4-1: Estimated Wastewater Peak Flow

| Residential/Commercial Peak Flows | | | | | Infiltration Flow (L/s) | Total Peak Flow (L/s) |
|-----------------------------------|-----------------|------------|-------------|-----------------|-------------------------|-----------------------|
| | # of Units/Area | Population | Peak Factor | Peak Flow (L/s) | | |
| Residential | 407 units | 693 | 3.32 | 7.5 | 0.1 | 7.6 |
| Commercial | 0.02 ha | N/A | 1.50 | 0.01 | | |

1. Average residential sanitary flow = 280 L/p/day per City of Ottawa Sewer Design Guidelines.
2. Peak factor for residential units calculated using Harmon's formula. Used a Harmon correction factor of 0.8.
3. Apartment population estimated based on 1.4 persons/unit for one-bedroom apartments, 2.1 persons/unit for two-bedroom apartments, and 3.1 persons/unit for three-bedroom apartments.
4. Estimated commercial/amenity area/lobby peak flows = 28,000 L/ha/day.
5. Infiltration flow = 0.33 L/s/ha.

The City has verified that the 250 mm diameter sanitary sewer on Dumaaurier Avenue has sufficient capacity to service the proposed development (see **Appendix B.3** for a record of correspondence).

The drains within the underground parking garage will need to be pumped and ultimately outlet to the proposed sanitary sewer system. The design of these drains, internal plumbing, and associated pumping system is to be completed by the building’s mechanical engineer.

A backflow preventer will be required for the proposed building in accordance with the City of Ottawa Sewer Design Guidelines. This requirement will be coordinated with the building’s mechanical engineer.



Wastewater Servicing

4.1 RELOCATION OF EXISTING SANITARY SEWER

As shown on **Drawing EX-1** and **Drawing SSP-1**, the existing 225 mm sanitary sewer running through the north end of the site, currently servicing the Ottawa Boys & Girls club (1085 Grenon Avenue), as well as potentially the Ruth Wildgen Park (1099 Grenon Avenue) will be relocated outside of the property line to allow for the development of new building structures and services within the subject site.

The sanitary sewer will be realigned within the adjacent property and reconnected to the existing 225mm diameter sanitary sewer on 1099 Grenon Avenue. To achieve this, 53 m of 225mm diameter PVC sanitary sewer at 0.4% slope and 1200mm diameter maintenance holes will be provided.

The relocation will be coordinated with the property owners and the relevant authorities.



5.0 STORMWATER MANAGEMENT

5.1 OBJECTIVES

The goal of the stormwater servicing and stormwater management (SWM) plan is to determine the measures necessary to control the quantity and quality of stormwater released from the proposed development to meet the criteria established during the consultation process with City of Ottawa and Rideau Valley Conservation Authority (RVCA), and to provide sufficient details required for approval and construction.

5.2 EXISTING CONDITIONS AND SWM CRITERIA

The proposed re-development area (0.42 ha) currently consists of an existing commercial building down on the southern edge of the property, paved parking lots and some landscaped area. The existing structures on the site will be removed to allow for the proposed development.

The Stormwater Management (SWM) criteria for the subject site is based on pre-application consultation comments in **Appendix C.1** as provided by the City of Ottawa in May 2020 as follows:

- Post-development peak flows up to 100-year event are to be controlled to the pre-development peak 5-year release rate using a runoff coefficient of 0.5, per City of Ottawa Sewer Design Guidelines. It is noted that the ultimate outlet for the storm runoff is Graham Creek. Excess stormwater is to be detained on-site.
- The 5-yr storm event using the IDF information derived from the Meteorological Services of Canada rainfall data, taken from the MacDonald Cartier Airport, collected 1966 to 1997.
- Use the pre-development runoff coefficient or a maximum equivalent 'C' of 0.50, whichever is less
- A calculated time of concentration (cannot be less than 10 minutes).

Other criteria considered in the SWM design are described in Section 5 of the Ottawa Sewer Design Guidelines (October 2012) including all subsequent technical bulletins.

Pre-development (i.e., current) site conditions have been classified into impervious (hard) and pervious (soft) areas, with impervious areas accounting for 70% (0.29 ha) while pervious areas cover up to 30% (0.13 ha) of the site. Based on these statistics, the overall pre-development runoff coefficient (C) for the site was calculated as C=0.69. As a result, a C value of 0.50 will be used to estimate the allowable release rate from the site, as it is the lesser of the two values.

The allowable peak stormwater flow rate for the site was calculated as follows using the Modified Rational Method:

$$Q = 2.78 (C)(I)(A)$$

Where:

Q = peak flow rate, L/s



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Stormwater Management

C = site runoff coefficient

I = rainfall intensity, mm/hr (per City of Ottawa IDF curves)

A = drainage area, ha

$$5\text{-year Intensity (mm/hr)} = \frac{998.071}{(10 + 6.053)^{0.814}} = 104.19 \text{ mm/hr}$$

$$Q = 2.78(0.50)(104.19 \text{ mm/hr})(0.42 \text{ ha}) = \mathbf{60.8 \text{ L/s}}$$

Therefore, the post-development peak flow up to the 100-year storm event must be controlled to **60.8 L/s**. The pre-development time of concentration was assumed to be 10 minutes given that the existing site is serviced through two existing catchbasins connected to the existing adjacent storm sewer system with an inlet time of 10 minutes as per City guidelines.

The RVCA confirmed that enhanced water quality protection (80% TSS removal) is required for the site based on the number of surface parking spaces (>5 spaces). Other best management practices were also encouraged to be integrated where possible, correspondence with the RVCA is included in **Appendix C.3**.

5.3 STORMWATER MANAGEMENT DESIGN

The proposed 0.42 ha re-development area will be serviced by the existing 375mm diameter concrete storm sewer running north to south on Dumaaurier Avenue, as shown on **Drawing SD-1** in **Appendix E**.

A proposed stormwater cistern will attenuate peak flows from the building's roof, outdoor amenity areas, surface parking lot, and landscaped areas west of the building to ensure that the overall site release rate meets the target peak outflow. The proposed stormwater cistern will be serviced by the internal plumbing of the building. As shown on **Drawing SD-1** in **Appendix E**, peak flows from the proposed cistern will be discharged into the 300 mm diameter storm service lateral and ultimately into the site storm system that will also convey uncontrolled runoff from the proposed landscaped areas prior to discharging into the existing 375 mm diameter storm sewer on Dumaaurier Avenue. A Stormceptor unit or approved equivalent will provide the required 80% TSS removal for site runoff to achieve an Enhanced level of protection, per the RVCA & MECP.

Catch basins and landscape drains for the areas tributary to the stormwater cistern will connect to the cistern via internal plumbing (designed by the building's mechanical engineer). The stormwater cistern will be pumped at a controlled rate into the existing 375 mm diameter concrete storm sewer on Dumaaurier Avenue via a 300 mm diameter PVC storm service (see **Drawing SD-1** in **Appendix E**). The stormwater cistern's-controlled release rate will be set by a pump to be designed by the building's mechanical engineer.

The stormwater cistern location will be coordinated with the building's architect and structural engineer. Current plans will be provided, and peak flows will be identified to the building's mechanical engineer to help size the internal plumbing system appropriately.

The proposed site plan, drainage areas and proposed storm sewer infrastructure are shown on **Drawing SD-1**.



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Stormwater Management

5.3.1 Water Quantity Control

The Modified Rational Method (MRM) was used to assess the flow rate and volume of runoff generated under post-development conditions. The site was subdivided into sub-catchments tributary to separate storm outlets and subject to different controls based on the proposed grading plan. **Drawing SD-1** delineates the appropriate sub-catchment areas. The MRM spreadsheet is included in **Appendix C.2**.

The following assumptions were made in the creation of the storm drainage plan and accompanying MRM spreadsheet:

- 1) No rooftop storage will be provided for the proposed site.
- 2) The stormwater runoff on the site (including Tank & Roof areas that start with R) will be collected using a combination of Watts area drains, catchbasins, subdrains and internal building plumbing for detention in a stormwater cistern.
- 3) Some pedestrian access and landscaping areas on the east end of the site will sheet drain uncontrolled to DumaURIer avenue (UNC-1).
- 4) The storm runoff within the access road area of the site will be captured into the site storm sewer system and directed to the proposed oil/grit separator unit.

In order to meet the target release rate for stormwater of 60.8 L/s up to the 100-year storm, on-site storage is required.

5.3.1.1 Uncontrolled Areas

An uncontrolled area (UNC-1) cannot be graded to enter the site storm sewer system and as such, will sheet drain to DumaURIer Avenue as per existing conditions (see **Drawing EX-1** and **Drawing SD-1**).

Table 5-1 Peak Uncontrolled 5- and 100- Year run-off

| Area IDs | Area (ha) | Runoff 'C' (5- Year) | 5 Year uncontrolled peak flow (L/s) | Runoff 'C' (100 -Year)* | 100 Year uncontrolled peak flow (L/s) |
|----------|-----------|-------------------------|--|----------------------------|---|
| UNC-1 | 0.06 | 0.57 | 10.6 | 0.71 | 22.6 |

1. Runoff coefficients for 100yr storm increased by 25%, per City of Ottawa SDG

5.3.1.2 Stormwater Cistern

The allowable release rate from the proposed building's underground cistern was determined by subtracting all uncontrolled 100-year peak flows (area UNC-1) from the allowable 60.8 L/s release rate, which results in approximately 38.1 L/s.

The stormwater cistern will be designed to provide 120 m³ of storage with a maximum controlled release rate of 38.1 L/s. The stormwater cistern is to discharge at the controlled release rate using a pump. **Table 5-2** summarizes the flow rates and volume of stormwater in the cistern in the 5-year and 100-year storm events.



Stormwater Management

Table 5-2: Proposed Cistern 5 and 100-Year Release Rates

| Storm Return Period | Area (ha) | Q _{release} (L/s) | V _{stored} (m ³) | V _{available} (m ³) |
|---------------------|-----------|----------------------------|---------------------------------------|--|
| 5-year | 0.36 | 38.1 | 21 | 120 |
| 100-year | 0.36 | 38.1 | 83 | |

5.3.2 Results

Table 5-3 and **Table 5-4** demonstrate that the proposed stormwater management plan provides adequate attenuation storage to meet the target peak outflow for the site.

Table 5-3: Estimated Post-Development Discharge (5-Year)

| Area Type | Q _{release} (L/s) | Target (L/s) |
|------------------------------|----------------------------|--------------|
| Controlled Cistern Discharge | 38.1 | 60.8 |
| Uncontrolled (UNC-1) | 10.6 | |
| Total | 48.7 | |

Table 5-4: Estimated Post-Development Discharge (100-Year)

| Area Type | Q _{release} (L/s) | Target (L/s) |
|------------------------------|----------------------------|--------------|
| Controlled Cistern Discharge | 38.1 | 60.8 |
| Uncontrolled (UNC-1) | 22.6 | |
| Total | 60.8 | |

5.3.3 Water Quality Control

The RVCA confirmed that enhanced water quality protection (80% TSS removal) is required for the site based on the number of surface parking spaces (>5 spaces) correspondence with the RVCA is included in **Appendix C.3**. To achieve this, storm runoff within the access road area of the site will be captured into the site storm sewer system and directed to the proposed oil/grit separator unit.

The Stormceptor sizing software has been used to size the required unit to provide 80% TSS removal based on drainage areas within the proposed access road and parking lots (i.e., 0.17 ha) as shown in the Stormceptor sizing design sheet included in **Appendix C.4**.

A Stormceptor STC 300 (EF 04) or an approved equivalent designed to provide 80% TSS removal has been proposed to collect and treat storm runoff from the site before discharging into the existing storm sewer on Dumaurier Avenue as shown in **Drawing SSP-1** in **Appendix EE**.



Stormwater Management

5.4 RELOCATION OF EXISTING STORM SEWER

As shown on **Drawing EX-1** and **Drawing SSP-1**, the existing 300 mm storm sewer and 200mm catch basin lead running through the north end of the site, currently servicing the Ottawa Boys & Girls club (1085 Grenon Avenue), as well as potentially the Ruth Wildgen Park (1099 Grenon Avenue) will be relocated outside of the property line to allow for the development of new building structures and services within the subject site.

The storm sewer will be realigned within the adjacent property and reconnected to the existing 300mm diameter storm sewer on 1099 Grenon Avenue. To achieve this, 53 m of 300mm diameter PVC storm sewer at between 0.7% and 1% slope, and 1200mm diameter maintenance holes will be provided.

The relocation will be coordinated with the property owners and the relevant authorities.



6.0 GRADING AND DRAINAGE

The proposed re-development site measures approximately 0.42 ha in area. A detailed grading plan (see **Drawing GP-1**) has been prepared to satisfy the stormwater management requirements described in **Section 5.0** and to allow for positive drainage away from the face of the building.

A concrete retaining wall is proposed on the north end of the site to allow for a grade change of about 1.50m between the adjoining site (Boys & Girls Club of Ottawa) and the proposed development. The structural design of the retaining wall will be completed by the building structural engineer.

The site grading along the parking lots and access areas (access road) is designed to effectively drain stormwater runoff in the area towards the proposed catchbasins. Grading for the access ramp to the underground parking level has been coordinated with the architect.

The surface parking lot has been graded to sheet drain over catchbasins discharging to the stormwater cistern. No surface ponding above catchbasins is to be provided in the parking area.

The subject site maintains overland flow routes to sheet drain towards Dumaaurier Avenue as per existing conditions. A ramp has also been provided near the southeast end corner of the proposed building to provide accessibility to the commercial entrance.



Utilities

7.0 UTILITIES

Hydro Ottawa, Bell, Rogers, and Enbridge all have existing utility plants in the area, which will be used to service the site. The detailed design of the required utility services will be further investigated as part of the composite utility planning process, which will follow design circulation for the servicing plans. Existing hydro line, guy wire and pole located on the north end of the site will be relocated as per Hydro Ottawa. The relocation of existing utilities will be coordinated with the individual utility providers as part of the site plan approval process by the civil engineer.

Municipal water and sewer services are supplied by underground service trenches on the east portion of the Site leading to Dumaaurier Avenue. Electricity is supplied to the Site buildings from underground service trenches from the west of the building. The phone line is supplied to the site building from Ramsey Crescent to the south of the Site (GHD) existing monitoring well on the parking area to be capped and decommissioned.



8.0 EROSION CONTROL DURING CONSTRUCTION

In order to protect downstream water quality and prevent sediment build up in catch basins and storm sewers, erosion and sediment control measures must be implemented during construction. The following recommendations will be included in the contract documents and communicated to the Contractor.

1. Implement best management practices to provide appropriate protection of the existing and proposed drainage system and the receiving water course(s).
2. Limit the extent of the exposed soils at any given time.
3. Re-vegetate exposed areas as soon as possible.
4. Minimize the area to be cleared and grubbed.
5. Protect exposed slopes with geotextiles, geogrid, or synthetic mulches.
6. Provide sediment traps and basins during dewatering works.
7. Install sediment traps (such as SiltSack® by Terrafix) between catch basins and frames.
8. Schedule the construction works at times which avoid flooding due to seasonal rains.

The Contractor will also be required to complete inspections and guarantee the proper performance of their erosion and sediment control measures at least after every rainfall. The inspections are to include:

- Verification that water is not flowing under silt barriers.
- Cleaning and changing the sediment traps placed on catch basins.

Refer to **Drawing EC/DS-1** for the proposed location of silt fences, straw bales, and other erosion control measures.



9.0 GEOTECHNICAL INVESTIGATION AND PHASE I ESA

9.1 GEOTECHNICAL INVESTIGATION

A geotechnical report for the site was prepared by Paterson Group Inc. on December 18, 2019 (see **Appendix D.1**) based on field investigations completed in November 10 and 11 2019. The investigation consisted of three boreholes advanced to a maximum depth of 18.2m below existing grade, the borehole locations were distributed around the existing building on the site. As is stated in the geotechnical report, the subsurface profile encountered at the boreholes consist of asphaltic concrete overlying a fill layer consisting of crushed stone with sand and trace concrete and brick. A thin layer of brown silty clay was encountered at BH1A underlying the above noted layers. Glacial till was encountered below the above noted layers consisting of a compact to a very dense silty sand with clay, gravel, cobbles, and boulders. Weathered shale bedrock was encountered at depths ranging between 3.9 and 5.3 m below the existing ground surface. Upon review of the core hole samples, the upper first meter of the bedrock was found to be of fair quality.

As stated in the report, the subject site is located in an area where the bedrock consists of shale and dolomite of the Rockcliffe Formation. The overburden drift thickness is anticipated to be between 2 to 5 m in depth. Three groundwater monitoring wells were installed as part of the geotechnical investigation. Groundwater level measurements were recorded at the monitoring well locations. It should be noted that no groundwater was encountered in any of the monitoring wells. It should also be noted that the groundwater level is subject to seasonal fluctuations. Therefore, groundwater could vary at the time of construction. As contained in the report, the subject site is considered satisfactory for the proposed development. The proposed high-rise building is anticipated to be founded on spread footings placed directly or indirectly by the use of a lean concrete in-filled trench on a clean, surface sounded bedrock bearing surface. Bedrock removal can be accomplished by hoe ramming where only small quantity of the bedrock needs to be removed. Sound bedrock may be removed by line drilling and controlled blasting and/or hoe ramming. Prior to considering blasting operations, the blasting effects on the existing services, buildings and other structures should be addressed. A pre-blast or pre-construction survey of the existing structures located in proximity of the blasting operations should be completed prior to commencing site activities. The extent of the survey should be determined by the blasting consultant and should be sufficient to respond to any inquiries/claims related to the blasting operations. As a general guideline, peak particle velocities (measured at the structures) should not exceed 25 mm/s during the blasting program to reduce the risks of damage to the existing structures. The blasting operations should be planned and conducted under the supervision of a licensed professional engineer who is also an experienced blasting consultant. Excavation side slopes in sound bedrock can be carried out using almost vertical side walls. A minimum 1m horizontal ledge, should be left between the bottom of the overburden excavation and the top of the bedrock surface to provide an area to allow for potential sloughing or to provide a stable base for the overburden shoring system.

A potential for heaving and rapid deterioration of the shale bedrock exists at this site. Paterson recommends limiting exposure of the bedrock surface to oxygen, keeping it as low as possible. The bedrock surface



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Geotechnical Investigation and Phase I ESA

within the proposed building footprint should be protected from excessive dewatering and exposure to ambient air. To accomplish this a 50 mm thick concrete mud slab should be placed on the exposed bedrock surface within a 48 hour period of being exposed. A 17 MPa sulphate resistant lean concrete may be used. As an alternative to the mud slab, keeping the shale surface covered with granular backfill is also acceptable. Selected excavated vertical sides of the exposed bedrock can be protected using a sprayed elastomeric coating or shotcrete to seal the bedrock from exposure to air and dewatering.

Foundation design can be based on Auxiliary footings placed on an undisturbed, dense glacial till bearing surface can be designed using a bearing resistance value at serviceability limit states (SLS) of 250 kPa and a factored bearing resistance value at ultimate limit states (ULS) of 500 kPa. A geotechnical resistance factor of 0.5 was applied to the above noted bearing resistance value at ULS. Footings designed using the above-noted bearing resistance value at SLS will be subjected to potential post-construction total and differential settlements of 25 and 20 mm, respectively. More design parameters to be considered in the foundation design are detailed in **Appendix D.1**

The report recommends a flexible pavement structure summarized in **Table 9-1** below for the design of car only parking areas in the lower level of the parking garage, local roadways, access lanes and heavy vehicle parking.

Table 9-1: Recommended Pavement Structure

| Material | Parking Areas | Local Roadways, Access Lanes and Heavy Vehicle Parking |
|---|---------------|--|
| Superpave 12.5 Asphaltic Concrete – Wear Course | 50 mm | 40 mm |
| SP 19 Asphaltic Concrete – Binder Course | - | 50 mm |
| Granular Base Course, OPSS Granular A | 150 mm | 150 mm |
| Granular Subbase Course, OPSS Granular B Type II | 300 mm | 400 mm |

Minimum Performance Graded (PG) 58-34 asphalt cement should be used for parking areas and local roadways and PG 64-34 asphalt cement should be used for roadways with bus traffic. The pavement granular base and subbase should be placed in maximum 300 mm thick lifts and compacted to a minimum of 100% of the material's SPMDDD using suitable vibratory equipment. The proposed pavement structure, where it abuts the existing pavement, should match the existing pavement layers. It is recommended that a 300 mm wide and 50 mm deep stepped joint be provided where the new asphalt layer joins with the existing asphalt layer to provide more resistance to cracking at the joint.

9.1.1 Foundation Drain

The geotechnical report (included in **Appendix D.1**) states that a composite drainage system (such as Miradrain G100N, Delta Drain 6000 or equivalent) is to extend down to the footing level. 150 mm diameter sleeves at 3 m centres need to be cast in the foundation wall at the footing interface to allow the infiltration of water to flow to an interior perimeter drainage pipe. The perimeter drainage pipe should direct water to sump pit(s) within the lower basement area. The spacing of the underfloor drainage system should be



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Geotechnical Investigation and Phase I ESA

confirmed at the time of excavation when water infiltration can be better assessed. For design purposes, a 150 mm in diameter perforated pipe with a geotextile sock is to be placed in each bay. Unheated structures such as the access ramp are to be insulated against the deleterious effect of frost action. The foundation drain for the building is to be serviced by a 200 mm diameter sub-drain connected to the cistern. These flows will then be directed via a proposed 300 mm diameter storm sewer to the existing 375 mm diameter storm sewer on Dumaurier Avenue. A full port backwater valve is to be installed on this service lateral to prevent flooding if the storm sewer on Dumaurier Avenue surcharges. Refer to **Drawing SSP-1** in **Appendix E** for the proposed location of this service lateral.

9.2 2018 PHASE I ENVIRONMENTAL SITE ASSESSMENT (ESA)

GHD was retained by 3223701 Canada Inc. (Client), to conduct a Phase I Environmental Site Assessment (ESA) of a commercial property located at Civic Nos. 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue, in Ottawa, Ontario (Site or Property). The building on Site consists of a single storey commercial plaza building. The Phase I ESA was conducted as detailed in our email quote dated August 8, 2018.

The purpose of the Phase I ESA was to identify, through a non-intrusive investigation, significant actual or potential environmental impairment associated with the Site, the on-Site building, and the immediate vicinity of the Site. As contained in the report in **Appendix D.2** the Phase I ESA was conducted for the Client for the purpose of due diligence for the potential purchase of the Property.

Based on the Phase I ESA study including the Site visit, documents reviewed, and the review of Site history and information provided by regulatory agencies, the following conclusions are noted. There was one potentially contaminating activity (PCA) identified at the Site; the placement of fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.

There was also one PCA identified at neighboring properties; the presence of a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site. The aforementioned PCAs are considered to represent areas of potential environmental concern (APECs) for the Site. Following the completion of the Phase I ESA for the subject Property, a Phase II Environmental Site Assessment was recommended for the Site.

9.3 2019 PHASE II ENVIRONMENTAL SITE ASSESSMENT (ESA)

GHD (Consultant) was retained by 3223701 Canada Inc. (Brigil), to complete a Phase Two Environmental Site Assessment (a detailed report is enclosed in **Appendix D.3**) in general accordance with the O. Reg. 153/04 Phase Two ESA format for the current commercial/institutional property identified as 2831, 2851, and 2865 DuMaurier in Ottawa, Ontario (Site or Phase Two Property). GHD had previously prepared a Phase I Environmental Site Assessment (Phase I ESA) (Ref No: 11181273-E1-RPT-1, dated August 16, 2018) for 3223701 Canada Inc. The Phase I ESA was conducted for environmental due diligence for potential purchase of the Site. The Phase Two Environmental Site Assessment (Phase Two ESA) was recommended based on the APECs identified as part of the Phase I ESA. The purpose of the Phase Two ESA is to assess the soil and groundwater quality at the Site. The investigation involved the advancement



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Geotechnical Investigation and Phase I ESA

of five boreholes which were sampled for environmental purposes. All five boreholes were completed with groundwater monitoring well screened in the overburden or upper bedrock.

Based on the water table elevations recorded in the monitoring wells installed as part of this investigation on the Site, the direction of groundwater flow in the vicinity of the boreholes was determined to be towards the south.

During the investigation, soil layers were sampled for metals, PAHs, pH, Flashpoint, and TCLP for metals and inorganics, VOCs, and PCBs, with borehole depth ranging from 0.6 – 3.5m. Six soil samples were submitted for laboratory analysis of Metals, Polycyclic Aromatic Hydrocarbons (PAHs) and pH. One duplicate soil sample was submitted for analysis of Metals, PAH and pH parameters. One soil sample was also submitted for toxicity characteristic leaching procedure (TCLP) analysis to determine options for off-Site disposal.

Soil samples were collected from the boreholes advanced on October 5, 2018 were analysed for a combination of PAHs, metals and inorganics, and pH. Four soil samples, BH1-SS3 (1.4-2.0 mBG), BH2-SS5 (2.4-3.0 mBG), BH4-SS2/SS3 (0.6-1.8 mBG) and BH5-SS3 (a duplicate sample of BH4-SS2/SS3) presented O. Reg. 153/04 Table 3 exceedances of electrical conductivity and sodium adsorption ratio. The soil sample BH2-SS5 also presented exceedances of Boron. It is suspected that areas of contaminated soil are present across the Site and in localized areas where poor quality fill material was used for grading and/or backfill for the foundations of the existing on-site building. It is suspected that there may be additional contaminated soil present in other localized areas of the Site.

Six groundwater samples, including one duplicate sample, were submitted for laboratory analysis of a combination of Metals, VOCs, PHCs and pH. One trip blank water sample was also submitted for analysis of VOCs. Based on the soil depths, Site setting, and the existing land uses in the vicinity of the Site, the Full depth Generic Criteria provided in O. Reg. 153/04 Table 3 (non-potable, residential/institutional, coarse texture) is considered to be the applicable comparison. The Site is not a sensitive Site, a Surface Water Site, or a potable groundwater use Site.

There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in four of the six submitted soil samples, including the duplicate QA/QC soil sample. There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in two of the six submitted groundwater samples, including the duplicate QA/QC soil sample. The Site is not considered to be in compliance with the O. Reg. 153/04 criteria for the proposed land use and requires soil remediation/removal or a risk assessment prior to redevelopment. Groundwater was sampled on October 19, 2018 and analyzed for Metals, VOCs, BTEX, and PHCs. Groundwater sample, MW2 presented O. Reg. 153/04 Table 3 exceedances of Chloride. Sample MW3S presented O. Reg. 153/04 Table 3 exceedances of PHCs (F2 and F3). The PHC contamination appears to be localized in the area of MW3S as PHCs were not detected in the analysis of the groundwater samples collected from the other well locations.



9.4 2021 PHASE I ENVIRONMENTAL SITE ASSESSMENT (ESA)

Lopers & Associates (Lopers) was retained in January 2021 to carry out Phase one ESA for the site as part of due diligence requirements associated with the submission of a Development Application to the City of Ottawa Municipal Planning Department (see **Appendix D.4** for details). This Phase one ESA can also be used to support the filing of a record of site condition of the property. It is important note that GHD also conducted Phase I ESA for the site in August 2018 for the purpose of due diligence as part of a potential purchase of the property (see **Appendix D.2** for details).

According to Lopers, the presence of a former waste disposal site approximately 20m east of the property is a significant potential contaminating activity (PCA) which represents an area of potential environmental concern for the site (APEC), other PCAs identified include an active automotive service garage and former retail fuel outlet. Previous environmental reports and investigations have documented petroleum hydrocarbon (PHC), groundwater contamination and that waste fill material has been observed in boreholes on the north portion of the property, the Property is not in compliance with the Soil, Groundwater and Sediment Standards for use under Part XV.1 of the Environmental Protection Act, which are also for consideration of O.Reg. 153/04.

The contaminants of potential concern (CPCs) associated with the former disposal site are volatile organic compounds (VOCs) (for groundwater only), metals, polycyclic aromatic hydrocarbons (PAHs) and PHCs/BTEXs. An investigation of the soil and groundwater quality with respect to these CPCs at the property was completed in 2019. Based on the identification of an APEC at the Phase One Property;

- i. a phase two Environmental Site Assessment is required to assess the soil and/or groundwater quality in the vicinity of the APEC.
- ii. Record of Site Condition Based on Phase One Environmental Site Assessment Alone.

According to Lopers, O. Reg. 153/04 stipulates that reports being used to support the filing of a RSC must be done no later than 18 months before the submission of a RSC. Given that a recent (2019) Phase Two ESA report has been prepared for the Phase One Property, and because it is not anticipated that remediation of the Phase One ESA property will be completed and an RSc submission will not be completed in the next 18 months, it is recommended that an additional Phase Two ESA study, which is anticipated to include documentation of remediation and be used to support a RSC submission, take place in conjunction with redevelopment of the Phase One property.



Approvals/Permits

10.0 APPROVALS/PERMITS

A Ministry of the Environment, Conservation and Parks (MECP) Environmental Compliance Approval (ECA) will be required for the extension of the sanitary sewer on Dumauiier Avenue needed to service the proposed development. Consultation with the Ottawa District Office of the MECP confirmed that the extension of this sanitary sewer is eligible for the Transfer of Review Program for standard works with the City of Ottawa, although such works have now been transferred to the CLI-ECA program. A consultation record is included in **Appendix B.2**. An ECA is not expected to be required for the remainder of the subject site as the site is under singular, private ownership, is not within industrial lands, and does not discharge to a combined sewer.

If the ground or surface water volumes being pumped during the construction phase are between 50,000 and 400,000 L/day, it is required to register on the Environmental Activity and Sector Registry (EASR). A minimum of two to four weeks should be allotted for completion of the EASR registration and the preparation of the Water Taking and Discharge Plan by a Qualified Person as stipulated under O.Reg. 63/16. A Permit to Take Water (PTTW) through the MECP would be required for dewatering in excess of 400,000 L/day, which is unlikely for this site. However, if a PTTW is required, at least 4 to 5 months should be allowed for completion of the application and issuance of the permit by the MECP. If blasting is used to remove the bedrock as part of the excavation for the building foundation, prior approval is required from the owners/operators of any water storage reservoir, pumping station, and water works transformer station within 200 m of the site.



Conclusions

11.0 CONCLUSIONS

11.1 POTABLE WATER SERVICING

The proposed 40-storey residential high-rise building will be serviced by the existing 300 mm diameter watermain on Dumaaurier Avenue. To create a suitable water service connection for the property a section of the existing 300 mm dia. watermain was modified to include: replacement of about 9 m pipe length with new deflected 9 m 300 mm dia. pipe length, new valves, tees, bends and two 150 mm watermain stubs to provide potable water and fire flow water supply to the development. Water demand calculation was based on a demand rate of 280 L/cap/day for residential units and 28,000 L/ha/day for commercial and amenity space.

The building contains 407 residential units with an estimated population of 693 persons. The commercial and amenity areas account for a total area of 3,538 m². The calculated average day flow, maximum day flow and peak hour demand are 2.36 L/s, 5.79 L/s and 12.66 L/s. The fire flow requirement was calculated in accordance with Fire Underwriters Survey (FUS) and determined to be approximately 5,000 L/min (83.3 L/s), it is anticipated that the building will be sprinklered, with final sprinkler design to conform to the NFPA 13 standard.

Based on the boundary conditions available, the 300 mm diameter watermain on Dumaaurier Avenue provides adequate fire flow capacity as per the requirements of the Fire Underwriters Survey while respecting City of Ottawa design guidelines. Two 150 mm diameter service laterals connected to the 300 mm diameter watermain on Dumaaurier Avenue will be capable of providing the anticipated water demands to the lower storeys. A booster pump, to be designed by the building's mechanical engineer, will be required to maintain minimum required pressures for the upper storeys.

The existing 150 mm private watermain running through the north end of the site, currently servicing Ottawa Boys & Girls club (1085 Grenon Avenue) as well as Ruth Wildgen Park (1099 Grenon Avenue) will be relocated outside the boundary of the site to allow for the development of structures and services within the subject site and to ensure an adequate level of service is provided to the adjoining properties.

11.2 WASTEWATER SERVICING

The proposed 40-storey residential high-rise building is to contain 407 units in total consisting of 240 one-bedroom units, 161 two-bedroom units, 6 three-bedroom units, 200 m² commercial area and 3,338 m² communal amenity areas with a total estimated population of 693 people using the City of Ottawa's recommended population densities.

The calculated peak flow for the site is 7.6 L/s. The sanitary servicing for the proposed development will be provided through a single proposed 200 mm diameter service lateral connecting to a new 250mm sanitary sewer flowing into an extension of the existing 250 mm diameter concrete sanitary sewer flowing southwards on Dumaaurier Avenue. An extension of the sanitary sewer network northwards towards the site was required to conveniently collect wastewater from the site. Consultation with the MECP Ottawa District



SERVICING AND STORMWATER MANAGEMENT REPORT – 2829 DUMAURIER AVENUE

Conclusions

Office confirmed that this sanitary sewer extension within the Dumaaurier Avenue right-of-way is eligible for the standard Transfer of Review program with the City of Ottawa.

The proposed sanitary service lateral is sufficiently sized to provide gravity drainage for the site. The floor drains in the underground parking will be connected to the building plumbing system and discharged to the sanitary service lateral through a sump pump. A backflow preventer will be required for the proposed building in accordance with the Ottawa sewer design guide and will be coordinated with the building's mechanical engineer.

The existing 225mm sanitary sewer running through the north end of the site, currently servicing Ottawa Boys & Girls Club, (1085 Grenon Ave) as well as Ruth Wildgen Park, (1099 Grenon Ave) will be relocated outside of the site to allow for the development of new building structures. Sanitary services will ensure an adequate level-of-service is provided for the adjoining properties.

11.3 STORMWATER MANAGEMENT AND SERVICING

The proposed 0.42 ha redevelopment area will be serviced by the existing 375mm diameter concrete storm sewer running north to south on Dumaaurier Avenue. This storm sewer ultimately outlets to Graham Creek downstream, as was confirmed using the City's GeoOttawa GIS data. A proposed stormwater cistern within the underground parking facility will attenuate peak flows from the building's roof, outdoor amenity areas, surface parking lot, and landscaped areas west of the building. In order to meet the 100yr target release rate for storm runoff of 60.8 L/s, a pump will be designed to limit peak outflow, while storage is provided within the underground cistern. The storm servicing within the site will be directed to the cistern via a combination of traditional catchbasin and leads and the internal plumbing of the building.

The available volume of 120 m³ within the stormwater cistern exceeds the required storage for 100yr runoff. Outflow will be controlled via pump system, and will be designed by the building mechanical engineers at a controlled rate of no more than 38.1 L/s.

A proposed oil/grit separator unit will treat storm runoff from the site to achieve 80% TSS removal. A Stormceptor 300 or approved equivalent is recommended for this purpose.

11.4 SITE GRADING AND DRAINAGE

Grading for the site is designed as per City of Ottawa requirements and provides for outlet of emergency overland flow under extreme flood conditions. Erosion and sediment control measures will be implemented during construction to reduce the impact on existing facilities.

A concrete retaining wall is proposed on the north end of the site to allow for a grade change of about 1.50m between the adjoining site (Boys & Girls Club of Ottawa) and the proposed development. The structural design of the retaining wall will be provided in a subsequent submissions from the building's structural engineers, as the retaining walls will be integrated with the building structure and foundation.



Conclusions

11.5 UTILITIES

Hydro Ottawa, Bell, Rogers, and Enbridge all have existing utility plants in the area, which will be used to service the site. The exact size, location, and routing of utilities will be finalized after design circulation. Existing overhead wires and utility plants may need to be moved/reconfigured to allow sufficient clearance to the proposed building. The relocation of existing utilities will be coordinated with the individual utility providers as part of the site plan approval process by the civil engineer.

11.6 APPROVALS/PERMITS

A Ministry of the Environment, Conservation and Parks (MECP) Environmental Compliance Approval (ECA) will be required for the extension of the sanitary sewer on Dumaudier Avenue needed to service the proposed development. Consultation with the Ottawa District Office of the MECP confirmed that the extension of this sanitary sewer is eligible for the Transfer of Review Program for standard works with the City of Ottawa, although will now be processed under the new CLI-ECA program. An ECA is not expected to be required for the remainder of the subject site as the site is under singular, private ownership, is not within industrial lands, and does not discharge to a combined sewer.

A Permit to Take Water (PTTW) may be required if the dewatering during the construction of the underground parking level is expected to exceed 400,000 L/day. No other approval requirements from other regulatory agencies are anticipated. For dewatering activities between 50,000 and 400,000 L/day, registration on the Environmental Activity and Sector Registry (EASR) will be required. If blasting is used to remove the bedrock as part of the excavation for the building foundation, prior approval is required from the owners/operators of any water storage reservoir, pumping station, and water works transformer station within 200 m of the site.



APPENDICES

Appendix A POTABLE WATER SERVICING

A.1 WATER DEMAND CALCULATIONS



2829 Dumaaurier Avenue - Domestic Water Demand Estimates

Based on Unit Statistics from Roderick Lahey Architect Inc. Site Plan SP-1 dated April 8 2024
 Last updated on April 15, 2024

Population densities as per City of Ottawa Guidelines:

| | | |
|-----------|-----|-----|
| 1 Bedroom | 1.4 | ppu |
| 2 Bedroom | 2.1 | ppu |
| 3 Bedroom | 3.1 | ppu |

| Unit Type | Area (m ²) | Number of Units | Population | Daily Demand Rate (L/cap/day or L/ha/d) | Avg. Day Demand ^{1,2} | | Max. Day Demand ^{1,2} | | Peak Hour Demand ^{1,2} | |
|----------------------|------------------------|-----------------|------------|---|--------------------------------|-------------|--------------------------------|-------------|---------------------------------|--------------|
| | | | | | (L/min) | (L/s) | (L/min) | (L/s) | (L/min) | (L/s) |
| 1 Bedroom | - | 240 | 336 | 280 | 65.3 | 1.09 | 163.3 | 2.72 | 359.3 | 5.99 |
| 2 Bedroom | - | 161 | 338 | 280 | 65.7 | 1.10 | 164.3 | 2.74 | 361.5 | 6.02 |
| 3 Bedroom | - | 6 | 19 | 280 | 3.7 | 0.06 | 9.2 | 0.15 | 20.3 | 0.34 |
| Commercial Space | 200 | - | - | 28000 | 0.4 | 0.01 | 0.6 | 0.01 | 1.1 | 0.02 |
| Total Communal Space | 3,338 | - | - | 28000 | 6.5 | 0.11 | 9.7 | 0.16 | 17.5 | 0.29 |
| | | | | | | | | | | |
| | | | | | | | | | | |
| Total Site : | 3538 | 407 | 693 | | 141.6 | 2.36 | 347.2 | 5.79 | 759.7 | 12.66 |

1 Water demand criteria used to estimate peak demand rates for residential areas are as follows:

- maximum daily demand rate = 2.5 x average day demand rate
- peak hour demand rate = 2.2 x maximum day demand rate

2 Water demand criteria used to estimate peak demand rates for commercial/amenity/lobby areas are as follows:

- maximum daily demand rate = 1.5 x average day demand rate
- peak hour demand rate = 1.8 x maximum day demand rate

A.2 FIRE FLOW REQUIREMENTS PER FUS GUIDELINES (2020)





FUS Fire Flow Calculation Sheet - 2020 FUS Guidelines

Stantec Project #: 160401596
 Project Name: 2839 Dumaourier Avenue
 Date: 5/16/2024

Fire Flow Calculation #: 1

Description: Proposed 40 Storey High Rise Residential w/ 4 Storey Podium

40-storey residential high-rise with commercial space on ground floor and 4-storey podium. Information taken from Site Plan SP-1 prepared

Notes: by Roderick Lahey Architect Inc. dated April 8, 2024. 2-hour fire separation provided between each floor and 1-hour fire separation provided for exterior vertical communications.

| Step | Task | Notes | | | | | | Value Used | Req'd Fire Flow (L/min) | |
|------|---|--|-----------------------|--------------------|------------------------------|------------------------------------|----------------------------------|--------------------------|-------------------------|-----|
| 1 | Determine Type of Construction | Type II - Noncombustible Construction / Type IV-A - Mass Timber Construction | | | | | | 0.8 | - | |
| 2 | Determine Effective Floor Area | Sum of Largest Floor + 25% of Two Additional Floors | | | Vertical Openings Protected? | | | YES | - | |
| | | 1455.2 | 1335 | 1455.2 | | | | 2152.75 | - | |
| 3 | Determine Required Fire Flow | (F = 220 x C x A ^{1/2}). Round to nearest 1000 L/min | | | | | | - | 8000 | |
| 4 | Determine Occupancy Charge | Limited Combustible | | | | | | -15% | 6800 | |
| 5 | Determine Sprinkler Reduction | Conforms to NFPA 13 | | | | | | -30% | -2720 | |
| | | Standard Water Supply | | | | | | -10% | | |
| | | Not Fully Supervised or N/A | | | | | | 0% | | |
| | | % Coverage of Sprinkler System | | | | | | 100% | | |
| 6 | Determine Increase for Exposures (Max. 75%) | Direction | Exposure Distance (m) | Exposed Length (m) | Exposed Height (Stories) | Length-Height Factor (m x stories) | Construction of Adjacent Wall | Firewall / Sprinklered ? | - | - |
| | | North | 10.1 to 20 | 38 | 2 | 61-80 | Type I-II - Unprotected Openings | NO | 6% | 680 |
| | | East | > 30 | 60 | 1 | 41-60 | Type I-II - Unprotected Openings | NO | 0% | |
| | | South | 10.1 to 20 | 25 | 1 | 21-49 | Type I-II - Unprotected Openings | NO | 4% | |
| | | West | > 30 | 60 | 1 | 41-60 | Type I-II - Unprotected Openings | NO | 0% | |
| 7 | Determine Final Required Fire Flow | Total Required Fire Flow in L/min, Rounded to Nearest 1000L/min | | | | | | | 5000 | |
| | | Total Required Fire Flow in L/s | | | | | | | 83.3 | |
| | | Required Duration of Fire Flow (hrs) | | | | | | | 1.75 | |
| | | Required Volume of Fire Flow (m ³) | | | | | | | 525 | |

A.3 BOUNDARY CONDITIONS



Chochlinski, Daniel

From: Kuruvilla, Santhosh <Santhosh.Kuruvilla@ottawa.ca>
Sent: Tuesday, February 2, 2021 3:23 PM
To: Kuruvilla, Santhosh
Subject: FW: 160401596 - 2829 Dumaaurier Avenue - Hydraulic Boundary Conditions Request
Attachments: 2829 Dumaaurier February 2021.pdf

The following are boundary conditions, HGL, for hydraulic analysis at 2829 Dumaaurier (zone 1W) assumed to be connected to the 305mm on Dumaaurier Avenue (see attached PDF for location).

Minimum HGL = 107.4m


Maximum HGL = 114.3m

Max Day + Fire Flow (116.7 L/s) = 105.2m

These are for current conditions and are based on computer model simulation.

Disclaimer: The boundary condition information is based on current operation of the city water distribution system. The computer model simulation is based on the best information available at the time. The operation of the water distribution system can change on a regular basis, resulting in a variation in boundary conditions. The physical properties of watermains deteriorate over time, as such must be assumed in the absence of actual field test data. The variation in physical watermain properties can therefore alter the results of the computer model simulation.

Boundary Condition for 2829 Dumaurier Avenue

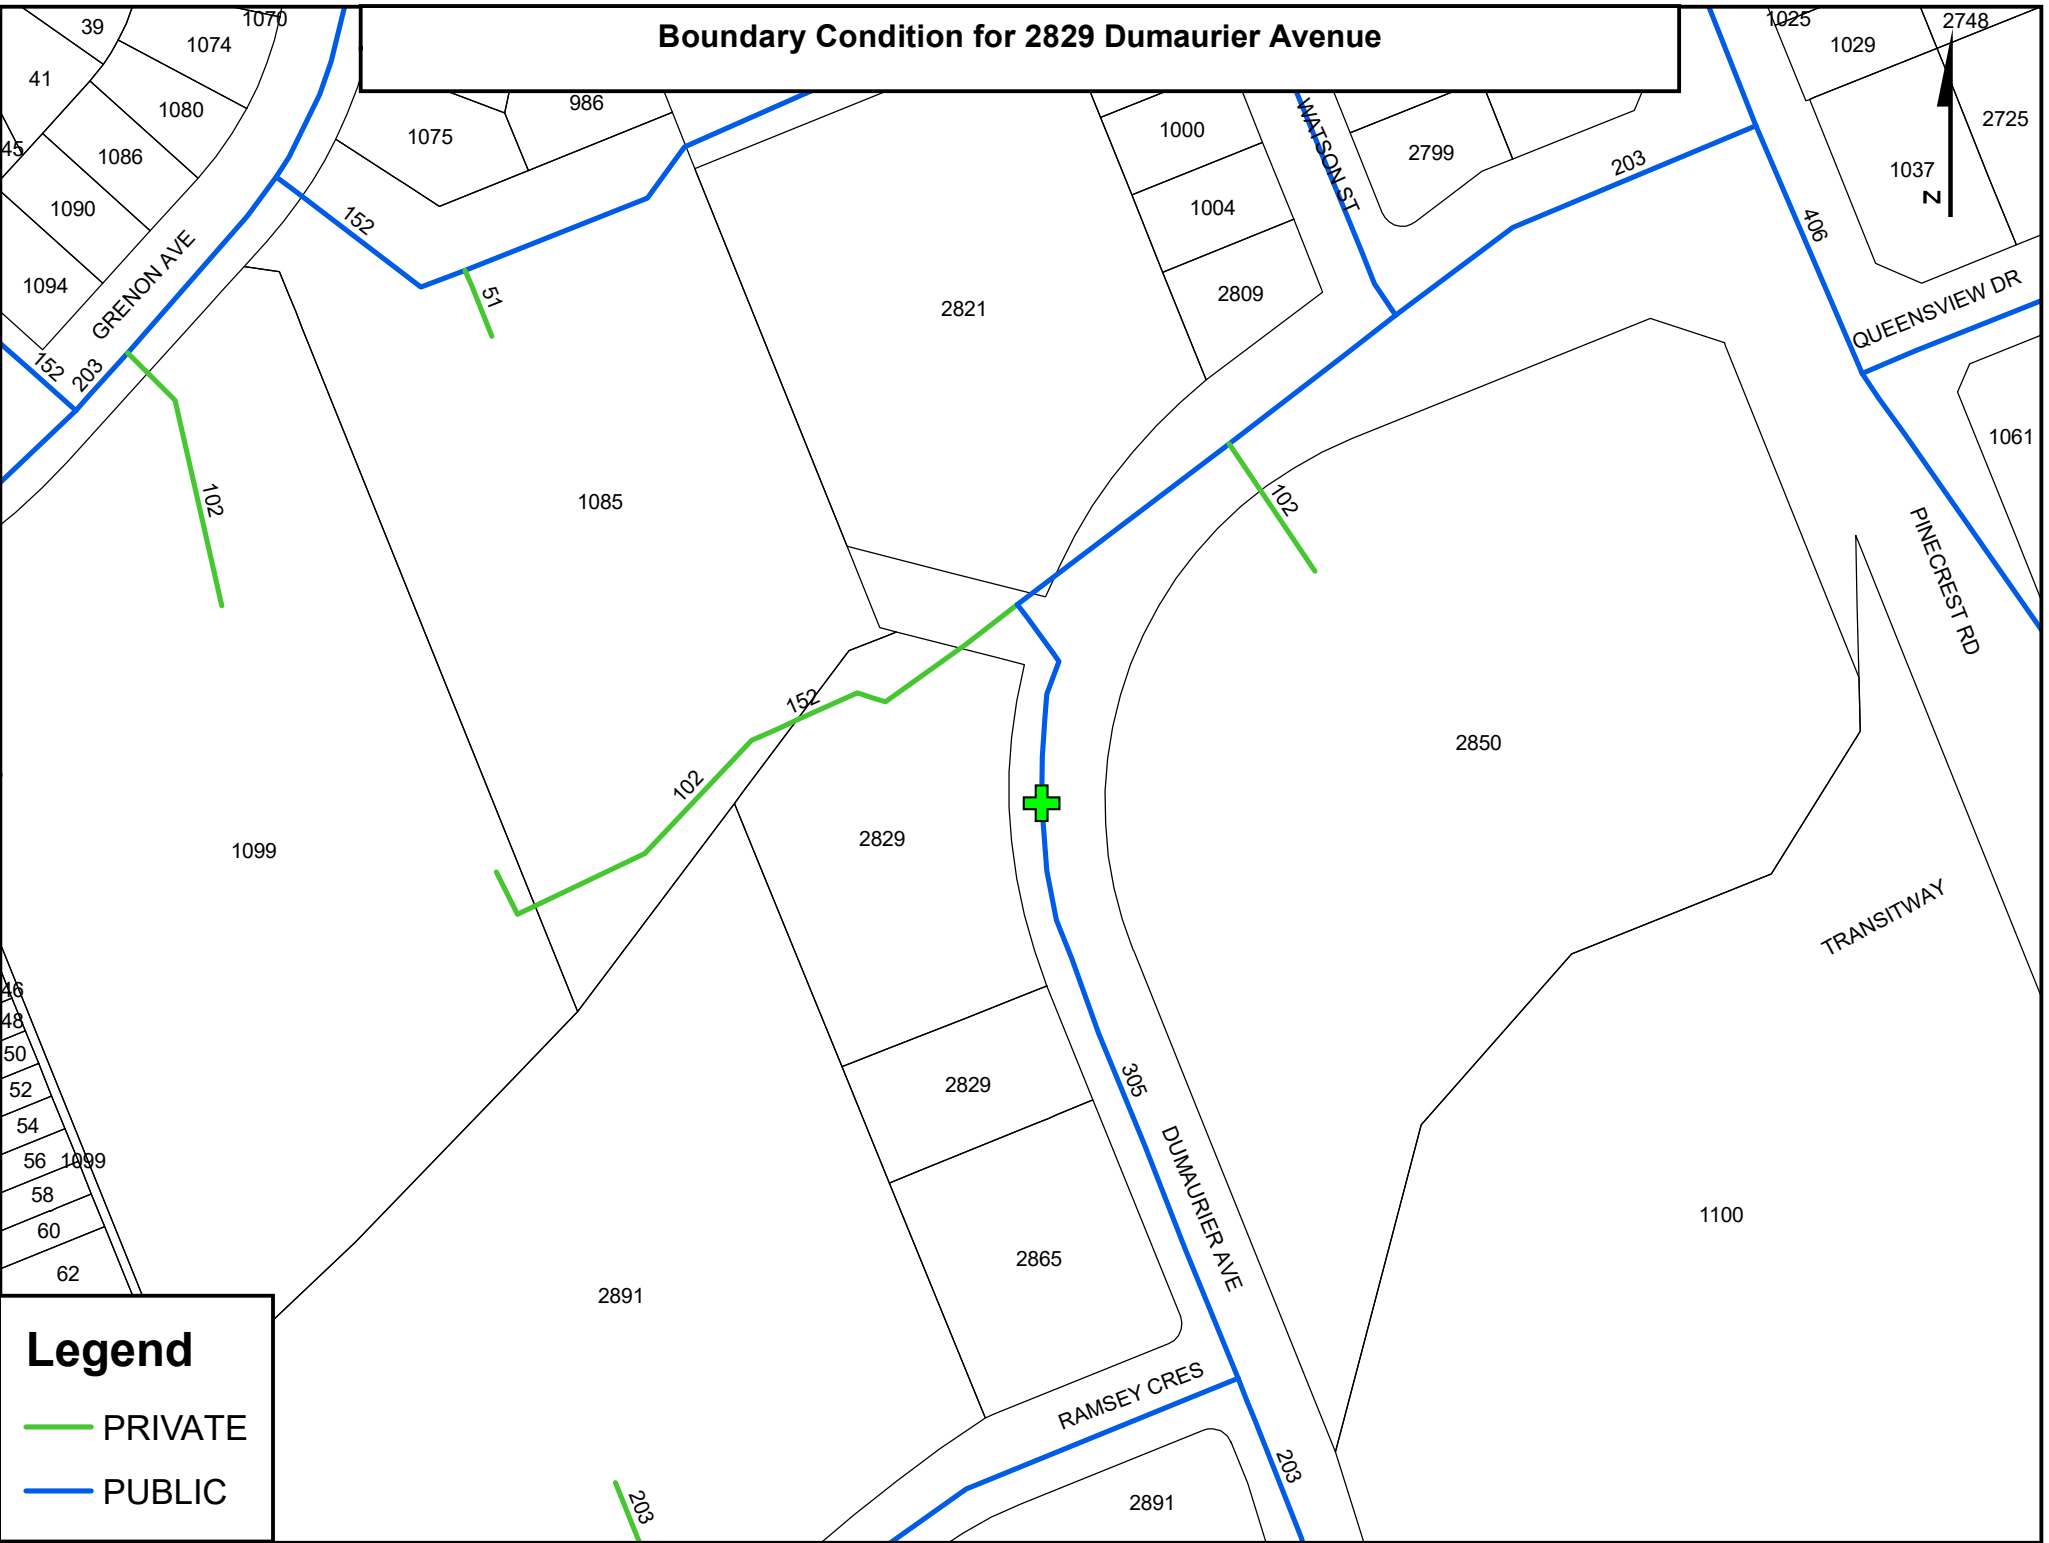


Legend

-  PRIVATE
-  PUBLIC

Appendix B SANITARY SERVICING

B.1 SANITARY SEWER DESIGN SHEET



|  | SUBDIVISION: 2829 Dumaaurier Avenue | | SANITARY SEWER DESIGN SHEET (City of Ottawa) | | | | | | | | | | DESIGN PARAMETERS | | | | | | | | | | | | | | | | | | | | | | | |
|--|---|-------------|--|--------|------------|-----|------|----------------------|------|------------|-----------------|----------------|-------------------|----------------|------------------------|-----------------------------|-----------------------------|----------------------------------|--------------------------------|-----------------------|-------------------------|--------------------------|---------------------------------------|-----------------------------|-------------------------------------|-------------------------------------|--------------------------------|---------------------------|----------------------------|----------------------------|-------------------|-------------------|-----------------------|-------------------------------|-------------------|--|
| | DATE: 5/16/2024 | REVISION: 3 | | | | | | | | | | | DESIGNED BY: WAJ | CHECKED BY: | FILE NUMBER: 160401596 | MAX PEAK FACTOR (RES.)= 4.0 | MIN PEAK FACTOR (RES.)= 2.0 | PEAKING FACTOR (INDUSTRIAL): 2.4 | PEAKING FACTOR (ICI >20%): 1.5 | PERSONS / SINGLE: 3.4 | PERSONS / TOWNHOME: 2.7 | PERSONS / APARTMENT: 1.8 | AVG. DAILY FLOW / PERSON: 280 l/p/day | COMMERCIAL: 28,000 l/ha/day | INDUSTRIAL (HEAVY): 55,000 l/ha/day | INDUSTRIAL (LIGHT): 35,000 l/ha/day | INSTITUTIONAL: 28,000 l/ha/day | INFILTRATION: 0.33 l/s/ha | MINIMUM VELOCITY: 0.60 m/s | MAXIMUM VELOCITY: 3.00 m/s | MANNINGS n: 0.013 | BEDDING CLASS: B | MINIMUM COVER: 2.50 m | HARMON CORRECTION FACTOR: 0.8 | | |
| LOCATION | | | RESIDENTIAL AREA AND POPULATION | | | | | | | COMMERCIAL | | INDUSTRIAL (L) | | INDUSTRIAL (H) | | INSTITUTIONAL | | GREEN / UNUSED | | C+H | INFILTRATION | | | TOTAL | PIPE | | | | | | | | | | | |
| AREA ID NUMBER | FROM M.H. | TO M.H. | AREA (ha) | SINGLE | UNITS TOWN | APT | POP. | CUMULATIVE AREA (ha) | POP. | PEAK FACT. | PEAK FLOW (l/s) | AREA (ha) | ACCU. AREA (ha) | AREA (ha) | ACCU. AREA (ha) | AREA (ha) | ACCU. AREA (ha) | AREA (ha) | ACCU. AREA (ha) | AREA (ha) | ACCU. AREA (ha) | PEAK FLOW (l/s) | TOTAL AREA (ha) | ACCU. AREA (ha) | INFILT. FLOW (l/s) | FLOW (l/s) | LENGTH (m) | DIA (mm) | MATERIAL | CLASS | SLOPE (%) | CAP. (FULL) (l/s) | CAP. V PEAK FLOW (%) | VEL. (FULL) (m/s) | VEL. (ACT.) (m/s) | |
| R101A, G101A | BLDG SAN 101 | 101 | 0.36 | 0 | 0 | 0 | 693 | 0.36 | 693 | 3.32 | 7.5 | 0.02 | 0.02 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.01 | 0.38 | 0.38 | 0.1 | 7.6 | 1.2 | 200 | PVC | SDR 35 | 1.00 | 33.4 | 22.68% | 1.05 | 0.70 | |
| | 101 | 100 | 0.00 | 0 | 0 | 0 | 0 | 0.36 | 693 | 3.32 | 7.5 | 0.00 | 0.02 | 0.00 | 0.00 | 0.00 | 0.00 | 0.06 | 0.06 | 0.00 | 0.00 | 0.01 | 0.06 | 0.44 | 0.1 | 7.6 | 23.3 | 250 | PVC | SDR 35 | 0.50 | 42.9 | 17.73% | 0.86 | 0.54 | |
| | 100 | EX 101 | 0.00 | 0 | 0 | 0 | 0 | 0.36 | 693 | 3.32 | 7.5 | 0.00 | 0.02 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.06 | 0.00 | 0.00 | 0.01 | 0.00 | 0.44 | 0.1 | 7.6 | 30.7 | 250 | PVC | SDR 35 | 0.30 | 33.2 | 22.89% | 0.67 | 0.45 | |
| | EX 101 | EX 100 | 0.00 | 0 | 0 | 0 | 0 | 0.36 | 693 | 3.32 | 7.5 | 0.00 | 0.02 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.06 | 0.00 | 0.00 | 0.01 | 0.00 | 0.44 | 0.1 | 7.6 | 114.4 | 250 | PVC | SDR 35 | 1.54 | 75.2 | 10.10% | 1.52 | 0.81 | |
| | | | | | | | | | | | | | | | | | | | | | | | | | | | | 250 | | | | | | | | |

B.2 CORRESPONDENCE WITH MECP



Chochlinski, Daniel

From: Diamond, Emily (MECP) <Emily.Diamond@ontario.ca>
Sent: Wednesday, January 13, 2021 3:04 PM
To: Chochlinski, Daniel
Cc: Kilborn, Kris; Paerez, Ana
Subject: FW: 160401596 - 2829 Dumaurier Avenue SAN Sewer Extension - ECA ToR Eligibility

Good Afternoon Daniel,

You may proceed under the Transfer of Review.

Have a great day!

Emily Diamond

Environmental Officer
Ministry of the Environment, Conservation and Parks
Ottawa District Office
2430 Don Reid Drive
Ottawa, Ontario, K1H 1E1
Cell: 613-866-0938
Fax: 613-521-5437
e-mail: emily.diamond@ontario.ca

From: Ahmed, Aziz (MECP) <Aziz.Ahmed@ontario.ca>
Sent: January 13, 2021 2:56 PM
To: Diamond, Emily (MECP) <Emily.Diamond@ontario.ca>
Subject: RE: 160401596 - 2829 Dumaurier Avenue SAN Sewer Extension - ECA ToR Eligibility

Emily,

No concerns, can proceed under ToR.

Stay safe,

Aziz

Aziz S. Ahmed, P.Eng. | Manager
Municipal Water and Wastewater Permissions Section, Environmental Permissions Branch | Environmental Assessment and Permissions Division
Ministry of the Environment, Conservation and Parks | 40 St. Clair Ave. West, 2nd Floor, Toronto, ON M4V 1M2
Tel: 416.314.4625 | Cell: 416.712.7427 | Toll Free: 1-888-999-1305 | Fax: 416.314.1037 ✉: Aziz.Ahmed@ontario.ca

If you have any accommodation needs or require communication supports or alternate formats, please let me know.

Si vous avez des besoins en matière d'adaptation, ou si vous nécessitez des aides à la communication ou des médias substitués, veuillez me le faire savoir.

From: Diamond, Emily (MECP) <Emily.Diamond@ontario.ca>
Sent: January-13-21 2:28 PM

To: Ahmed, Aziz (MECP) <Aziz.Ahmed@ontario.ca>

Subject: FW: 160401596 - 2829 Dumaaurier Avenue SAN Sewer Extension - ECA ToR Eligibility

Hi Aziz,

I have a consultant asking whether this project would fall under the ToR. Could you please advise.

Thank you!

Emily Diamond

Environmental Officer
Ministry of the Environment, Conservation and Parks
Ottawa District Office
2430 Don Reid Drive
Ottawa, Ontario, K1H 1E1
Cell: 613-866-0938
Fax: 613-521-5437
e-mail: emily.diamond@ontario.ca

From: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>

Sent: January 13, 2021 12:55 PM

To: Diamond, Emily (MECP) <Emily.Diamond@ontario.ca>

Cc: Kilborn, Kris <kris.kilborn@stantec.com>; Paerez, Ana <Ana.Paerez@stantec.com>

Subject: 160401596 - 2829 Dumaaurier Avenue SAN Sewer Extension - ECA ToR Eligibility

CAUTION -- EXTERNAL E-MAIL - Do not click links or open attachments unless you recognize the sender.

Hi Emily,

I am writing you to ask a question about a potential ECA Application for the 2829 Dumaaurier Avenue project which Stantec Consulting is completing civil design services for in support of its Site Plan Application with the City of Ottawa.

We have identified that we may need to extend the existing 250 mm diameter concrete municipal sanitary sewer on Dumaaurier Avenue northwards to service the proposed building at 2829 Dumaaurier Avenue. During the pre-application consultation process with the City of Ottawa, we have been asked to reach out to you to identify whether this potential sanitary sewer extension work would be eligible for review under the Transfer of Review program (Standard Works) with the City of Ottawa. The reason for this question is the sanitary sewer's proximity to the now-closed Pinecrest Landfill.

Please find attached the following:

- 1) Map of the site identifying (conceptually) the potential extension of the sanitary sewer within the Dumaaurier Avenue right-of-way.
- 2) A map provided by the City showing the infrastructure associated with the closed Pinecrest Landfill.

Please do not hesitate to reach out to me if you require any additional information. Thank you in advance for your time.

Regards,

Daniel Chochlinski EIT

Engineering Intern, Community Development

Mobile: 343-961-9619

daniel.chochlinski@stantec.com

Stantec

400 - 1331 Clyde Avenue

Ottawa ON K2C 3G4





Better Together, Even If We're Apart. [Read more](#) about Stantec's COVID-19 response, including remote working and business continuity measures.

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

B.3 CORRESPONDENCE WITH CITY ON SANITARY SEWER CAPACITY



Chochlinski, Daniel

From: Tousignant, Eric <Eric.Tousignant@ottawa.ca>
Sent: Wednesday, February 10, 2021 2:47 PM
To: Kuruvilla, Santhosh
Subject: RE: 160401596 - 2829 Dumaaurier Avenue - Sanitary Sewer Capacity

Hi Santhosh

I have no concerns with the additional flow.

Eric

From: Kuruvilla, Santhosh <Santhosh.Kuruvilla@ottawa.ca>
Sent: February 04, 2021 10:20 AM
To: Tousignant, Eric <Eric.Tousignant@ottawa.ca>
Subject: FW: 160401596 - 2829 Dumaaurier Avenue - Sanitary Sewer Capacity

Good morning Eric,

Hope you are doing good.

I received an email from Stantec (see below) regarding sanitary capacity question for the future site plan application.

Will you be able to assist them with this question?

Thanks,

Santhosh

From: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Sent: February 04, 2021 10:05 AM
To: Kuruvilla, Santhosh <Santhosh.Kuruvilla@ottawa.ca>
Cc: Paerez, Ana <Ana.Paerez@stantec.com>; Kilborn, Kris <kris.kilborn@stantec.com>
Subject: 160401596 - 2829 Dumaaurier Avenue - Sanitary Sewer Capacity

CAUTION: This email originated from an External Sender. Please do not click links or open attachments unless you recognize the source.

ATTENTION : Ce courriel provient d'un expéditeur externe. Ne cliquez sur aucun lien et n'ouvrez pas de pièce jointe, excepté si vous connaissez l'expéditeur.

Good Morning Santhosh,

We have prepared the sanitary peak flow calculations for the 2829 Dumaaurier Avenue site. May you please ask Eric Tousignant to verify whether sufficient residual capacity exists in the 250 mm dia. downstream sanitary sewer on Dumaaurier Avenue to accommodate the increased flows? If you would prefer that we reach out to Eric directly, please let us know.

I have attached the sanitary peak flow calculations as well as a map outlining the site boundary and where we intend to discharge the sanitary wastewater.

If you require any additional information from our end, do not hesitate to reach out.

Regards,

Daniel Chochlinski EIT

Engineering Intern, Community Development

Mobile: 343-961-9619

daniel.chochlinski@stantec.com

Stantec

400 - 1331 Clyde Avenue



Ottawa ON K2C 3G4



Better Together, Even If We're Apart. [Read more about Stantec's COVID-19 response, including remote working and business continuity measures.](#)

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

Address, Street, or Place

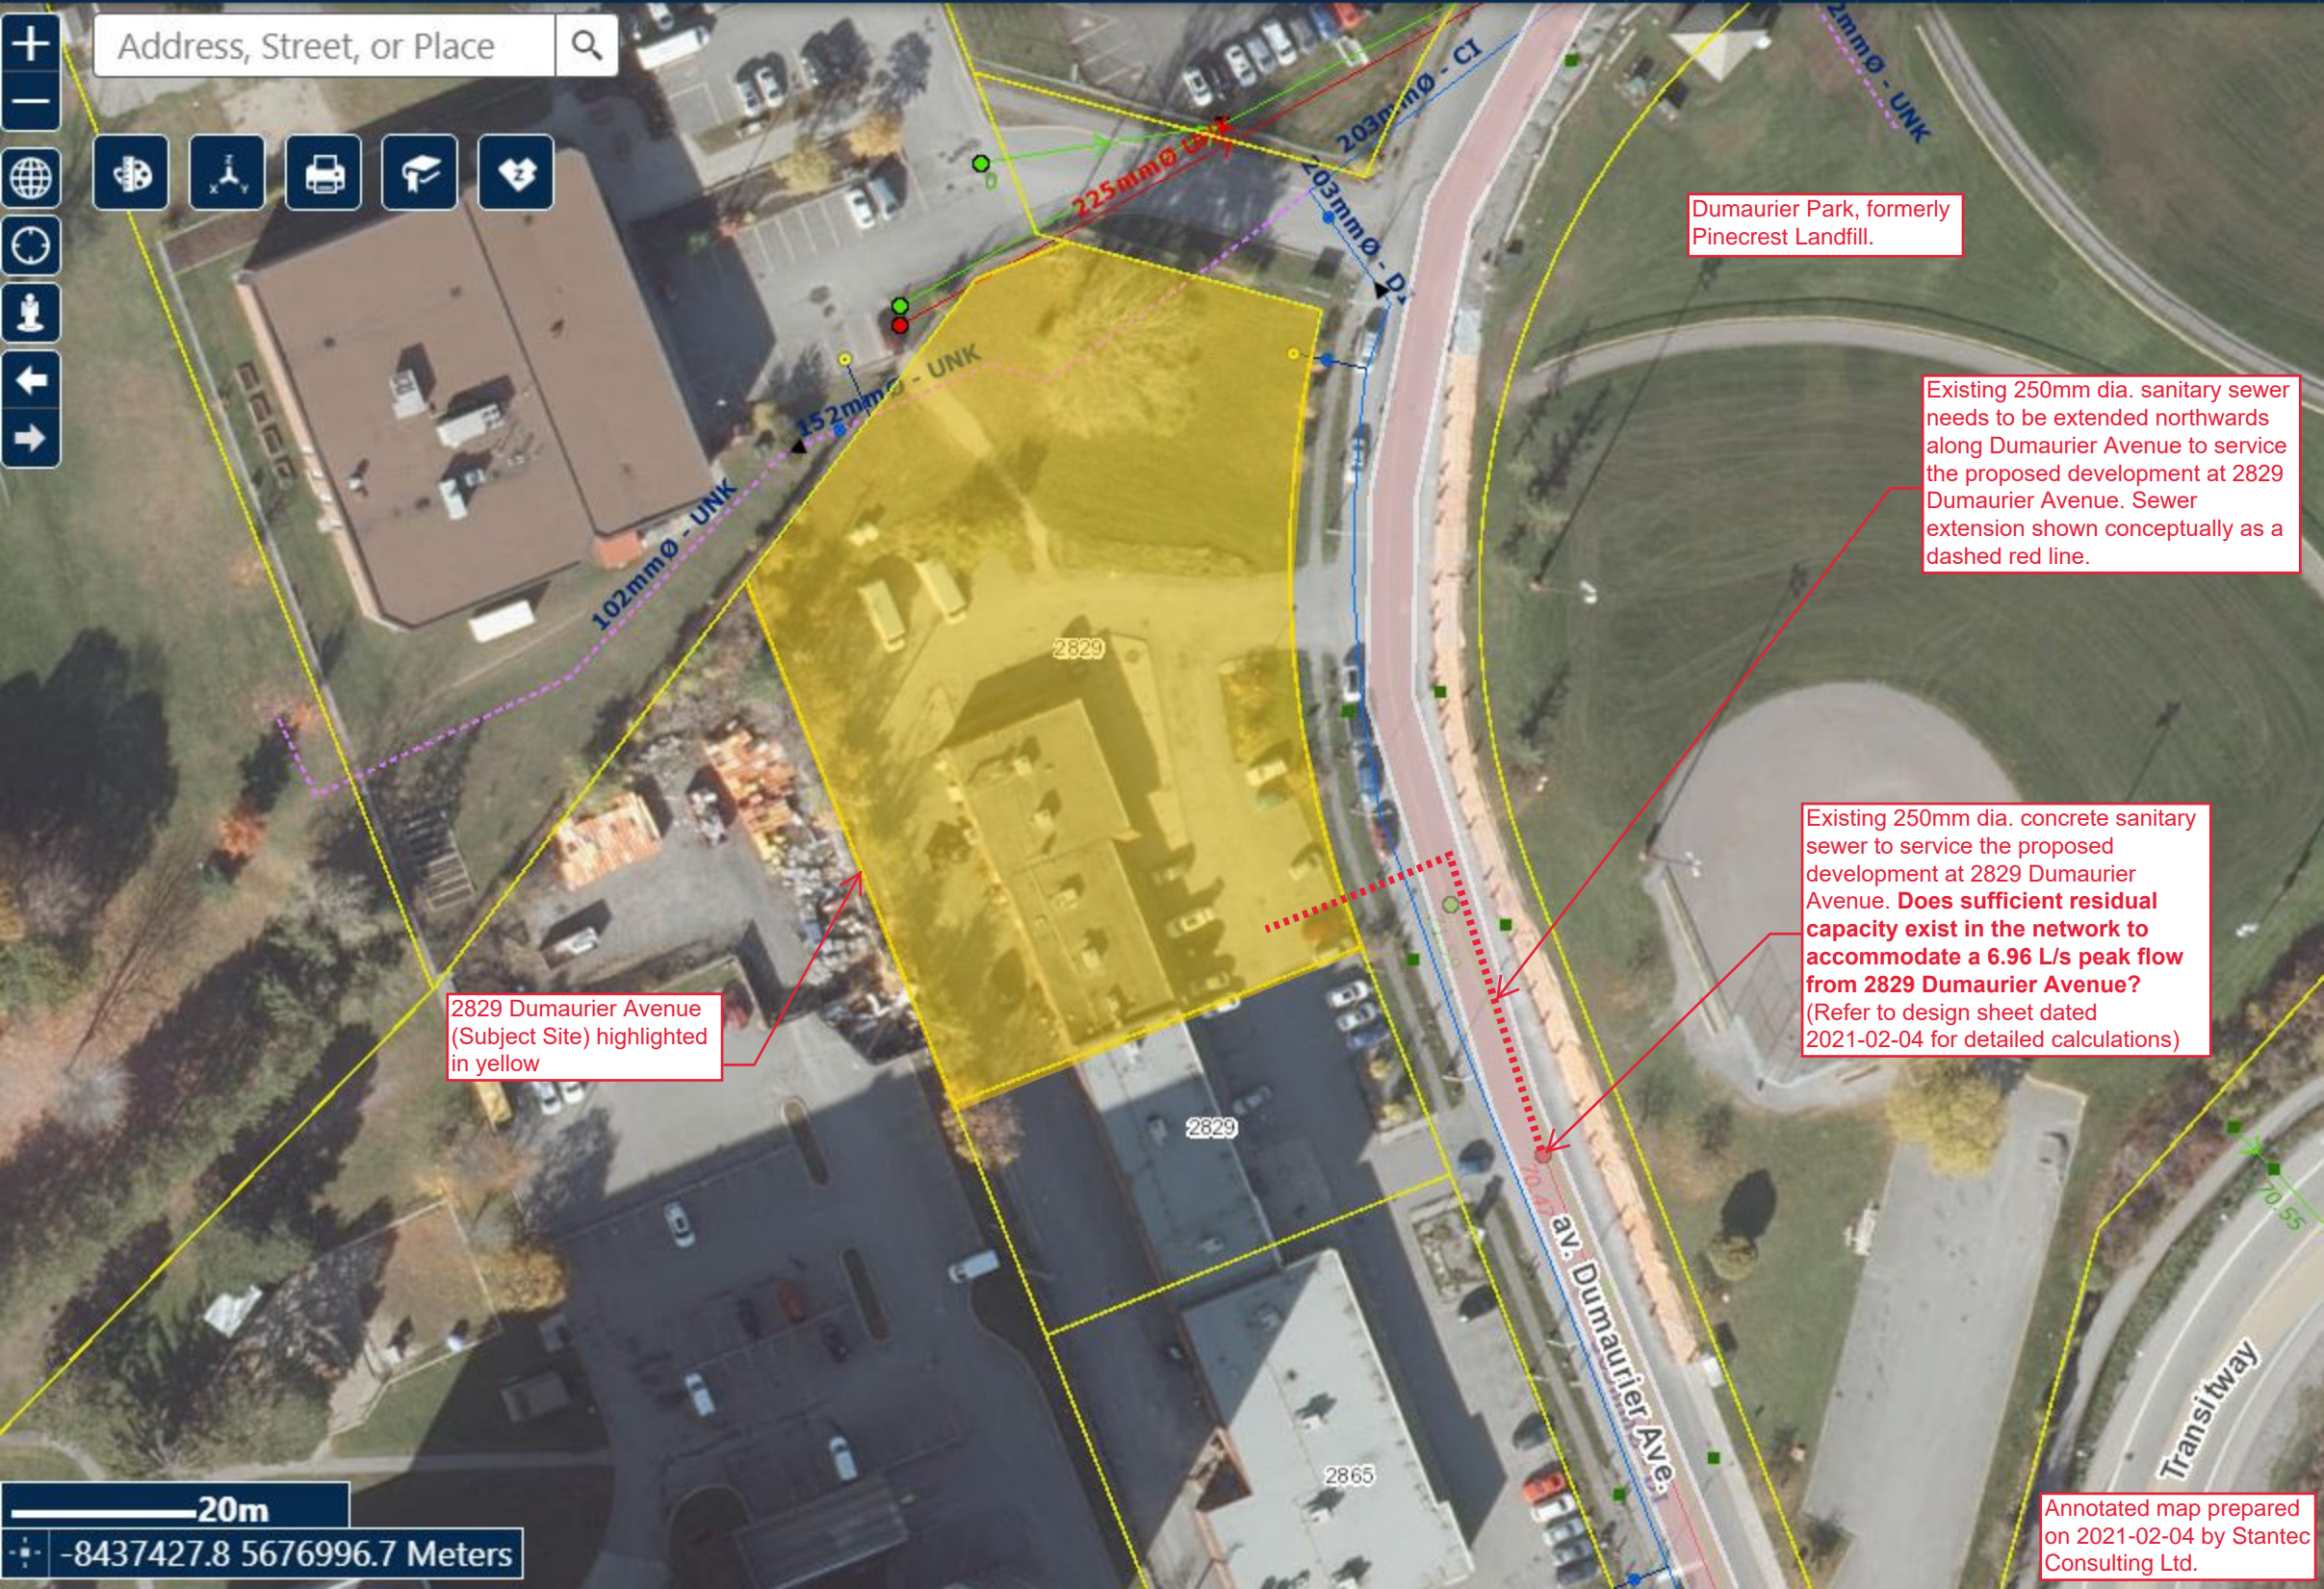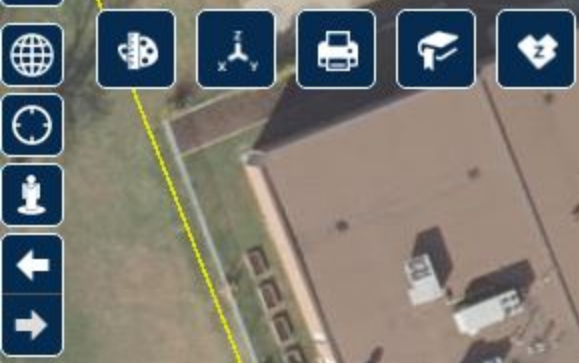

Dumaaurier Park, formerly Pinecrest Landfill.

Existing 250mm dia. sanitary sewer needs to be extended northwards along Dumaaurier Avenue to service the proposed development at 2829 Dumaaurier Avenue. Sewer extension shown conceptually as a dashed red line.

Existing 250mm dia. concrete sanitary sewer to service the proposed development at 2829 Dumaaurier Avenue. **Does sufficient residual capacity exist in the network to accommodate a 6.96 L/s peak flow from 2829 Dumaaurier Avenue?** (Refer to design sheet dated 2021-02-04 for detailed calculations)

2829 Dumaaurier Avenue (Subject Site) highlighted in yellow

Annotated map prepared on 2021-02-04 by Stantec Consulting Ltd.

Address, Street, or Place

Map navigation controls: zoom in (+), zoom out (-), globe, 3D view, print, pan, home, back, forward

Dumaurier Park, formerly Pinecrest Landfill.


Existing 250mm dia. sanitary sewer needs to be extended northwards along Dumaurier Avenue to service the proposed development at 2829 Dumaurier Avenue. Sewer extension shown conceptually as a dashed red line.

Existing 250mm dia. concrete sanitary sewer to service the proposed development at 2829 Dumaurier Avenue. **Does sufficient residual capacity exist in the network to accommodate a 6.96 L/s peak flow from 2829 Dumaurier Avenue?** (Refer to design sheet dated 2021-02-04 for detailed calculations)

2829 Dumaurier Avenue (Subject Site) highlighted in yellow

Annotated map prepared on 2021-02-04 by Stantec Consulting Ltd.

Scale bar: 20m
Coordinates: -8437427.8 5676996.7 Meters

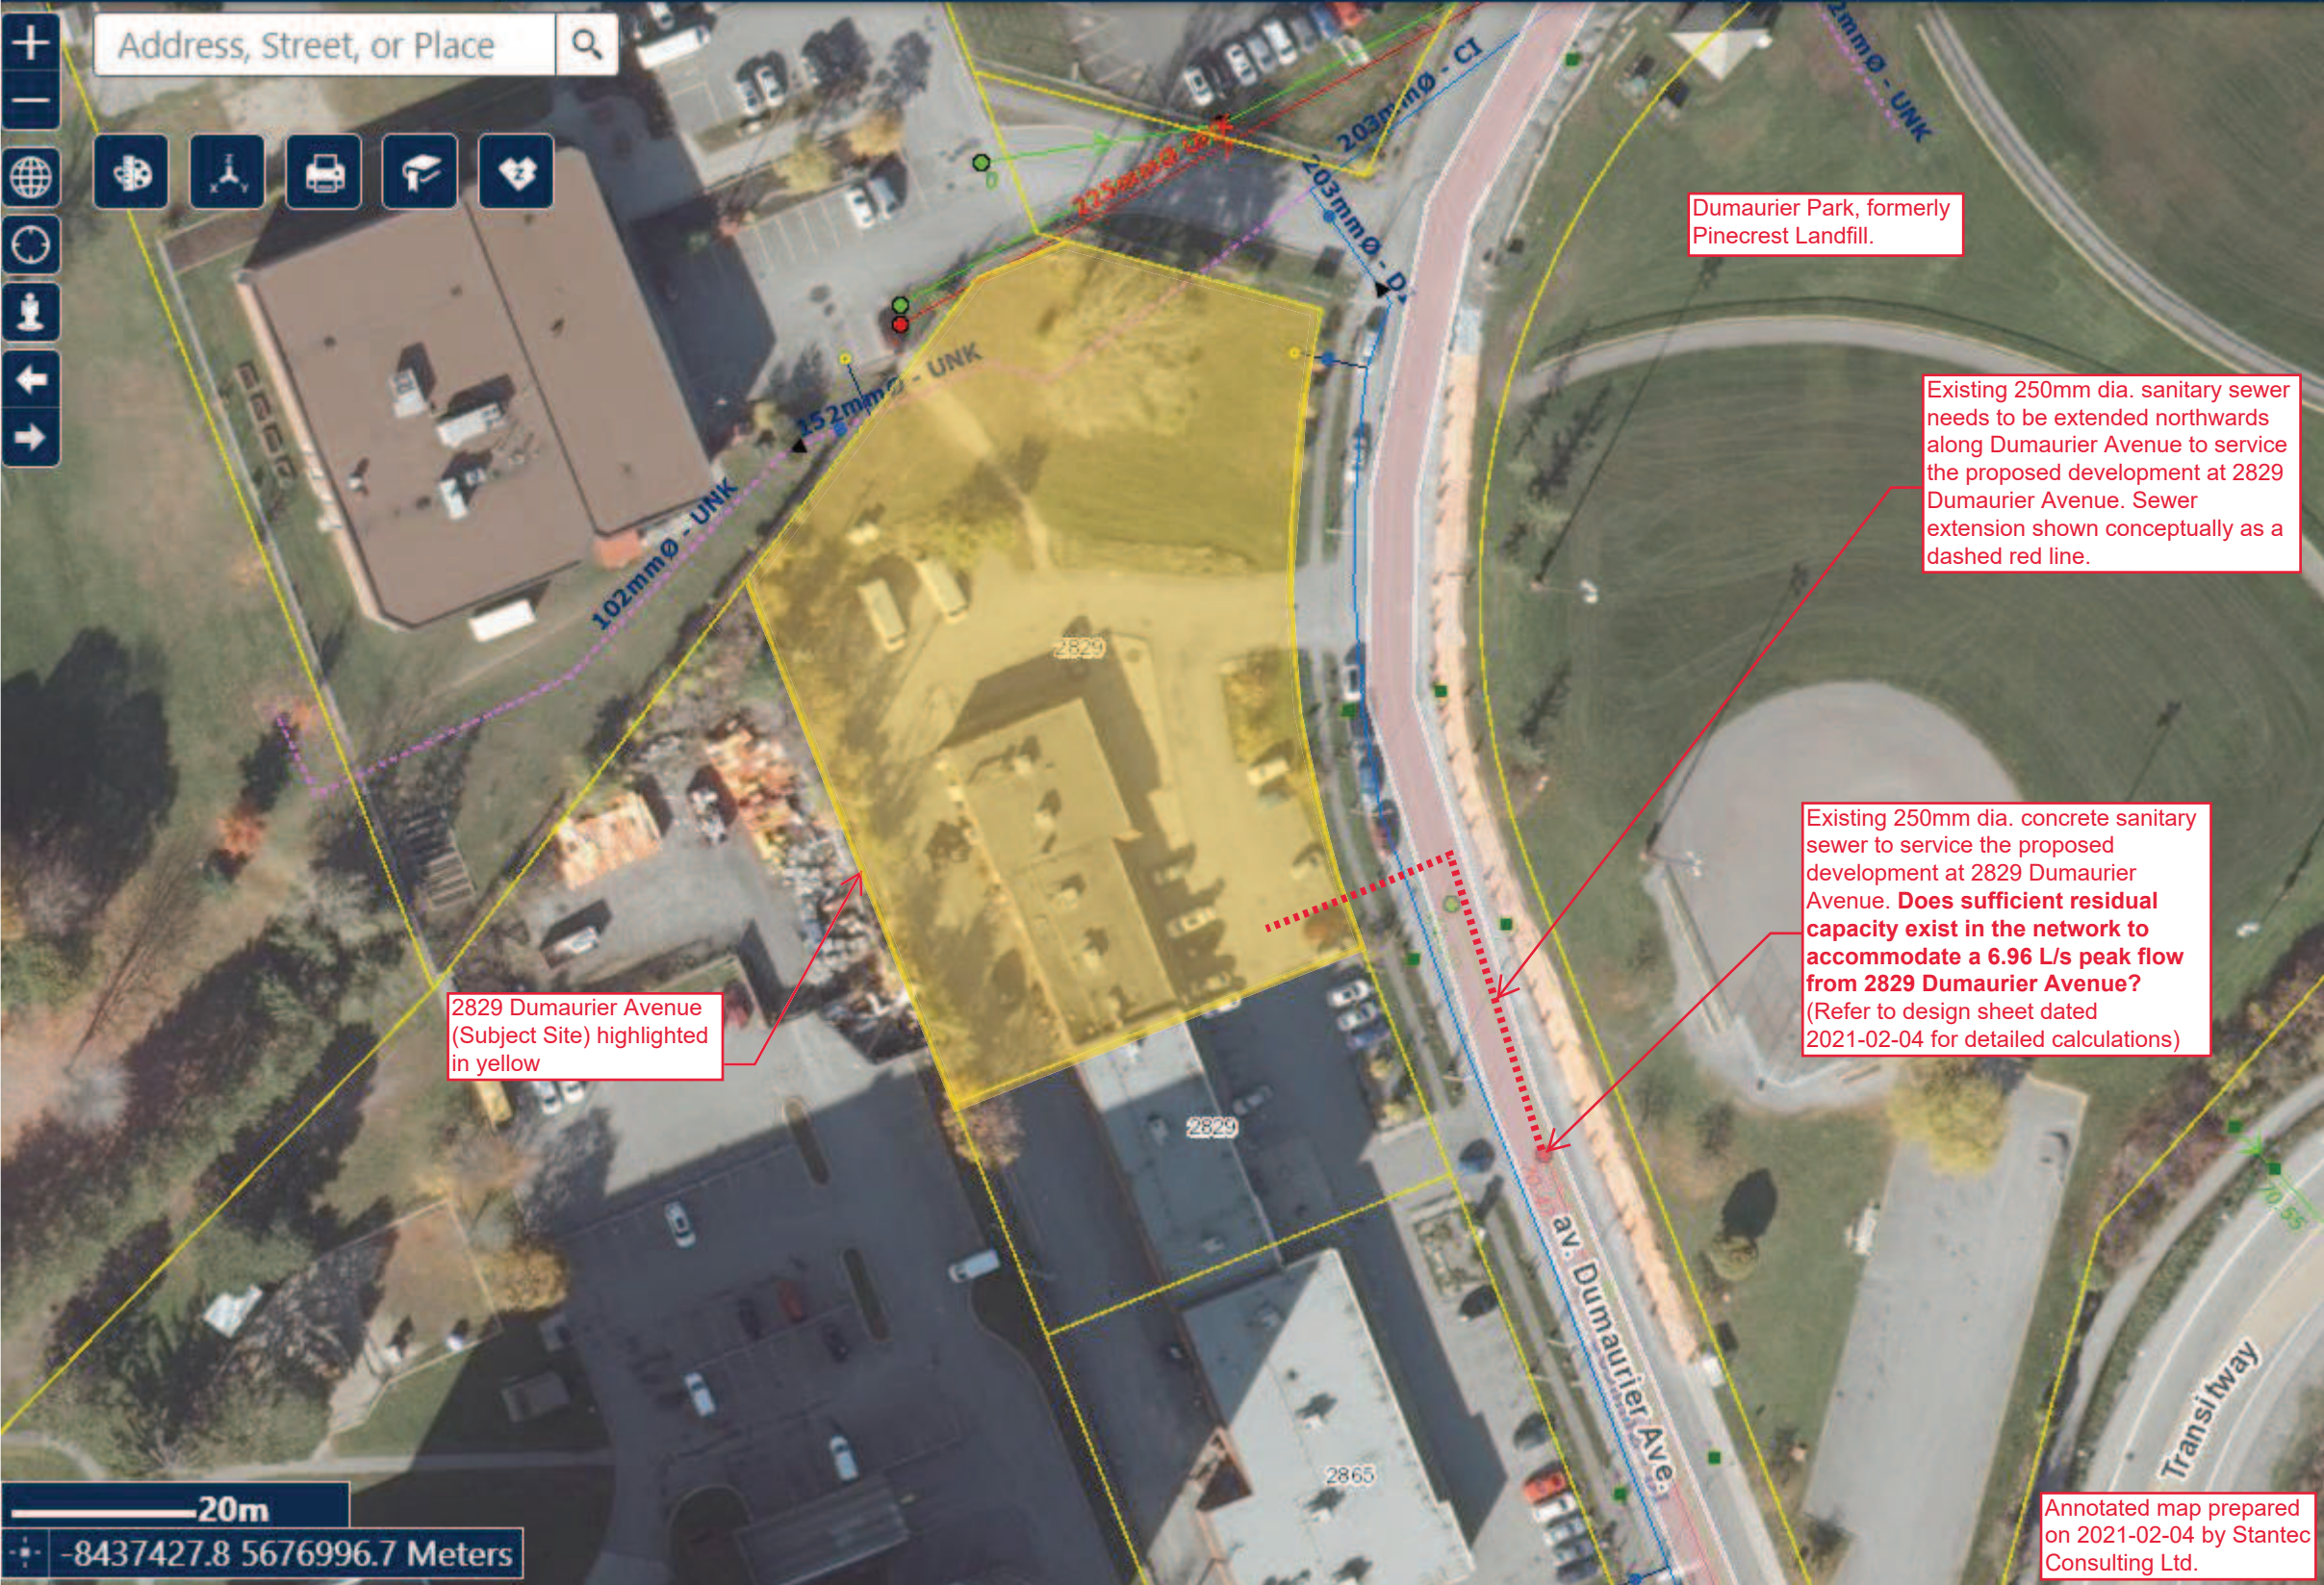

Appendix C STORMWATER SERVICING AND MANAGEMENT

C.1 PRECONSULTATION NOTES WITH CITY OF OTTAWA




2829 Dumaaurier
Pre-Consultation Comments

Planning Comments

1. New Site Plan Control, Complex <https://ottawa.ca/en/planning-development-and-construction/developing-property/development-application-review-process/development-application-submission/development-application-forms>
2. New Zoning By-law Amendment, Minor
3. The site is designated General Urban Area within the City's Official Plan. New taller building may be considered for sites that are in an area already characterized by taller building (adjacent OCH high rise).
4. The actual maximum height of the building should be based on an analysis of the neighbourhood context, appropriate transition to the adjacent low-rise developments, as well as the result of shadow and wind analysis. The upmost limit will be capped at 30 storeys given that this area is currently not within a secondary plan, so high-rise 31+ is not permitted.
 - a. Please provide a shadow study showing the as-of-right shadow impact v. the proposed shadow impact.
 - b. Please provide a cross section showing the building in relation to other buildings along Dumaaurier. This comparison should take into account the grading change along the area. This will help develop an appropriate podium height that fits within the existing context. The maximum podium height should also be no more than the ROW width along Dumaaurier.
 - c. Please provide a plan showing possible high-rise intensification on the adjacent sites and how appropriate distance between towers are maintained.
 - d. Please illustrate how the building transition into adjacent low-rise area.
5. UDRP is not required.
6. Please provide a section 37 analysis.
 - a. Please provide GFA uplift. The as-of-right should be based on the current FSI maximum.
 - b. Please provide a list of drawdown factors.
 - c. Please note that section 37 will be transitioning to a Community Benefit Charge. The current target timeline is for spring 2021. The submission timing of the complete application will determine which system it falls under.
7. Will this building be rental or condo? Have there been any consideration for affordable housing units to be located within the building?

8. Please demonstrate how the 2829 and 2865 properties will function following the built out of 2829 Dumaurier.
9. Please consider securing a grocery store or food retail store as a tenant for the ground floor.
10. Please consider retaining the large maple tree on-site.
11. Please consider a pedestrian connection (in consultation with the adjacent property owner) through the adjacent property to connect Ruth Wildgen Park. Please consider this in conjunction with the retention of the maple tree.

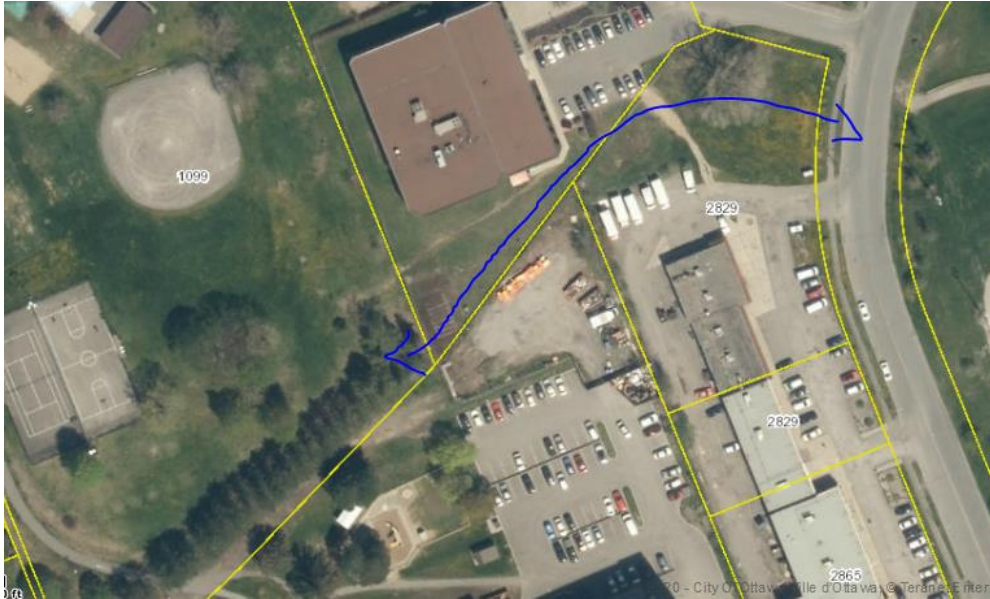

12. Please note the total amount of parking spaces being proposed.
13. Please provide a proposed strategy for public consultation as directed by Bill 73, this can be included in the planning rationale.
14. Cash-in-lieu of parkland and associated appraisal fee will be required as a condition of approval as per the [Parkland Dedication Bylaw](#).
15. Please consult with MTO prior to application submission. Kapusta, Stephen (MTO) Stephen.Kapusta@ontario.ca
16. Please consult with RVCA prior to application submission. Eric Lalande eric.lalande@rvca.ca
17. Please consult with the Ward Councillor prior to application submission. Kavanagh, Theresa Theresa.Kavanagh@ottawa.ca

Urban Design Comments

18. The point tower + podium form may be appropriate if a high-rise building is deemed appropriate.

19. However, the proposed 8 or 9-storey podium may be too tall in general terms. The height and the design of the podium should be determined by the context, including the width and geometry of the adjacent streets, the prevalent pattern of development in the vicinities, and the future vision. The proposed conceptual podium design seems quite arbitrary and does not respond to the context well.
20. The concept may have met the minimum tower separation standards established in the new zoning (approved by Council but subject to appeal). However, the City's aim is to achieve a minimum of 23m tower separation, and this site is large enough to achieve it.
21. On a related matter, the proposed tower may have a floor plate greater than the 750m² established by the City in the guidelines. Larger floor plates often mean wider shadows. If a slightly large floor plate is considered given the size and configuration of the site, greater tower separations must also be contemplated.
22. Overall, there is a need for a thorough urban design analysis of the neighbourhood before determining the appropriate built form on this site. This will include (but not limited to) an understanding of the relationship between the site and the future LRT station and the necessary connections, the development potential on the abutting properties, the desire and direction for transition, the characteristics of the streets, the potential needs for public spaces such as parks, streets, lanes, pathways, and etc. The attached TOR for the preparation of Design Brief indicates the information required as part of the submission.

Engineering Comments

Please note the following information regarding the engineering design submission for the above noted site:

1. The Servicing Study Guidelines for Development Applications are available at the following address: <https://ottawa.ca/en/city-hall/planning-and-development/information-developers/development-application-review-process/development-application-submission/guide-preparing-studies-and-plans>
2. Servicing and site works shall be in accordance with the following documents:
 - ⇒ Ottawa Sewer Design Guidelines (October 2012), including the related Technical Bulletins.
 - ⇒ Ottawa Design Guidelines – Water Distribution (2010), including the related Technical Bulletins.
 - ⇒ Geotechnical Investigation and Reporting Guidelines for Development Applications in the City of Ottawa (2007)
 - ⇒ City of Ottawa Slope Stability Guidelines for Development Applications (revised 2012)
 - ⇒ City of Ottawa Environmental Noise Control Guidelines (January, 2016)
 - ⇒ City of Ottawa Park and Pathway Development Manual (2012)

- ⇒ City of Ottawa Accessibility Design Standards (2012)
 - ⇒ Ottawa Standard Tender Documents (latest version)
 - ⇒ Ontario Provincial Standards for Roads & Public Works (2013)
3. Record drawings and utility plans are also available for purchase from the City (Contact the City's Information Centre by email at InformationCentre@ottawa.ca or by phone at (613) 580-2424 x.44455). If you have any issues obtaining information, please contact the Infrastructure Approvals Project Manager.
 4. There appears to be easement(s) on-site. Please provide these easement documents along with your first submission and ensure the proposed design respects the easement requirements.
 5. The underground parking structure will impede with the existing watermain located at the north end of the site. Additionally, in case the proponent revises the design, note that fire routes are not to be located on top of underground parking structures.
 6. FYI: The site is located within the LRT Stage 2 Circulation Zone.
 7. The site appears to be within the Ministry of Transportation's (MTO) Building and Land Use Permit Control Area. Please consult with MTO for required permits and criteria. Please include correspondence with MTO with your application to the City of Ottawa.
 8. Sanitary Infrastructure
 - a. There is an available 250mm diameter concrete sanitary sewer located on Dumaaurier Ave. However, it currently does not front the proposed site, though it does service the existing building. This sewer is approximately 25 to 30m south of the proposed site's south boundary.
 - b. A sanitary sewer extension within the Dumaaurier Ave Right-Of-Way (ROW) will be required to service this site.
 - c. The proponent will be required to demonstrate what the expected sanitary flows from the proposed site will be and show that the existing sanitary sewer infrastructure can accommodate the proposed site flows without any adverse affects.
 - d. Due to the municipal sanitary sewer extension a Ministry of Environment, Conservation and Parks Environmental Compliance Approval (MECP ECA) will be required. Please contact Emily Diamond at the MECP Ottawa local office to inquire if the municipal sanitary sewer extension work qualifies to be reviewed under the Transfer of Review program (Standard Works) with the City of Ottawa or not, due to the proximity to the closed Pinecrest-Dumaaurier landfill site. Please provide the correspondence as part of the site servicing study.

- e. There is another 225mm diameter sanitary sewer located on private property north of the proposed site and on Dumaurier Ave. This sanitary sewer does not service the existing site. However, both sanitary sewers on Dumaurier Ave reach the same collector.

9. Watermain

- a. There is an available 305mm diameter ductile iron watermain fronting the site along Dumaurier Ave. Servicing for this site is expected to connect to this watermain.
- b. Note that a private 152mm diameter watermain service runs along the north property boundary on-site, servicing 1085 Grenon Ave as well as Ruth Wildgen Park (1099 Grenon Ave). This private service is to remain unless authorized to be relocated by the serviced properties.
- c. Drinking Water Boundary condition requests must include the location of the service connection and the expected loads required by the proposed development. Please provide the following information:
 - i. Location of service (map/plan view)
 - ii. (Draft) site plan or similar plan for building location
 - iii. Fire flow demand: ____ L/s (as per FUS, 1999)
 - iv. Average daily demand: ____ L/s.
 - v. Maximum daily demand: ____ L/s.
 - vi. Maximum hourly daily demand: ____ L/s.
 - vii. Supporting calculations for domestic demands
 - viii. Supporting calculations for FUS required fire flow

10. Storm

- a. There is an available 375mm diameter concrete storm sewer located on Dumaurier Ave with it's most upstream maintenance hole located near the site's southeast corner. Please note a site stormwater connection is to be made perpendicular to the municipal sewer.
- b. If a municipal storm sewer extension is required, the same MECP ECA requirements as the municipal sanitary sewer extension would apply.

11. The Stormwater Management Criteria, for the subject site, is to be based on the following:

- i. Post development peak 100 year flows are to be controlled to the pre-development peak 5 year release rate. Excess stormwater is to be detained on-site.

- ii. The 5-yr storm event using the IDF information derived from the Meteorological Services of Canada rainfall data, taken from the MacDonald Cartier Airport, collected 1966 to 1997.
- iii. The pre-development runoff coefficient or a maximum equivalent 'C' of 0.5, whichever is less (§ 8.3.7.3).
- iv. A calculated time of concentration (Cannot be less than 10 minutes).
- v. Use of rooftop controls are recommended for this site, but are not limited to them, to meet the requirements.

12. City of Ottawa Landfill Gas Monitoring Program

- a. A portion of the closed Pinecrest landfill extends under the north part of the subject property. Pockets of waste were noted in some of the probes near the north end of the existing building on-site. There are a number of LFG probes located on existing plaza property that are included in the City's monitoring program, and elevated methane concentrations are still measured at some of these probes.
- b. The methane collection system consists of 18 extraction wells (EW1 to EW18 on the attached plan) located along Dumaurier Ave and Watson Street connected to the control building on the north edge of Dumaurier Park. The system was installed in 1989 and operated until 2003. Although the methane collection system is currently not active, it has not been officially approved for decommissioning by the Ontario Ministry of Environment, Conservation and Parks (MECP) due to the continued elevated methane levels near/adjacent to this site. The City reportedly offered to connect adjacent landowners within the landfill footprint to the system, but no adjacent owners accepted the offer.
- c. A Phase I and II Environmental Site Assessments (ESAs) are to be completed in accordance with the requirements of Ontario Regulation 153/04.
- d. The City will provide an updated summary of monitoring results to the proponent, to be incorporated into the Phase II ESA report; the results on the 2019 monitoring program were just received last month.
- e. Since the proposed redevelopment will be a mixture of commercial and residential use, a Record of Site Condition (RSC) in accordance with O. Reg. 153/04 will be required.
- f. Due to the continued presence of elevated methane on this property, a methane mitigation plan will be required as part of redevelopment (sub-slab venting system, etc.)
- g. Given the environmental issues on this property, this site may be a potential candidate for participation in the City's Brownfield program.
- h. We are conferring with the City's Environmental Remediation Unit on the potential setback requirements from the methane extraction wells.

Although they are not currently active, the methane collection system has not been officially approved for decommissioning by the MECP. We will get back to you on this matter.

Should you have any questions or require additional information, please contact me directly at (613) 580-2424, x22517 or by email at gabrielle.schaeffer@ottawa.ca

Transportation Comments

- Follow Traffic Impact Assessment Guidelines
 - o A TIA is required. Proceed to submitting Scoping report.
 - o Start this process asap. The application will not be deemed complete until the submission steps 1-4, including the functional plan (if applicable), draft RMA package (if applicable) and/or monitoring report (if applicable).
 - o You are highly encouraged to submit Step 4 for review and comment by City Staff prior to application.
 - o Request base mapping asap if RMA is required. Contact Engineering Services (<https://ottawa.ca/en/city-hall/planning-and-development/engineering-services>)
- Clear throat requirement for apartments with more than 200 units on a collector is 25m.
- Site within 400 m buffer of Pinecrest LRT Station.
- Concrete sidewalks, as per City Standards, are to be provided along the site's frontage. Sidewalk is to be depressed and continuous across site access (as per City Specification 7.1).
- On site plan:
 - o Show all details of the roads abutting the site up to and including the opposite curb; include such items as pavement markings, accesses and/or sidewalks.
 - o Turning movement diagrams required for all accesses showing the largest vehicle to access/egress the site.
 - o Turning movement diagrams required for internal movements (loading areas, garbage, emergency vehicles).
 - o Show all curb radii measurements; ensure that all curb radii are reduced as much as possible
 - o Show lane/aisle widths.
 - o Grey out any area that will not be impacted by this application.
- AODA legislation is in effect for all organizations, please ensure that the design conforms to these standards.

- Noise Impact Studies required for the following:
 - o Road, due to proximity to Hwy 417 and Dumaaurier
 - o Rail, due to proximity to future LRT
- Stationary, due to the proximity to neighbouring exposed mechanical equipment and if there will be any exposed mechanical equipment due to the proximity to neighbouring noise sensitive land uses.

Documents required to deem application complete:

- TIA (Steps 1-4 submitted and reviewed by City staff)
- Noise Study (Road & Stationary)

Should you have any questions or require additional information, please contact Gervais, Josiane josiane.gervais@ottawa.ca

LRT Comments

1. A warning clause will have to be registered on title for noise and vibration, electromagnetic interference.
2. Noise attenuation may be required to deal with noise from the LRT – a study is required to assess this impact with and determine mitigation measures.
3. Depending on the timing of the construction program, a blasting plan will be required.

Heritage Comment

The subject property is very near 2821 Dumaaurier Ave, which is listed on the City's Heritage Register. Given the scale of the development proposed nearby, we would recommend that the applicant provide a short heritage brief, acknowledging the nearby heritage resource and to comment on how the proposal will be compatible with the church, identifying any impacts it may have.

I've attached the information sheet we have for 2821 Dumaaurier Ave.

Forester Comment

1. a Tree Conservation Report (TCR) must be supplied for review along with the suite of other plans/reports required by the City; an approved TCR is a requirement of Site Plan approval
2. any removal of privately-owned trees 10cm or larger in diameter requires a tree permit issued under the Urban Tree Conservation Bylaw; the permit is based on the approved TCR

3. any removal of City-owned trees will require the permission of Forestry Services who will also review the submitted TCR
4. for this site, the TCR may be combined with the Landscape Plan or EIS, provided all information is clearly displayed
5. the TCR must list all trees on site by species, diameter and health condition
6. the TCR must address all trees with a critical root zone that extends into the developable area – all trees including those located on adjoining properties, that could be impacted by the construction need to be addressed.
7. trees with a trunk that crosses/touches a property line are considered co-owned by both property owners; permission from the adjoining property owner must be obtained prior to the removal of co-owned trees
8. If trees are to be removed, the TCR must clearly show where they are, and document the reason they can not be retained – please provide a plan showing retained and removed treed areas
9. All retained trees must be shown and all retained trees within the area impacted by the development process must be protected as per City guidelines listed on Ottawa.ca
 - a. the location of tree protection fencing must be shown on a plan
 - b. show the full critical root zone of the retained trees
 - c. if excavation will occur within the critical root zone, please show the limits of excavation and calculate the percentage of the area that will be disturbed
10. the City encourages the retention of healthy trees; if possible, please seek opportunities for retention of trees of the single large tree on site.
11. Please ensure newly planted trees have an adequate soil volume for their size at maturity
12. For more information on the process or help with tree retention options, contact Mark Richardson mark.richardson@ottawa.ca

Please refer to the links to “[Guide to preparing studies and plans](#)” and [fees](#) for general information. Additional information is available related to [building permits, development charges, and the Accessibility Design Standards](#). Be aware that other fees and permits may be required, outside of the development review process. You may obtain background drawings by contacting informationcentre@ottawa.ca.

These pre-con comments are valid for one year. If you submit a development application(s) after this time, you may be required to meet for another pre-consultation meeting and/or the submission requirements may change. You are as well encouraged to contact us for a follow-up meeting if the plan/concept will be further refined.

Please contact me at stream.shen@ottawa.ca or at 613-580-2424 extension 24488 if you have any questions.

Sincerely,

A handwritten signature in black ink, appearing to be 'Stream Shen', written over a horizontal line.

Stream Shen MCIP RPP
Planner II
Development Review - West

C.2 MODIFIED RATIONAL METHOD CALCULATIONS



Stormwater Management Calculations

Modified Rational Method Calculators for Storage

| | | | | | |
|---|-------------------|-----|---------|----------------|------------------|
| 5 yr Intensity City of Ottawa | $I = a/(t + b)^c$ | a = | 998.071 | t (min) | I (mm/hr) |
| | | b = | 6.053 | | |
| | | c = | 0.814 | | |
| | | | | | |
| | | | | 10 | 104.19 |
| | | | | 20 | 70.25 |
| | | | | 30 | 53.93 |
| | | | | 40 | 44.18 |
| | | | | 50 | 37.65 |
| | | | | 60 | 32.94 |
| | | | | 70 | 29.37 |
| | | | | 80 | 26.56 |
| | | | | 90 | 24.29 |
| | | | | 100 | 22.41 |
| | | | | 110 | 20.82 |
| | | | | 120 | 19.47 |

5 YEAR Predevelopment Target Release from Portion of Site

Subdrainage Area: Predevelopment Tributary Area to Outlet
Area (ha): 0.420
C: 0.50 (as directed by the City of Ottawa)

Typical Time of Concentration of 10 minutes used

| tc (min) | I (5 yr) (mm/hr) | Qtarget (L/s) |
|----------|------------------|---------------|
| 10 | 104.19 | 60.76 |

5 year uncontrolled area and peak flow

Subdrainage Area: UNC-1
Area (ha): 0.06
C: 0.57

| tc (min) | I (5 yr) (mm/hr) | Q5 (L/s) |
|----------|------------------|----------|
| 10 | 104.19 | 10.57 |

5 YEAR Modified Rational Method for Controlled portion of site

Subdrainage Area: Controlled Areas (R1A-R1D, TANK1-8)
Area (ha): 0.36
C: 0.71

| tc (min) | I (5 yr) (mm/hr) | Qactual (L/s) | Qrelease (L/s) | Qstored (L/s) | Vstored (m ³) |
|----------|------------------|---------------|----------------|---------------|---------------------------|
| 10 | 104.19 | 72.89 | 38.1 | 34.77 | 20.86 |
| 20 | 70.25 | 49.14 | 38.1 | 11.02 | 13.23 |
| 30 | 53.93 | 37.72 | 37.7 | 0.00 | 0.00 |
| 40 | 44.18 | 30.91 | 30.9 | 0.00 | 0.00 |
| 50 | 37.65 | 26.34 | 26.3 | 0.00 | 0.00 |
| 60 | 32.94 | 23.05 | 23.0 | 0.00 | 0.00 |
| 70 | 29.37 | 20.55 | 20.5 | 0.00 | 0.00 |
| 80 | 26.56 | 18.58 | 18.6 | 0.00 | 0.00 |
| 90 | 24.29 | 16.99 | 17.0 | 0.00 | 0.00 |
| 100 | 22.41 | 15.67 | 15.7 | 0.00 | 0.00 |
| 110 | 20.82 | 14.57 | 14.6 | 0.00 | 0.00 |
| 120 | 19.47 | 13.62 | 13.6 | 0.00 | 0.00 |

Notes:

- All storage provided in cistern
- Cistern to be pumped at a maximum rate of 38.12L/s (5yr allowable - 100yr uncontrolled)
- Allowable target release rate (60.8 L/s) less the 100yr uncontrolled areas peak flow rate. Accounts for uncontrolled area flowing directly to Dumaurier Avenue.
- Assuming 120 m³ of cistern volume to allow for some freeboard.

| Stage | Head (m) | Discharge (L/s) | Vreq (cu. m) | Vavail (cu. m) | Volume Check |
|---------------------|----------|-----------------|--------------|----------------|--------------|
| 5-year volume check | - | - | 38.1 | 20.86 | 120.00 OK |

SUMMARY TO OUTLET

| | | |
|------------------------------------|-----------|--------------------------|
| | Vrequired | Vavailable* |
| Tributary Area | 0.36 ha | |
| Total 5yr Flow to Sewer | 38.1 L/s | 21 120 m ³ Ok |
| Non-Tributary Area | 0.06 ha | |
| Total 5yr Flow Uncontrolled | 10.6 L/s | |
| Total Area | 0.42 ha | |
| Total 5yr Flow Target | 48.7 L/s | |
| Target | 60.8 L/s | |

Modified Rational Method Calculators for Storage

| | | | | | |
|---|-----------------|-----|----------|----------------|------------------|
| 100 yr Intensity City of Ottawa | $I = a/(t + b)$ | a = | 1735.688 | t (min) | I (mm/hr) |
| | | b = | 6.014 | | |
| | | c = | 0.820 | | |
| | | | | | |
| | | | | 10 | 178.56 |
| | | | | 20 | 119.95 |
| | | | | 30 | 91.87 |
| | | | | 40 | 75.15 |
| | | | | 50 | 63.95 |
| | | | | 60 | 55.89 |
| | | | | 70 | 49.79 |
| | | | | 80 | 44.99 |
| | | | | 90 | 41.11 |
| | | | | 100 | 37.90 |
| | | | | 110 | 35.20 |
| | | | | 120 | 32.89 |

100 YEAR Predevelopment Target Release from Portion of Site

Subdrainage Area: Predevelopment Tributary Area to Outlet
Area (ha): 0.420
C: 0.50 (as directed by the City of Ottawa)

Typical Time of Concentration of 10 minutes used

| tc (min) | I (5 yr) (mm/hr) | Qtarget (L/s) |
|----------|------------------|---------------|
| 10 | 104.19 | 60.76 |

100yr peak flow restricted to 5yr allowable rate based on C=0.5

100 year uncontrolled area and peak flow

Subdrainage Area: UNC-1
Area (ha): 0.06
C: 0.71

| tc (min) | I (100 yr) (mm/hr) | Q100 (L/s) |
|----------|--------------------|------------|
| 10 | 178.56 | 22.64 |

Subtract this rate from the total site allowable rate

100 YEAR Modified Rational Method for Controlled portion of site

Subdrainage Area: Controlled Areas (R1A-R1D, TANK1-8)
Area (ha): 0.36
C: 0.90 25% increase from 5yr C-value, max of 0.9

| tc (min) | I (100 yr) (mm/hr) | Qactual (L/s) | Qrelease (L/s) | Qstored (L/s) | Vstored (m ³) |
|----------|--------------------|---------------|----------------|---------------|---------------------------|
| 10 | 178.56 | 158.82 | 38.1 | 120.70 | 72.42 |
| 20 | 119.95 | 106.69 | 38.1 | 68.57 | 82.29 |
| 30 | 91.87 | 81.71 | 38.1 | 43.59 | 78.47 |
| 40 | 75.15 | 66.84 | 38.1 | 28.72 | 68.93 |
| 50 | 63.95 | 56.88 | 38.1 | 18.76 | 56.29 |
| 60 | 55.89 | 49.72 | 38.1 | 11.60 | 41.75 |
| 70 | 49.79 | 44.29 | 38.1 | 6.17 | 25.90 |
| 80 | 44.99 | 40.02 | 38.1 | 1.90 | 9.11 |
| 90 | 41.11 | 36.57 | 36.6 | 0.00 | 0.00 |
| 100 | 37.90 | 33.71 | 33.7 | 0.00 | 0.00 |
| 110 | 35.20 | 31.31 | 31.3 | 0.00 | 0.00 |
| 120 | 32.89 | 29.26 | 29.3 | 0.00 | 0.00 |

Notes:

- All storage provided in cistern
- Cistern to be pumped at a maximum rate of 38.12L/s (5yr allowable - 100yr uncontrolled)
- Allowable target release rate (60.8 L/s) less the 100yr uncontrolled areas peak flow rate. Accounts for uncontrolled area flowing directly to Dumaurier Avenue.
- Assuming 120 m³ of cistern volume to allow for some freeboard.

| Stage | Head (m) | Discharge (L/s) | Vreq (cu. m) | Vavail (cu. m) | Volume Check |
|-----------------------|----------|-----------------|--------------|----------------|--------------|
| 100-year volume check | - | - | 38.1 | 82.29 | 120.00 OK |

SUMMARY TO OUTLET

| | | |
|--------------------------------------|-----------|--------------------------|
| | Vrequired | Vavailable* |
| Tributary Area | 0.36 ha | |
| Total 100yr Flow to Sewer | 38.1 L/s | 82 120 m ³ Ok |
| Non-Tributary Area | 0.06 ha | |
| Total 100yr Flow Uncontrolled | 22.6 L/s | |
| Total Area | 0.42 ha | |
| Total 100yr Flow Target | 60.8 L/s | |
| Target | 60.8 L/s | |

C.3 CORRESPONDENCE WITH RIDEAU VALLEY CONSERVATION AUTHORITY (RVCA)



Chochlinski, Daniel

From: Chochlinski, Daniel
Sent: Sunday, January 24, 2021 3:43 PM
To: Eric Lalande
Cc: Kilborn, Kris; Paerez, Ana
Subject: RE: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Eric,

Thank you for following up. We will proceed with the enhanced protection requirement (80% TSS removal) for the site, as indicated.

Take care,

Daniel Chochlinski EIT

Engineering Intern, Community Development
Mobile: 343-961-9619
daniel.chochlinski@stantec.com
Stantec
400 - 1331 Clyde Avenue
Ottawa ON K2C 3G4



Better Together, Even If We're Apart. [Read more about Stantec's COVID-19 response, including remote working and business continuity measures.](#)

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

From: Eric Lalande <eric.lalande@rvca.ca>
Sent: Saturday, January 23, 2021 10:53 AM
To: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Subject: RE: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Dan,

Sorry I've missed this email, and wanted to make sure I follow up. The water quality requirements are as stated an enhanced level of protection is required.

Thank you,

Eric Lalande, MCIP, RPP
Planner, RVCA
613-692-3571 x1137

From: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Sent: Friday, January 8, 2021 11:46 AM
To: Eric Lalande <eric.lalande@rvca.ca>
Cc: Paerez, Ana <Ana.Paerez@stantec.com>; Kilborn, Kris <kris.kilborn@stantec.com>
Subject: RE: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Eric,

I have followed up and confirmed that our Client does not intend to reduce the number of surface parking spaces to 5 or less for the 2829 Dumaurier Avenue site. Therefore, if the 80% TSS removal quality control requirement is still applicable to the site, we will ensure to meet it with our stormwater management plan.

Please let me know if your measured distance to the stormwater outlet at all changes this requirement for our site.

Regards,

Daniel Chochlinski EIT
Engineering Intern, Community Development
Mobile: 343-961-9619
daniel.chochlinski@stantec.com
Stantec
400 - 1331 Clyde Avenue
Ottawa ON K2C 3G4



Better Together, Even If We're Apart. [Read more](#) about Stantec's COVID-19 response, including remote working and business continuity measures.

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.


From: Chochlinski, Daniel
Sent: Monday, January 4, 2021 11:58 AM
To: Eric Lalande <eric.lalande@rvca.ca>
Cc: Paerez, Ana <Ana.Paerez@stantec.com>; Kilborn, Kris <kris.kilborn@stantec.com>
Subject: RE: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Eric,

I don't have this information available to me now so would greatly appreciate if you could look it up upon your return later this week. Thank you for your help so far; I look forward to continuing our discussion later.

Take care,

Daniel Chochlinski EIT
Engineering Intern, Community Development
Mobile: 343-961-9619
daniel.chochlinski@stantec.com
Stantec
400 - 1331 Clyde Avenue
Ottawa ON K2C 3G4



Better Together, Even If We're Apart. [Read more](#) about Stantec's COVID-19 response, including remote working and business continuity measures.

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

From: Eric Lalande <eric.lalande@rvca.ca>
Sent: Monday, January 4, 2021 11:55 AM
To: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Subject: Re: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Dan,

From the site to the outlet of the municipal system at the receiving watercourse. I could look it up but it wouldn't be until I'm back on Thursday.

Get [Outlook for Android](#)

From: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Sent: Monday, January 4, 2021 11:52:49 AM
To: Eric Lalande <eric.lalande@rvca.ca>
Cc: Paerez, Ana <Ana.Paerez@stantec.com>; Kilborn, Kris <kris.kilborn@stantec.com>
Subject: RE: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Eric,

Thank you so much for your prompt reply. I will consult with our team and Client about the possibility of reducing the number of surface parking spaces to 5 or less.

May you please confirm when you say 'distance to receiving watercourse' whether you mean the distance from the site to the existing receiving storm sewer? If so, this distance is approximately 11 metres as measured from the property line to the nearest storm maintenance hole.

Regards,

Daniel Chochlinski EIT
Engineering Intern, Community Development
Mobile: 343-961-9619
daniel.chochlinski@stantec.com
Stantec
400 - 1331 Clyde Avenue
Ottawa ON K2C 3G4



Better Together, Even If We're Apart. [Read more about Stantec's COVID-19 response, including remote working and business continuity measures.](#)

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

From: Eric Lalande <eric.lalande@rvca.ca>
Sent: Monday, January 4, 2021 11:47 AM
To: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Subject: Re: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Hi Daniel,

The RVCA would typically require enhanced water quality protection (80% TSS Removal). Best management practices are encouraged to be integrated where possible.

I would note that this requirement would be applied based on the number of surface parking. (>5 spaces). As well as distance from the outlet. If you could confirm the distance to the stormwater outlet (receiving watercourse), or reduce surface spaces, there may have sufficient opportunities to waive the requirement.

I'm off on vacation today until Thursday, I could follow up more then.

Cheers, Happy New Year.

Eric

Get [Outlook for Android](#)

From: Chochlinski, Daniel <Daniel.Chochlinski@stantec.com>
Sent: Monday, January 4, 2021 11:38:04 AM
To: Eric Lalande <eric.lalande@rvca.ca>
Cc: Paerez, Ana <Ana.Paerez@stantec.com>; Kilborn, Kris <kris.kilborn@stantec.com>
Subject: 160401596 - 2829 Dumaurier Avenue - RVCA Stormwater Management Criteria

Good morning Eric,

Stantec is preparing the civil engineering design submission in support of the rezoning and site plan application for a 30-storey high-rise located at 2829 Dumaurier Avenue (key plan attached) in the City of Ottawa.

In our pre-application consultation, the City has directed us to consult with you before the submission of our engineering package to confirm if there are any additional design criteria (namely, for stormwater quality control). May you please provide us with this information?

Below is a list of some pertinent site information:

1. The proposed 30-storey high-rise is proposed to contain commercial space on the ground floor and residential units on the remaining storeys.
 - a. The building is to contain 108 one-bedroom units, 171 one-bedroom + study, 43 two-bedroom units, and 8 two-bedroom + study units.
 - b. I have attached a draft of the site plan, dated 2020-12-17.
2. The proposed building replaces an existing one storey commercial building.
3. 16 surface parking spots are proposed. The remainder of the building's parking spots are expected to be provided in a multi-level underground parking garage.
4. Stormwater quantity control for the site is anticipated to be provided via rooftop storage and an underground stormwater storage tank, either discharging by gravity (controlled by an ICD) or pumped at a controlled release rate.
 - a. The City of Ottawa has indicated that the allowable stormwater release rate is to be calculated using a maximum C of 0.5 and a 5-year storm event.

Please let me know if you require any additional information from our end. Thank you in advance for your help, and Happy New Year!

Regards,

Daniel Chochlinski EIT

Engineering Intern, Community Development

Mobile: 343-961-9619

daniel.chochlinski@stantec.com

Stantec

400 - 1331 Clyde Avenue

Ottawa ON K2C 3G4



Better Together, Even if We're Apart. [Read more](#) about Stantec's COVID-19 response, including remote working and business continuity measures.

The content of this email is the confidential property of Stantec and should not be copied, modified, retransmitted, or used for any purpose except with Stantec's written authorization. If you are not the intended recipient, please delete all copies and notify us immediately.

C.4 STORMCEPTOR SIZING SHEET AND STANDARD DETAIL



Detailed Stormceptor Sizing Report – 2858 Dumaaurier Avenue

| Project Information & Location | | | |
|--------------------------------|------------------------|----------------------------|-----------|
| Project Name | 2858 Dumaaurier Avenue | Project Number | 160401596 |
| City | Ottawa | State/ Province | Ontario |
| Country | Canada | Date | 2/9/2021 |
| Designer Information | | EOR Information (optional) | |
| Name | ana paerez | Name | |
| Company | Stantec Consulting | Company | |
| Phone # | 506-204-5856 | Phone # | |
| Email | ana.paerez@stantec.com | Email | |

Stormwater Treatment Recommendation

The recommended Stormceptor Model(s) which achieve or exceed the user defined water quality objective for each site within the project are listed in the below Sizing Summary table.

| | |
|--------------------------------------|----------------------------------|
| Site Name | 2858 Dumaaurier Avenue |
| Recommended Stormceptor Model | STC 300 |
| Target TSS Removal (%) | 80.0 |
| TSS Removal (%) Provided | 81 |
| PSD | Fine Distribution |
| Rainfall Station | OTTAWA MACDONALD-CARTIER INT'L A |

The recommended Stormceptor model achieves the water quality objectives based on the selected inputs, historical rainfall records and selected particle size distribution.

| Stormceptor Sizing Summary | |
|----------------------------|------------------------|
| Stormceptor Model | % TSS Removal Provided |
| STC 300 | 81 |
| STC 750 | 88 |
| STC 1000 | 89 |
| STC 1500 | 90 |
| STC 2000 | 92 |
| STC 3000 | 93 |
| STC 4000 | 94 |
| STC 5000 | 95 |
| STC 6000 | 96 |
| STC 9000 | 97 |
| STC 10000 | 97 |
| STC 14000 | 98 |
| StormceptorMAX | Custom |

Stormceptor

The Stormceptor oil and sediment separator is sized to treat stormwater runoff by removing pollutants through gravity separation and flotation. Stormceptor's patented design generates positive TSS removal for each rainfall event, including large storms. Significant levels of pollutants such as heavy metals, free oils and nutrients are prevented from entering natural water resources and the re-suspension of previously captured sediment (scour) does not occur. Stormceptor provides a high level of TSS removal for small frequent storm events that represent the majority of annual rainfall volume and pollutant load. Positive treatment continues for large infrequent events, however, such events have little impact on the average annual TSS removal as they represent a small percentage of the total runoff volume and pollutant load.

Design Methodology

Stormceptor is sized using PCSWMM for Stormceptor, a continuous simulation model based on US EPA SWMM. The program calculates hydrology using local historical rainfall data and specified site parameters. With US EPA SWMM's precision, every Stormceptor unit is designed to achieve a defined water quality objective. The TSS removal data presented follows US EPA guidelines to reduce the average annual TSS load. The Stormceptor's unit process for TSS removal is settling. The settling model calculates TSS removal by analyzing:

- Site parameters
- Continuous historical rainfall data, including duration, distribution, peaks & inter-event dry periods
- Particle size distribution, and associated settling velocities (Stokes Law, corrected for drag)
- TSS load
- Detention time of the system

Hydrology Analysis

PCSWMM for Stormceptor calculates annual hydrology with the US EPA SWMM and local continuous historical rainfall data. Performance calculations of Stormceptor are based on the average annual removal of TSS for the selected site parameters. The Stormceptor is engineered to capture sediment particles by treating the required average annual runoff volume, ensuring positive removal efficiency is maintained during each rainfall event, and preventing negative removal efficiency (scour). Smaller recurring storms account for the majority of rainfall events and average annual runoff volume, as observed in the historical rainfall data analyses presented in this section.

Rainfall Station

| | | | |
|-------------------------------|----------------------------------|---|---------|
| State/Province | Ontario | Total Number of Rainfall Events | 4093 |
| Rainfall Station Name | OTTAWA MACDONALD-CARTIER INT'L A | Total Rainfall (mm) | 20978.1 |
| Station ID # | 6000 | Average Annual Rainfall (mm) | 567.0 |
| Coordinates | 45°19'N, 75°40'W | Total Evaporation (mm) | 1872.4 |
| Elevation (ft) | 370 | Total Infiltration (mm) | 20.9 |
| Years of Rainfall Data | 37 | Total Rainfall that is Runoff (mm) | 19084.8 |

Notes

- Stormceptor performance estimates are based on simulations using PCSWMM for Stormceptor, which uses the EPA Rainfall and Runoff modules.
- Design estimates listed are only representative of specific project requirements based on total suspended solids (TSS) removal defined by the selected PSD, and based on stable site conditions only, after construction is completed.
- For submerged applications or sites specific to spill control, please contact your local Stormceptor representative for further design assistance.

| Drainage Area | |
|------------------|-------|
| Total Area (ha) | 0.17 |
| Imperviousness % | 99.90 |

| Up Stream Storage | |
|-------------------|-----------------|
| Storage (ha-m) | Discharge (cms) |
| 0.000 | 0.000 |

| Water Quality Objective | |
|-------------------------------|------|
| TSS Removal (%) | 80.0 |
| Runoff Volume Capture (%) | |
| Oil Spill Capture Volume (L) | |
| Peak Conveyed Flow Rate (L/s) | |
| Water Quality Flow Rate (L/s) | |

| Up Stream Flow Diversion | |
|--------------------------------|--|
| Max. Flow to Stormceptor (cms) | |

| Design Details | |
|------------------------------------|---------------|
| Stormceptor Inlet Invert Elev (m) | 71.48 |
| Stormceptor Outlet Invert Elev (m) | 71.45 |
| Stormceptor Rim Elev (m) | 73.27 |
| Normal Water Level Elevation (m) | |
| Pipe Diameter (mm) | |
| Pipe Material | PVC - plastic |
| Multiple Inlets (Y/N) | No |
| Grate Inlet (Y/N) | No |


| Particle Size Distribution (PSD) | | |
|---|----------------|------------------|
| Removing the smallest fraction of particulates from runoff ensures the majority of pollutants, such as metals, hydrocarbons and nutrients are captured. The table below identifies the Particle Size Distribution (PSD) that was selected to define TSS removal for the Stormceptor design. | | |
| Fine Distribution | | |
| Particle Diameter (microns) | Distribution % | Specific Gravity |
| 20.0 | 20.0 | 1.30 |
| 60.0 | 20.0 | 1.80 |
| 150.0 | 20.0 | 2.20 |
| 400.0 | 20.0 | 2.65 |
| 2000.0 | 20.0 | 2.65 |

| | | | |
|------------------------------------|-------|--|---------|
| Site Name | | 2858 Dumaurier Avenue | |
| Site Details | | | |
| Drainage Area | | Infiltration Parameters | |
| Total Area (ha) | 0.17 | Horton's equation is used to estimate infiltration | |
| Imperviousness % | 99.90 | Max. Infiltration Rate (mm/hr) | 61.98 |
| Surface Characteristics | | Min. Infiltration Rate (mm/hr) | 10.16 |
| Width (m) | 82.00 | Decay Rate (1/sec) | 0.00055 |
| Slope % | 2 | Regeneration Rate (1/sec) | 0.01 |
| Impervious Depression Storage (mm) | 0.508 | Evaporation | |
| Pervious Depression Storage (mm) | 5.08 | Daily Evaporation Rate (mm/day) | 2.54 |
| Impervious Manning's n | 0.015 | Dry Weather Flow | |
| Pervious Manning's n | 0.25 | Dry Weather Flow (lps) | 0 |
| Maintenance Frequency | | Winter Months | |
| Maintenance Frequency (months) > | 12 | Winter Infiltration | 0 |
| TSS Loading Parameters | | | |
| TSS Loading Function | | | |
| Buildup/Wash-off Parameters | | TSS Availability Parameters | |
| Target Event Mean Conc. (EMC) mg/L | | Availability Constant A | |
| Exponential Buildup Power | | Availability Factor B | |
| Exponential Washoff Exponent | | Availability Exponent C | |
| | | Min. Particle Size Affected by Availability (micron) | |


| Cumulative Runoff Volume by Runoff Rate | | | |
|---|--------------------|------------------|------------------------------|
| Runoff Rate (L/s) | Runoff Volume (m³) | Volume Over (m³) | Cumulative Runoff Volume (%) |
| 1 | 20212 | 12471 | 61.8 |
| 4 | 29452 | 3235 | 90.1 |
| 9 | 31781 | 907 | 97.2 |
| 16 | 32497 | 191 | 99.4 |
| 25 | 32664 | 24 | 99.9 |
| 36 | 32688 | 0 | 100.0 |
| 49 | 32688 | 0 | 100.0 |

Cumulative Runoff Volume by Runoff Rate


For area: 0.17(ha), imperviousness: 99.90%, rainfall station: OTTAWA MACDONALD-CARTIER INT'L A

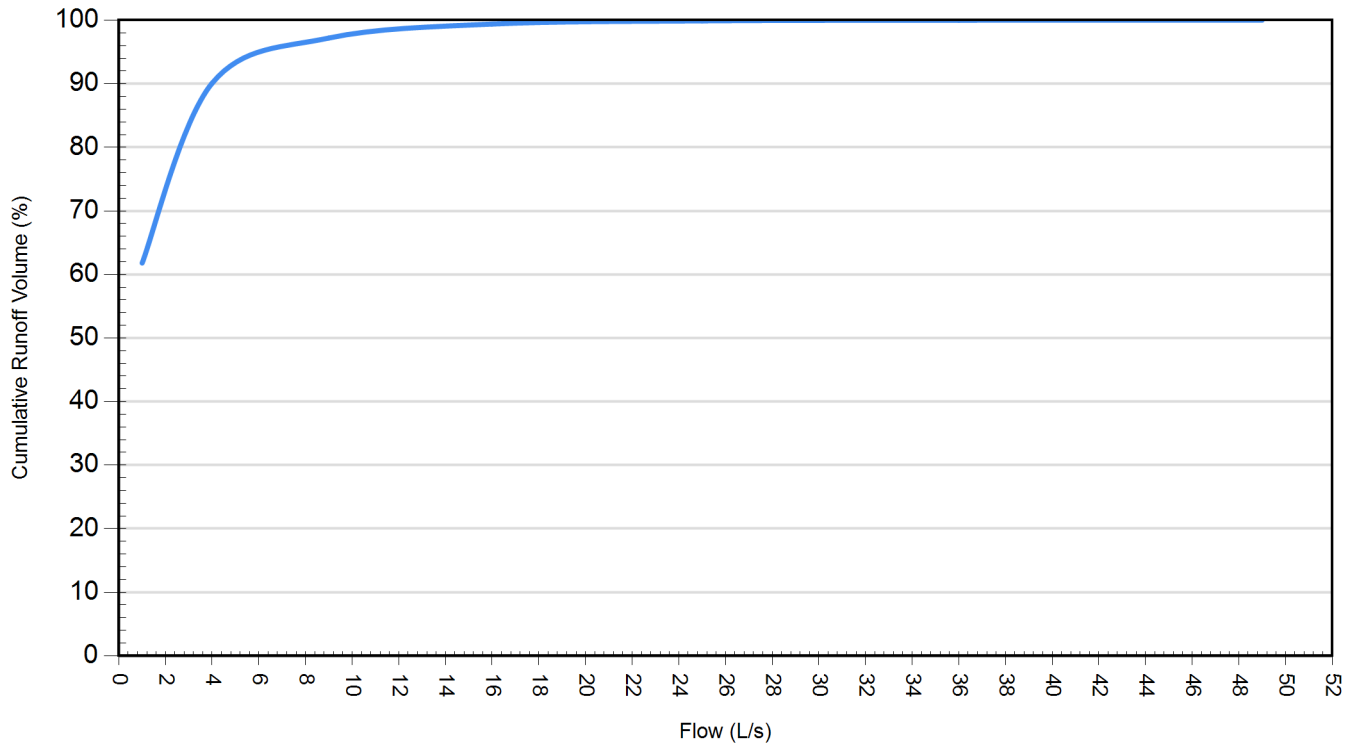


| Rainfall Event Analysis | | | | |
|-------------------------|---------------|--------------------------------|-------------------|---------------------------------|
| Rainfall Depth (mm) | No. of Events | Percentage of Total Events (%) | Total Volume (mm) | Percentage of Annual Volume (%) |
| 6.35 | 3113 | 76.1 | 5230 | 24.9 |
| 12.70 | 501 | 12.2 | 4497 | 21.4 |
| 19.05 | 225 | 5.5 | 3469 | 16.5 |
| 25.40 | 105 | 2.6 | 2317 | 11.0 |
| 31.75 | 62 | 1.5 | 1765 | 8.4 |
| 38.10 | 35 | 0.9 | 1206 | 5.8 |
| 44.45 | 28 | 0.7 | 1163 | 5.5 |
| 50.80 | 12 | 0.3 | 557 | 2.7 |
| 57.15 | 7 | 0.2 | 378 | 1.8 |
| 63.50 | 1 | 0.0 | 63 | 0.3 |
| 69.85 | 1 | 0.0 | 64 | 0.3 |
| 76.20 | 1 | 0.0 | 76 | 0.4 |
| 82.55 | 0 | 0.0 | 0 | 0.0 |
| 88.90 | 1 | 0.0 | 84 | 0.4 |
| 95.25 | 0 | 0.0 | 0 | 0.0 |
| 101.60 | 0 | 0.0 | 0 | 0.0 |
| 107.95 | 0 | 0.0 | 0 | 0.0 |
| 114.30 | 1 | 0.0 | 109 | 0.5 |
| 120.65 | 0 | 0.0 | 0 | 0.0 |
| 127.00 | 0 | 0.0 | 0 | 0.0 |

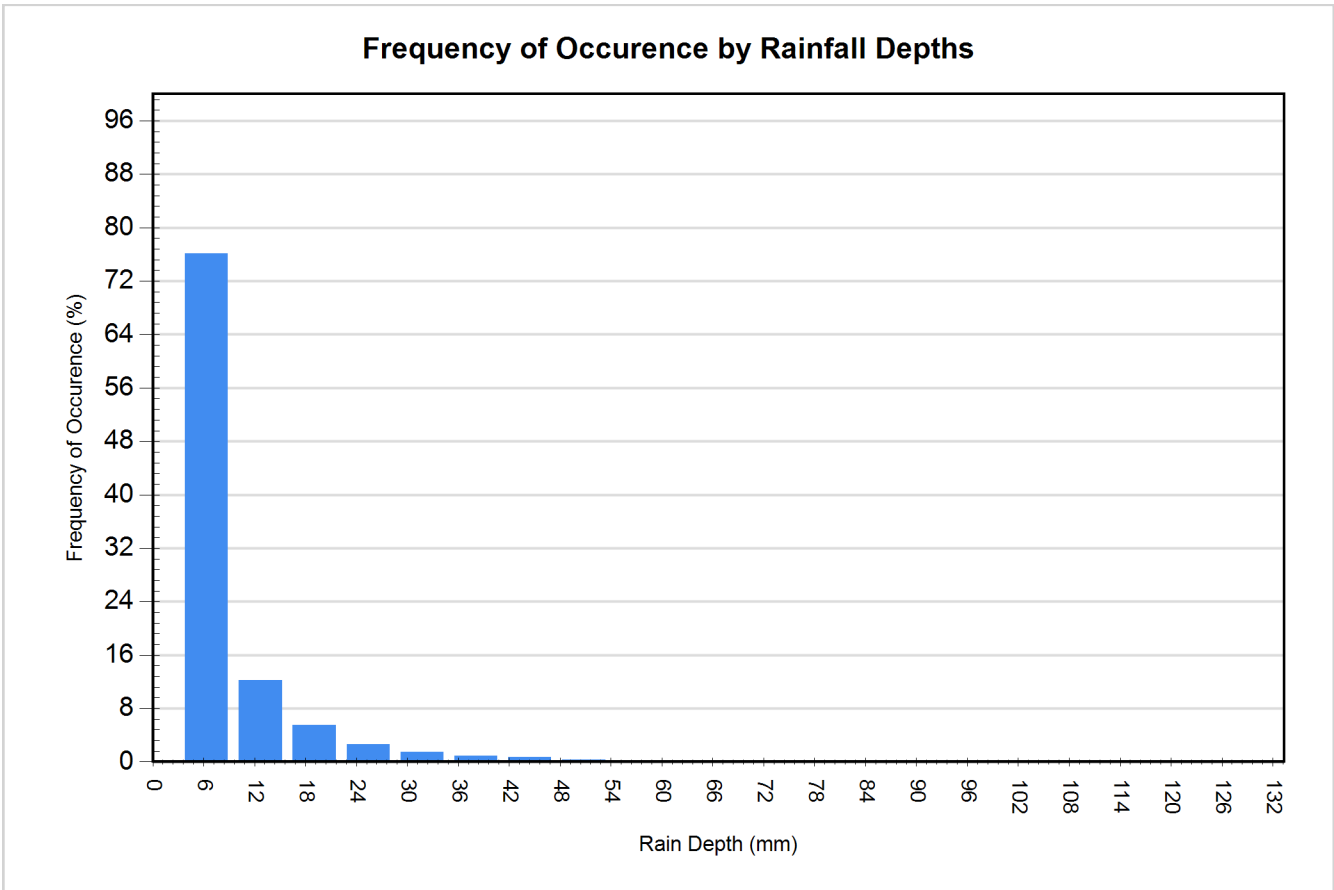


For Stormceptor Specifications and Drawings Please Visit:
<http://www.imbriumsystems.com/technical-specifications>

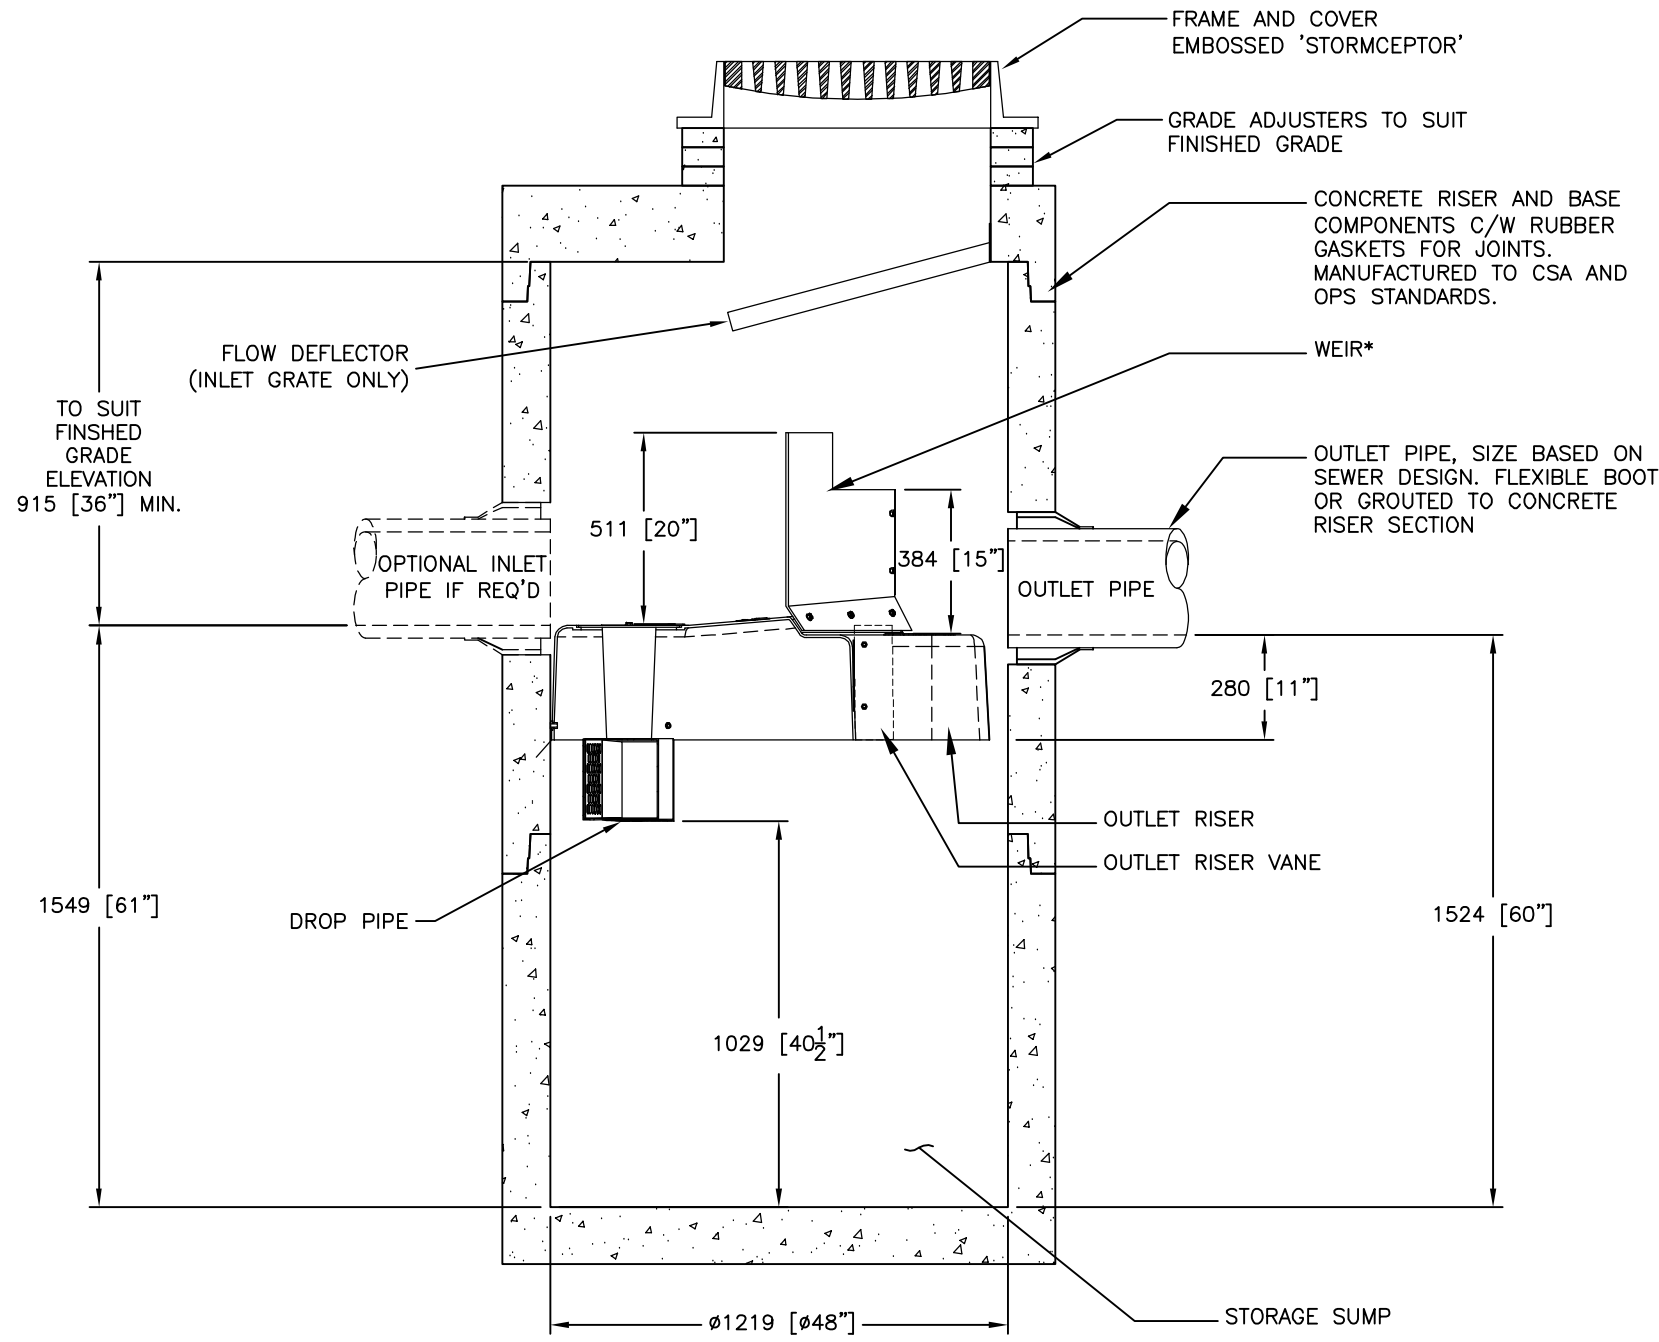

SECTION VIEW

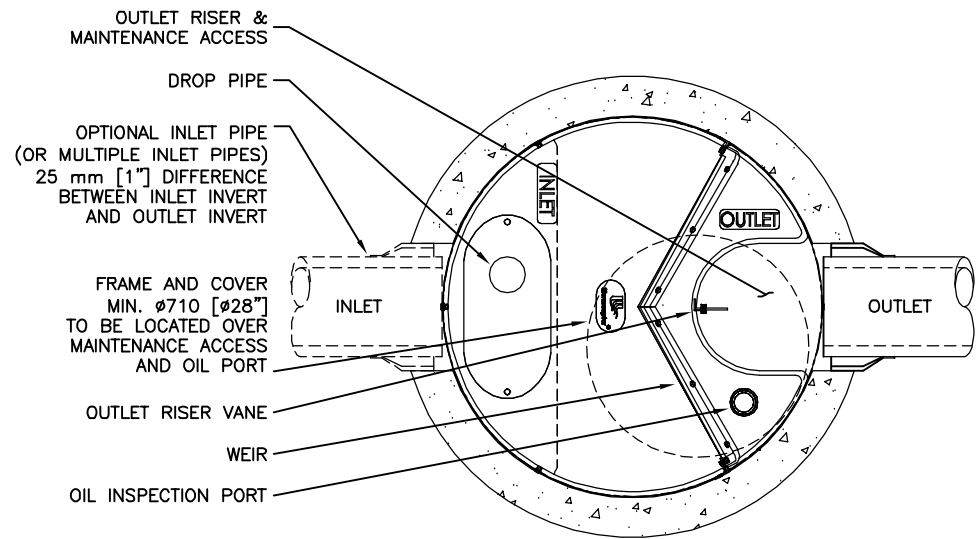

PLAN VIEW (STANDARD)

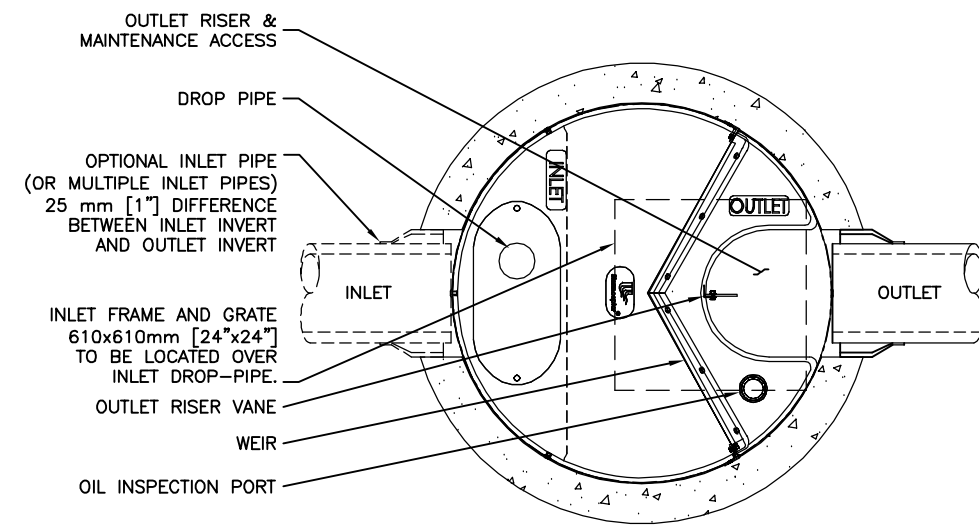

PLAN VIEW (INLET TOP)

FOR SITE SPECIFIC DRAWINGS PLEASE CONTACT YOUR LOCAL STORMCEPTOR REPRESENTATIVE. SITE SPECIFIC DRAWINGS ARE BASED ON THE BEST AVAILABLE INFORMATION AT THE TIME. SOME FIELD REVISIONS TO THE SYSTEM LOCATION OR CONNECTION PIPING MAY BE NECESSARY BASED ON AVAILABLE SPACE OR SITE CONFIGURATION REVISIONS. ELEVATIONS SHOULD BE MAINTAINED EXCEPT WHERE NOTED ON BYPASS STRUCTURE (IF REQUIRED).

GENERAL NOTES:

- * MAXIMUM SURFACE LOADING RATE (SLR) INTO LOWER CHAMBER THROUGH DROP PIPE IS 1135 L/min/m² (27.9 gpm/ft²) FOR STORMCEPTOR EF4 AND 535 L/min/m² (13.1 gpm/ft²) FOR STORMCEPTOR EFO4 (OIL CAPTURE CONFIGURATION). WEIR HEIGHT IS 150 mm (6 INCH) FOR EF04.
- 1. ALL DIMENSIONS INDICATED ARE IN MILLIMETERS (INCHES) UNLESS OTHERWISE SPECIFIED.
- 2. STORMCEPTOR STRUCTURE INLET AND OUTLET PIPE SIZE AND ORIENTATION SHOWN FOR INFORMATIONAL PURPOSES ONLY.
- 3. UNLESS OTHERWISE NOTED, BYPASS INFRASTRUCTURE, SUCH AS ALL UPSTREAM DIVERSION STRUCTURES, CONNECTING STRUCTURES, OR PIPE CONDUITS CONNECTING TO COMPLETE THE STORMCEPTOR SYSTEM SHALL BE PROVIDED AND ADDRESSED SEPARATELY.
- 4. DRAWING FOR INFORMATION PURPOSES ONLY. REFER TO ENGINEER'S SITE/UTILITY PLAN FOR STRUCTURE ORIENTATION.
- 5. NO PRODUCT SUBSTITUTIONS SHALL BE ACCEPTED UNLESS SUBMITTED 10 DAYS PRIOR TO PROJECT BID DATE, OR AS DIRECTED BY THE ENGINEER OF RECORD.

INSTALLATION NOTES

- A. ANY SUB-BASE, BACKFILL DEPTH, AND/OR ANTI-FLOTATION PROVISIONS ARE SITE-SPECIFIC DESIGN CONSIDERATIONS AND SHALL BE SPECIFIED BY ENGINEER OF RECORD.
- B. CONTRACTOR TO PROVIDE EQUIPMENT WITH SUFFICIENT LIFTING AND REACH CAPACITY TO LIFT AND SET THE STRUCTURE (LIFTING CLUTCHES PROVIDED)
- C. CONTRACTOR WILL INSTALL AND LEVEL THE STRUCTURE, SEALING THE JOINTS, LINE ENTRY AND EXIT POINTS (NON-SHRINK GROUT WITH APPROVED WATERSTOP OR FLEXIBLE BOOT)
- D. CONTRACTOR TO TAKE APPROPRIATE MEASURES TO PROTECT THE DEVICE FROM CONSTRUCTION-RELATED EROSION RUNOFF.
- E. DEVICE ACTIVATION, BY CONTRACTOR, SHALL OCCUR ONLY AFTER SITE HAS BEEN STABILIZED AND THE STORMCEPTOR UNIT IS CLEAN AND FREE OF DEBRIS.

**STANDARD DETAIL
NOT FOR CONSTRUCTION**

| SITE SPECIFIC DATA REQUIREMENTS | | | | | | |
|----------------------------------|------|-------|-----|---------|-----|--|
| STORMCEPTOR MODEL | EF4 | | | | | |
| STRUCTURE ID | * | | | | | |
| WATER QUALITY FLOW RATE (L/s) | * | | | | | |
| PEAK FLOW RATE (L/s) | * | | | | | |
| RETURN PERIOD OF PEAK FLOW (yrs) | * | | | | | |
| DRAINAGE AREA (HA) | * | | | | | |
| DRAINAGE AREA IMPERVIOUSNESS (%) | * | | | | | |
| PIPE DATA: | I.E. | MAT'L | DIA | SLOPE % | HGL | |
| INLET #1 | * | * | * | * | * | |
| INLET #2 | * | * | * | * | * | |
| OUTLET | * | * | * | * | * | |
| * PER ENGINEER OF RECORD | | | | | | |

This design and information shown on this drawing is provided as a service to the project owner, engineer and contractor by Imbrium Systems ("Imbrium"). Neither the drawing, nor any part thereof, may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or by any information storage and retrieval system, without the prior written consent of Imbrium. Failure to comply with these terms and conditions shall constitute a disclaimer of any liability or responsibility for such use. If discrepancies between the supplied information upon which the drawing is based and actual field conditions are discovered, the contractor shall be responsible for re-evaluation of the design. Imbrium accepts no liability for designs based on missing, incomplete or inaccurate information supplied by others.

| MARK | DATE | REVISION DESCRIPTION | BY |
|------|---------|----------------------|-----|
| ### | ### | INITIAL RELEASE | JSK |
| ### | 6/8/18 | UPDATES | JSK |
| ### | 5/26/17 | | |

Stormceptor® EF

SCALE = NTS

imbrium

7037 RIDGE ROAD, SUITE 300, HANOVER, MD 21076
USA 888-276-8828 CA 800-588-4801 INTL. +1-410-960-9600

THE ENGINEER/ARCHITECT/PLANNING/CONSULTING FIRM OR THE CONTRACTOR/GENERAL CONTRACTOR SHALL BE RESPONSIBLE FOR THE ACCURACY OF THE INFORMATION PROVIDED ON THIS DRAWING. THE CONTRACTOR SHALL BE RESPONSIBLE FOR VERIFYING THE INFORMATION PROVIDED ON THIS DRAWING. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY INFORMATION FROM THE PROJECT OWNER AND ENGINEER OF RECORD. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY INFORMATION FROM THE PROJECT OWNER AND ENGINEER OF RECORD.

DATE: 5/26/2017

| | |
|------------------|-----------------|
| DESIGNED: JSK | DRAWN: JSK |
| CHECKED: BSF | APPROVED: SP |
| PROJECT No.: EF4 | SEQUENCE No.: * |
| SHEET: 1 | OF 1 |

C.5 STORM DESIGN SHEET





2829 Dumauiur Avenue

STORM SEWER DESIGN SHEET (City of Ottawa)

DESIGN PARAMETERS

I = a / (t+b)^c (As per City of Ottawa Guidelines, 2012)

Table with 4 columns: 1:2 yr, 1:5 yr, 1:10 yr, 1:100 yr. Rows for a, b, c values.

MANNING'S n = 0.013, BEDDING CLASS = B, MINIMUM COVER: 2.00 m, TIME OF ENTRY 10 min

DATE: 2024-05-15, DESIGNED BY: WAJ, CHECKED BY:

FILE NUMBER: 160401596

Main data table with columns: LOCATION, DRAINAGE AREA, PIPE SELECTION. Includes rows for 'Controlled site area' with various stormwater parameters and pipe specifications.

Appendix D EXTERNAL REPORTS

D.1 GEOTECHNICAL INVESTIGATION (PATERSON, 2019)



Geotechnical
Engineering

Environmental
Engineering

Hydrogeology

Geological
Engineering

Materials Testing

Building Science

Archaeological Services

Geotechnical Investigation

Proposed Hi-Rise Building
2929 DuMaurier Avenue
Ottawa, Ontario

Prepared for

3223701 Canada Inc.

Paterson Group Inc.

Consulting Engineers
154 Colonnade Road South
Ottawa, Ontario
Canada K2E 7J5

Tel: (613) 226-7381
Fax: (613) 226-6344
www.patersongroup.ca

December 18, 2019

Report PG4928-1

Table of Contents

| | | Page |
|------------|---|-------------|
| 1.0 | Introduction | 1 |
| 2.0 | Proposed Development | 1 |
| 3.0 | Method of Investigation | |
| | 3.1 Field Investigation | 2 |
| | 3.2 Field Survey | 3 |
| | 3.3 Laboratory Testing | 3 |
| | 3.4 Analytical Testing | 3 |
| 4.0 | Observations | |
| | 4.1 Surface Conditions | 4 |
| | 4.2 Subsurface Profile | 4 |
| | 4.3 Groundwater | 5 |
| 5.0 | Discussion | |
| | 5.1 Geotechnical Assessment | 6 |
| | 5.2 Site Grading and Preparation | 6 |
| | 5.3 Foundation Design | 8 |
| | 5.4 Design for Earthquakes | 9 |
| | 5.5 Basement Slab | 10 |
| | 5.6 Basement Wall | 10 |
| | 5.7 Rock Anchor Design | 12 |
| | 5.8 Pavement Structure | 15 |
| 6.0 | Design and Construction Precautions | |
| | 6.1 Foundation Drainage and Backfill | 17 |
| | 6.2 Protection of Footings Against Frost Action | 18 |
| | 6.3 Excavation Side Slopes | 18 |
| | 6.4 Pipe Bedding and Backfill | 21 |
| | 6.5 Groundwater Control | 21 |
| | 6.6 Winter Construction | 22 |
| | 6.7 Corrosion Potential and Sulphate | 23 |
| 7.0 | Recommendations | 24 |
| 8.0 | Statement of Limitations | 25 |

Appendices

- Appendix 1** Soil Profile and Test Data Sheets
 Symbols and Terms
 Analytical Testing Results
- Appendix 2** Figure 1 - Key Plan
 Drawing PG4928-1 - Test Hole Location Plan

1.0 Introduction

Paterson Group (Paterson) was commissioned by 3223701 Canada Inc. to conduct a geotechnical investigation for the proposed hi-rise building to be located at 2829 DuMaurier Avenue in the City of Ottawa, Ontario (refer to Figure 1 - Key Plan in Appendix 2 of this report).

The objectives of the current investigation were to:

- ❑ Determine the subsurface and groundwater conditions by means of boreholes and existing soils information.
- ❑ Provide geotechnical recommendations pertaining to design of the proposed development including construction considerations which may affect the design.

The following report has been prepared specifically and solely for the aforementioned project which is described herein. The report contains Paterson's findings and includes geotechnical recommendations pertaining to the design and construction of the subject development as understood at the time of writing this report.

2.0 Proposed Development

The development is understood to consist of a 30 storey multi-use residential complex with up to five levels of underground parking with a ground floor mezzanine and commercial areas. It is further understood that the proposed building will encompass the majority of the subject site. Associated at-grade access lanes, car parking and landscaped areas are also anticipated. The proposed building is anticipated to be municipally serviced.

The subject property is presently occupied by a slab on grade commercial building. It is expected that the existing building within the north portion of the site will be demolished as part of the proposed project.

3.0 Method of Investigation

3.1 Field Investigation

Field Program

The field program for the current investigation was completed between November 10 and 11, 2019. At that time, 3 boreholes were advanced to a maximum depth of 18.2 m below existing grade. The borehole locations were distributed in a manner to provide general coverage of the proposed development taking into consideration existing site features. The borehole locations are shown on Drawing PG4928-1 - Test Hole Location Plan included in appendix 2.

Sampling and In-Situ Testing

Soil samples were recovered with a 50 mm diameter split-spoon sample or from the auger flights. The split-spoon and auger samples were classified on site and placed in sealed plastic bags. All samples were transported to Paterson's laboratory. The depths at which the split-spoon and auger samples were recovered from the boreholes are presented as SS and AU, respectively, on the Soil Profile and Test Data sheets in Appendix 1.

The Standard Penetration Test (SPT) was conducted in conjunction with the recovery of the split-spoon samples. The SPT results are recorded as "N" values on the Soil Profile and Test Data sheets. The "N" value is the number of blows required to drive the split-spoon sampler 300 mm into the soil after a 150 mm initial penetration using a 63.5 kg hammer falling from a height of 760 mm.

Rock samples were recovered from all boreholes using a core barrel and diamond drilling techniques. The bedrock samples were classified on site, placed in hard cardboard core boxes and transported to Paterson's laboratory. The depths at which rock core samples were recovered from the boreholes are presented as RC on the Soil Profile and Test Data sheets in Appendix 1.

The recovery value and a Rock Quality Designation (RQD) value were calculated for each drilled section of bedrock and are presented on the borehole logs. The recovery value is the length of the bedrock sample recovered over the length of the drilled section. The RQD value is the total length of intact rock pieces longer than 100 mm over the length of the core run. The values indicate the bedrock quality.

The subsurface conditions observed in the boreholes were recorded in detail in the field. The soil profiles are presented on the Soil Profile and Test Data sheets in Appendix 1.

Groundwater

A 32 mm diameter groundwater monitoring wells were installed in all boreholes to monitor the groundwater level subsequent to the completion of the sampling program. The groundwater observations are discussed in subsection 4.3 and presented in the Soil Profile and Test Data Sheets in Appendix 1.

3.2 Field Survey

The test hole locations were determined and located in the field by Paterson. The locations of the boreholes and the ground surface elevations for each borehole location are presented on Drawing PG4928-1 -Test Hole Location Plan in Appendix 2.

3.3 Laboratory Testing

The soil samples and bedrock cores were recovered from the subject site and visually examined in Paterson's laboratory to review the field logs.

All samples will be stored in the laboratory for a period of one month after issuance of this report. The samples will then be discarded unless otherwise directed.

3.4 Analytical Testing

One soil sample was submitted for analytical testing to assess the corrosion potential for exposed ferrous metals and the potential of sulphate attacks against subsurface concrete structures. The sample was submitted to determine the concentration of sulphate and chloride, the resistivity and the pH of the sample. The results are presented in Appendix 1 and are discussed further in Subsection 6.7.

4.0 Observations

4.1 Surface Conditions

The subject property is presently occupied a slab on grade commercial building with associated above ground parking structure.

The ground surface across the subject site is relatively flat and at grade with the Dumaurier Avenue. A slope was noted on the north side of the property. The residential property situated to the west of the subject site is slightly elevated. The site is bordered by high rise residential building and parking lot to the west, Dumaurier Avenue and Ramsey Crescent to the east and south, and an institutional property to the north.

4.2 Subsurface Profile

Overburden

Generally, the subsurface profile encountered at the boreholes consist of asphaltic concrete overlying a fill layer consisting of crushed stone with sand and trace concrete and brick. A thin layer of brown silty clay was encountered at BH1A underlying the above noted layers. Glacial till was encountered below the above noted layers consisting of a compact to a very dense silty sand with clay, gravel, cobbles, and boulders.

Bedrock

Bedrock was cored at all borehole locations. Weathered shale bedrock was encountered at depths ranging between 3.9 and 5.3 m below the existing ground surface. Upon review of the core hole samples, the upper first meter of the bedrock was found to be of fair quality.

Based on available geological mapping, the subject site is located in an area where the bedrock consists of shale and dolomite of the Rockcliffe Formation. The overburden drift thickness is anticipated to be between 2 to 5 m in depth.

4.3 Groundwater

Three groundwater monitoring wells were installed as part of our geotechnical investigation. Groundwater level measurements were recorded at the monitoring well locations and our findings are presented in Table 1. It should be noted that no groundwater was encountered in any of the monitoring wells. It should also be noted that the groundwater level is subject to seasonal fluctuations. Therefore, groundwater could vary at the time of construction.

| Table 1 - Groundwater Measurements at Monitoring Well Locations | | | | |
|--|-------------------------------------|-----------------------------|-------------------------------|--------------------------|
| Test Hole Location | Ground Surface Elevation (m) | GW Level Reading (m) | GW Level Elevation (m) | Date |
| BH 1 | 74.80 | 7.12 | 67.68 | November 20, 2019 |
| BH 2 | 73.38 | 5.75 | 67.63 | November 20, 2019 |
| BH 3 | 73.56 | 5.94 | 67.62 | November 20, 2019 |

5.0 Discussion

5.1 Geotechnical Assessment

From a geotechnical perspective, the subject site is considered satisfactory for the proposed development. The proposed hi-rise building is anticipated to be founded on spread footings placed directly or indirectly by the use of a lean concrete in-filled trench on a clean, surface sounded bedrock bearing surface.

Bedrock removal may be required to complete the underground level. Hoe ramming is an option where only small quantities of bedrock need to be removed. Line drilling and controlled blasting where large quantities of bedrock need to be removed is recommended. The blasting operations should be planned and completed under the guidance of a professional engineer with experience in blasting operations.

The above and other considerations are further discussed in the following sections.

5.2 Site Grading and Preparation

Stripping Depth

Since the building will occupy the entire boundaries of the subject site, all overburden will be removed to bedrock.

Bedrock Removal

Bedrock removal can be accomplished by hoe ramming where only small quantity of the bedrock needs to be removed. Sound bedrock may be removed by line drilling and controlled blasting and/or hoe ramming. Prior to considering blasting operations, the blasting effects on the existing services, buildings and other structures should be addressed. A pre-blast or pre-construction survey of the existing structures located in proximity of the blasting operations should be completed prior to commencing site activities. The extent of the survey should be determined by the blasting consultant and should be sufficient to respond to any inquiries/claims related to the blasting operations.

As a general guideline, peak particle velocities (measured at the structures) should not exceed 25 mm/s during the blasting program to reduce the risks of damage to the existing structures.

The blasting operations should be planned and conducted under the supervision of

a licensed professional engineer who is also an experienced blasting consultant.

Excavation side slopes in sound bedrock can be carried out using almost vertical side walls. A minimum 1 m horizontal ledge, should be left between the bottom of the overburden excavation and the top of the bedrock surface to provide an area to allow for potential sloughing or to provide a stable base for the overburden shoring system.

Vibration Considerations

Construction operations are the cause of vibrations, and possibly, sources of nuisance to the community. Therefore, means to reduce the vibration levels as much as possible should be incorporated in the construction operations to maintain, as much as possible, a cooperative environment with the residents.

The following construction equipments could be the source of vibrations: hoe ram, compactor, dozer, crane, truck traffic, etc. Vibrations, whether caused by blasting operations or by construction operations, could be the source of detrimental vibrations on the nearby buildings and structures. Therefore, all vibrations are recommended to be limited.

Two parameters are used to determine the permissible vibrations, namely, the maximum peak particle velocity and the frequency. For low frequency vibrations, the maximum allowable peak particle velocity is less than that for high frequency vibrations. As a guideline, the peak particle velocity should be less than 15 mm/s between frequencies of 4 to 12 Hz, and 50 mm/s above a frequency of 40 Hz (interpolate between 12 and 40 Hz). The guidelines are for current construction standards. Considering that these guidelines are above perceptible human level and, in some cases, could be very disturbing to some people, a pre-construction survey is recommended be completed to minimize the risks of claims during or following the construction of the proposed building.

Protection of Potential Expansive Bedrock

It is possible that expansive shale will be encountered at the subject site. Although the effects of expansive shale will not affect the proposed building structure, it is possible that it will affect the proposed basement floor slabs founded close to the shale bedrock and the basement floor slab of the adjacent hotel.

A potential for heaving and rapid deterioration of the shale bedrock exists at this site. To reduce the long term deterioration of the shale, exposure of the bedrock surface to oxygen should be kept as low as possible. The bedrock surface within the proposed

building footprint should be protected from excessive dewatering and exposure to ambient air.

To accomplish this a 50 mm thick concrete mud slab should be placed on the exposed bedrock surface within a 48 hour period of being exposed. A 17 MPa sulphate resistant lean concrete may be used. As an alternative to the mud slab, keeping the shale surface covered with granular backfill is also acceptable.

Selected excavated vertical sides of the exposed bedrock can be protected using a sprayed elastomeric coating or shotcrete to seal the bedrock from exposure to air and dewatering.

5.3 Foundation Design

Bearing Resistance Values

Auxiliary footings placed on an undisturbed, **dense glacial till bearing surface** can be designed using a bearing resistance value at serviceability limit states (SLS) of **250 kPa** and a factored bearing resistance value at ultimate limit states (ULS) of **500 kPa**. A geotechnical resistance factor of 0.5 was applied to the above noted bearing resistance value at ULS. Footings designed using the above-noted bearing resistance value at SLS will be subjected to potential post-construction total and differential settlements of 25 and 20 mm, respectively.

Footings placed on the **upper levels of the fractured shale and dolomite bedrock** a clean, surface sounded shale bedrock bearing surface can be designed using a factored bearing resistance value at ultimate limit states (ULS) of **1,500 kPa**, incorporating a geotechnical resistance factor of 0.5. Where the design underside of footing is slightly above the bedrock surface, footings can be placed over concrete in-filled (17 MPa). zero entry, near vertical trenches extended to a surface sounded bedrock bearing surface using the same bearing resistance values. The concrete in-filled trenches should extend a minimum 300 mm beyond the footing faces in all directions.

A clean, surface-sounded bedrock bearing surface should be free of loose materials, and have no near surface seams, voids, fissures or open joints which can be detected from surface sounding with a rock hammer.

A factored bearing resistance value at ULS of **4,000 kPa**, incorporating a geotechnical resistance factor of 0.5 if founded on **sound dolomite and shale bedrock** and the bedrock is free of seams, fractures and voids within 1.5 m below the founding level. This could be verified by completing and probing 50 mm diameter drill holes to a depth

of 1.5 m below the founding level within the footing footprint(s). One drill hole should be completed per footing. The drill hole inspection should be completed by the geotechnical consultant.

Settlement

Footings bearing on an acceptable bedrock bearing surface and designed using the bearing resistance values provided herein will be subjected to negligible potential post-construction total and differential settlements.

Soil/Bedrock Transition

It's expected that all footings will be founded on bedrock. However, between the footings for the main building and any auxiliary footings (canopy, vent shafts, etc.) where the building is founded on bedrock the auxiliary footings on the glacial till deposit, it is recommended to decrease the soil bearing capacity by 25% for the footing placed on soil bearing media to reduce the potential long term total and differential settlements. Also, at the soil/bedrock and bedrock/soil transitions, it is recommended that a 2 m transition zone composed of 0.5 m layer of nominally compacted OPSS Granular A or Granular B type II be placed directly on sound bedrock. Steel reinforcement, extending at least 3 m on both sides of the 2 m long transition should be placed in the top part of the footing and foundation walls.

Lateral Support

The bearing medium under footing-supported structures is required to be provided with adequate lateral support with respect to excavations and different foundation levels. Adequate lateral support is provided to a sound bedrock bearing medium when a plane extending down and out from the bottom edge of the footing at a minimum of 1H:6V (or flatter) passes only through sound bedrock or a material of the same or higher capacity as the bedrock, such as concrete. A weathered bedrock bearing medium will require a lateral support zone of 1H:1V (or flatter).

5.4 Design for Earthquakes

The site class for seismic site response can be taken as **Class C** for the foundations considered at this site. However, A higher site class (**Class A**) can be achieved. The higher site class will require a site specific shear wave velocity test to be completed in confirmation of the seismic site classification. The soils underlying the subject site are not susceptible to liquefaction. Refer to the latest revision of the Ontario Building Code for a full discussion of the earthquake design requirements.

5.5 Basement Slab

All overburden soil will be removed from the subject site leaving the bedrock as the founding medium for the lower basement floor slab. It is expected that the basement area will be mostly parking and a rigid pavement structure designed by a structural engineer will be applicable. However, if storage or other uses of the lower level where a concrete floor slab will be used it is recommended that the upper 200 mm of sub-slab fill consists of 19 mm clear crushed stone. All backfill material within the footprint of the proposed building should be placed in maximum 300 mm thick loose layers and compacted to at least 98% of its SPMDD.

5.6 Basement Wall

It is understood that the basement walls are to be poured against a dampproofing system, which will be placed against the exposed bedrock face. Below the bedrock surface, a nominal coefficient for at-rest earth pressure of 0.01 is recommended in conjunction with a bulk unit weight of 24.5 kN/m³ (effective 15.5 kN/m³). A seismic earth pressure component will not be applicable for the foundation wall, which is to be poured against the bedrock face. It is expected that the seismic earth pressure will be transferred to the underground floor slabs, which should be designed to accommodate these pressures. A hydrostatic groundwater pressure should be added for the portion below the groundwater level.

Where soil is to be retained, the conditions can be well-represented by assuming the retained soil consists of a material with an angle of internal friction of 30 degrees and a bulk (drained) unit weight of 20 kN/m³. Undrained conditions are anticipated (i.e. below the groundwater level). Therefore, the applicable effective (undrained) unit weight of the retained soil can be taken as 13 kN/m³, where applicable. A hydrostatic pressure should be added to the total static earth pressure when using the effective unit weight.

Two distinct conditions, static and seismic, must be reviewed for design calculations. The parameters for design calculations for the two conditions are presented below.

Static Conditions

The static horizontal earth pressure (p_o) can be calculated using a triangular earth pressure distribution equal to $K_o \cdot \gamma \cdot H$ where:

- K_o = at-rest earth pressure coefficient of the applicable retained soil, 0.5
- γ = unit weight of fill of the applicable retained soil (kN/m^3)
- H = height of the wall (m)

An additional pressure having a magnitude equal to $K_o \cdot q$ and acting on the entire height of the wall should be added to the above diagram for any surcharge loading, q (kPa), that may be placed at ground surface adjacent to the wall. The surcharge pressure will only be applicable for static analyses and should not be used in conjunction with the seismic loading case.

Actual earth pressures could be higher than the “at-rest” case if care is not exercised during the compaction of the backfill materials to maintain a minimum separation of 0.3 m from the walls with the compaction equipment.

Seismic Conditions

The total seismic force (P_{AE}) includes both the earth force component (P_o) and the seismic component (ΔP_{AE}).

The seismic earth force (ΔP_{AE}) can be calculated using $0.375 \cdot a_c \cdot \gamma \cdot H^2/g$ where:

- $a_c = (1.45 - a_{max}/g) a_{max}$
- γ = unit weight of fill of the applicable retained soil (kN/m^3)
- H = height of the wall (m)
- g = gravity, 9.81 m/s^2

The peak ground acceleration, (a_{max}), for the Ottawa area is $0.32g$ according to OBC 2012. Note that the vertical seismic coefficient is assumed to be zero.

The earth force component (P_o) under seismic conditions can be calculated using $P_o = 0.5 K_o \gamma H^2$, where $K_o = 0.5$ for the soil conditions noted above.

The total earth force (P_{AE}) is considered to act at a height, h (m), from the base of the wall, where:

$$h = \{P_o \cdot (H/3) + \Delta P_{AE} \cdot (0.6 \cdot H)\} / P_{AE}$$

The earth forces calculated are unfactored. For the ULS case, the earth loads should be factored as live loads, as per OBC 2012.

5.7 Rock Anchor Design

The geotechnical design of grouted rock anchors in sedimentary bedrock is based upon two possible failure modes. The anchor can fail either by shear failure along the grout/rock interface or by pullout of a 60 to 90 degree cone of rock with the apex of the cone near the middle of the bonded length of the anchor. It should be noted that interaction may develop between the failure cones of anchors that are relatively close to one another resulting in a total group capacity smaller than the sum of the load capacity of each anchor taken individually.

A third failure mode of shear failure along the grout/steel interface should also be reviewed by a qualified structural engineer to ensure all typical failure modes have been reviewed. Typical rock anchor suppliers, such as Dywidag Systems International (DSI Canada), have qualified personnel on staff to recommend appropriate rock anchor size and materials.

It should be further noted that center to center spacing between bond lengths be at least four times the anchor hole diameter and greater than 1.2 m to lower the group influence effects. It is also recommended that anchors in close proximity to each other be grouted at the same time to ensure any fractures or voids are completely in-filled and that fluid grout does not flow from one hole to an adjacent empty one.

Anchors can be of the “passive” or the “post-tensioned” type, depending on whether the anchor tendon is provided with post-tensioned load or not prior to being put into service. To resist seismic uplift pressures, a passive rock anchor system can be used. It should be noted that a post-tensioned anchor will take the uplift load with much less deflection than a passive anchor.

Regardless of whether an anchor is of the passive or the post tensioned type, it is recommended that the anchor be provided with a bonded length, or fixed anchor length, at the base of the anchor, which will provide the anchor capacity, as well an unbonded length, or free anchor length, between the rock surface and the start of the bonded length. As the depth at which the apex of the shear failure cone develops is midway along the bonded length, a fully bonded anchor would tend to have a much shallower cone, and therefore less geotechnical resistance, than one where the bonded length is limited to the bottom part of the overall anchor.

Permanent anchors should be provided with corrosion protection. As a minimum, this requires that the entire drill hole be filled with cementitious grout. The free anchor length is provided by installing a plastic sleeve to act as a bond break.

Grout to Rock Bond

A factored tensile grout to rock bond resistance value at ULS of **1.0 MPa**, incorporating a resistance factor of 0.3, can be used. A minimum grout strength of 30 MPa is recommended.

Rock Cone Uplift

As discussed previously, the geotechnical capacity of the rock anchors depends on the dimensions of the rock anchors and the configuration of the anchorage system. Based on existing bedrock information, a **Rock Mass Rating (RMR) of 64** was assigned to the bedrock, and Hoek and Brown parameters (**m and s**) were taken as **0.575 and 0.00293**, respectively.

Recommended Rock Anchor Lengths

Parameters used to calculate rock anchor lengths are provided in Table 2.

| Table 2 - Parameters used in Rock Anchor Review | |
|--|----------------------------------|
| Grout to Rock Bond Strength - Factored at ULS | 1.0 MPa |
| Compressive Strength - Grout | 30 MPa |
| Rock Mass Rating (RMR) - Good quality interbedded Shale and Doloston bedrock Hoek and Brown parameters | 64 m=0.574 and s=0.00293 |
| Unconfined compressive strength - black shale bedrock | 40 MPa |
| Unit weight - Submerged Bedrock | 15.2 kN/m ³ |
| Apex angle of failure cone | 60° |
| Apex of failure cone | mid-point of fixed anchor length |

From a geotechnical perspective, the fixed anchor length will depend on the diameter of the drill holes. Recommended anchor lengths for a 75 and 125 mm diameter hole are provided in Table 3 below.

| Table 3 - Recommended Rock Anchor Lengths - Grouted Rock Anchor | | | | |
|--|---------------------------|------------------------|---------------------|---|
| Diameter of Corehole (mm) | Anchor Lengths (m) | | | Factored Tensile Resistance (kN) |
| | Bonded Length | Unbonded Length | Total Length | |
| 75 | 2.1 | 0.7 | 2.8 | 500 |
| | 3.4 | 0.6 | 4.0 | 800 |
| | 4.5 | 0.5 | 5.0 | 1,000 |
| 125 | 1.3 | 1.1 | 2.4 | 500 |
| | 2.1 | 1.2 | 3.3 | 800 |
| | 2.7 | 1.2 | 3.9 | 1,000 |

It is recommended that the anchor drill hole diameter be within 1.5 to 2 times the rock anchor tendon diameter and the anchor drill holes be inspected by geotechnical personnel and should be flushed clean prior to grouting. The use of a grout tube to place grout from the bottom up in the anchor holes is further recommended.

The geotechnical capacity of each rock anchor should be proof tested at the time of construction. More information on testing can be provided upon request. Compressive strength testing is recommended to be completed for the rock anchor grout. A set of grout cubes should be tested for each day grout is prepared.

Bedrock Excavation Face Stabilisation

Due to the poor quality of bedrock near surface and potential founding of the proposed development, bedrock stabilization may be required when the proposed foundation extends into the shale bedrock.

Horizontal rock anchors may be required at specific locations to prevent pop-outs of the bedrock, especially in areas where bedrock fractures are conducive to the failure of the bedrock surface.

The requirement for horizontal rock anchors and/or shotcrete for face protection excavation should be evaluated during the excavation operations and should be discussed with the structural engineer during the design stage.

5.8 Pavement Structure

For design purposes, the flexible pavement structure presented in the following table could be used for the design of car only parking areas in the lower level of the parking garage.

| Table 4 - Recommended Pavement Structure - Parking Areas | |
|---|--|
| Thickness (mm) | Material Description |
| 50 | Wear Course - HL 3 or Superpave 12.5 Asphaltic Concrete |
| 150 | BASE - OPSS Granular A Crushed Stone |
| 300 | SUBBASE - OPSS Granular B Type II |
| SUBGRADE - Either fill, in situ silty clay or sand or crushed stone material placed over in situ soil. | |

| Table 5 - Recommended Pavement Structure - Local Roadways, Access Lanes and Heavy Vehicle Parking | |
|---|--|
| Thickness (mm) | Material Description |
| 40 | Wear Course - Superpave 12.5 Asphaltic Concrete |
| 50 | Binder Course - Superpave 19.0 Asphaltic Concrete |
| 150 | BASE - OPSS Granular A Crushed Stone |
| 400 | SUBBASE - OPSS Granular B Type II |
| SUBGRADE - Either fill, in situ silty clay or sand or crushed stone material placed over in situ soil. | |

Minimum Performance Graded (PG) 58-34 asphalt cement should be used for parking areas and local roadways and PG 64-34 asphalt cement should be used for roadways with bus traffic. The pavement granular base and subbase should be placed in maximum 300 mm thick lifts and compacted to a minimum of 100% of the material's SPMDD using suitable vibratory equipment.

The proposed pavement structure, where it abuts the existing pavement, should match the existing pavement layers. It is recommended that a 300 mm wide and 50 mm deep stepped joint be provided where the new asphalt layer joins with the existing asphalt layer to provide more resistance to cracking at the joint.

6.0 Design and Construction Precautions

6.1 Foundation Drainage and Backfill

Foundation Drainage

It is understood that the building foundation walls will be placed in close proximity to all the boundaries. It is expected that insufficient room will be available for exterior backfill along these walls and, therefore, the foundation wall will be poured against a drainage system placed against the shoring face.

It is recommended that the composite drainage system (such as Miradrain G100N, Delta Drain 6000 or equivalent) extend down to the footing level. It is recommended that 150 mm diameter sleeves at 3 m centres be cast in the foundation wall at the footing interface to allow the infiltration of water to flow to an interior perimeter drainage pipe. The perimeter drainage pipe should direct water to sump pit(s) within the lower basement area.

Underfloor Drainage

It is anticipated that underfloor drainage will be required to control water infiltration. The spacing of the underfloor drainage system should be confirmed at the time of excavation when water infiltration can be better assessed. For design purposes, we suggest a 150 mm in diameter perforated pipe with a geotextile sock be placed in each bay.

Foundation Backfill

Above the bedrock surface, backfill against the exterior sides of the foundation walls should consist of free-draining non frost susceptible granular materials. The greater part of the site excavated materials will be frost susceptible and, as such, are not recommended for re-use as backfill against the foundation walls, unless used in conjunction with a drainage geocomposite, such as Miradrain G100N or Delta Drain 6000, connected to the perimeter foundation drainage system. Imported granular materials, such as clean sand or OPSS Granular B Type I granular material, should otherwise be used for this purpose.

6.2 Protection of Footings Against Frost Action

The parking garage is expected to not require protection against frost action due to the founding depth. Unheated structures such as the access ramp may required to be insulated against the deleterious effect of frost action.

Perimeter footings of heated structures are required to be insulated against the deleterious effects of frost action. A minimum of 1.5 m of soil cover alone, or a minimum of 0.6 m of soil cover, in conjunction with adequate foundation insulation, should be provided. More details regarding foundation insulation can be provided, if requested.

Exterior unheated footings, such as those for isolated exterior piers, are more prone to deleterious movement associated with frost action than the exterior walls of the heated structure and require additional protection, such as soil cover of 2.1 m or an equivalent combination of soil cover and foundation insulation.

6.3 Excavation Side Slopes

Unsupported Side Slopes

The side slopes of excavations in the soil and fill overburden materials should either be excavated at acceptable slopes or should be retained by shoring systems from the beginning of the excavation until the structure is backfilled. Insufficient room is expected for majority of the excavation to be constructed by open-cut methods (i.e. unsupported excavations).

The excavation side slopes above the groundwater level extending to a maximum depth of 3 m should be excavated at 1H:1V or shallower. The shallower slope is required for excavation below groundwater level. The subsurface soils are considered to be a Type 2 and 3 soil according to the Occupational Health and Safety Act and Regulations for Construction Projects.

Excavated soil should not be stockpiled directly at the top of excavations and heavy equipment should be kept away from the excavation sides.

Slopes in excess of 3 m in height should be periodically inspected by the geotechnical consultant in order to detect if the slopes are exhibiting signs of distress. A trench box is recommended to protect personnel working in trenches with steep or vertical sides. Services are expected to be installed by “cut and cover” methods and excavations should not remain open for extended periods of time.

Temporary Shoring

Temporary shoring will be required to support the overburden soils. The design and implementation of these temporary systems will be the responsibility of the excavation contractor or the shoring contractor and their design team. Inspections and approval of the temporary system will also be the responsibility of the designer. Geotechnical information provided below is to assist the designer in completing a suitable and safe shoring system. The designer should take into account the potential for a fully saturated condition following a significant precipitation event. Any changes to the approved shoring design system should be reported immediately to the owner's representative prior to implementation.

Temporary shoring may be required to complete the required excavations where insufficient room is available for open cut methods. The shoring requirements will depend on the depth of the excavation, the proximity of the adjacent buildings and underground structures and the elevation of the adjacent building foundations and underground services. Additional information can be provided when the above details are known.

For design purposes, the temporary system may consist of soldier pile and lagging system or interlocking steel sheet piling. Any additional loading due to street traffic, construction equipment, adjacent structures and facilities, etc., should be added to the earth pressures described below. These systems can be cantilevered, anchored or braced. The earth pressures acting on the shoring system may be calculated using the following parameters.

| Table 6 - Soil Parameters for Shoring System Design | |
|--|---------------|
| Parameters | Values |
| Active Earth Pressure Coefficient (K_a) | 0.33 |
| Passive Earth Pressure Coefficient (K_p) | 3 |
| At-Rest Earth Pressure Coefficient (K_o) | 0.5 |
| Unit Weight (γ), kN/m ³ | 20 |
| Submerged Unit Weight (γ), kN/m ³ | 13 |

Generally, it is expected that the shoring systems will be provided with tie-back rock anchors to ensure their stability. It is further recommended that the toe of the shoring be adequately supported to resist toe failure.

The geotechnical design of grouted rock anchors in sedimentary bedrock is based upon two possible failure modes. The anchor can fail either by shear failure along the grout/rock interface or by pullout of a 60 to 90 degree cone of rock with the apex of the cone near the middle of the bonded length of the anchor.

The anchor derives its capacity from the bonded portion, or fixed anchor length, at the base of the anchor. An unbonded portion, or free anchor length, is also usually provided between the rock surface and the start of the bonded length. A factored tensile grout to rock bond resistance value at ULS of **1.0 MPa**, incorporating a resistance factor of 0.3, can be used. A minimum grout strength of 40 MPa is recommended.

It is recommended that the anchor drill hole diameter be within 1.5 to 2 times the rock anchor tendon diameter and the anchor drill holes be inspected by geotechnical personnel and should be flushed clean prior to grouting. The use of a grout tube to place grout from the bottom up in the anchor holes is further recommended.

The geotechnical capacity of each rock anchor should be proof tested at the time of construction. More information on testing can be provided upon request. Compressive strength testing is recommended to be completed for the rock anchor grout. A set of grout cubes should be tested for each day grout is prepared.

Soldier Pile and Lagging System

The active earth pressure acting on a soldier pile and lagging shoring system can be calculated using a rectangular earth pressure distribution with a maximum pressure of $0.65 K \gamma H$ for strutted or anchored shoring or a triangular earth pressure distribution with a maximum value of $K \gamma H$ for a cantilever shoring system. H is the height of the excavation.

The active earth pressure should be used where wall movements are permissible while the at-rest pressure should be used if no movement is permissible.

The total unit weight should be used above the groundwater level while the submerged unit weight should be used below the groundwater level.

The hydrostatic groundwater pressure should be added to the earth pressure distribution wherever the submerged unit weights are used for earth pressure calculations should the level on the groundwater not be lowered below the bottom of the excavation. If the groundwater level is lowered, the total unit weight for the soil should be used full weight, with no hydrostatic groundwater pressure component.

Concrete Underpinning

Based on proximity of existing adjacent buildings support in the form of concrete underpinning maybe required during excavation for the proposed building. It is expected that the founding elevations of the existing foundations will be in close proximity to the bedrock surface (less than 1.5 m) and conventional concrete underpinning may be used to support the full width and length of the foundation.

It is expected that the structural engineer along with the geotechnical engineer will review the site conditions at the time of construction and finalize the underpinning program based on their observations at that time.

6.4 Pipe Bedding and Backfill

Bedding and backfill materials should be in accordance with the most recent Material Specifications & Standard Detail Drawings from the Department of Public Works and Services, Infrastructure Services Branch of the City of Ottawa.

A minimum of 150 mm of OPSS Granular A should be placed for bedding for sewer or water pipes when placed on soil subgrade. If the bedding is placed on bedrock, the thickness of the bedding should be increased to 300 mm for sewer pipes. The bedding should extend to the spring line of the pipe. Cover material, from the spring line to a minimum of 300 mm above the obvert of the pipe should consist of OPSS Granular A (concrete or PSM PVC pipes) or sand (concrete pipe). The bedding and cover materials should be placed in maximum 225 mm thick lifts and compacted to 95% of the SPMDD.

Where hard surface areas are considered above the trench backfill, the trench backfill material within the frost zone (about 1.8 m below finished grade) should match the soils exposed at the trench walls to reduce the potential differential frost heaving. The trench backfill should be placed in maximum 300 mm thick loose lifts and compacted to a minimum of 95% of the SPMDD.

6.5 Groundwater Control

It is anticipated that groundwater infiltration into the excavations should be controllable using open sumps. The contractor should be prepared to direct water away from all bearing surfaces and subgrades, regardless of the source, to prevent disturbance to the founding medium.

A temporary Ministry of Environment, Conservation and Parks (MECP) Category 3 Permit to Take Water (PTTW) may be required if more than 400,000 L/day are to be pumped during the construction phase. At least 4 to 5 months should be allowed for completion of the application and issuance of the permit by the MECP.

For typical ground or surface water volumes being pumped during the construction phase, typically between 50,000 to 400,000 L/day, it is required to register on the Environmental Activity and Sector Registry (EASR). A minimum of two to four weeks should be allotted for completion of the EASR registration and the Water Taking and Discharge Plan to be prepared by a Qualified Person as stipulated under O.Reg. 63/16. If a project qualifies for a PTTW based upon anticipated conditions, an EASR will not be allowed as a temporary dewatering measure while awaiting the MECP review of the PTTW application.

6.6 Winter Construction

Precautions must be taken if winter construction is considered for this project. The subsoil conditions at this site mostly consist of frost susceptible materials. In presence of water and freezing conditions ice could form within the soil mass. Heaving and settlement upon thawing could occur.

In the event of construction during below zero temperatures, the founding stratum should be protected from freezing temperatures by the use of straw, propane heaters and tarpaulins or other suitable means. In this regard, the base of the excavations should be insulated from sub-zero temperatures immediately upon exposure and until such time as heat is adequately supplied to the building and the footings are protected with sufficient soil cover to prevent freezing at founding level.

The trench excavations should be carried out in a manner to avoid the introduction of frozen materials, snow or ice into the trenches. Precaution must be taken where excavations are carried in proximity of existing structures which may be adversely affected due to the freezing conditions. In particular, it should be recognized that where a shoring system is used, the soil behind the shoring system will be subjected to freezing conditions and could result in heaving of the structure(s) placed within or above frozen soil. Provisions should be made in the contract document to protect the walls of the excavations from freezing, if applicable.

6.7 Corrosion Potential and Sulphate

The analytical testing results indicate that the sulphate content is less than 0.1%. This result indicates that Type 10 Portland Cement (i.e. normal cement) would be appropriate for this site. The chloride content and pH of the samples indicate that they are not significant factors in creating a corrosive environment, whereas the resistivity is indicative of an aggressive corrosive environment.

7.0 Recommendations

A materials testing and observation services program is a requirement for the provided foundation design data to be applicable. The following aspects of the program should be performed by the geotechnical consultant:

- Review of the geotechnical aspects of the excavating contractor's shoring design, prior to construction.
- Review the bedrock stabilization and excavation requirements.
- Review proposed foundation drainage design and requirements.
- Observation of all bearing surfaces prior to the placement of concrete.
- Sampling and testing of the concrete and fill materials used.
- Observation of all subgrades prior to backfilling.
- Field density tests to determine the level of compaction achieved.

A report confirming that these works have been conducted in general accordance with our recommendations could be issued, upon request, following the completion of a satisfactory materials testing and observation program by the geotechnical consultant.

8.0 Statement of Limitations

The recommendations provided in this report are in accordance with our present understanding of the project. We request permission to review our recommendations when the drawings and specifications are completed.

A soils investigation is a limited sampling of a site. Should any conditions at the site be encountered which differ from those at the test locations, we request immediate notification to permit reassessment of our recommendations.


The recommendations provided herein should only be used by the design professionals associated with this project. They are not intended for contractors bidding on or undertaking the work. The latter should evaluate the factual information provided in this report and determine its suitability and completeness for their intended construction schedule and methods. Additional testing may be required for their purposes.

The present report applies only to the project described in this document. Use of this report for purposes other than those described herein or by person(s) other than 3223701 Canada Inc. or their agents is not authorized without review by Paterson for the applicability of our recommendations to the alternative use of the report.

Paterson Group Inc.



Joey R. Villeneuve, M.A.Sc., P.Eng.

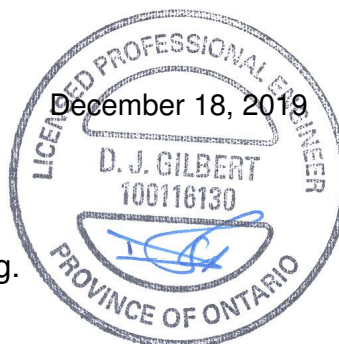

David J. Gilbert, P.Eng.

Report Distribution

- 3223701 Canada Inc.
- Paterson Group

APPENDIX 1

SOIL PROFILE AND TEST DATA SHEETS

SYMBOLS AND TERMS

ANALYTICAL TESTING RESULTS

DATUM TBM - Top spindle of fire hydrant located at the northeast corner of subject site.
Geodetic elevation = 74.952m.

REMARKS

FILE NO.
PG4928

HOLE NO.
BH 1

BORINGS BY CME 55 Power Auger

DATE 2019 November 11

| SOIL DESCRIPTION | STRATA PLOT | SAMPLE | | | | DEPTH (m) | ELEV. (m) | Pen. Resist. Blows/0.3m ● 50 mm Dia. Cone | | | | Monitoring Well Construction | |
|--|-------------|--------|--------|------------|----------------|-----------|-----------|--|----|----|----|------------------------------|--|
| | | TYPE | NUMBER | RECOVERY % | N VALUE or RQD | | | ○ Water Content % | | | | | |
| | | | | | | | | 20 | 40 | 60 | 80 | | |
| GROUND SURFACE | | | | | | | | | | | | | |
| TOPSOIL | 0.18 | | | | | 0 | 74.80 | | | | | | |
| FILL: Brown clayey silt, some sand and gravel | | AU | 1 | | | | | | | | | | |
| | 0.86 | | | | | 1 | 73.80 | | | | | | |
| FILL: Brown silty sand | | SS | 2 | 42 | 7 | | | | | | | | |
| | 1.52 | | | | | 2 | 72.80 | | | | | | |
| FILL: Brown sand, trace gravel | | SS | 3 | 62 | 5 | | | | | | | | |
| | 2.90 | | | | | 3 | 71.80 | | | | | | |
| Loose, brown FINE SAND with silty clay | | SS | 4 | 8 | 3 | | | | | | | | |
| | 3.81 | | | | | 4 | 70.80 | | | | | | |
| GLACIAL TILL: Dense, brown silty sand with gravel, clay and shale fragments | | SS | 5 | 75 | 5 | | | | | | | | |
| | 5.28 | | | | | 5 | 69.80 | | | | | | |
| | | | | | | 6 | 68.80 | | | | | | |
| | | | | | | 7 | 67.80 | | | | | | |
| BEDROCK: Fair to excellent quality, green shale interbedded with dolomite | | RC | 1 | 100 | 67 | | | | | | | | |
| | | | | | | 8 | 66.80 | | | | | | |
| | | | | | | 9 | 65.80 | | | | | | |
| | | | | | | 10 | 64.80 | | | | | | |
| | | | | | | | | | | | | | |

20 40 60 80 100
Shear Strength (kPa)
▲ Undisturbed △ Remoulded

DATUM TBM - Top spindle of fire hydrant located at the northeast corner of subject site.
Geodetic elevation = 74.952m.

REMARKS

BORINGS BY CME 55 Power Auger

DATE 2019 November 11

FILE NO. PG4928

HOLE NO. BH 1

| SOIL DESCRIPTION | STRATA PLOT | SAMPLE | | | | DEPTH (m) | ELEV. (m) | Pen. Resist. Blows/0.3m ● 50 mm Dia. Cone | | | | Monitoring Well Construction | |
|---|-------------|--------|--------|------------|----------------|-----------|-----------|--|----|----|----|------------------------------|--|
| | | TYPE | NUMBER | RECOVERY % | N VALUE or RQD | | | 20 | 40 | 60 | 80 | | |
| GROUND SURFACE | | | | | | 10 | 64.80 | | | | | | |
| BEDROCK: Fair to excellent quality, green shale interbedded with dolomite | | RC | 5 | 97 | 92 | 11 | 63.80 | | | | | | |
| | | RC | 6 | 100 | 98 | 12 | 62.80 | | | | | | |
| BEDROCK: Good excellent quality, grey dolostone | | RC | 7 | 100 | 93 | 13 | 61.80 | | | | | | |
| | | RC | 8 | 92 | 74 | 14 | 60.80 | | | | | | |
| | | RC | 9 | 95 | 85 | 15 | 59.80 | | | | | | |
| 13.51 | | | | | 16 | 58.80 | | | | | | | |
| 18.19 | | | | | 17 | 57.80 | | | | | | | |
| End of Borehole (GWL @ 7.12m - Nov. 20, 2019) | | | | | 18 | 56.80 | | | | | | | |

20 40 60 80 100
Shear Strength (kPa)
▲ Undisturbed △ Remoulded

DATUM TBM - Top spindle of fire hydrant located at the northeast corner of subject site.
Geodetic elevation = 74.952m.

REMARKS

FILE NO.
PG4928

HOLE NO.
BH 2

BORINGS BY CME 55 Power Auger

DATE 2019 November 11

| SOIL DESCRIPTION | STRATA PLOT | SAMPLE | | | | DEPTH (m) | ELEV. (m) | Pen. Resist. Blows/0.3m ● 50 mm Dia. Cone | | | | Monitoring Well Construction |
|---|-------------|--------|--------|------------|----------------|-----------|-----------|--|----|----|----|------------------------------|
| | | TYPE | NUMBER | RECOVERY % | N VALUE or RQD | | | ○ Water Content % | | | | |
| GROUND SURFACE | | | | | | | | 20 | 40 | 60 | 80 | |
| BEDROCK: Excellent quality, green shale interbedded with dolostone | | RC | 6 | 85 | 80 | 10 | 63.38 | | | | | |
| | | RC | 7 | 100 | 95 | 11 | 62.38 | | | | | |
| | | RC | 8 | 95 | 88 | 12 | 61.38 | | | | | |
| BEDROCK: Good to excellent quality, grey dolostone | | RC | 9 | 100 | 98 | 13 | 60.38 | | | | | |
| | | RC | 10 | 98 | 98 | 14 | 59.38 | | | | | |
| | | RC | 8 | 95 | 88 | 15 | 58.38 | | | | | |
| | | RC | 9 | 100 | 98 | 16 | 57.38 | | | | | |
| | | RC | 10 | 98 | 98 | 17 | 56.38 | | | | | |
| | | RC | 8 | 95 | 88 | 18 | 55.38 | | | | | |
| End of Borehole (GWL @ 5.75m - Nov. 20, 2019) | | | | | | | | | | | | |

20 40 60 80 100
Shear Strength (kPa)
▲ Undisturbed △ Remoulded

DATUM TBM - Top spindle of fire hydrant located at the northeast corner of subject site.
Geodetic elevation = 74.952m.

REMARKS

BORINGS BY CME 55 Power Auger

DATE 2019 November 11

FILE NO. PG4928

HOLE NO. BH 3

| SOIL DESCRIPTION | STRATA PLOT | SAMPLE | | | | DEPTH (m) | ELEV. (m) | Pen. Resist. Blows/0.3m ● 50 mm Dia. Cone | | | | Monitoring Well Construction | | |
|---|-------------|--------|--------|------------|----------------|-----------|-----------|--|----|----|----|------------------------------|--|--|
| | | TYPE | NUMBER | RECOVERY % | N VALUE or RQD | | | ○ Water Content % | | | | | | |
| | | | | | | | | 20 | 40 | 60 | 80 | | | |
| GROUND SURFACE | | | | | | 10 | 63.56 | | | | | | | |
| BEDROCK: Good quality, green shale interbedded with dolostone | | RC | 6 | 98 | 81 | 11 | 62.56 | | | | | | | |
| | | | | | | 12 | 61.56 | | | | | | | |
| BEDROCK: Fair to excellent quality, grey dolostone | | RC | 7 | 90 | 57 | 13 | 60.56 | | | | | | | |
| | | RC | 8 | 100 | 92 | 14 | 59.56 | | | | | | | |
| | | RC | 9 | 95 | 95 | 15 | 58.56 | | | | | | | |
| | | RC | 10 | 97 | 97 | 16 | 57.56 | | | | | | | |
| | | | | | | 17 | 56.56 | | | | | | | |
| | | | | | | 18 | 55.56 | | | | | | | |
| End of Borehole (GWL @ 5.94m - Nov. 20, 2019) | | | | | | | | | | | | | | |

20 40 60 80 100
Shear Strength (kPa)
▲ Undisturbed △ Remoulded

SYMBOLS AND TERMS

SOIL DESCRIPTION

Behavioural properties, such as structure and strength, take precedence over particle gradation in describing soils. Terminology describing soil structure are as follows:

| | | |
|------------------|---|--|
| Desiccated | - | having visible signs of weathering by oxidation of clay minerals, shrinkage cracks, etc. |
| Fissured | - | having cracks, and hence a blocky structure. |
| Varved | - | composed of regular alternating layers of silt and clay. |
| Stratified | - | composed of alternating layers of different soil types, e.g. silt and sand or silt and clay. |
| Well-Graded | - | Having wide range in grain sizes and substantial amounts of all intermediate particle sizes (see Grain Size Distribution). |
| Uniformly-Graded | - | Predominantly of one grain size (see Grain Size Distribution). |

The standard terminology to describe the relative strength of cohesionless soils is the compactness condition, usually inferred from the results of the Standard Penetration Test (SPT) 'N' value. The SPT N value is the number of blows of a 63.5 kg hammer, falling 760 mm, required to drive a 51 mm O.D. split spoon sampler 300 mm into the soil after an initial penetration of 150 mm. An SPT N value of "P" denotes that the split-spoon sampler was pushed 300 mm into the soil without the use of a falling hammer.

| Compactness Condition | 'N' Value | Relative Density % |
|-----------------------|-----------|--------------------|
| Very Loose | <4 | <15 |
| Loose | 4-10 | 15-35 |
| Compact | 10-30 | 35-65 |
| Dense | 30-50 | 65-85 |
| Very Dense | >50 | >85 |

The standard terminology to describe the strength of cohesive soils is the consistency, which is based on the undisturbed undrained shear strength as measured by the in situ or laboratory shear vane tests, unconfined compression tests, or occasionally by the Standard Penetration Test (SPT). Note that the typical correlations of undrained shear strength to SPT N value (tabulated below) tend to underestimate the consistency for sensitive silty clays, so Paterson reviews the applicable split spoon samples in the laboratory to provide a more representative consistency value based on tactile examination.

| Consistency | Undrained Shear Strength (kPa) | 'N' Value |
|-------------|--------------------------------|-----------|
| Very Soft | <12 | <2 |
| Soft | 12-25 | 2-4 |
| Firm | 25-50 | 4-8 |
| Stiff | 50-100 | 8-15 |
| Very Stiff | 100-200 | 15-30 |
| Hard | >200 | >30 |

SYMBOLS AND TERMS (continued)

SOIL DESCRIPTION (continued)

Cohesive soils can also be classified according to their “sensitivity”. The sensitivity, S_t , is the ratio between the undisturbed undrained shear strength and the remoulded undrained shear strength of the soil. The classes of sensitivity may be defined as follows:

| | |
|---------------------|----------------|
| Low Sensitivity: | $S_t < 2$ |
| Medium Sensitivity: | $2 < S_t < 4$ |
| Sensitive: | $4 < S_t < 8$ |
| Extra Sensitive: | $8 < S_t < 16$ |
| Quick Clay: | $S_t > 16$ |

ROCK DESCRIPTION

The structural description of the bedrock mass is based on the Rock Quality Designation (RQD).

The RQD classification is based on a modified core recovery percentage in which all pieces of sound core over 100 mm long are counted as recovery. The smaller pieces are considered to be a result of closely-spaced discontinuities (resulting from shearing, jointing, faulting, or weathering) in the rock mass and are not counted. RQD is ideally determined from NQ or larger size core. However, it can be used on smaller core sizes, such as BQ, if the bulk of the fractures caused by drilling stresses (called “mechanical breaks”) are easily distinguishable from the normal in situ fractures.

| RQD % | ROCK QUALITY |
|--------|--|
| 90-100 | Excellent, intact, very sound |
| 75-90 | Good, massive, moderately jointed or sound |
| 50-75 | Fair, blocky and seamy, fractured |
| 25-50 | Poor, shattered and very seamy or blocky, severely fractured |
| 0-25 | Very poor, crushed, very severely fractured |

SAMPLE TYPES

| | | |
|----|---|---|
| SS | - | Split spoon sample (obtained in conjunction with the performing of the Standard Penetration Test (SPT)) |
| TW | - | Thin wall tube or Shelby tube, generally recovered using a piston sampler |
| G | - | "Grab" sample from test pit or surface materials |
| AU | - | Auger sample or bulk sample |
| WS | - | Wash sample |
| RC | - | Rock core sample (Core bit size BQ, NQ, HQ, etc.). Rock core samples are obtained with the use of standard diamond drilling bits. |

SYMBOLS AND TERMS (continued)

PLASTICITY LIMITS AND GRAIN SIZE DISTRIBUTION

| | | |
|-----------------|---|---|
| WC% | - | Natural water content or water content of sample, % |
| LL | - | Liquid Limit, % (water content above which soil behaves as a liquid) |
| PL | - | Plastic Limit, % (water content above which soil behaves plastically) |
| PI | - | Plasticity Index, % (difference between LL and PL) |
| D _{xx} | - | Grain size at which xx% of the soil, by weight, is of finer grain sizes These grain size descriptions are not used below 0.075 mm grain size |
| D ₁₀ | - | Grain size at which 10% of the soil is finer (effective grain size) |
| D ₆₀ | - | Grain size at which 60% of the soil is finer |
| C _c | - | Concavity coefficient = $(D_{30})^2 / (D_{10} \times D_{60})$ |
| C _u | - | Uniformity coefficient = D_{60} / D_{10} |

C_c and C_u are used to assess the grading of sands and gravels:

Well-graded gravels have: $1 < C_c < 3$ and $C_u > 4$

Well-graded sands have: $1 < C_c < 3$ and $C_u > 6$

Sands and gravels not meeting the above requirements are poorly-graded or uniformly-graded.

C_c and C_u are not applicable for the description of soils with more than 10% silt and clay (more than 10% finer than 0.075 mm or the #200 sieve)

CONSOLIDATION TEST

| | | |
|-----------------|---|---|
| p' _o | - | Present effective overburden pressure at sample depth |
| p' _c | - | Preconsolidation pressure of (maximum past pressure on) sample |
| C _{cr} | - | Recompression index (in effect at pressures below p' _c) |
| C _c | - | Compression index (in effect at pressures above p' _c) |
| OC Ratio | | Overconsolidation ratio = p'_c / p'_o |
| Void Ratio | | Initial sample void ratio = volume of voids / volume of solids |
| W _o | - | Initial water content (at start of consolidation test) |

PERMEABILITY TEST

| | | |
|---|---|--|
| k | - | Coefficient of permeability or hydraulic conductivity is a measure of the ability of water to flow through the sample. The value of k is measured at a specified unit weight for (remoulded) cohesionless soil samples, because its value will vary with the unit weight or density of the sample during the test. |
|---|---|--|

SYMBOLS AND TERMS (continued)


STRATA PLOT



Topsoil




Asphalt

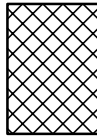


Fill



Peat

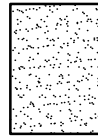

Sand

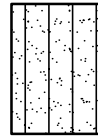

Silty Sand




Silt



Sandy Silt



Clay

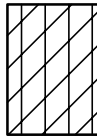


Silty Clay



Clayey Silty Sand



Glacial Till

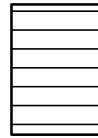

Shale



Bedrock

MONITORING WELL AND PIEZOMETER CONSTRUCTION

MONITORING WELL CONSTRUCTION



PIEZOMETER CONSTRUCTION



Certificate of Analysis
 Client: Paterson Group Consulting Engineers
 Client PO: 29072

Report Date: 14-Nov-2019

Order Date: 12-Nov-2019

Project Description: PG4928

| | | | | |
|---------------------|-----------------|---|---|---|
| Client ID: | BH1-SS3, 5'-7' | - | - | - |
| Sample Date: | 11-Nov-19 11:00 | - | - | - |
| Sample ID: | 1946129-01 | - | - | - |
| MDL/Units | Soil | - | - | - |

Physical Characteristics

| | | | | | |
|----------|--------------|------|---|---|---|
| % Solids | 0.1 % by Wt. | 80.4 | - | - | - |
|----------|--------------|------|---|---|---|

General Inorganics

| | | | | | |
|-------------|---------------|------|---|---|---|
| pH | 0.05 pH Units | 7.34 | - | - | - |
| Resistivity | 0.10 Ohm.m | 15.8 | - | - | - |

Anions

| | | | | | |
|----------|------------|-----|---|---|---|
| Chloride | 5 ug/g dry | 333 | - | - | - |
| Sulphate | 5 ug/g dry | 21 | - | - | - |

APPENDIX 2

FIGURE 1 - KEY PLAN

DRAWING PG4928-1 - TEST HOLE LOCATION PLAN



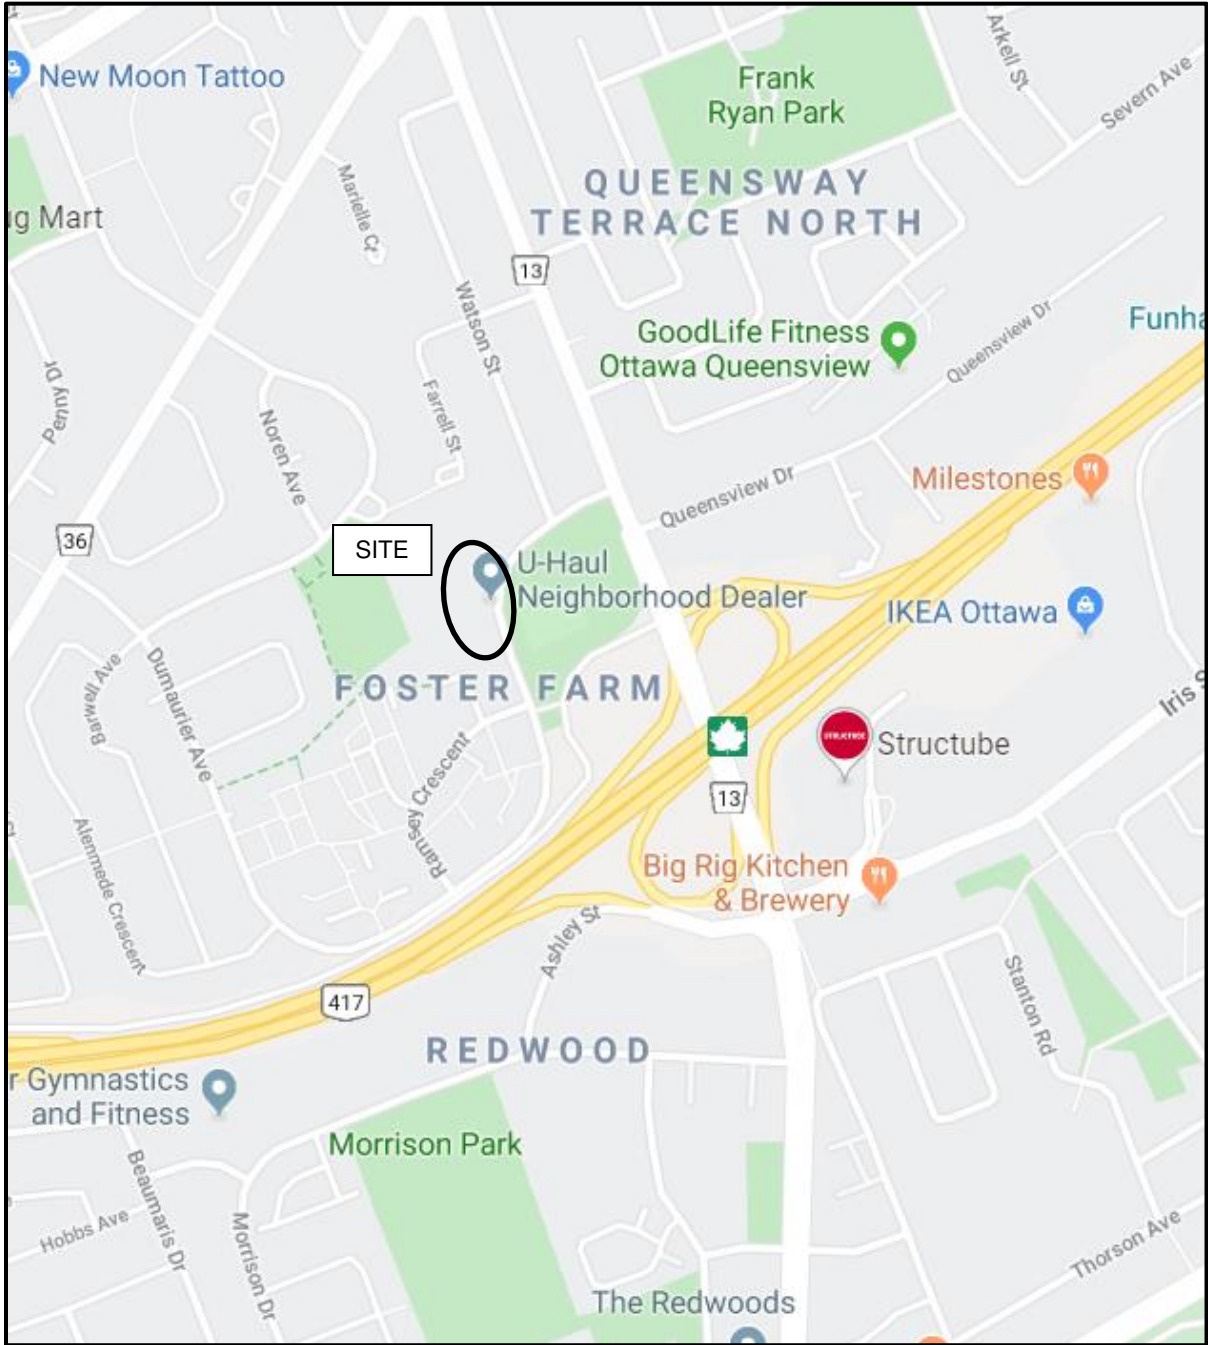



FIGURE 1

KEY PLAN

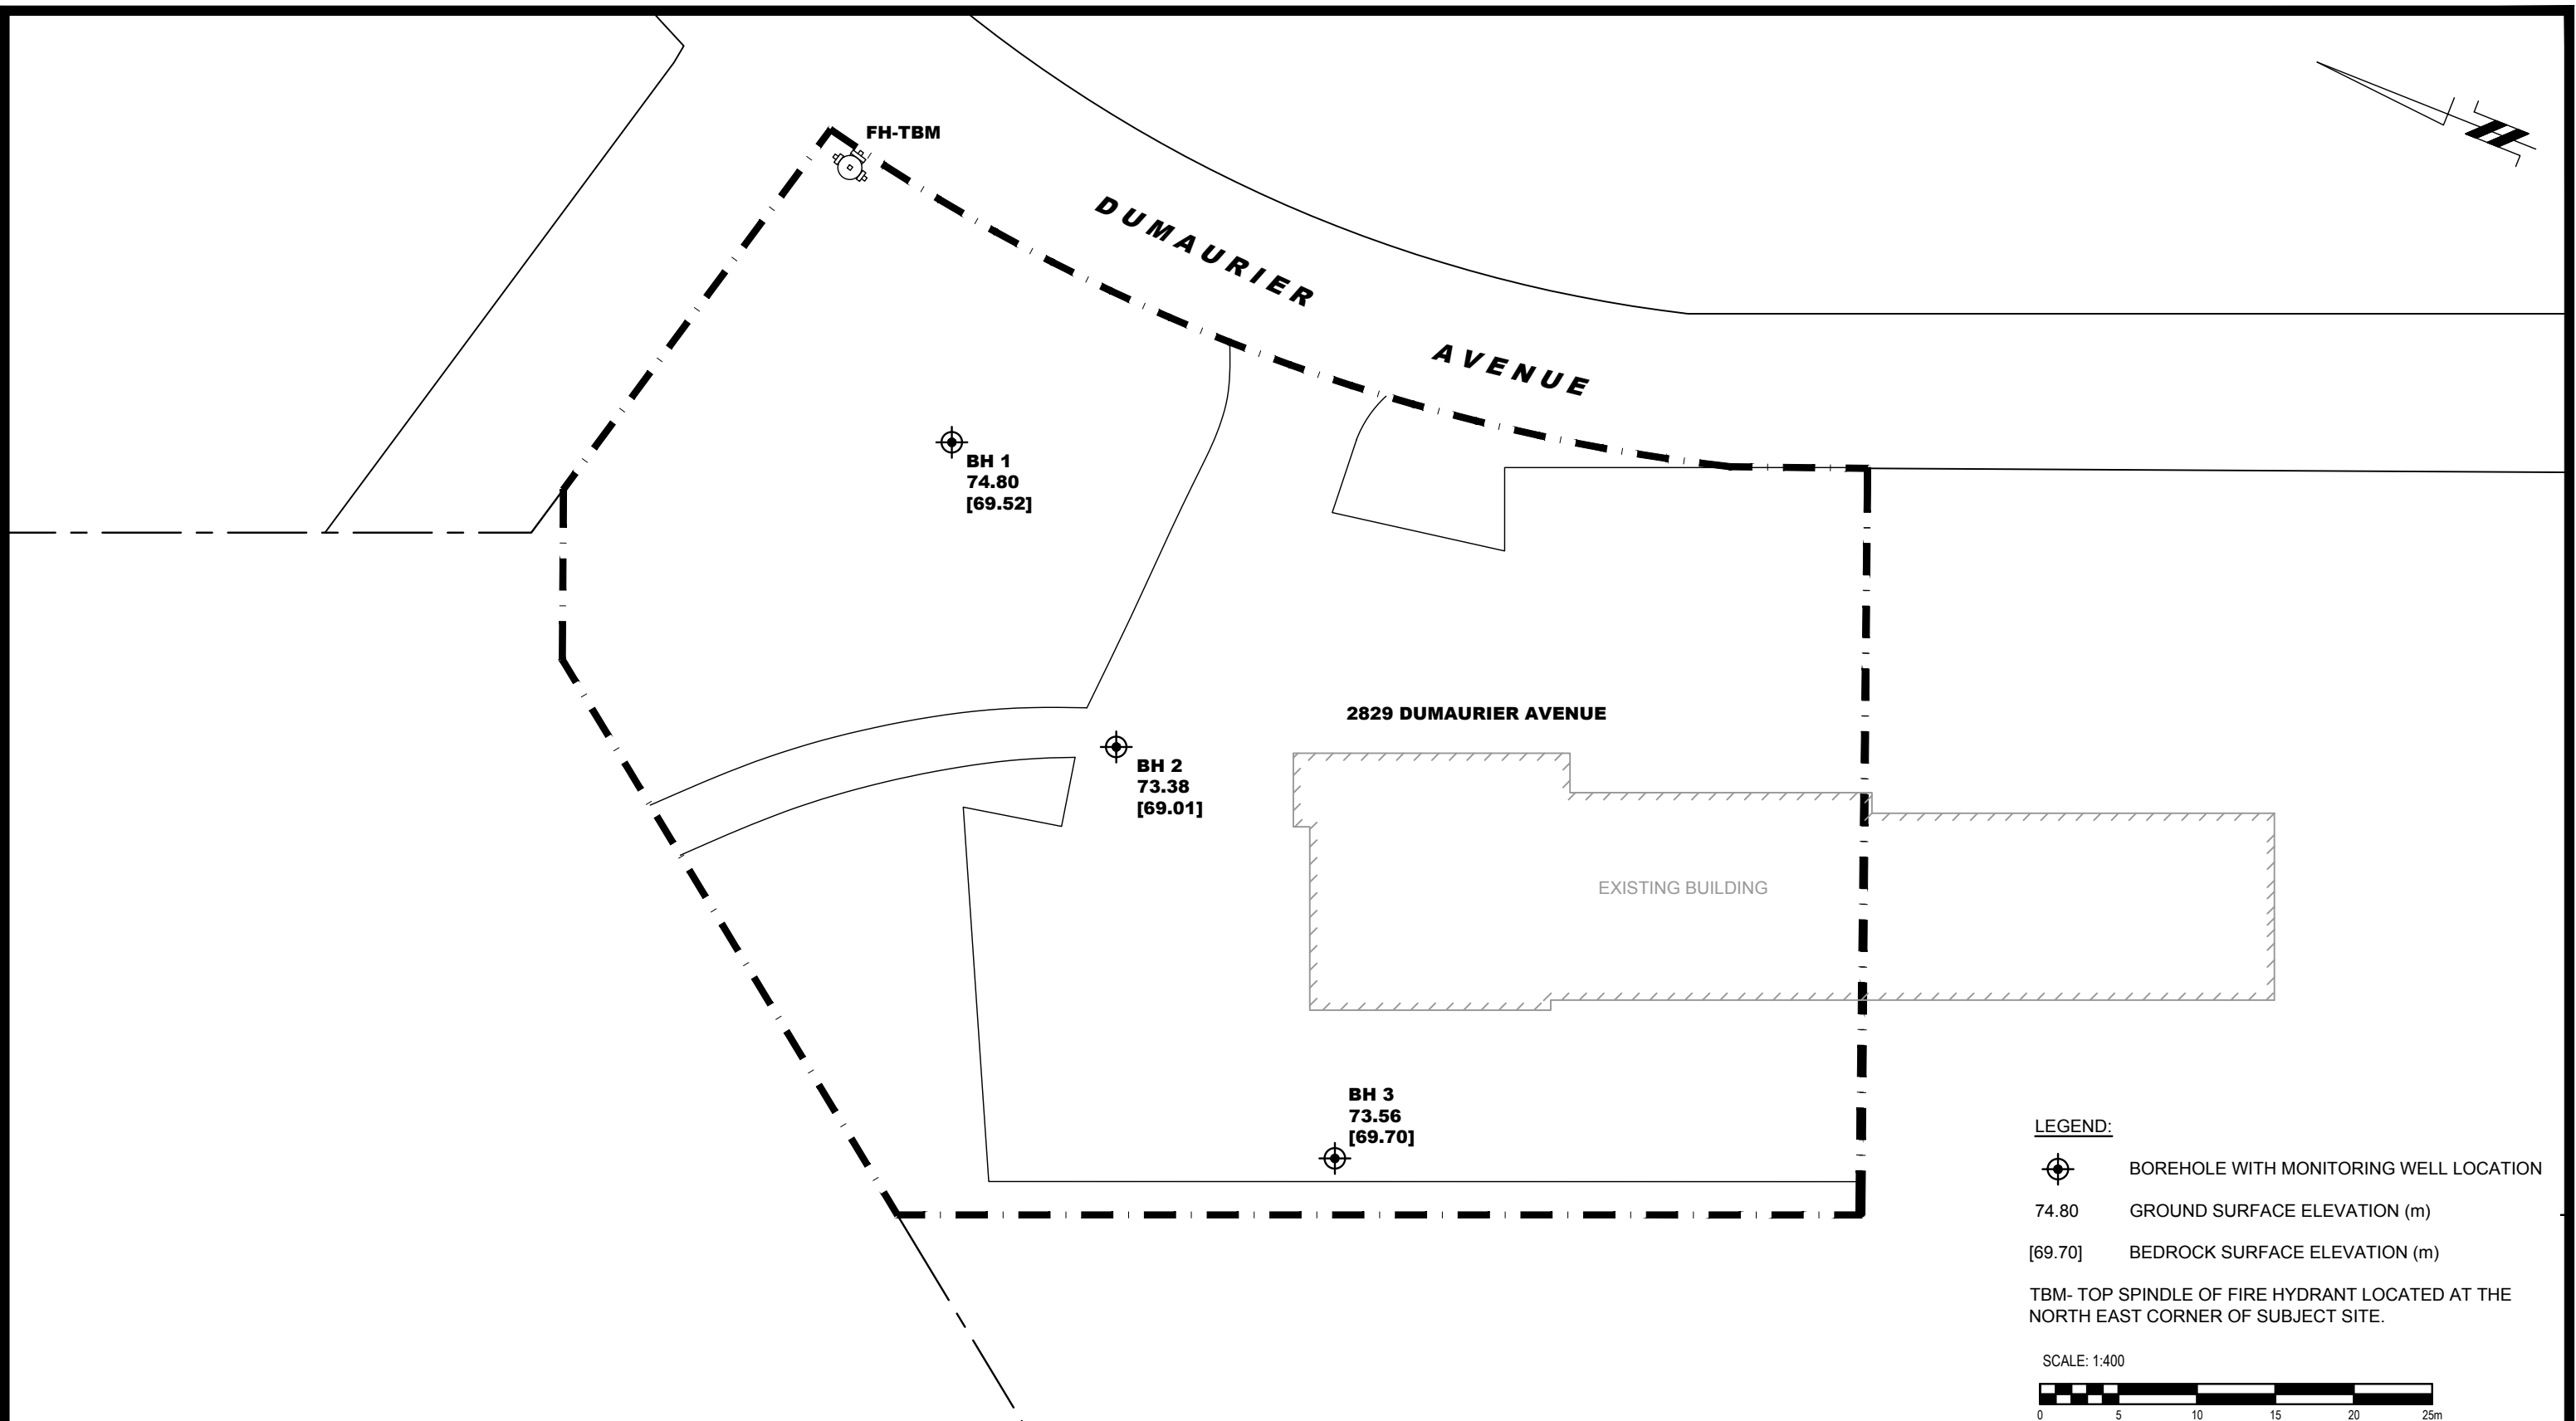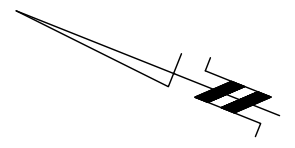


LEGEND:

 BOREHOLE WITH MONITORING WELL LOCATION

74.80 GROUND SURFACE ELEVATION (m)

[69.70] BEDROCK SURFACE ELEVATION (m)

TBM- TOP SPINDLE OF FIRE HYDRANT LOCATED AT THE NORTH EAST CORNER OF SUBJECT SITE.



patersongroup
consulting engineers

154 Colonnade Road South
Ottawa, Ontario K2E 7J5
Tel: (613) 226-7381 Fax: (613) 226-6344

| NO. | REVISIONS | DATE | INITIAL |
|-----|-----------|------|---------|
| | | | |
| | | | |
| | | | |

3223701 CANADA INC.
GEOTECHNICAL INVESTIGATION
PROPOSED HIGH-RISE BUILDING-2829 DUMAUER AVENUE
 OTTAWA, ONTARIO
 Title: **TEST HOLE LOCATION PLAN**

| | | | |
|--------------|-------|---------------|-----------------|
| Scale: | 1:400 | Date: | 11/2019 |
| Drawn by: | YA | Report No.: | PG4928-1 |
| Checked by: | JV | Dwg. No.: | PG4928-1 |
| Approved by: | DJG | Revision No.: | |

p:\autocad\drawings\geotechnical\pg4928\pg4928-1.rvt.dwg

D.2 PHASE I ENVIRONMENTAL SITE ASSESSMENT (GHD 2018)





Phase I Environmental Site Assessment

2831, 2833, 2835, 2841 and
2865 DiMaurier Avenue
Ottawa, Ontario

3223701 Canada Inc.

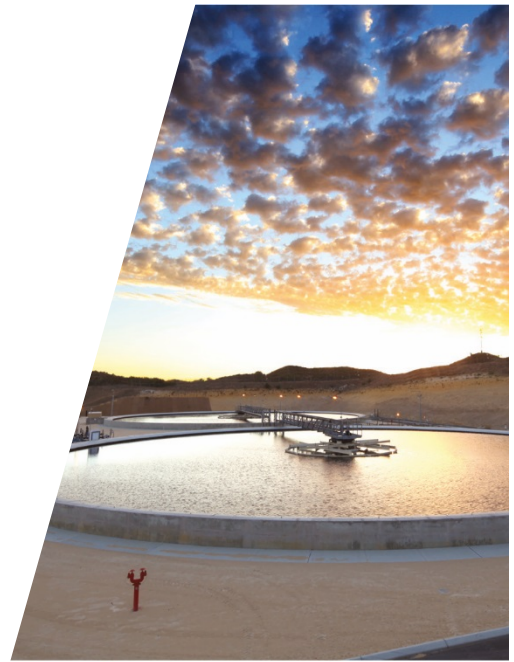




Table of Contents

| | | |
|-------|---|----|
| 1. | Introduction..... | 1 |
| 2. | Site Description | 2 |
| 2.1 | Building and Property..... | 2 |
| 2.2 | Site Operations | 3 |
| 2.3 | Environmental Setting..... | 3 |
| 2.3.1 | Geological Setting..... | 3 |
| 2.3.2 | Neighbouring Properties..... | 3 |
| 3. | Historical Records Review | 4 |
| 3.1 | Previous Reports | 4 |
| 3.2 | Property Title Search | 4 |
| 3.3 | Fire Insurance Plans..... | 5 |
| 3.4 | City Directories..... | 5 |
| 3.5 | Aerial Photographs | 5 |
| 3.6 | Ecolog ERIS Environmental Database..... | 7 |
| 3.7 | Environmental Databases..... | 8 |
| 3.8 | Regulatory Agency Correspondence..... | 9 |
| 4. | Site Visit | 10 |
| 4.1 | Utility Services | 10 |
| 4.2 | Underground Storage Tanks (USTs)..... | 10 |
| 4.3 | Aboveground Storage Tanks (ASTs)..... | 11 |
| 4.4 | Chemical Use and Storage..... | 11 |
| 4.5 | Chemical Spills/Releases | 11 |
| 4.6 | Solid Waste/Recyclables | 11 |
| 4.7 | Hazardous Material..... | 11 |
| 4.8 | Wastewater | 11 |
| 4.8.1 | Floor/Trench Drains, Pits and Sumps..... | 11 |
| 4.9 | Stormwater..... | 12 |
| 4.10 | Asbestos-Containing Materials (ACM)..... | 12 |
| 4.11 | Polychlorinated Biphenyls (PCBs)..... | 12 |
| 4.12 | Chlorofluorocarbons (CFCs)..... | 12 |
| 4.13 | Urea Formaldehyde Foam Insulation (UFFI)..... | 13 |
| 4.14 | Lead-Based Paint | 13 |
| 4.15 | Air Emissions | 13 |
| 4.16 | Ionizing Radiation | 13 |



| | |
|---|----|
| 4.17 Radon..... | 13 |
| 4.18 Interviews..... | 13 |
| 5. Conclusion..... | 14 |
| 6. Limitation of the Investigation..... | 14 |

Figure Index

| | |
|----------|-------------------|
| Figure 1 | Site Location Map |
| Figure 2 | Site Plan |

Table Index

| | | |
|-----------|---|---|
| Table 3.1 | Summary of Chain of Title Records | 5 |
| Table 3.2 | Aerial Photographs | 6 |

Appendix Index

| | |
|------------|---|
| Appendix A | Title Search |
| Appendix B | Ecolog ERIS Report |
| Appendix C | TSSA Correspondence |
| Appendix D | Ministry of Environment Freedom of Information Correspondence |
| Appendix E | City of Ottawa HLUI Correspondence |



1. Introduction

GHD was retained by 3223701 Canada Inc. (Client), represented by Mr. Jean-Luc-Rivard, to conduct a Phase I Environmental Site Assessment (ESA) of a commercial property located at Civic Nos. 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue, in Ottawa, Ontario (Site or Property). The building on Site consists of a single storey commercial plaza building. The Phase I ESA was conducted as detailed in our email quote dated August 8, 2018.

The purpose of the Phase I ESA was to identify, through a non-intrusive investigation, significant actual or potential environmental impairment associated with the Site, the on-Site building, and the immediate vicinity of the Site. GHD understands that the Phase I ESA has been conducted for the Client for the purpose of due diligence purposes as part of a potential purchase of the Property.

The Phase I ESA was conducted in general accordance with the Canadian Standards Association CSA Z768-01 publication for conducting Environmental Site Assessments. CSA Z768-01 is the accepted Canadian standard for Environmental Assessments. The CSA Z768-01 ESA process was developed using Federal and Provincial environmental regulations, policies and guidelines. This Phase I ESA included a Site visit, a review of Site history using publicly available and readily accessible documents including historical Property title records, documentation review, and inquiries with regulatory agencies. The following tasks were conducted by GHD during this assessment:

- A review of publicly available historical documents, city directories, aerial photographs, and fire insurance plans of the Site and surrounding area.
- Submission of inquiries to applicable regulatory agencies regarding environmental infractions or notices registered against the Property, owner, or occupant.
- Interviews with person(s) knowledgeable about the Site and the Site operations.
- A review of past and current Site usage and adjacent property occupancy.
- A review of environmental databases.
- An inspection of the Property, equipment, operations, utility services, and associated records available for the Site.
- Inquiries of present and historical activities of the current and former occupants or owners that may have caused or are causing potential environmental impact to the Site.
- A review of available aboveground storage tank (AST) and underground storage tank (UST) records.
- A review of chemical use, storage and handling practices, and spill/release incidents.
- A review of waste handling, storage, and disposal practices as they may impact the environment.
- A review of wastewater discharges.
- Identification of point-source air emissions.
- A review of equipment that potentially contain polychlorinated biphenyls (PCBs) and chlorofluorocarbons (CFCs).



- Visual identification of potential asbestos-containing materials (ACM), urea formaldehyde foam insulation (UFFI), and lead-based paint.
- A review of available third party environmental reports, documents, and correspondence provided by Site personnel or the Client.

This Phase I ESA was conducted for due diligence purposes and therefore GHD has followed CSA documents as described earlier. If this Phase I ESA is intended to be utilised in support of the filing of a Record of Site Condition under Ontario Regulation 153/04 or for submission to the City of Ottawa for Site Plan submission, additional work would be required in order to produce a Phase One ESA report per Ontario Regulation 153/04 requirements.

As part of the Phase I ESA, a Site visit was conducted on August 10, 2018, by Mr. Luke Lopers, P. Eng., a technical representative of GHD. At the time of the Site visit, GHD conducted an interview with Mr. Daniel Blais, Property Manager to assist in documenting the Site conditions and operating history. Mr. Blais reported that he has been familiar with the Site for at least 20 years.

The following report summarises the information gathered by GHD during the Phase I ESA in order to identify significant actual or potential environmental liabilities associated with the Site and the on-Site buildings. GHD relied on information received from all parties as accurate unless contradicted by field observations or written documentation.

This report has been prepared for the use of 3223701 Canada Inc., and may not be relied upon by any other party without the written concurrence of GHD.

2. Site Description

2.1 Building and Property

The Site is located in the Foster Farm borough within the City of Ottawa, Ontario. The Property is located on the west side of DuMaurier Avenue, within the neighbourhood that is bordered by DuMaurier Avenue to the east and west, Ramsey Crescent to the south, and Richmond Road to the north. The Civic Nos. associated with the Property are 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue in Ottawa, Ontario (Site or Property). The Site is legally described as Part of Lot 20, Concession 2, being Parts 4 to 7 and Parts 9 to 17 on Registered Plan 4R16235, Nepean, City of Ottawa. The property identification numbers associated with the Site are 03944-0827, 03944-0826, and 03944-0238.

The coordinates of the approximate center of the Site are 45° 21' 01" N by 75° 47' 37" W (UTM Coordinates 437840 m E, 5022180 m N). A Site Location Map (Figure 1) and a Site Plan (Figure 2) are provided following this report. The municipal zoning for the Site is currently General Mixed Use Zone (residential, commercial, and/or institutional).

The Site is rectangular in shape, covers an area of approximately 0.8 hectares (2 acres), and is located in an area that is developed for mixed use (residential, commercial, and/or institutional). The Site is occupied by a single storey slab-on-grade commercial plaza building. The Site building covers approximately 30 percent of the Site. The remainder of the Site consists of asphalt paved parking, access laneways and landscaped sections along the perimeter. Vehicular access to the Site



is from DuMaurier Avenue to the east and Ramsey Crescent to the south. The topography in the Phase I Study Area is undulating with a general slope downward to the south and southwest. The property to the northwest of the Site is elevated approximately 3 to 4 m with respect to the Site, while the property to the west of the Site is elevated approximately 0.6 m with respect to the Site.

General exterior building construction materials consist of brick veneer finishes, metal and wood siding and metal framed glass windows and doors consisting of metal framed glazing units. Interior construction materials consist of drywall board walls, drywall board, suspended tile ceilings, mixture of vinyl tile, carpet, ceramic tile, and poured concrete floor finishes. The roof which was accessed at the time of the Site visit, is a flat tar and gravel roof.

2.2 Site Operations

The Site building consisted of an occupied single storey slab-on-grade commercial plaza building at the time of the Site visit. Tenants of the Site building included: Pinecrest Deli (2831), Halal Meat and Grocery (2833), Da Al Sahaba Association (2835), Barney's Pizza (2841), and Giant Tiger (2865). There were no identified Potentially Contaminating Activities (PCAs) observed during the site walkover. No visual evidence of areas of potential environmental concern (APECs) with respect to current Site operations was noted by GHD at the time of the Site visit.

2.3 Environmental Setting

The Site is located in an area that is developed for mixed use (residential, commercial, and/or institutional). The Site is generally flat and at grade with respect to DuMaurier Avenue and Ramsey Crescent and is lower with respect to the surrounding neighbouring properties to the north and west. The topography in the area of the Site slopes slightly down to the south and southwest towards the Queensway. The nearest significant surface water body is the Ottawa River, located approximately 1.3 km northwest of the Property. There are no natural surface water bodies or open drainage ditches currently located on the Site.

2.3.1 Geological Setting

Knowledge of the geological setting is based on published bedrock, soil and groundwater maps for the general area, as well as previous GHD studies conducted in the area. According to the 1987 Geological Survey of Canada, Surficial Geology Map for Ottawa (Map No.: 1506A), the natural soil consists of "Abandoned river channel deposits of silt and silty clay; commonly including lenses of sand and generally underlain at variable depth by stratified, buff, medium grained sand".

Based on regional topography and the location of the closest significant water body, the interpreted local groundwater flow direction in the shallow groundwater aquifer unit is toward the southwest, while it is suspected that regional groundwater flow is toward the north-northwest towards the Ottawa River.

2.3.2 Neighbouring Properties

At the time of Site inspection, the properties adjacent to the Site were visually inspected by GHD for evidence of potentially contaminating activities (PCAs) that may result in APECs for the Site. The inspection was conducted from public rights-of-way without physically accessing adjoining



properties. At the time of Site inspection the area within 100 m of the Site is occupied by the following facilities or features:

- Northeast | Institutional property (Church) located at Civic No. 2821 DuMaurier Avenue.
- Northwest | Institutional property (community center and school) located at Civic No. 1085 Grenon Avenue.
- East | DuMaurier Avenue followed by parkland (baseball fields) located at 2850 DuMaurier Avenue.
- South | Ramsey Crescent followed by residential dwellings at Civic No. 2891 DuMaurier Avenue.
- West | Residential apartment and dwellings at Civic No. 2891 DuMaurier Avenue.

The Site and surrounding properties are located in a predominantly residential, institutional and commercial sector of the City of Ottawa. It should be noted that the parkland to the east of DuMaurier Avenue is a known closed landfill Site, which is a PCA and is considered to represent an APEC for the Site. No other PCAs were identified in the Phase I Study Area at the time of the Site inspection.

3. Historical Records Review

Historical land use of the Site was investigated by GHD through the review of historical records including, Property title documents, city directories, available fire insurance plans, aerial photographs, and environmental databases. The following sections present the findings of the historical records reviewed.

3.1 Previous Reports

The Client did not provide any previous reports (environmental or geotechnical) for review. No previous environmental studies for the Property were discovered as a result of our assessment.

It should be noted that a historical Ecolog ERIS search was completed for the Property (2865 DuMaurier Avenue) in August 2013 by Pinchin Ltd. Additionally, two monitoring wells were observed at the Site during the Site visit. These observations suggest that previous environmental reports have been completed for the Site.

3.2 Property Title Search

A request for current ownership title search was submitted to Ecolog ERIS on behalf of GHD. The Phase I ESA Property is legally described as Part of Lot 20, Concession 2, being Parts 4 to 7 and Parts 9 to 17 on Registered Plan 4R16235, Nepean, City of Ottawa, with associated property identification numbers 03944-0827, 03944-0826, and 03944-0238. The results of the Title search with respect to current ownership of the Site are summarized in Table 3.1 below. A summary of the results of the search are included in Appendix A.



Table 3.1 Summary of Chain of Title Records

| Year | Property Ownership |
|------------------------|----------------------------|
| 2831, 2833, 2835, 2841 | DuMaurier Avenue |
| January 8, 2001 | 1248816 Ontario Inc. |
| 2865 | DuMaurier Avenue |
| January 8, 2001 | Giant Tiger Stores Limited |

No PCAs or APECs were identified for the Site with respect to the current property ownership.

3.3 Fire Insurance Plans

Fire insurance plans (FIP) assist in the identification of historical land use and commonly indicate building layouts, detached structures, Site improvements, facility operations, names of tenants, the existence and location of boiler rooms, aboveground and underground storage tanks and adjoining property uses. GHD conducted a search for publicly available historical fire insurance plans for the Site and adjacent lands from the National Archives Library in Ottawa, Ontario.

No FIPs were available for the Site or neighbouring properties. No other fire insurance plans or reports were obtained by GHD or were provided by the Client for review.

3.4 City Directories

City directories list occupant(s) at a site address for a specific year, and infer land use with respect to occupant history. GHD consulted National Archives Canada located in Ottawa, Ontario, for any publicly available historical city directories for intermittent years between 1940 and 2000.

According to the information obtained from the reviewed City Directories, DuMaurier Avenue was first listed in 1970, however, the civic address of the Site was not listed.

The first description of the Site as Civic Nos.: 2835, 2845 and 2851 DuMaurier Avenue were in 1980, when the Site was listed as being occupied by DuMaurier Shopping Plaza, Livio's Pizza, and Le Quickie Convenience Store. The Site has been listed for commercial (retail) purposes since the 1980s.

The surrounding properties are listed as both institutional and residential since at least 1970. In general, no current or historical service stations, automotive garages or dry cleaners are listed within a 100 m radius of the Site. No operations, which are considered PCAs, were identified within 100 m of the Site in the City directories.

3.5 Aerial Photographs

Aerial photographs are reviewed to generally document development of the Site and properties in close vicinity of the Site. They identify potential waste disposal areas, storage activities, landfilling, and other PCAs on Site and in the immediate vicinity of the Site. Typically, the scale of aerial photographs only permits the identification of large features on the landscape. Aerial photographs of the Site and surrounding area were obtained for intermittent years between 1956 and 2011 from the National Air Photo Library (NAPL) and on the City of Ottawa Mapping System



(<http://maps.ottawa.ca/geottawa/>). Comments for each photograph are presented in the following Table 3.2.

Table 3.2 Aerial Photographs

| Year | Site Description | Neighbourhood Description |
|------|--|--|
| 1956 | The Site is undeveloped, is partially tree covered and may have been used for agricultural purposes on the southern portion of the Site. What appears to be a creek or drainage feature is present on the north portion of the Site. | Neighbouring properties are undeveloped and generally consist of agricultural land or tree covered areas. A railway line is present approximately 180 m south of the Site. Pinecrest Road has been constructed further east of the Site. Some residential development is apparent further to the north of the Site. |
| 1965 | Increased tree cover is apparent on the north portion of the Site. An additional drainage feature (ditch) is present on the south portion of the Site and is present in an east-west orientation. No developed use of the Site was observed. | The property to the east of the Site appears to have undergone some soil disturbance, suspected to be associated with landfilling activities. The railway line to the south of the Site has been removed and replaced with Highway 417 (Queensway). The institutional property to the northeast of the Site appears to be under construction. Residential development is apparent further northeast of the Site. |
| 1976 | The Site has been cleared of trees and appears to be grass covered. Soil disturbance is apparent on the north portion of the Site. Previously observed drainage features at the Site are no longer present. What appears to be a walking path is present across the approximate centre of the Site in a northeast-southwest orientation. | DuMaurier Avenue has been constructed immediately east of the Site, while Ramsey Crescent has been constructed immediately to the south. The neighbouring properties to the east and south of the Site have been developed with residential apartments and townhomes in the present orientations. Some indications of soil disturbance remain on the property to the east of the Site. What appears to be an access path or road is present to the north of the Site. The institutional property to the northwest of the Site has been partially developed with the present day school building. |
| 1991 | The Site has been developed with a commercial building, similar to the present day orientation. The south portion of the existing commercial plaza appears to be connected to the north portion of the building by a narrow walkway. | Neighbouring properties appear to be developed to their present configurations. The property to the east of DuMaurier Avenue is occupied by baseball fields. The institutional property to the northwest of the Site has been fully developed with a community centre and previously existing school building. |
| 1999 | Essentially unchanged from 1991. | Essentially unchanged from 1991. |
| 2005 | The Site building is present in the current configuration. An addition to the central portion of the building has been constructed. | Essentially unchanged from 1999. |
| 2011 | Essentially unchanged from 2005. | Essentially unchanged from 2005. |

The Site appears to have been undeveloped until at least 1976. The Site was fully developed as a commercial plaza since at least 1991. What appear to be two drainage features were present on the



Site and were filled in prior to Site development. Based on the above information, the fill material used to grade the Site, which is of unknown environmental quality is considered a PCA and APEC for the Site.

In addition, the property to the east of DuMaurier Avenue appears to have undergone soil disturbance from at least 1965 to 1976. This property is a known closed landfill site (as identified in Sections 3.6 and 3.7 of this report). The presence of this closed landfill site (PCA) in close proximity to the subject Site represents an APEC for the Site.

No additional PCAs resulting in APECs for the Site were identified during the review of the aerial photographs.

3.6 Ecolog ERIS Environmental Database

GHD contracted Ecolog ERIS to conduct a search of available Federal, Provincial and private environmental databases, within a 250-m radius of the Site. The database searches were completed to assist in the identification of environmental conditions at the Site and on immediate and extended neighbouring properties. A total of 69 Provincial, Federal, and private environmental databases were searched by Ecolog ERIS in the August 8, 2018 report.

This report was prepared in general accordance with the Canadian Standards Association CSA Z768-01 publication for conducting Environmental Site Assessments. The CSA Z768-01 considers sites located within 100 m radius of the subject Site as the most influential for APEC. As such only the properties that could have potential adverse environmental concerns for the subject Site are summarized below while all findings are presented in the complete report provided in Appendix B.

The Site was listed in the ERIS Historical Searches and Pesticide Register databases. The following records were noted for the Site:

- A historical ERIS search was completed for the Site by Pinchin Ltd. in August of 2013.
- Giant Tiger Store #22 was listed in the Pesticide Register as a vendor. Given that the records pertain to a Site occupant who is listed as a vendor, the application of pesticides at the Site is not suspected.

Of the aforementioned On-Site records, neither are considered to be PCAs or were considered APECs for the Site.

Immediate neighbouring properties within a 100-m radius of the Site were listed in the Waste Disposal Sites – MOE 1991 Historical Approval Inventory, Anderson's Waste Disposal Sites, Environmental Compliance Approval, Certificates of Approval, Ontario Spills, Ontario Regulation 347 Waste Generators Summary, ERIS Historical Searches, and TSSA Historic Incidents databases.

One property identified in the historic records, a former landfill site, located approximately 20 m east of the Site is a PCA and is considered to represent an APEC for the Site. Based on the records, this property operated as a municipal landfill, however, the period of operation of this landfill Site is uncertain.



3.7 Environmental Databases

GHD reviewed several published environmental summary documents and databases as part of the Site history review to determine if past use of the Site or land in close vicinity of the Site may have resulted in environmental impairment of the Site. The following documents were reviewed with the findings presented as follows:

1. Inventory of Coal Gasification Plant Waste Sites in Ontario, April 1987:

The report titled Inventory of Coal Gasification Plant Waste Sites in Ontario, April 1987 provides an inventory and preliminary assessment of the potential environmental impacts of 41 known manufactured gas plant waste sites in the Province of Ontario as of April 1987. Industrial facilities that utilized coal carbonization for manufacturing of gas, coke, ammonia and other products were addressed in this study. The Site was not listed in the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars. There were no former Sites Producing or Using Coal Tar and Related Tars identified within 2 km of the Site.

2. MOE Waste Disposal Site Inventory, June 1991:

The MOE Waste Disposal Site Inventory June 1991 contains a list, prepared by the MOE, of all known active and closed waste disposal sites in the Province of Ontario as of October 31, 1990. This document is a "working document", subject to continual revisions and updating. The document contains an active site inventory, a closed site inventory, a closed municipal coal gasification plant site inventory, and an inventory of industrial sites producing and using coal tars and related tars in Ontario. No active waste disposal sites were identified within 250 m of the Site; however, a closed landfill was identified to the east of the Site. Landfill No. X1006 is classified as A5 – Potential Human Impact – Urban Municipal/Domestic Waste. The MOE Waste Disposal Site Inventory June 1991 was confirmed by the results of the subcontracted Ecolog Environmental ERIS search; a copy of the Ecolog ERIS Database Summary is included in Appendix B. Further information is provided in the below Mapping and Assessment of Former Industrial Sites section.

3. Ontario PCB Inventory:

The Ontario Inventory of PCB Storage Sites (1987 – October 2004), as noted in the subcontracted Ecolog ERIS Database Summary report dated May 26, 2011 and January 25, 2018, contains information on PCB Storage Sites in the Province of Ontario, which is maintained by the Ontario Ministry of the Environment, Waste Management Branch. The database is an inventory of known private and provincially-operated PCB storage sites as of 1987. The document does not include Federal PCB storage sites, which are under Environment Canada jurisdiction. The Site was not listed in the Ontario Inventory of PCB Storage Sites. No properties within 250 m of the Site were identified in the Ontario Inventory of PCB Storage Sites. A copy of the Ecolog ERIS Database Summary is included in Appendix B.

4. Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario, November 1988:

The report titled Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario, November 1988 provides the results of an inventory and preliminary assessment of



potential environmental impacts of 44 known industrial sites in Ontario which produced or used coal tar and related tars, as of November 1988. This report was prepared to continue the inventory and assessment process started by the Inventory of Coal Gasification Plant Waste Sites in Ontario, April 1987. The Site was not listed in the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars. There were no former Sites Producing or Using Coal Tar and Related Tars identified within 2 km of the Site.

5. Mapping and Assessment of Former Industrial Sites, City of Ottawa:

The report titled Mapping and Assessment of Former Industrial Sites, City of Ottawa, July 1988, provides the results of an inventory and preliminary assessment of 177 known former industrial sites in the City of Ottawa, as of July 1988. The Site is not listed in the Mapping and Assessment of Former Industrial Sites report, and no former industrial sites were identified within 250 m of the Site. However, a former landfill (L-1: Pinecrest Road – DuMaurier Avenue and Watson Street) was identified at the Site and on the adjacent property to the east. As noted in the MOE Waste Disposal Inventory (June 1991) section above, a closed landfill was identified to the east of the Site and contained urban municipal/domestic wastes.

GHD also reviewed the report titled Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa, October 2004, prepared by Golder Associates, which indicated the neighbouring property to the east of DuMaurier Avenue as part of the Pinecrest and DuMaurier closed landfill site. The following information was reviewed as part of this Phase One ESA:

- Active Time Period | 1953 to 1957.
- Total Approximate Area | 4 hectares, bounded by Pinecrest Road, DuMaurier Avenue, Hwy 417 Interchange, and line north of St. Remi Church and through 1000 and 999 Watson Road and 2793 DuMaurier Avenue.
- Waste Thickness | Estimated depth of refuse is 3 to 5 m, locally at the southern end; fill layer is at least 6 m in thickness but thins towards the north end.
- Type of Waste | mainly domestic some commercial and industrial waste.

Based on the above information, the closed landfill is considered a PCA and is considered to represent an APEC for the Site.

6. MOECC Notices, Instruments and Records of Site Condition:

The Ministry of the Environment and Climate Change (MOECC) Brownfields Environmental Site Registry (ESR) was consulted for historical certificates and instrument compliance records and records of site condition (RSCs). The Site was not listed in the Brownfields ESR. No properties within 100 m of the Site were listed in the Brownfields ESR.

3.8 Regulatory Agency Correspondence

GHD contacted the Ontario Ministry of the Environment, Conservation and Parks (MECP) and the City of Ottawa to request any information they may have in their files concerning the Site. GHD also contacted the Technical Standards and Safety Authority (TSSA) to request a search of their databases for the current or historical presence of any ASTs or USTs at the Site.



Summary of TSSA Correspondence

An email response was received from the TSSA on August 10, 2018, indicating that there were no records were found in the TSSA database indicating the presence of underground storage tanks, spills, incidents or infractions at the Property or at immediately adjacent properties. A copy of the TSSA response is included in Appendix C.

Summary of MOECC Freedom of Information Correspondence

A request was submitted to the Ontario Ministry of the Environment, Conservation and Parks (MECP) under the Freedom of Information (FOI) and Protection of Privacy Act relating to the Site. The requested information included environmental approvals, certificates and instruments maintained by the MECP for the Site. The MECP response was not received in the timeframe allowed for this mandate. A copy of the MECP request is included in Appendix D. A copy of the MECP response and an addendum to this report will be provided should the documentation alter the findings and conclusions of this assessment.

Summary of City of Ottawa HLUI Correspondence

A request was made to the City of Ottawa to review their Historic Land Use Inventory (HLUI). The HLUI response was not received in the timeframe allowed for this mandate. A copy of the HLUI request is included in Appendix E. A copy of the HLUI response and an addendum to this report will be provided should the documentation alter the findings and conclusions of this assessment. Appendix E of this report.

4. Site Visit

The following Site conditions were observed by GHD during the August 10, 2018 Site visit and are considered pertinent to the current Phase I ESA.

4.1 Utility Services

Electricity is supplied to the Site by Hydro-Ottawa. Natural gas is supplied by Enbridge Inc.

The Site building is heated by natural gas fired heating ventilating and air conditioning (HVAC) units, located on the roof of the building. Domestic hot water for the building is heated by natural gas; the hot water tanks are located in the individual commercial units.

Potable water and sanitary sewer services are supplied to the Site by the municipal system. No water supply wells or septic systems were reported to exist on Site and no evidence of on-Site water supply wells or septic systems were noted during the Site visit.

4.2 Underground Storage Tanks (USTs)

No visual evidence (such as filler or vent pipes), suggesting the presence of current or former USTs, was observed by GHD during the Site visit. The presence of former or current USTs was not reported by the Site representative.



4.3 Aboveground Storage Tanks (ASTs)

No visual evidence (such as filler or vent pipes, or retention walls), suggesting the presence of existing ASTs, was observed by GHD during the Site visit. The presence of former or current ASTs was not reported by the Site representative.

4.4 Chemical Use and Storage

The on-Site operations (commercial/retail) are not anticipated to require the use and storage of chemicals, with the exception of small volumes of commercially available cleaning products.

4.5 Chemical Spills/Releases

No significant oil or chemical staining was noted on the finished or landscaped surfaces exterior to the Site buildings. No distressed vegetation, or abnormal odours suggesting the presence of significant chemical or petroleum spills or releases, were noted at the time of the current Site visit.

It should be noted that two monitoring wells were observed at the Site at the time of the Site visit. No reports were provided to document the installation or chemical analysis of soil and/or groundwater from these locations. The locations of the observed monitoring wells are noted on Figure 2.

4.6 Solid Waste/Recyclables

The solid waste generated at the Site typically includes general domestic waste and recyclable materials such as cardboard, paper and plastic. In addition, cooking oil and grease can be expected to be generated, due to the on site restaurant. Solid waste and recyclable materials were observed at the time of the Site visit, stored in commercial waste containers for collection on a bi-weekly basis by private waste collection services for off-Site disposal and recycling, respectively. No evidence of on-Site solid waste disposal was noted by GHD at the time of the Site visit.

4.7 Hazardous Material

Based on GHD's field observations and interviews with the Client representative, no hazardous material is generated on the Site, nor is such material expected to be stored or generated based on the nature of the operations (light commercial) currently conducted at the Site. No visual evidence of hazardous material disposal at the Site was noted during the Site visit.

4.8 Wastewater

Wastewater generated at the Site includes domestic liquid effluent. The domestic effluent is discharged into the municipal wastewater system. No visual evidence suggesting the presence of other wastewater production was observed during the Site visit.

4.8.1 Floor/Trench Drains, Pits and Sumps

No floor drains, pits or sumps were noted by GHD during the course of the Site Visit.



4.9 Stormwater

Stormwater at the Site is collected and/or discharged by overland flow on improved Site surfaces for subsequent discharge to the municipal wastewater system or storm sewer system. No evidence of process-related effluent discharges to the storm water system from on-Site sources was observed by GHD during the Site visit. No areas of potential environmental concern to the Site with respect to the on-Site storm sewer system were observed by GHD.

4.10 Asbestos-Containing Materials (ACM)

Under the Hazardous Products Act, as of April 24, 1980, the use of asbestos was prohibited in most consumer products where dust particles are generated during normal use. Asbestos is considered a health hazard generally when asbestos fibres become airborne.

Friable types of ACM (pipe insulation, sprayed-on insulation, boiler wrap, and ceiling tiles) may remain on Site and in use indefinitely, provided the ACM are adequately maintained, covered and prevented from being disturbed under normal use. Friable types of asbestos are more likely to become airborne as compared to non-friable types. Products containing non-friable ACM (floor tiles, asbestos cement tiling, and piping) present a limited potential danger for airborne fibre release.

During the Site visit, GHD made visual observations in easily accessible areas of the building for the presence of friable and non-friable ACM. No intrusive investigations were conducted to examine concealed spaces for the presence of ACM. Given the age of the building (late 1970s), there is a potential for the presence of ACM to be present in the vinyl floor tiles, drywall joint compound, suspended ceiling tiles, caulking and insulation.

4.11 Polychlorinated Biphenyls (PCBs)

According to the Chlorobiphenyls Regulation, which is part of the Canadian Environmental Protection Act, the manufacturing, processing, using, selling, or importing of new equipment containing more than 50 ppm PCBs was prohibited as of July 1, 1980. Existing PCB-containing equipment (prior to 1977, and prior to 1980 for electrical transformers and capacitors) could remain in place within the context of the Regulation, although the dismantling and disposal of PCB-containing equipment are subject to the Regulation.

Based on GHD's visual observations during the Site visit and information obtained during the course of the study, no evidence of on-Site waste PCB storage or potential PCB-containing equipment was identified.

4.12 Chlorofluorocarbons (CFCs)

Based on observations during the Site visit, equipment which was present at the Site that potentially contains chlorofluorocarbons (ozone-depleting substances) consists of commercial refrigerators, freezers, air conditioners, and fire extinguishers. The presence of CFCs in the on-Site refrigeration, cooling, and fire extinguishing equipment is not considered to represent a significant potential environmental concern for the Property.



4.13 Urea Formaldehyde Foam Insulation (UFFI)

Urea formaldehyde foam insulation (UFFI) was introduced to the Canadian building industry in 1960 as a means of insulating enclosed or inaccessible cavities in building walls. It was typically made at a construction site from a mixture of urea formaldehyde resin, a foaming agent, and compressed air. Most installations in Canada occurred prior to December 17, 1980, when it was banned due to the possibility of long-term health risks to occupants of buildings insulated with UFFI.

The presence of urea formaldehyde foam insulation was not reported by the Site representative; however, due to the period of construction it may be a risk to be present, unless a document can be presented to prove that it is not present.

4.14 Lead-Based Paint

The amount of lead in surface coating (paint) has been regulated since 1976 through Health Canada's Hazardous Products Act to below 0.5 percent, and in recent years the limit was reduced to 0.009 percent. Based on the initial year (late 1970s) of construction of the Site building, lead-based paint may be present on-Site. Any demolition or renovation activities should take into account the potential presence of lead-based paint.

4.15 Air Emissions

From observations made by GHD during the Site visit, there is no fixed-point air emission sources (other than domestic heating associated emission sources) that may constitute a potential adverse environmental impact presently operated on Site.

4.16 Ionizing Radiation

No evidence of ionising radiation sources was observed at the Site by GHD.

4.17 Radon

According to publicly available maps reviewed (2004, Carson, J M; Holman, P B; Ford, K L; Grant, J A; Shives, R B K; Airborne Gamma Ray Spectrometry Compilation Equivalent Uranium Ontario Map 4551; Geologic Survey of Ontario), the Site is located in an area with the equivalent Uranium (eU) appearing to range from 0.750 to 0.950 eU (ppm), generally representing a low radon gas emission potential.

A long-term radon test would need to be conducted by a certified radon measurement professional to determine if there is a potential for radon to represent a significant potential adverse environmental concern for the subject Site.

4.18 Interviews

Mr. Daniel Blais, Property Manager, was present during the Site inspection and was interviewed to assist in documenting the Site conditions and operating history. Mr. Blais stated that construction of the Site building was completed in the late 1970s and the Site has operated for commercial purposes since that time. Mr. Blais stated that the building is heated with natural gas and was not aware of any current fuel storage at the Site. Mr. Blais stated that, to the best of his knowledge,



there has never been a dry cleaners on Site. Mr. Blais was unaware of any environmental concerns with the Site since his involvement with the Property. Mr. Blais stated that he was aware that the property to the east of DuMaurier Avenue had operated as a landfill, however, he was uncertain of the time period of operation.

5. Conclusion

GHD has performed this Phase I ESA of the Site in general accordance with the CSA Z768-01 publication for conducting Environmental Site Assessments. Based on the Phase I ESA study including the Site visit, documents reviewed, and the review of Site history and information provided by regulatory agencies, the following conclusions are noted.

There was one potentially contaminating activity (PCA) identified at the Site; the placement of fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.

There was one PCA identified at neighbouring properties; the presence of a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site.

The aforementioned PCAs are considered to represent areas of potential environmental concern (APECs) for the Site.

Following the completion of the Phase I ESA for the subject Property, **it is our opinion that a Phase II Environmental Site Assessment is recommended for the Site.**

6. Limitation of the Investigation

The findings and conclusions of the Phase I ESA are founded on the accuracy and reliability of the information obtained from all parties, unless contradicted by visual Site observations or written documentation.

The conclusions are presented based upon the readily available public information within the time frame of this mandate by trained professionals, following a prescribed and recognised assessment procedure.

This report is not intended to address, or provide comment on the presence, or absence of organic growth organisms commonly referred to as mould, through statements, inferences, or omissions.

The report is prepared for the use of the Client and his named representatives in making an informed financial and business decision regarding environmental liabilities that may be associated with the Site. The use of this report for any other purpose is at the Client's own risk.

The Client must understand that changing circumstances in the physical or regulatory environment, the administration and use of the Site, as well as changes in any substances stored, used, or disposed of at the Site, could significantly alter the conclusions and information contained in this report. Therefore, it is important that the Client periodically re-evaluates the Site and reviews developments or operations, which may potentially impact the Site.




All of Which is Respectfully Submitted,
GHD

A handwritten signature in blue ink, appearing to read 'Luke Lopers'.

Luke Lopers, P. Eng.

A handwritten signature in blue ink, appearing to read 'Kevin Emenau'.

Kevin Emenau, P. Geo.

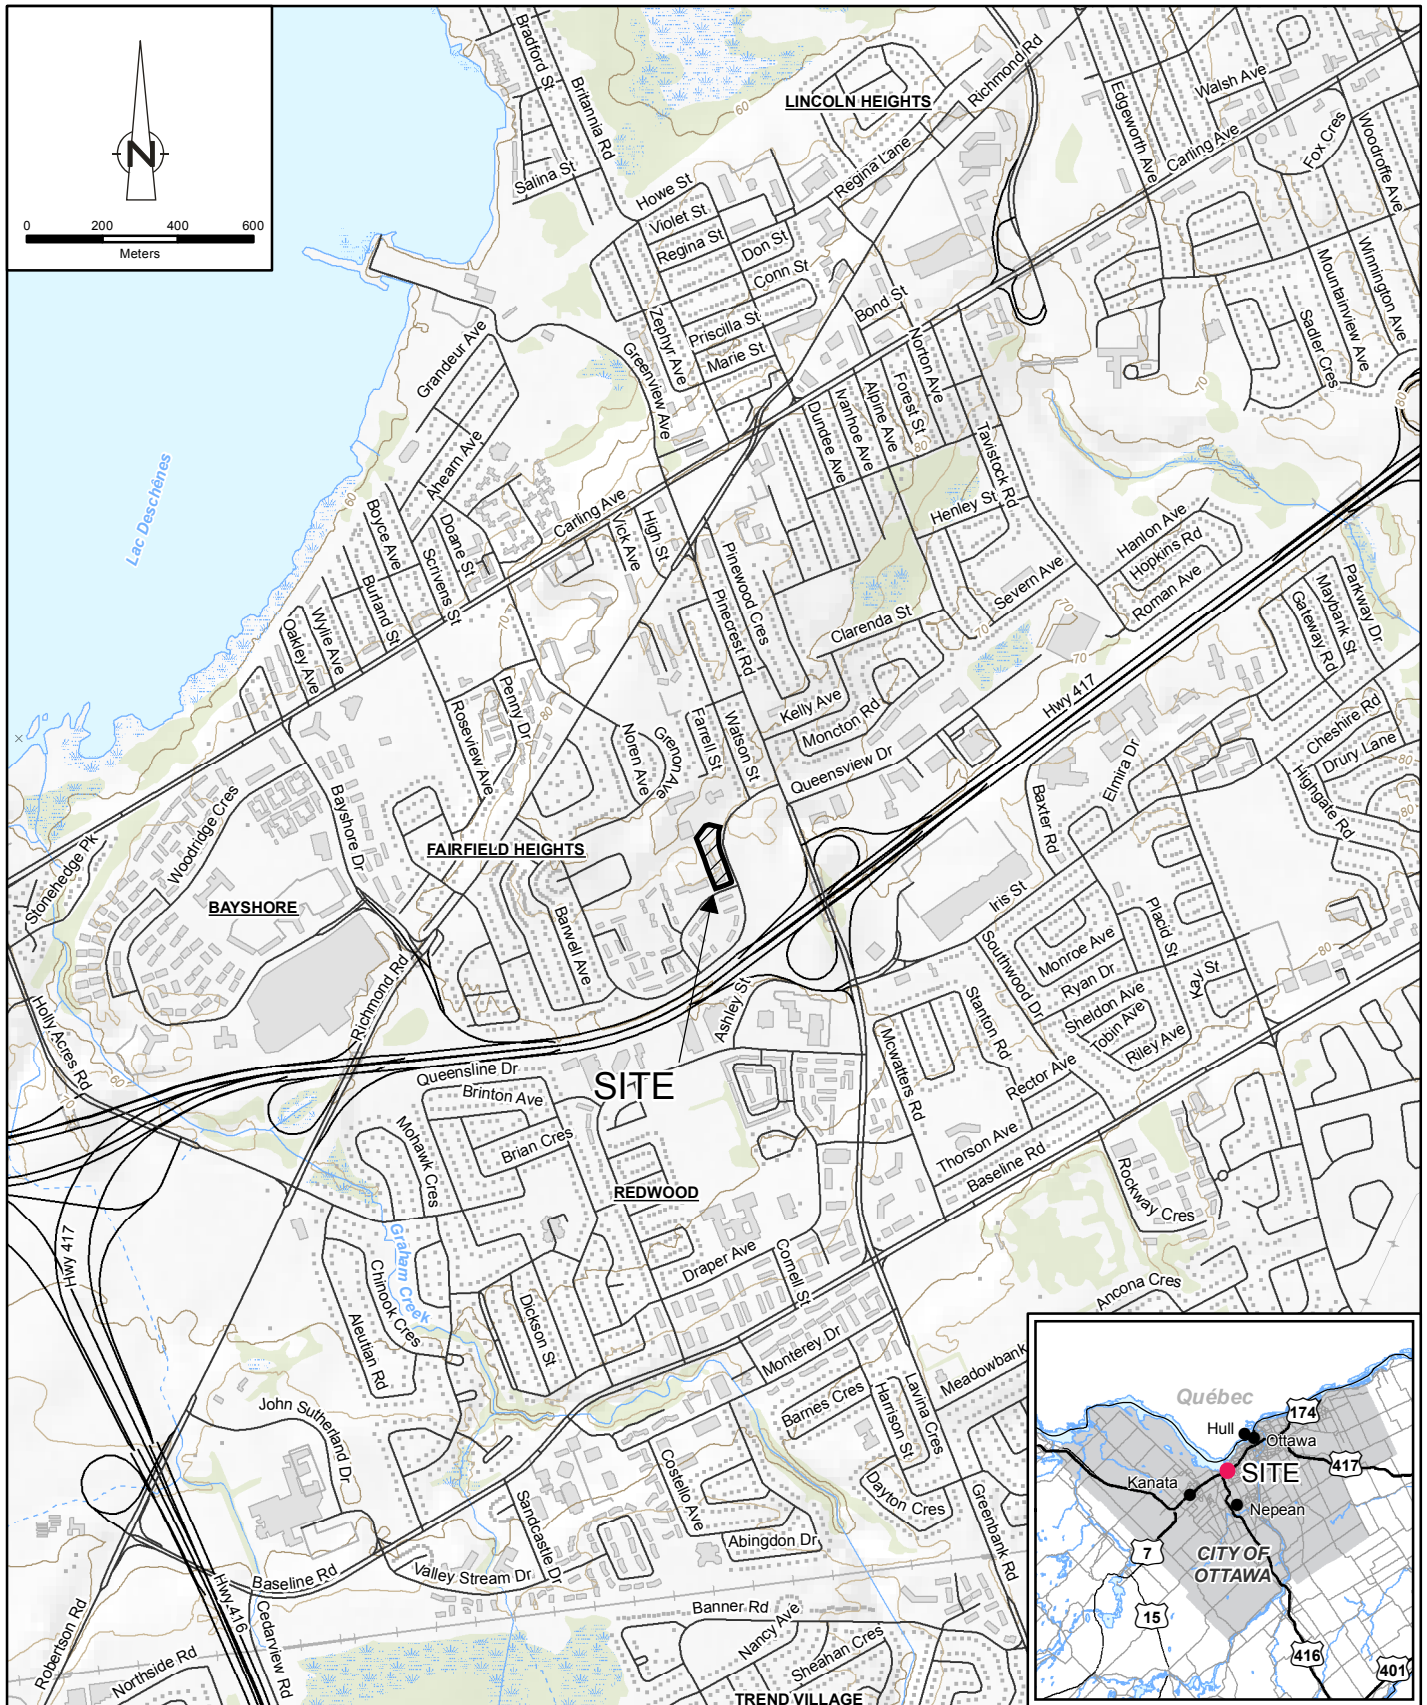

Source: MNRF NRVIS, 2018. Produced by GHD under licence from Ontario Ministry of Natural Resources and Forestry, © Queen's Printer 2018.
 Coordinate System: NAD 1983 UTM Zone 18N




3223701 CANADA INC.
 2831, 2833, 2835, 2841 AND 2865 DUMAURIER AVENUE, OTTAWA, ONTARIO
 PHASE I ENVIRONMENTAL SITE ASSESSMENT

11181273
 Aug 14, 2018

SITE LOCATION MAP

FIGURE 1

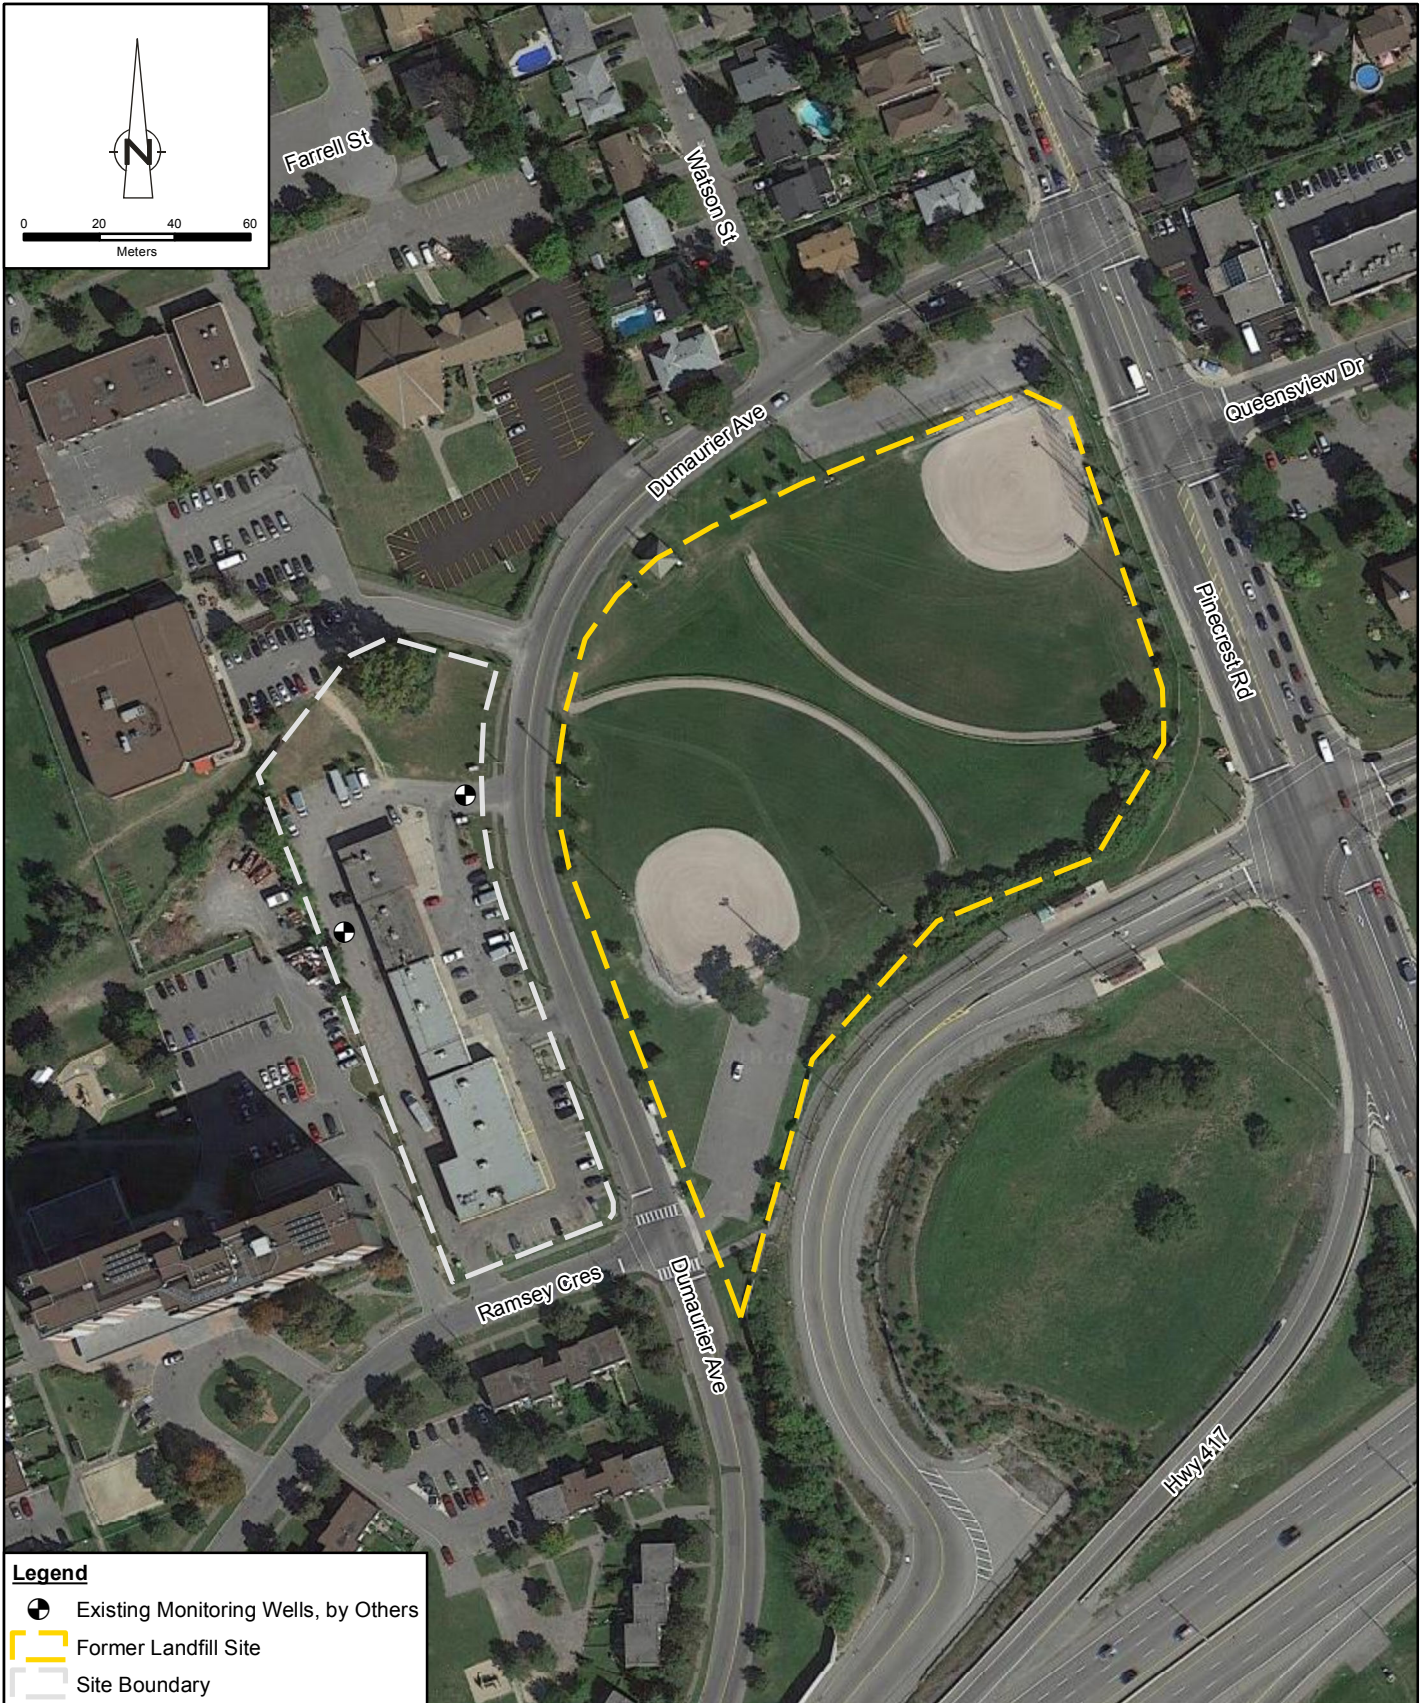

3223701 CANADA INC.
 2831, 2833, 2835, 2841 AND 2865 DUMAURIER AVENUE, OTTAWA, ONTARIO
 PHASE I ENVIRONMENTAL SITE ASSESSMENT

11181273
 Aug 14, 2018

SITE PLAN

FIGURE 2

Appendices

Appendix A Title Search

LAND
REGISTRY
OFFICE #4

03944-0827 (LT)

PAGE 1 OF 2
PREPARED FOR EEGOOLAB
ON 2018/08/14 AT 10:52:27

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: PART OF LOT 20 CONCESSION 2 OTTAWA FRONT, AND PART DUMAUER AVENUE PLAN 479600 AS CLOSED BY NS41961, 1 FOOT RESERVE PLAN 4R479600 PARTS 1 TO 8 PLAN 4R16235, OTTAWA. SUBJECT TO OVER PART 12 PLAN 4R16235 AS IN NS87431. SUBJECT TO RIGHT OVER PARTS 5, 10, 11, 12 AND 16 PLAN 4R16235AS IN N502320. TOGETHER WITH A RIGHT OF WAY OVER PARTS 10 TO 12 PLAN 4R16235 AS IN LT1345806. SUBJECT TO A RIGHT OF WAY IN FAVOUR OF PARTS 9 TO 17 PLAN 4R16235 OVER PART 5 PLAN 4R16235 AS IN LT1345806. SUBJECT TO AN EASEMENT IN FAVOUR OF HYDRO OTTAWA LIMITED OVER PARTS 3 AND 8 PLAN 4R16235 AS IN LT1353269.

PROPERTY REMARKS:

ESTATE/QUALIFIER:
FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:
DIVISION FROM 03944-0237

PIN CREATION DATE:
2001/07/30

OWNERS' NAMES
1248816 ONTARIO INC.

CAPACITY SHARE

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/CHKD |
|---|------------|-----------------|--------|--------------|---------------------------------------|-----------|
| ** PRINTOUT INCLUDES ALL DOCUMENT TYPES (DELETED INSTRUMENTS NOT INCLUDED) ** | | | | | | |
| **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: | | | | | | |
| ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * | | | | | | |
| ** AND ESCHEATS OR FORFEITURE TO THE CROWN. | | | | | | |
| ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF | | | | | | |
| ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY | | | | | | |
| ** CONVENTION. | | | | | | |
| ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. | | | | | | |
| **DATE OF CONVERSION TO LAND TITLES: 1993/08/09 ** | | | | | | |
| 4R268 | 1971/09/23 | PLAN REFERENCE | | | | C |
| CR710766 | 1977/06/22 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| NS24195 | 1978/08/09 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| 5R5222 | 1980/08/25 | PLAN REFERENCE | | | | C |
| 5R5439 | 1980/12/16 | PLAN REFERENCE | | | | C |
| NS106449 | 1980/12/17 | AGREEMENT | | | | C |
| NS106503 | 1980/12/18 | DEPOSIT | | | | C |
| 5R5458 | 1980/12/23 | PLAN REFERENCE | | | | C |
| NS140195 | 1982/01/06 | ORDER | | | | C |

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.


03944-0827 (LT)

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/ CHKD |
|-----------|------------|-------------------|-----------|-------------------------------------|----------------------|---------------|
| LT1078867 | 1997/10/01 | TRANS POWER SALE | \$155,000 | BUSINESS DEVELOPMENT BANK OF CANADA | 1248816 ONTARIO INC. | C |
| 4R16235 | 2000/11/20 | PLAN REFERENCE | | | | C |
| LT1353269 | 2001/01/08 | TRANSFER EASEMENT | | 1248816 ONTARIO INC. | HYDRO OTTAWA LIMITED | C |



PRINTED ON 14 AUG, 2018 AT 10:54:30
FOR EEGOLAB



PROPERTY INDEX MAP
OTTAWA-CARLETON(No. 04)

LEGEND

| | |
|----------------------------------|-------|
| FREEHOLD PROPERTY | |
| LEASEHOLD PROPERTY | |
| LIMITED INTEREST PROPERTY | |
| CONDOMINIUM PROPERTY | |
| RETIRED PIN (MAP UPDATE PENDING) | |
| PROPERTY NUMBER | 0449 |
| BLOCK NUMBER | 08050 |
| GEOGRAPHIC FABRIC | |
| EASEMENT | |

THIS IS NOT A PLAN OF SURVEY

NOTES

REVIEW THE TITLE RECORDS FOR COMPLETE PROPERTY INFORMATION AS THIS MAP MAY NOT REFLECT RECENT REGISTRATIONS

THIS MAP WAS COMPILED FROM PLANS AND DOCUMENTS RECORDED IN THE LAND REGISTRATION SYSTEM AND HAS BEEN PREPARED FOR PROPERTY INDEXING PURPOSES ONLY

FOR DIMENSIONS OF PROPERTIES BOUNDARIES SEE RECORDED PLANS AND DOCUMENTS

ONLY MAJOR EASEMENTS ARE SHOWN

REFERENCE PLANS UNDERLYING MORE RECENT REFERENCE PLANS ARE NOT ILLUSTRATED



LAND
REGISTRY
OFFICE #4

03944-0826 (LT)

PAGE 1 OF 2
PREPARED FOR EEGOOLAB
ON 2018/08/14 AT 10:55:08

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: PART OF LOT 20 CONCESSION 2 OTTAWA FRONT, PARTS 9 TO 17 PLAN 4R16235, OTTAWA. TOGETHER WITH RIGHT AS IN N502320. TOGETHER WITH A RIGHT OF WAY OVER PART 5 PLAN 4R16235 AS IN LT1345806. SUBJECT TO A RIGHT OF WAY IN FAVOUR OF PARTS 1 TO 8 PLAN 4R16235 OVER PARTS 10 TO 12 PLAN 4R16235 AS IN LT1345806.

PROPERTY REMARKS:

ESTATE/QUALIFIER:
FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:
DIVISION FROM 03944-0237

PIN CREATION DATE:
2001/07/30

OWNERS' NAMES
GIANT TIGER STORES LIMITED

CAPACITY SHARE
BENO

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/CHKD |
|---|------------|-----------------|--------|--------------|---------------------------------------|-----------|
| ** PRINTOUT INCLUDES ALL DOCUMENT TYPES (DELETED INSTRUMENTS NOT INCLUDED) ** | | | | | | |
| **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: | | | | | | |
| ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * | | | | | | |
| ** AND ESCHEATS OR FORFEITURE TO THE CROWN. | | | | | | |
| ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF | | | | | | |
| ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY | | | | | | |
| ** CONVENTION. | | | | | | |
| ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. | | | | | | |
| **DATE OF CONVERSION TO LAND TITLES: 1993/08/09 ** | | | | | | |
| 4R268 | 1971/09/23 | PLAN REFERENCE | | | | C |
| CR710766 | 1977/06/22 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| NS24195 | 1978/08/09 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| 5R5222 | 1980/08/25 | PLAN REFERENCE | | | | C |
| 5R5439 | 1980/12/16 | PLAN REFERENCE | | | | C |
| NS106449 | 1980/12/17 | AGREEMENT | | | | C |
| NS106503 | 1980/12/18 | DEPOSIT | | | | C |
| 5R5458 | 1980/12/23 | PLAN REFERENCE | | | | C |
| NS140195 | 1982/01/06 | ORDER | | | | C |

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.


LAND
 REGISTRY
 OFFICE #4

03944-0826 (LT)


* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/ CHKD |
|-----------|------------|--|-----------|----------------------------|----------------------------|---------------|
| 4R16235 | 2000/11/20 | PLAN REFERENCE | | | | C |
| LT1345806 | 2000/12/01 | TRANSFER | \$150,000 | 1248816 ONTARIO INC. | GIANT TIGER STORES LIMITED | C |
| | | REMARKS: PLANNING ACT CERTIFICATE. S/T & T/W RIGHTS OF WAY IN LT1345806. | | | | |
| LT1345807 | 2000/12/01 | NOTICE | | GIANT TIGER STORES LIMITED | 1248816 ONTARIO INC. | C |
| | | REMARKS: PARTS 9 TO 17 INCLUSIVE ON PLAN 4R16235 | | | | |

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
 NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

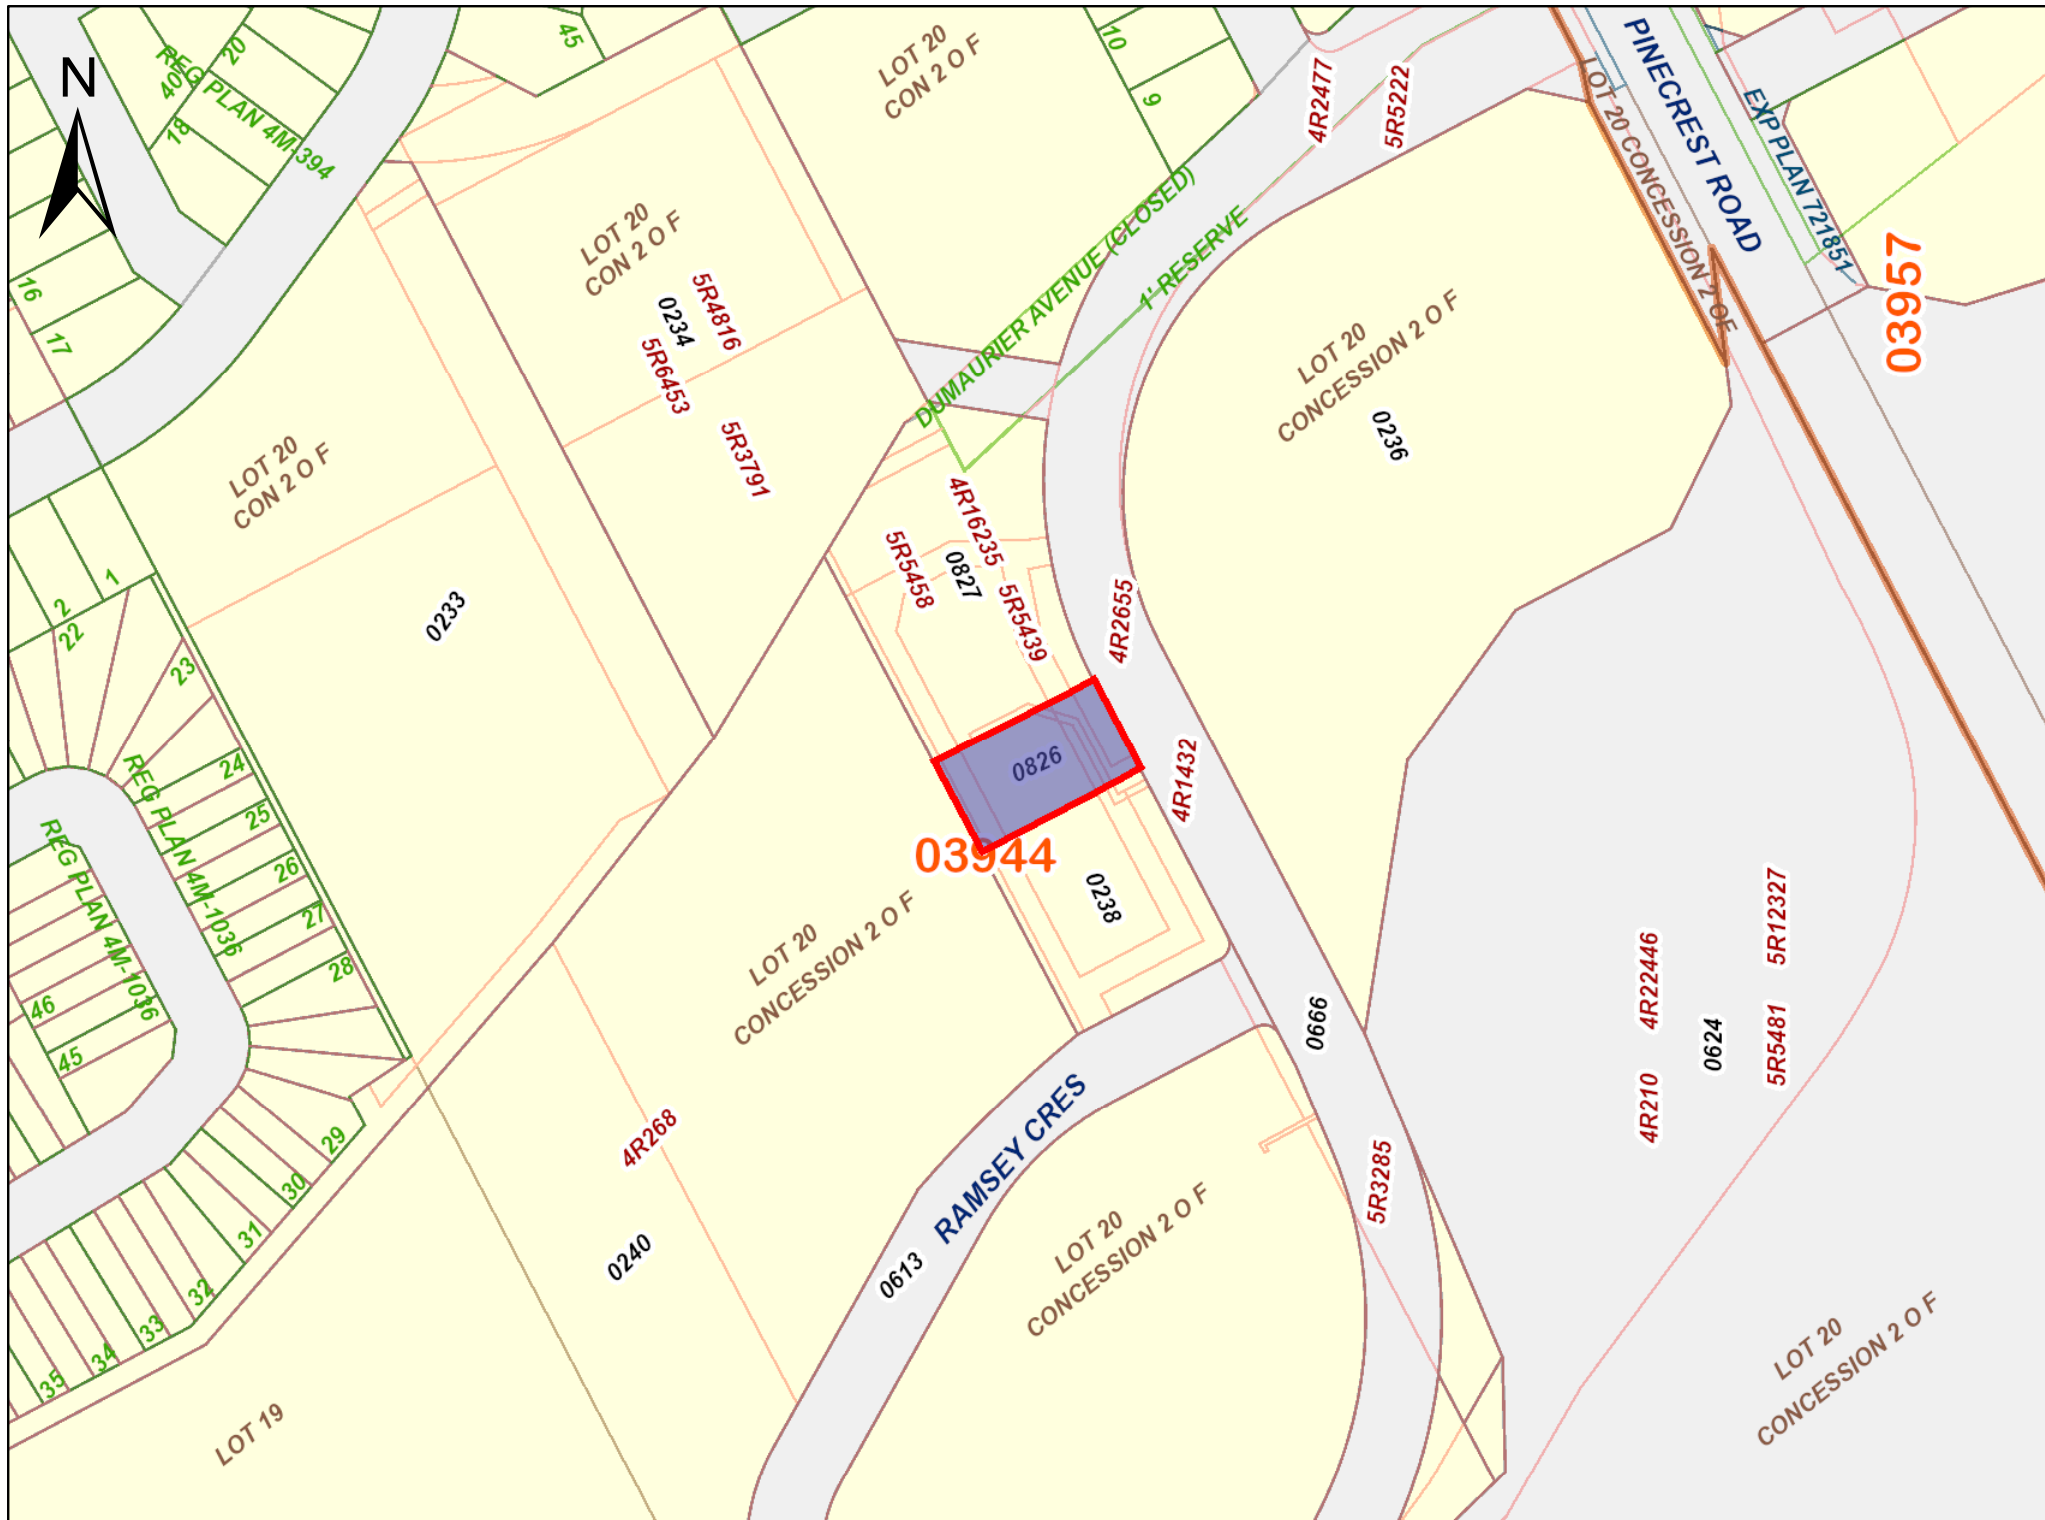

PRINTED ON 14 AUG, 2018 AT 10:57:58
FOR EEGOLAB



PROPERTY INDEX MAP
OTTAWA-CARLETON(No. 04)

LEGEND

| | |
|----------------------------------|-------|
| FREEHOLD PROPERTY | |
| LEASEHOLD PROPERTY | |
| LIMITED INTEREST PROPERTY | |
| CONDOMINIUM PROPERTY | |
| RETIRED PIN (MAP UPDATE PENDING) | |
| PROPERTY NUMBER | 0449 |
| BLOCK NUMBER | 08050 |
| GEOGRAPHIC FABRIC | |
| EASEMENT | |

THIS IS NOT A PLAN OF SURVEY

NOTES

REVIEW THE TITLE RECORDS FOR COMPLETE PROPERTY INFORMATION AS THIS MAP MAY NOT REFLECT RECENT REGISTRATIONS

THIS MAP WAS COMPILED FROM PLANS AND DOCUMENTS RECORDED IN THE LAND REGISTRATION SYSTEM AND HAS BEEN PREPARED FOR PROPERTY INDEXING PURPOSES ONLY

FOR DIMENSIONS OF PROPERTIES BOUNDARIES SEE RECORDED PLANS AND DOCUMENTS

ONLY MAJOR EASEMENTS ARE SHOWN

REFERENCE PLANS UNDERLYING MORE RECENT REFERENCE PLANS ARE NOT ILLUSTRATED



PROPERTY DESCRIPTION: PT LT 20 CON 2 OF, PTS 1, 2 & 3 5R5439; S/T & T/W NS106448 S/T EASEMENT IN FAVOUR OF HYDRO OTTAWA LIMITED OVER PART 24 4R16235 AS IN LT1353268.

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK NEP 25

PIN CREATION DATE:

1993/08/09

OWNERS' NAMES

GIANT TIGER STORES LIMITED

CAPACITY SHARE


BENO

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/CHKD |
|---|------------|--------------------|-----------|--------------|---------------------------------------|-----------|
| <p>**EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1993/08/09 ON THIS PIN**</p> <p>**WAS REPLACED WITH THE "PIN CREATION DATE" OF 1993/08/09**</p> <p>** PRINTOUT INCLUDES ALL DOCUMENT TYPES (DELETED INSTRUMENTS NOT INCLUDED) **</p> <p>**SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO:</p> <p>** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES *</p> <p>** AND ESCHEATS OR FORFEITURE TO THE CROWN.</p> <p>** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF</p> <p>** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY</p> <p>** CONVENTION.</p> <p>** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.</p> <p>**DATE OF CONVERSION TO LAND TITLES: 1993/08/09 **</p> | | | | | | |
| 4R268 | 1971/09/23 | PLAN REFERENCE | | | | C |
| CR710766 | 1977/06/22 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| NS24195 | 1978/08/09 | AGREEMENT | | | THE CORPORATION OF THE CITY OF OTTAWA | C |
| NS92283 | 1980/07/29 | AGREEMENT TO LEASE | | | D.A.P.I. LIMITED | C |
| REMARKS: RE SKETCH ATTACHED RE TERM OF 10 YEARS | | | | | | |
| 5R5439 | 1980/12/16 | PLAN REFERENCE | | | | C |
| NS106448 | 1980/12/17 | TRANSFER | \$150,000 | | GIANT TIGER STORES LIMITED | C |
| NS106448Z | 1980/12/17 | REST COV APL ANNEX | | | | C |
| NS106449 | 1980/12/17 | AGREEMENT | | | | C |


NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

| REG. NUM. | DATE | INSTRUMENT TYPE | AMOUNT | PARTIES FROM | PARTIES TO | CERT/ CHKD |
|-----------|------------|--------------------|--------|----------------------------|------------------------------------|---------------|
| 5R5458 | 1980/12/23 | PLAN REFERENCE | | | | C |
| N412985 | 1987/10/22 | NO ASSG LESSEE INT | | | LEIZERT, RUTH ROMANZAS, LEONIDA | C |
| N415003 | 1987/11/04 | NO ASSG LESSEE INT | | | LEIZERT, RUTH | C |
| 4R16235 | 2000/11/20 | PLAN REFERENCE | | | | C |
| LT1353268 | 2001/01/08 | TRANSFER EASEMENT | | GIANT TIGER STORES LIMITED | HYDRO OTTAWA LIMITED | C |

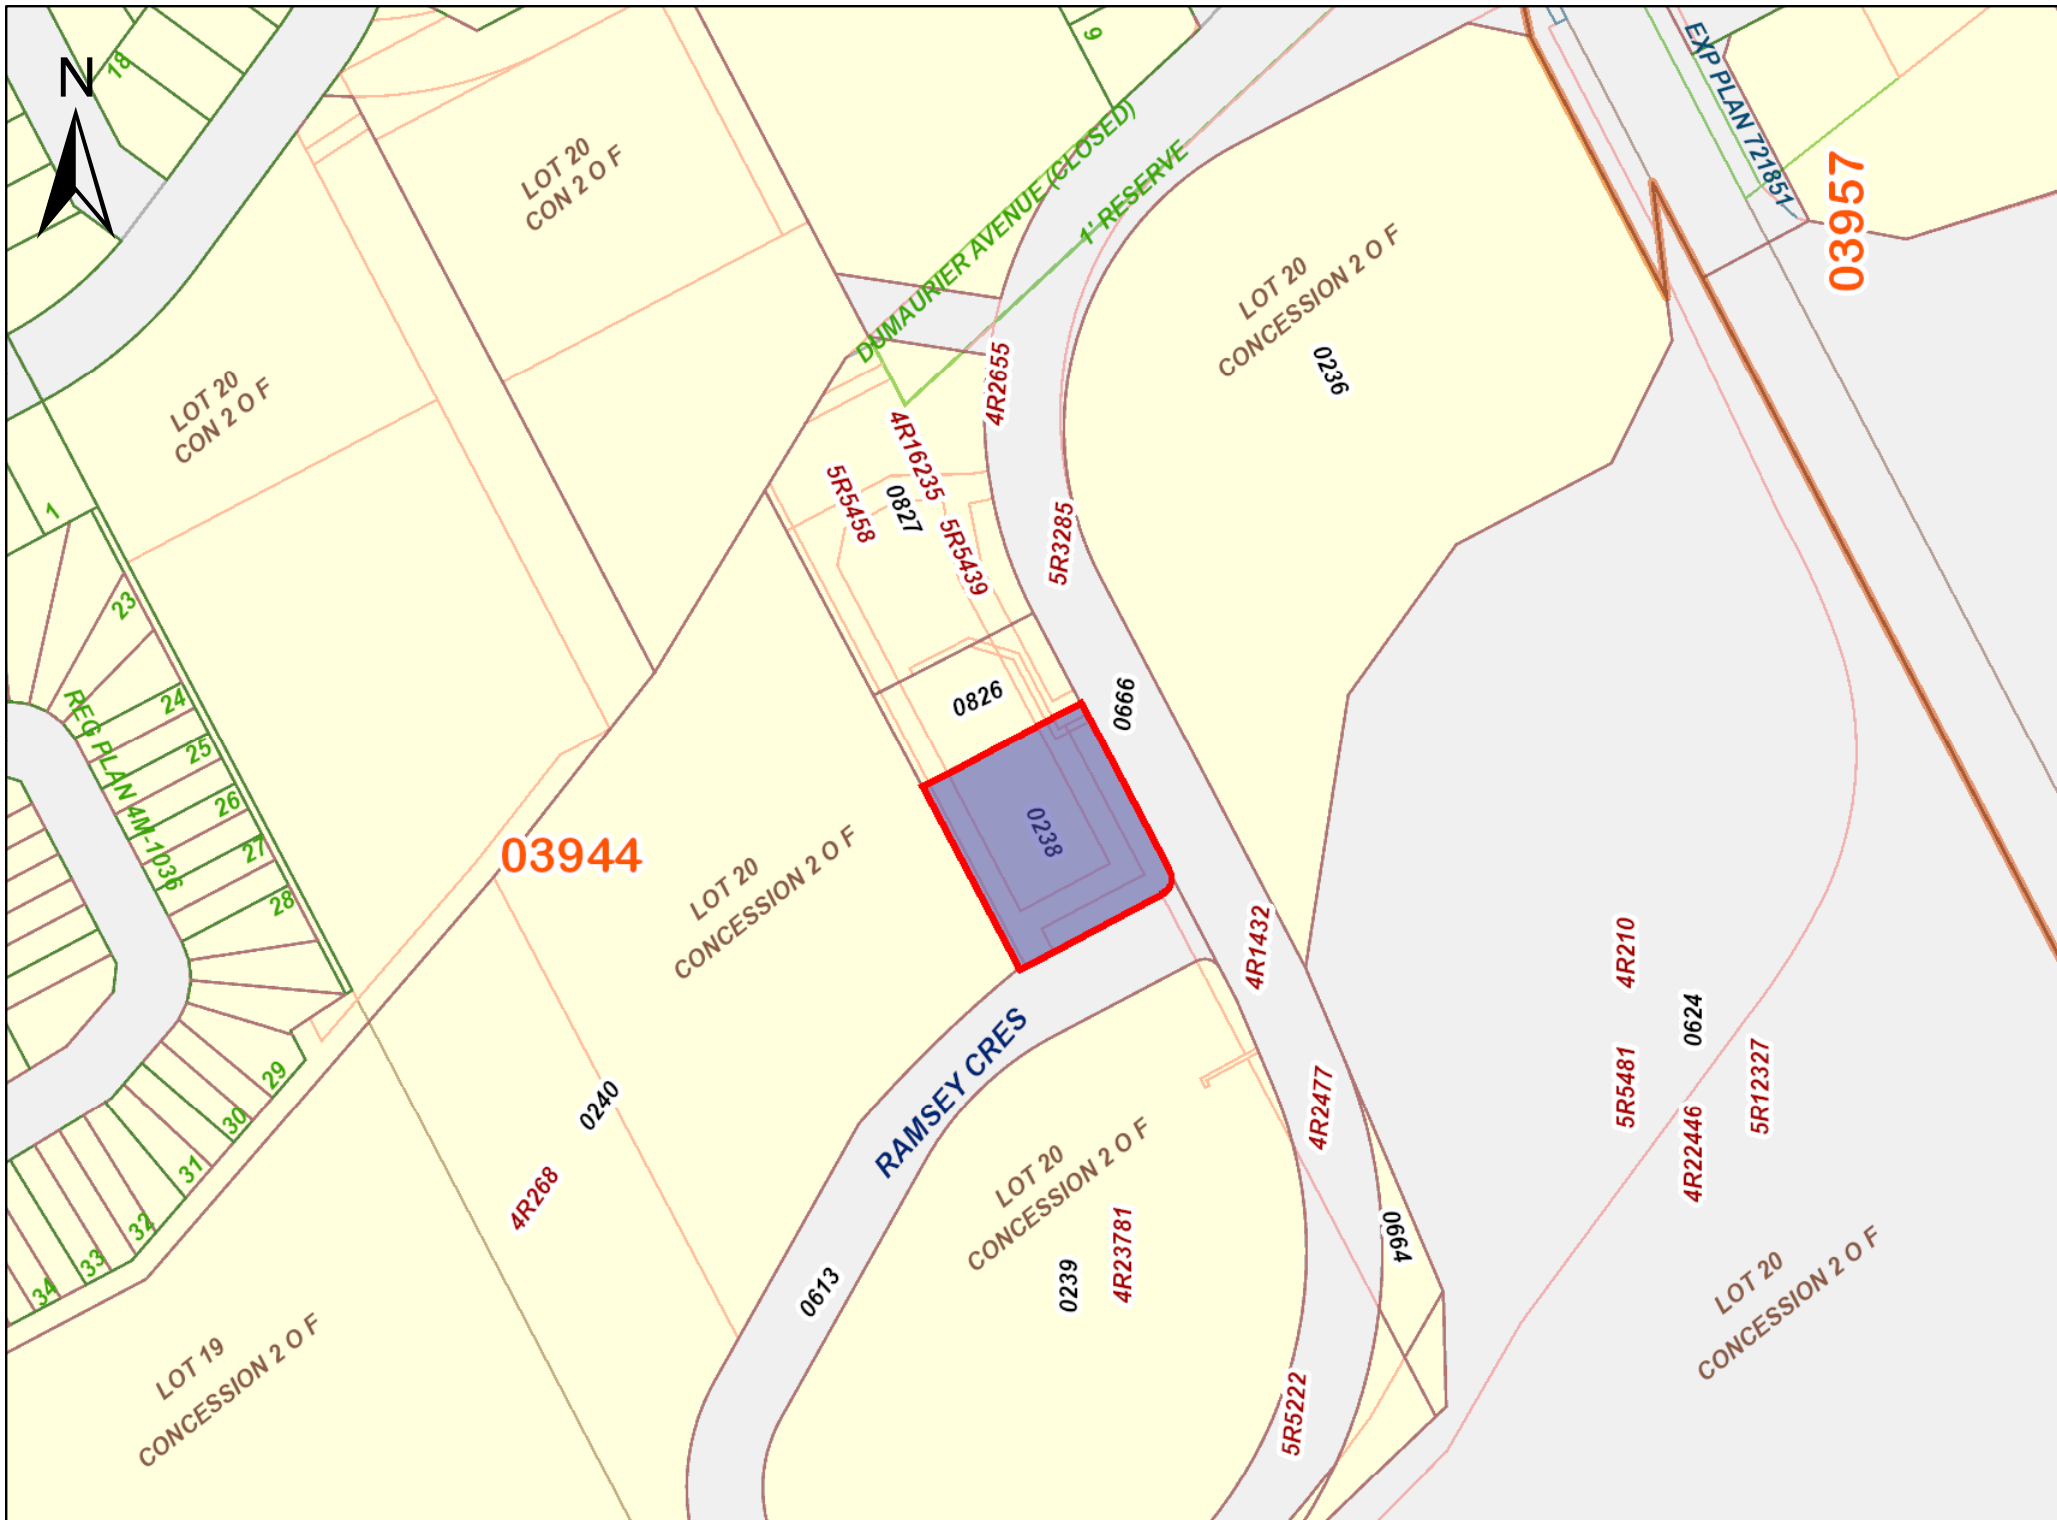

PRINTED ON 14 AUG, 2018 AT 10:59:14
FOR EEGOLAB



PROPERTY INDEX MAP
OTTAWA-CARLETON(No. 04)

LEGEND

| | |
|----------------------------------|-------|
| FREEHOLD PROPERTY | |
| LEASEHOLD PROPERTY | |
| LIMITED INTEREST PROPERTY | |
| CONDOMINIUM PROPERTY | |
| RETIRED PIN (MAP UPDATE PENDING) | |
| PROPERTY NUMBER | 0449 |
| BLOCK NUMBER | 08050 |
| GEOGRAPHIC FABRIC | |
| EASEMENT | |

THIS IS NOT A PLAN OF SURVEY

NOTES

REVIEW THE TITLE RECORDS FOR COMPLETE PROPERTY INFORMATION AS THIS MAP MAY NOT REFLECT RECENT REGISTRATIONS

THIS MAP WAS COMPILED FROM PLANS AND DOCUMENTS RECORDED IN THE LAND REGISTRATION SYSTEM AND HAS BEEN PREPARED FOR PROPERTY INDEXING PURPOSES ONLY

FOR DIMENSIONS OF PROPERTIES BOUNDARIES SEE RECORDED PLANS AND DOCUMENTS

ONLY MAJOR EASEMENTS ARE SHOWN

REFERENCE PLANS UNDERLYING MORE RECENT REFERENCE PLANS ARE NOT ILLUSTRATED



Appendix B

Ecolog ERIS Report

ERIS
ENVIRONMENTAL RISK INFORMATION SERVICES



DATABASE REPORT

Project Property: *Phase I ESA
2865 Dumaurier Avenue
Ottawa ON K2B 7W3
11177877Rivard-1*

Project No: *11177877Rivard-1*

Report Type: *Standard Express Report*

Order No: *20180808091*

Requested by: *GHD Ltd.*

Date Completed: *August 8, 2018*

**Environmental Risk
Information Services**
A division of Glacier Media Inc.
P: 1.866.517.5204
E: info@erisinfo.com

www.erisinfo.com

Table of Contents

| | |
|--|----|
| Table of Contents..... | 2 |
| Executive Summary..... | 3 |
| Executive Summary: Report Summary..... | 4 |
| Executive Summary: Site Report Summary - Project Property..... | 6 |
| Executive Summary: Site Report Summary - Surrounding Properties..... | 7 |
| Executive Summary: Summary By Data Source..... | 8 |
| Map..... | 11 |
| Aerial..... | 12 |
| Topographic Map..... | 13 |
| Detail Report..... | 14 |
| Unplottable Summary..... | 24 |
| Unplottable Report..... | 26 |
| Appendix: Database Descriptions..... | 34 |
| Definitions..... | 43 |

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report(s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Phase I ESA
2865 Dumaaurier Avenue Ottawa ON K2B 7W3*

Project No: *11177877Rivard-1*

Coordinates:

Latitude: *45.350177*
Longitude: *-75.79332*
UTM Northing: *5,022,157.92*
UTM Easting: *437,856.27*
UTM Zone: *UTM Zone 18T*

Elevation: *236 FT
72.06 M*

Order Information:

Order No: *20180808091*
Date Requested: *August 8, 2018*
Requested by: *GHD Ltd.*
Report Type: *Standard Express Report*

Historical/Products:

Land Title Search *Current Land Title Search*

Executive Summary: Report Summary

| Database | Name | Searched | Project Property | Within 0.25 km | Total |
|-----------------|---|-----------------|-------------------------|-----------------------|--------------|
| AAGR | <i>Abandoned Aggregate Inventory</i> | Y | 0 | 0 | 0 |
| AGR | <i>Aggregate Inventory</i> | Y | 0 | 0 | 0 |
| AMIS | <i>Abandoned Mine Information System</i> | Y | 0 | 0 | 0 |
| ANDR | <i>Anderson's Waste Disposal Sites</i> | Y | 0 | 1 | 1 |
| AUWR | <i>Automobile Wrecking & Supplies</i> | Y | 0 | 0 | 0 |
| BORE | <i>Borehole</i> | Y | 0 | 2 | 2 |
| CA | <i>Certificates of Approval</i> | Y | 0 | 2 | 2 |
| CFOT | <i>Commercial Fuel Oil Tanks</i> | Y | 0 | 0 | 0 |
| CHEM | <i>Chemical Register</i> | Y | 0 | 0 | 0 |
| CNG | <i>Compressed Natural Gas Stations</i> | Y | 0 | 0 | 0 |
| COAL | <i>Inventory of Coal Gasification Plants and Coal Tar Sites</i> | Y | 0 | 0 | 0 |
| CONV | <i>Compliance and Convictions</i> | Y | 0 | 0 | 0 |
| CPU | <i>Certificates of Property Use</i> | Y | 0 | 0 | 0 |
| DRL | <i>Drill Hole Database</i> | Y | 0 | 0 | 0 |
| DRYCLEANERS | <i>Dry Cleaning Facilities</i> | Y | 0 | 0 | 0 |
| EASR | <i>Environmental Activity and Sector Registry</i> | Y | 0 | 0 | 0 |
| EBR | <i>Environmental Registry</i> | Y | 0 | 0 | 0 |
| ECA | <i>Environmental Compliance Approval</i> | Y | 0 | 2 | 2 |
| EEM | <i>Environmental Effects Monitoring</i> | Y | 0 | 0 | 0 |
| EHS | <i>ERIS Historical Searches</i> | Y | 1 | 1 | 2 |
| EIIS | <i>Environmental Issues Inventory System</i> | Y | 0 | 0 | 0 |
| EMHE | <i>Emergency Management Historical Event</i> | Y | 0 | 0 | 0 |
| EXP | <i>List of TSSA Expired Facilities</i> | Y | 0 | 0 | 0 |
| FCON | <i>Federal Convictions</i> | Y | 0 | 0 | 0 |
| FCS | <i>Contaminated Sites on Federal Land</i> | Y | 0 | 0 | 0 |
| FOFT | <i>Fisheries & Oceans Fuel Tanks</i> | Y | 0 | 0 | 0 |
| FST | <i>Fuel Storage Tank</i> | Y | 0 | 0 | 0 |
| FSTH | <i>Fuel Storage Tank - Historic</i> | Y | 0 | 0 | 0 |
| GEN | <i>Ontario Regulation 347 Waste Generators Summary</i> | Y | 0 | 3 | 3 |
| GHG | <i>Greenhouse Gas Emissions from Large Facilities</i> | Y | 0 | 0 | 0 |
| HINC | <i>TSSA Historic Incidents</i> | Y | 0 | 1 | 1 |
| IAFT | <i>Indian & Northern Affairs Fuel Tanks</i> | Y | 0 | 0 | 0 |
| INC | <i>TSSA Incidents</i> | Y | 0 | 0 | 0 |
| LIMO | <i>Landfill Inventory Management Ontario</i> | Y | 0 | 0 | 0 |
| MINE | <i>Canadian Mine Locations</i> | Y | 0 | 0 | 0 |
| MISA PENALTY | <i>Environmental Penalty Annual Report</i> | Y | 0 | 0 | 0 |

| Database | Name | Searched | Project Property | Within 0.25 km | Total |
|-----------------|--|-----------------|-------------------------|-----------------------|--------------|
| MNR | <i>Mineral Occurrences</i> | Y | 0 | 0 | 0 |
| NATE | <i>National Analysis of Trends in Emergencies System (NATES)</i> | Y | 0 | 0 | 0 |
| NCPL | <i>Non-Compliance Reports</i> | Y | 0 | 0 | 0 |
| NDFT | <i>National Defense & Canadian Forces Fuel Tanks</i> | Y | 0 | 0 | 0 |
| NDSP | <i>National Defense & Canadian Forces Spills</i> | Y | 0 | 0 | 0 |
| NDWD | <i>National Defence & Canadian Forces Waste Disposal Sites</i> | Y | 0 | 0 | 0 |
| NEBI | <i>National Energy Board Pipeline Incidents</i> | Y | 0 | 0 | 0 |
| NEBW | <i>National Energy Board Wells</i> | Y | 0 | 0 | 0 |
| NEES | <i>National Environmental Emergencies System (NEES)</i> | Y | 0 | 0 | 0 |
| NPCB | <i>National PCB Inventory</i> | Y | 0 | 0 | 0 |
| NPRI | <i>National Pollutant Release Inventory</i> | Y | 0 | 0 | 0 |
| OGW | <i>Oil and Gas Wells</i> | Y | 0 | 0 | 0 |
| OOGW | <i>Ontario Oil and Gas Wells</i> | Y | 0 | 0 | 0 |
| OPCB | <i>Inventory of PCB Storage Sites</i> | Y | 0 | 0 | 0 |
| ORD | <i>Orders</i> | Y | 0 | 0 | 0 |
| PAP | <i>Canadian Pulp and Paper</i> | Y | 0 | 0 | 0 |
| PCFT | <i>Parks Canada Fuel Storage Tanks</i> | Y | 0 | 0 | 0 |
| PES | <i>Pesticide Register</i> | Y | 3 | 0 | 3 |
| PINC | <i>TSSA Pipeline Incidents</i> | Y | 0 | 0 | 0 |
| PRT | <i>Private and Retail Fuel Storage Tanks</i> | Y | 0 | 0 | 0 |
| PTTW | <i>Permit to Take Water</i> | Y | 0 | 0 | 0 |
| REC | <i>Ontario Regulation 347 Waste Receivers Summary</i> | Y | 0 | 0 | 0 |
| RSC | <i>Record of Site Condition</i> | Y | 0 | 0 | 0 |
| RST | <i>Retail Fuel Storage Tanks</i> | Y | 0 | 0 | 0 |
| SCT | <i>Scott's Manufacturing Directory</i> | Y | 0 | 0 | 0 |
| SPL | <i>Ontario Spills</i> | Y | 0 | 2 | 2 |
| SRDS | <i>Wastewater Discharger Registration Database</i> | Y | 0 | 0 | 0 |
| TANK | <i>Anderson's Storage Tanks</i> | Y | 0 | 0 | 0 |
| TCFT | <i>Transport Canada Fuel Storage Tanks</i> | Y | 0 | 0 | 0 |
| VAR | <i>TSSA Variances for Abandonment of Underground Storage Tanks</i> | Y | 0 | 0 | 0 |
| WDS | <i>Waste Disposal Sites - MOE CA Inventory</i> | Y | 0 | 0 | 0 |
| WDSH | <i>Waste Disposal Sites - MOE 1991 Historical Approval Inventory</i> | Y | 0 | 1 | 1 |
| WWIS | <i>Water Well Information System</i> | Y | 0 | 1 | 1 |
| Total: | | | 4 | 16 | 20 |

Executive Summary: Site Report Summary - Project Property

| <i>Map Key</i> | <i>DB</i> | <i>Company/Site Name</i> | <i>Address</i> | <i>Dir/Dist (m)</i> | <i>Elev diff (m)</i> | <i>Page Number</i> |
|-------------------|-----------|--|---|---------------------|----------------------|--------------------|
| 2 | EHS | | 2865 Dumaaurier Ave Ottawa ON K2B7W3 | S/11.7 | 0.00 | 14 |
| 2 | PES | GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B7W3 | S/11.7 | 0.00 | 14 |
| 2 | PES | GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | S/11.7 | 0.00 | 14 |
| 2 | PES | GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | S/11.7 | 0.00 | 15 |

Executive Summary: Site Report Summary - Surrounding Properties

| <i>Map Key</i> | <i>DB</i> | <i>Company/Site Name</i> | <i>Address</i> | <i>Dir/Dist (m)</i> | <i>Elev Diff (m)</i> | <i>Page Number</i> |
|--------------------|-----------|--|---|---------------------|----------------------|--------------------|
| 1 | WDSH | | Pinecrest Rd. & DuMaurier Ave. OTTAWA ON | NNE/11.1 | 0.00 | 15 |
| 3 | ANDR | Pinecrest & DuMaurier Dump | Ottawa ON K2B | ENE/31.8 | -0.19 | 15 |
| 4 | ECA | City of Ottawa | Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | SE/66.9 | -1.19 | 16 |
| 4 | ECA | City of Ottawa | Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | SE/66.9 | -1.19 | 16 |
| 5 | CA | Ottawa Community Housing Corporation | 1065 Ramsey Crescent Ottawa ON | SW/88.4 | 0.90 | 16 |
| 5 | SPL | UNKNOWN | 1065 RAMSEY CRESC., OTTAWA/CARLETON REGIONAL HOUSING AUTHORITY COMPLEX. OTTAWA CITY ON K2B 8A1 | SW/88.4 | 0.90 | 17 |
| 6 | EHS | | 2825 Dumaourier Ave. Ottawa ON K2B 7W3 | NNW/130.6 | 3.81 | 17 |
| 7 | GEN | CONSEIL SCOLAIRE DE LANGUE FRANCAIS | ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | NNW/189.5 | 4.78 | 17 |
| 7 | GEN | CONSEIL DES ECOLES PUBLIQUES | FRANCO-NATIONS 1085, AVENUE GRENON OTTAWA ON K2B 8L7 | NNW/189.5 | 4.78 | 18 |
| 7 | GEN | CONSEIL (OUT OF BUS) | ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | NNW/189.5 | 4.78 | 18 |
| 8 | CA | OTTAWA CITY | DUMAURIER AVE. NEAR WATSON ST. OTTAWA CITY ON | NNE/192.7 | 3.53 | 18 |
| 9 | HINC | | 2921 DUMAURIER AVENUE OTTAWA ON K2B 8A2 | S/194.4 | -2.32 | 19 |
| 10 | BORE | | ON | ESE/203.3 | -2.73 | 19 |
| 11 | SPL | Ottawa Community Housing Corporation | 1095 Ramsey Crescent Ottawa ON K2B 7Z9 | SSW/226.5 | -0.49 | 19 |
| 12 | BORE | | ON | ENE/230.7 | 0.73 | 20 |
| 12 | WWIS | | ON | ENE/230.7 | 0.73 | 20 |

Executive Summary: Summary By Data Source

ANDR - Anderson's Waste Disposal Sites

A search of the ANDR database, dated 1860s-Present has found that there are 1 ANDR site(s) within approximately 0.25 kilometers of the project property.

| <u>Lower Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|-----------------------|-------------------------|----------------------------|--------------------------|
| Pinecrest & DuMaurier Dump | Ottawa ON K2B | ENE | 31.83 | <u>3</u> |

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2014 has found that there are 2 BORE site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--------------------------------------|-----------------------|-------------------------|----------------------------|---------------------------|
| | ON | ENE | 230.67 | <u>12</u> |

| <u>Lower Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|-----------------------|-------------------------|----------------------------|---------------------------|
| | ON | ESE | 203.34 | <u>10</u> |

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 2 CA site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--------------------------------------|--|-------------------------|----------------------------|--------------------------|
| Ottawa Community Housing Corporation | 1065 Ramsey Crescent Ottawa ON | SW | 88.43 | <u>5</u> |
| OTTAWA CITY | DUMAUER AVE. NEAR WATSON ST. OTTAWA CITY ON | NNE | 192.72 | <u>8</u> |

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Jun 30, 2018 has found that there are 2 ECA site(s) within approximately 0.25 kilometers of the project property.

| <u>Lower Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|---|-------------------------|----------------------------|--------------------------|
| City of Ottawa | Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | SE | 66.88 | <u>4</u> |
| City of Ottawa | Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | SE | 66.88 | <u>4</u> |

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Feb 28, 2018 has found that there are 2 EHS site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--------------------------------------|---|-------------------------|----------------------------|--------------------------|
| | 2865 Dumaaurier Ave Ottawa ON K2B7W3 | S | 11.70 | <u>2</u> |
| | 2825 Dumaaurier Ave. Ottawa ON K2B 7W3 | NNW | 130.61 | <u>6</u> |

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-December 31, 2017 has found that there are 3 GEN site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--|--|-------------------------|----------------------------|--------------------------|
| CONSEIL (OUT OF BUS) | ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | NNW | 189.46 | <u>7</u> |
| CONSEIL SCOLAIRE DE LANGUE FRANCAIS | ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | NNW | 189.46 | <u>7</u> |
| CONSEIL DES ECOLES PUBLIQUES | FRANCO-NATIONS 1085, AVENUE GRENON OTTAWA ON K2B 8L7 | NNW | 189.46 | <u>7</u> |

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 1 HINC site(s) within approximately 0.25 kilometers of the project property.

| <u>Lower Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|--|-------------------------|----------------------------|--------------------------|
| | 2921 DUMAURIER AVENUE OTTAWA ON K2B 8A2 | S | 194.42 | <u>9</u> |

PES - Pesticide Register

A search of the PES database, dated 1988-Mar 2018 has found that there are 3 PES site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--|---|-------------------------|----------------------------|--------------------------|
| GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B7W3 | S | 11.70 | <u>2</u> |
| GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | S | 11.70 | <u>2</u> |
| GIANT TIGER STORE # 22 - ISHIKO LIMITED | 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | S | 11.70 | <u>2</u> |

SPL - Ontario Spills

A search of the SPL database, dated 1988-Feb 2018 has found that there are 2 SPL site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|---|------------------|---------------------|-------------------|
| UNKNOWN | 1065 RAMSEY CRESC., OTTAWA/CARLETON REGIONAL HOUSING AUTHORITY COMPLEX. OTTAWA CITY ON K2B 8A1 | SW | 88.43 | 5 |

| <u>Lower Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|--------------------------------------|---|------------------|---------------------|--------------------|
| Ottawa Community Housing Corporation | 1095 Ramsey Crescent Ottawa ON K2B 7Z9 | SSW | 226.49 | 11 |

WDSH - Waste Disposal Sites - MOE 1991 Historical Approval Inventory

A search of the WDSH database, dated Up to Oct 1990* has found that there are 1 WDSH site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|---|------------------|---------------------|-------------------|
| | Pinecrest Rd. & DuMaurier Ave. OTTAWA ON | NNE | 11.11 | 1 |

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31, 2017 has found that there are 1 WWIS site(s) within approximately 0.25 kilometers of the project property.

| <u>Equal/Higher Elevation</u> | <u>Address</u> | <u>Direction</u> | <u>Distance (m)</u> | <u>Map Key</u> |
|-------------------------------|----------------|------------------|---------------------|--------------------|
| | ON | ENE | 230.67 | 12 |



Map : 0.25 Kilometer Radius

Order No: 20180808091

Address: 2865 Dumaurier Avenue, Ottawa, ON K2B 7W3 CA




| | | | |
|-----------------------------------|----------------------|-----------------------------------|--------------------------------|
| Project Property | Expressway | Industrial and Resource - Regions | National Park |
| Buffer Outline | Principal Highway | Main Line | Provincial or Territorial Park |
| Eris Sites with Higher Elevation | Secondary Highway | Sidetrack | Other Park |
| Eris Sites with Same Elevation | Major Road | Transit Line | Golf Course or Driving Range |
| Eris Sites with Lower Elevation | Local road | Abandoned Line | Park or Sports Field |
| Eris Sites with Unknown Elevation | Trail | | Other Recreation Area |
| | Proposed Road | | |
| | Ferry Route/Ice Road | | |

75°48'W

45°21'N

45°21'N

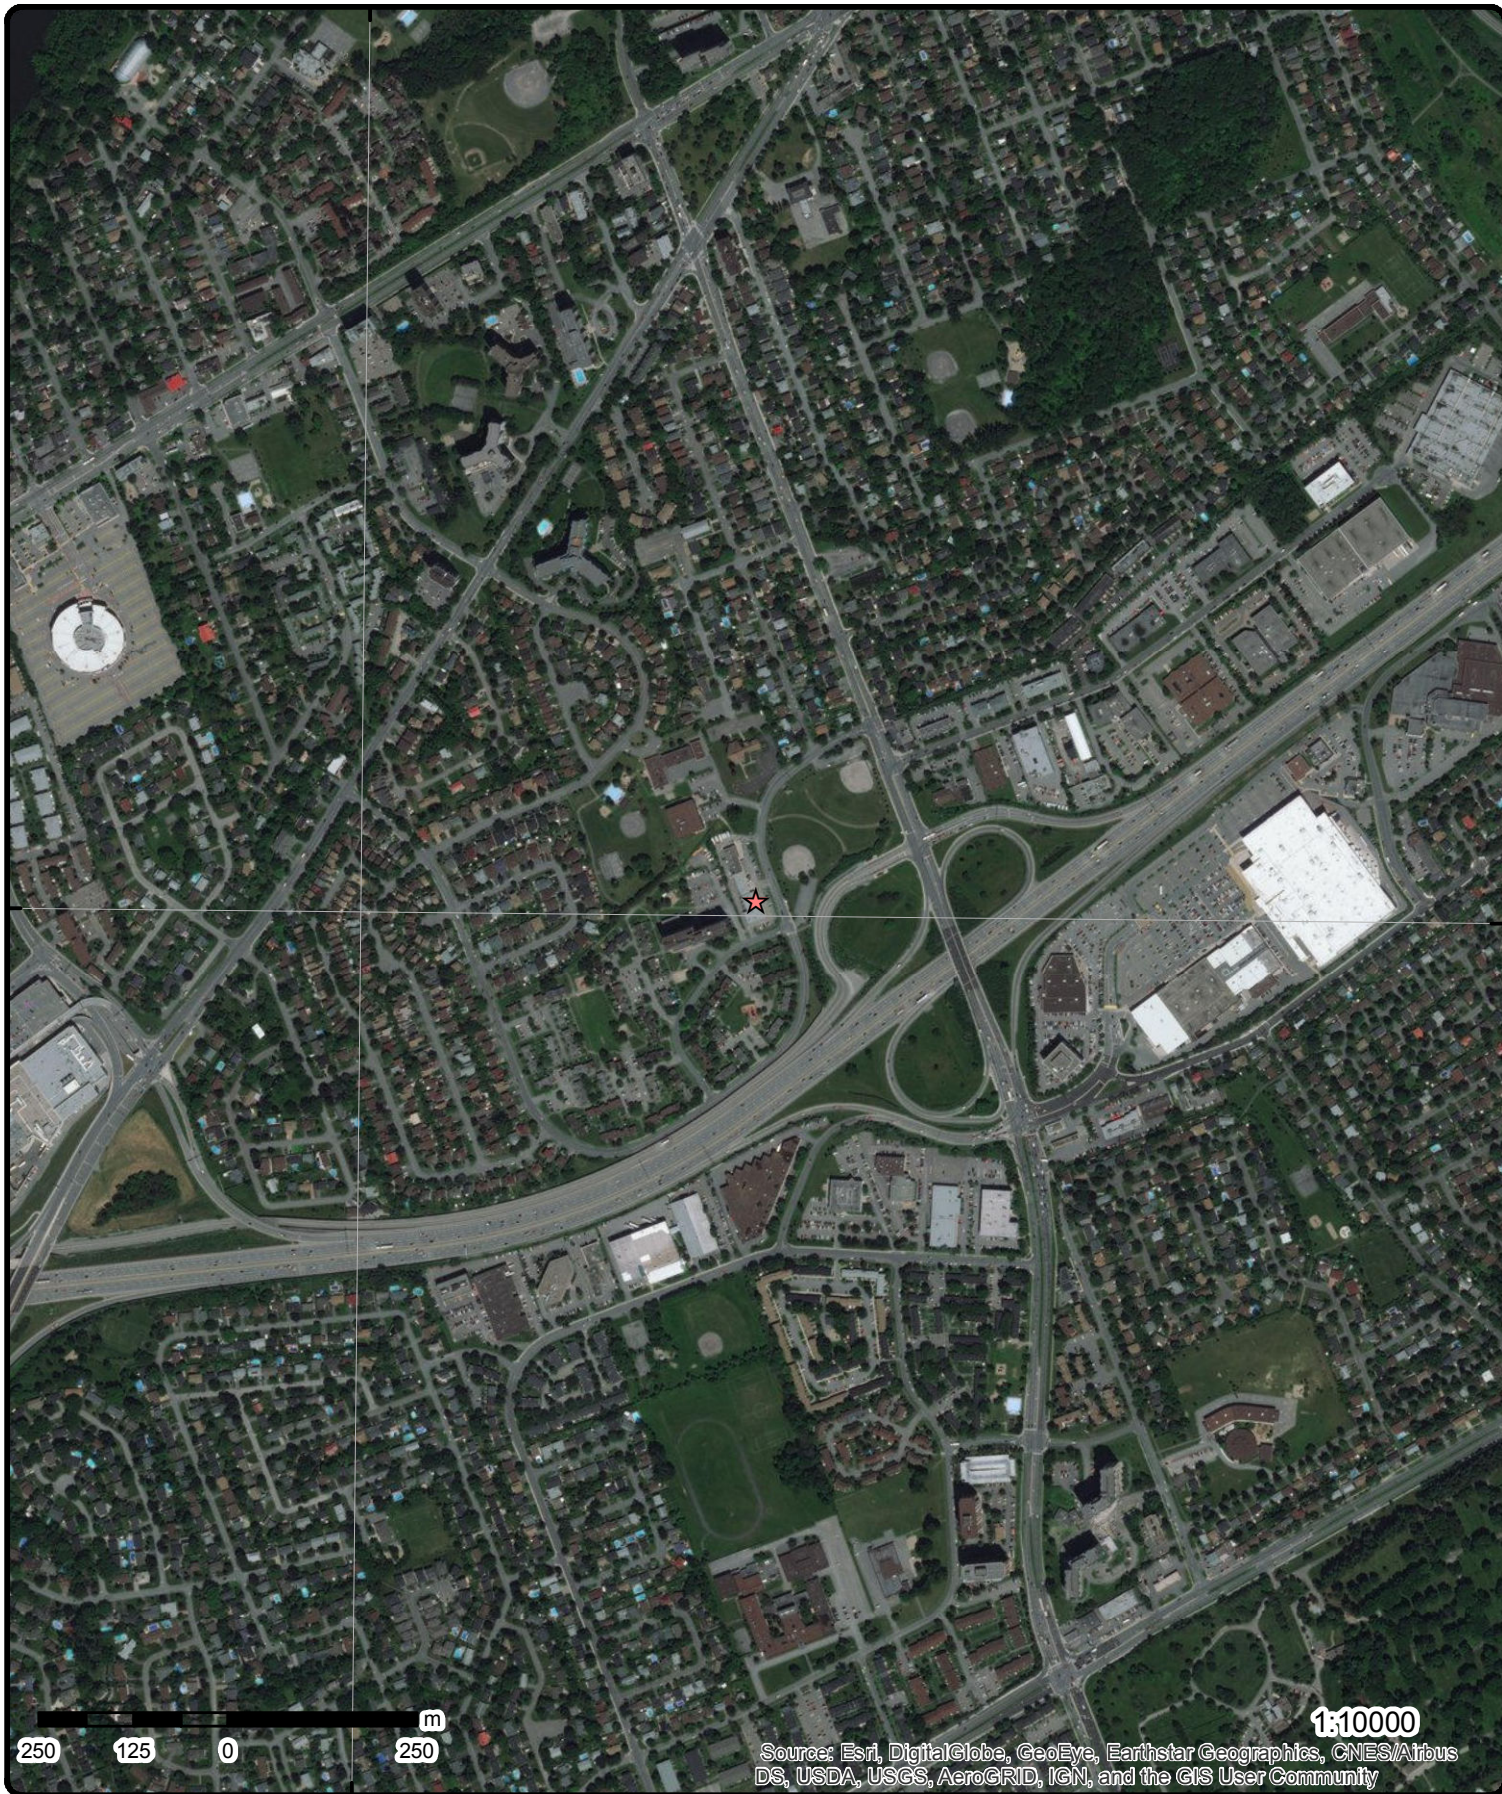

Aerial (2017)

Address: 2865 Dumauiier Avenue, Ottawa, ON K2B 7W3 CA

Source: ESRI World Imagery

Order No: 20180808091



© ERIS Information Limited Partnership



Sources: Esri, HERE, Garmin, Intermap, increment P Corp., GEBCO, USGS, FAO, NPS, NRCAN, GeoBase, IGN, Kadaster NL, Ordnance Survey, Esri Japan, METI, Esri China (Hong Kong), Swisstopo, © OpenStreetMap contributors, and the GIS User Community

Topographic Map

Address: 2865 Dumaurier Avenue, Ottawa, ON K2B 7W3 CA

Source: ESRI World Topographic Map

Order No: 20180808091



© ERIS Information Limited Partnership

Detail Report

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|---|-------------------|----------------------------|------------------|--|-----|
| <p>2</p> <p>Order ID: 265335 Order No: 20130806035 Customer ID: 92028 Company ID: 77 Status: C Report Code: 4CAN Report Type: Custom Report Report Date: 13-AUG-13 Report Requested by: Pinchin Ltd Nearest Intersection: Previous Site Name: Additional Info Ordered:</p> | 1 of 4 | S/11.7 | 72.1 / 0.00 | 2865 Dumaaurier Ave Ottawa ON K2B7W3 | EHS |
| <p>2</p> <p>Licence No: Detail Licence No: Licence Type Code: 23 Licence Type: Limited Vendor Licence Class: Licence Control: Trade Name: Post Office Box: Lot: Concession: Region: District: County:</p> | 2 of 4 | S/11.7 | 72.1 / 0.00 | GIANT TIGER STORE # 22 - ISHIKO LIMITED 2865 DUMAURIER AVE OTTAWA ON K2B7W3 | PES |
| <p>2</p> <p>Licence No: Detail Licence No: Licence Type Code: Licence Type: Vendor Licence Class: Licence Control: Trade Name: Post Office Box: Lot: Concession: Region: District: County:</p> | 3 of 4 | S/11.7 | 72.1 / 0.00 | GIANT TIGER STORE # 22 - ISHIKO LIMITED 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | PES |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|--|-------------------|---|------------------|--|------|
| <u>2</u> | 4 of 4 | S/11.7 | 72.1 / 0.00 | GIANT TIGER STORE # 22 - ISHIKO LIMITED 2865 DUMAURIER AVE OTTAWA ON K2B 7W3 | PES |
| Licence No: Detail Licence No: 23-01-13515-0 Licence Type Code: Licence Type: LIMITED Licence Class: Licence Control: Trade Name: Post Office Box: Lot: Concession: Region: District: County: | | Operator Box: Operator Class: Operator No: Operator Type: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Oper Phone Area Cd: Ext: Oper Phone No: Proponent Ext: | | | |
| <u>1</u> | 1 of 1 | NNE/11.1 | 72.1 / 0.00 | Pinecrest Rd. & DuMaurier Ave. OTTAWA ON | WDSH |
| Site No.: X1006 Region: SOUTHEAST County: OTTAWA CARLETON Concession: Lot: Pinecrest Rd. & DuMaurier Ave. Easting:: 437860 Northing:: 5021950 Zone:: 18 Date Closed: Status:: CLOSED Classification:: A5 - POTENTIAL HUMAN IMPACT-URBAN MUNICIPAL/DOMESTIC WASTE - CLOSED 10-20 YRS %CommercialWste:: n/a %DomesticWste Rec:: n/a %LiquidWste Rec:: n/a %HazardousWste Rec:: n/a %Non-haz.Wste Rec:: n/a %Sewage/Sludge Rec:: n/a %Other Wste Rec:: n/a | | | | | |
| <u>3</u> | 1 of 1 | ENE/31.8 | 71.9 / -0.19 | Pinecrest & DuMaurier Dump Ottawa ON K2B | ANDR |
| Legal Description: Nepean Con 2 Lot 20 pt Location Description: Pinecrest Rd & DuMaurier Ave, 100m S of Sprague Ave*, 100m N of DuMaurier Ave*, 100m W of Pinecrest Rd* Municipality: Ottawa City Current Municipality: Ottawa City RM: Ottawa-Carleton Region Facility: Dump Date Active: 1950s? Date Begun: Date Complete: Area (Ha): Landfill Type: Group Name: Operated By: Serial: MOEE 1006 NTS: 31G05 Diameter (m): | | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|---------|-------------------|----------------------------|------------------|------|----|
|---------|-------------------|----------------------------|------------------|------|----|

Historical Summary:

Pinecrest & DuMaurier Dump MOEE 1994 Pinecrest Rd & DuMaurier Ave cited as closed waste disposal site (Ontario Ministry of the Environment [1994] Waste disposal site inventory, [Toronto]: Ontario Environment, 1994., i, 196 pp., maps, ISBN 0772984093). datapoint plots to Nepean Con 2 Lot 20 pt. 1954 Airphotomap Slight ground disturbance visible at or near this location [YUML: 1954 Airphotomap 453754E]. 1965 Military Town Plan ASE 306 Not marked, partly wooded site [1965 Military Town Plan Ottawa-Hull ASE 306 Edition 1 (produced 1965)]. 1968 NTS Map 31G05 Not marked, site is 100m S of Sprague Ave*, 100m N of DuMaurier Ave*, 100m W of Pinecrest Rd* [1968 NTS Map Ottawa-Hull Sheet 31G05 edition 7 (air photos 1967, publication 1968)]. 1973 Military Town Plan MCE 306 Not marked [1973 Military Town Plan Ottawa-Hull MCE 306 Edition 2 (information 1972, produced 1973)]. 1976 NTS Map 31G05 Not marked [1976 NTS Map Ottawa-Hull Sheet 31G05 edition 8 (air photos 1975, culture check 1975, information 1975, publication 1976)]. 1982 Military Town Plan MCE 306 Not marked [1982 Military Town Plan Ottawa-Hull MCE 306 Edition 5 (information 1980, produced 1982)]. 1983 NTS Map 31G05 Not marked [1983 NTS Map Ottawa-Hull Sheet 31G05 edition 9 (air photos 1979, culture check 1979, publication 1983)]. 1987 NTS Map 31G05 Not marked [1987 NTS Map Ottawa-Hull Sheet 31G05 edition 10 (air photos 1984, culture check 1985, publication 1987)]. *[1992] MapArt Corporation Ontario, Towns and Cities [Street Atlas].

Waste Type:

UTM X Nad 27: 437860
UTM Y Nad 27: 5021950
UTM Zone: 18

| | | | | | |
|--------------------------|---|---------|--------------|--|---------------|
| 4 | 1 of 2 | SE/66.9 | 70.9 / -1.19 | City of Ottawa Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | ECA |
| Approval No: | 2842-7AQRZZ | | | SWP Area Name: | Rideau Valley |
| Approval Date: | 2008-01-30 | | | MOE District: | Ottawa |
| Status: | Approved | | | City: | Ottawa |
| Record Type: | ECA | | | Longitude: | -75.7928 |
| Link Source: | IDS | | | Latitude: | 45.3497 |
| Approval Type: | ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS | | | | |
| Project Type: | MUNICIPAL AND PRIVATE SEWAGE WORKS | | | | |
| Address: | Bayshore Transit Station to Pinecrest Road | | | | |
| Full Address: | | | | | |
| Full PDF Link: | https://www.accessenvironment.ene.gov.on.ca/instruments/6172-74LPZS-14.pdf | | | | |
| 4 | 2 of 2 | SE/66.9 | 70.9 / -1.19 | City of Ottawa Bayshore Transit Station to Pinecrest Road Ottawa ON K1P 1J1 | ECA |
| Approval No: | 9001-776HB6 | | | SWP Area Name: | Rideau Valley |
| Approval Date: | 2007-09-18 | | | MOE District: | Ottawa |
| Status: | Approved | | | City: | Ottawa |
| Record Type: | ECA | | | Longitude: | -75.7928 |
| Link Source: | IDS | | | Latitude: | 45.3497 |
| Approval Type: | ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS | | | | |
| Project Type: | MUNICIPAL AND PRIVATE SEWAGE WORKS | | | | |
| Address: | Bayshore Transit Station to Pinecrest Road | | | | |
| Full Address: | | | | | |
| Full PDF Link: | https://www.accessenvironment.ene.gov.on.ca/instruments/6041-76JHVU-14.pdf | | | | |
| 5 | 1 of 2 | SW/88.4 | 73.0 / 0.90 | Ottawa Community Housing Corporation 1065 Ramsey Crescent Ottawa ON | CA |
| Certificate #: | 6610-5HUS4N | | | | |
| Application Year: | 2003 | | | | |
| Issue Date: | 1/18/2003 | | | | |
| Approval Type: | Air | | | | |
| Status: | Approved | | | | |
| Application Type: | | | | | |
| Client Name:: | | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|---|-------------------|----------------------------|------------------|---|-----|
| Client Address:: Client City:: Client Postal Code:: Project Description:: Contaminants:: Emission Control:: | | | | | |
| 5 | 2 of 2 | SW/88.4 | 73.0 / 0.90 | UNKNOWN 1065 RAMSEY CRESC., OTTAWA/CARLETON REGIONAL HOUSING AUTHORITY COMPLEX. OTTAWA CITY ON K2B 8A1 | SPL |
| Ref No: 115040 Site No: Incident Dt: 6/28/1995 Year: Incident Cause: UNKNOWN Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Contaminant Qty: Environment Impact: POSSIBLE Nature of Impact: Water course or lake Receiving Medium: WATER Receiving Env: Health/Env Conseq: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 6/28/1995 Dt Document Closed: SAC Action Class: Incident Reason: INTENTIONAL/PLANNED Incident Summary: SOURCE UNKNOWN: MOTOR OILDUMPED IN STORM C.B.,E.G.NUMBER ISSUED TO DRAINALL | | | | | |
| 6 | 1 of 1 | NNW/130.6 | 75.9 / 3.81 | 2825 Dumaaurier Ave. Ottawa ON K2B 7W3 | EHS |
| Order ID: 98543 Order No: 20070410010 Customer ID: 47508 Company ID: 97 Status: C Report Code: 3CAN Report Type: CAN - Complete Report Report Date: 4/13/2007 Report Requested by: Trow Associates Inc. Nearest Intersection: Previous Site Name: Additional Info Ordered: Fire Insur. Maps And /or Site Plans | | | | | |
| 7 | 1 of 3 | NNW/189.5 | 76.8 / 4.78 | CONSEIL SCOLAIRE DE LANGUE FRANCAIS ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | GEN |
| Generator No.: ON1285754 Status: Approval Years: 94,95,96 PO Box No.: Country: Choice of Contact: | | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|--|---|----------------------------|--------------------|---|------------|
| Contam. Facility: MHSW Facility: SIC Code: SIC Description: | 8511 | ELEMT./SECON. EDUC. | | Co Admin: Phone No. Admin: | |
| --Details-- | | | | | |
| Waste Code: Waste Description: | | 243 PCB'S | | | |
| 7 | 2 of 3 | NNW/189.5 | 76.8 / 4.78 | CONSEIL DES ECOLES PUBLIQUES FRANCO-NATIONS 1085, AVENUE GRENON OTTAWA ON K2B 8L7 | GEN |
| Generator No.: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description: | ON1879409 94,95,96,97,98 8511 | ELEMT./SECON. EDUC. | | PO Box No.: Country: Choice of Contact: Co Admin: Phone No. Admin: | |
| --Details-- | | | | | |
| Waste Code: Waste Description: | | 243 PCB'S | | | |
| 7 | 3 of 3 | NNW/189.5 | 76.8 / 4.78 | CONSEIL (OUT OF BUS) ECOLE FRANCO-NATIONS 1085 AVE GRENON OTTAWA ON K2B 8L7 | GEN |
| Generator No.: Status: Approval Years: Contam. Facility: MHSW Facility: SIC Code: SIC Description: | ON1285754 97,98 8511 | ELEMT./SECON. EDUC. | | PO Box No.: Country: Choice of Contact: Co Admin: Phone No. Admin: | |
| --Details-- | | | | | |
| Waste Code: Waste Description: | | 243 PCB'S | | | |
| 8 | 1 of 1 | NNE/192.7 | 75.6 / 3.53 | OTTAWA CITY DUMAUER AVE. NEAR WATSON ST. OTTAWA CITY ON | CA |
| Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name:: Client Address:: Client City:: Client Postal Code:: Project Description:: Contaminants:: Emission Control:: | 8-4101-87- 87 5/13/1988 Industrial air Approved in 1988 LANDFILL GAS VENT Methane (Incl. Hydrocarbons Expr. As Ch4 No Controls | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|--|-------------------|----------------------------|------------------|---|------|
| 9 | 1 of 1 | S/194.4 | 69.7 / -2.32 | 2921 DUMAURIER AVENUE OTTAWA ON K2B 8A2 | HINC |
| <p>External File Num: FS INC 0710-05604 Date of Occurrence: 9/17/2007 Fuel Occurrence Type: Pipeline Strike Fuel Type Involved: Natural Gas Status Desc:: Completed - Causal Analysis(End) Job Type Desc:: Incident/Near-Miss Occurrence (FS) Oper. Type Involved:: Construction Site (pipeline strike) Service Interruptions:: No Property Damage:: No Fuel Life Cycle Stage:: Transmission, Distribution and Transportation Root Cause:: Root Cause: Equipment/Material/Component:No Procedures:No Maintenance:No Design:No Training:No Management:Yes Human Factors:No</p> <p>Reported Details:: Fuel Category:: Gaseous Fuel Occurrence Type:: Incident Affiliation:: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) County Name:: Ottawa Approx. Quant. Rel:: Nearby body of water:: Enter Drainage Syst.:: Approx. Quant. Unit:: Environmental Impact::</p> | | | | | |
| 10 | 1 of 1 | ESE/203.3 | 69.3 / -2.73 | ON | BORE |
| <p>Borehole ID: 610827 Use: Drill Method:: Easting:: 438041 Location Accuracy:: Elev. Reliability Note:: Total Depth m:: -999 Township:: Lot:: Completion Date:: Primary Water Use::</p> <p>Type: Borehole Status:: UTM Zone:: 18 Northing:: 5022072 Orig. Ground Elev m:: 72.2 DEM Ground Elev m:: 70.9 Primary Name:: Concession:: Municipality: Static Water Level:: -999.9 Sec. Water Use::</p> <p>--Details-- Stratum ID: 218386655 Bottom Depth(m): 1.8 Top Depth(m): 0.0 Stratum Desc: FILL.</p> <p>Stratum ID: 218386656 Bottom Depth(m): Top Depth(m): 1.8 Stratum Desc: BEDROCK, SHALE. WEATHERED. LAYERED. SAND, CLAY. BROWN, GREY, FISSURED. SAND-FINE. VERY LOOSE. S</p> | | | | | |
| 11 | 1 of 1 | SSW/226.5 | 71.6 / -0.49 | Ottawa Community Housing Corporation 1095 Ramsey Crescent Ottawa ON K2B 7Z9 | SPL |
| <p>Ref No: 1237-7LWQCF Site No: Incident Dt: Year: Incident Cause: Other Discharges</p> <p>Discharger Report: Material Group: Client Type: Sector Type: Other Motor Vehicle Source Type:</p> | | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|-----------------------------|---|----------------------------|------------------|------------------------------|--|
| Incident Event: | | | | Nearest Watercourse: | |
| Contaminant Code: | 12 | | | Site Name: | Ottawa Community Housing Corporation<UNOFFICIAL> |
| Contaminant Name: | GASOLINE | | | Site Address: | |
| Contaminant Limit 1: | | | | Site District Office: | Ottawa |
| Contam Limit Freq 1: | | | | Site County/District: | |
| Contaminant UN No 1: | | | | Site Postal Code: | |
| Contaminant Qty: | 20 L | | | Site Region: | |
| Environment Impact: | Not Anticipated | | | Site Municipality: | Ottawa |
| Nature of Impact: | | | | Site Lot: | |
| Receiving Medium: | | | | Site Conc: | |
| Receiving Env: | | | | Northing: | |
| Health/Env Conseq: | | | | Easting: | |
| MOE Response: | No Field Response | | | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 12/1/2008 | | | Site Map Datum: | |
| Dt Document Closed: | 12/4/2008 | | | | |
| SAC Action Class: | Watercourse Spills | | | | |
| Incident Reason: | Unknown - Reason not determined | | | | |
| Incident Summary: | Ottawa Community Housing, Gas 20L to Cb Cln | | | | |

| <u>12</u> | 1 of 2 | ENE/230.7 | 72.8 / 0.73 | ON | BORE |
|---------------------------------|-----------|-----------|-------------|------------------------------|--|
| Borehole ID: | 610845 | | | Type: | Borehole |
| Use: | | | | Status:: | |
| Drill Method:: | | | | UTM Zone:: | 18 |
| Easting:: | 438051 | | | Northing:: | 5022282 |
| Location Accuracy:: | | | | Orig. Ground Elev m:: | 73.2 |
| Elev. Reliability Note:: | | | | DEM Ground Elev m:: | 73.7 |
| Total Depth m:: | 35.1 | | | Primary Name:: | |
| Township:: | | | | Concession:: | |
| Lot:: | | | | Municipality: | |
| Completion Date:: | NOV-1953 | | | Static Water Level:: | -999.9 |
| Primary Water Use:: | | | | Sec. Water Use:: | |
| --Details-- | | | | | |
| Stratum ID: | 218386706 | | | Top Depth(m): | 0.0 |
| Bottom Depth(m): | 4.6 | | | Stratum Desc: | SAND. BROWN. |
| Stratum ID: | 218386707 | | | Top Depth(m): | 4.6 |
| Bottom Depth(m): | 8.8 | | | Stratum Desc: | HARDPAN. |
| Stratum ID: | 218386708 | | | Top Depth(m): | 8.8 |
| Bottom Depth(m): | 32.0 | | | Stratum Desc: | LIMESTONE. |
| Stratum ID: | 218386709 | | | Top Depth(m): | 32.0 |
| Bottom Depth(m): | 35.1 | | | Stratum Desc: | SHALE,SANDSTONE. BLACK. 00112DOLOMITE. BEDROCK,DOLOMITE. BEDROCK,DOLOMITE. 00000 020 0 |

| <u>12</u> | 2 of 2 | ENE/230.7 | 72.8 / 0.73 | ON | WWIS |
|---------------------------|--------------|-----------|-------------|---------------------------|----------|
| Well ID: | 1508638 | | | Data Entry Status: | |
| Construction Date: | | | | Data Src: | 1 |
| Primary Water Use: | Domestic | | | Date Received: | 1/6/1954 |
| Sec. Water Use: | 0 | | | Selected Flag: | Yes |
| Final Well Status: | Water Supply | | | Abandonment Rec: | |
| Water Type: | | | | Contractor: | 3566 |
| Casing Material: | | | | Form Version: | 1 |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|--|-------------------|----------------------------|------------------|---|----|
| Audit No: Tag: Construction Method: Elevation (m): Elevation Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Flowing (Y/N): Flow Rate: Clear/Cloudy: | | | | Owner: Street Name: County: OTTAWA-CARLETON Municipality: OTTAWA CITY Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: | |
| <u>Bore Hole Information</u> | | | | | |
| Bore Hole ID: 10030672 DP2BR: 29 Spatial Status: Code OB: r Code OB Desc: Bedrock Open Hole: Cluster Kind: Date Completed: 18-NOV-53 Remarks: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: | | | | Elevation: 73.72 Elevrc: Zone: 18 East83: 438050.7 Org CS: North83: 5022282 UTMRC: 9 UTMRC Desc: unknown UTM Location Method: p9 | |
| <u>Overburden and Bedrock</u> | | | | | |
| <u>Materials Interval</u> | | | | | |
| Formation ID: 931010204 Layer: 2 Color: General Color: Mat1: 14 Most Common Material: HARDPAN Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth: 15 Formation End Depth: 29 Formation End Depth UOM: ft | | | | | |
| Formation ID: 931010203 Layer: 1 Color: 6 General Color: BROWN Mat1: 09 Most Common Material: MEDIUM SAND Mat2: Other Materials: Mat3: Other Materials: Formation Top Depth: 0 Formation End Depth: 15 Formation End Depth UOM: ft | | | | | |
| Formation ID: 931010205 | | | | | |

| Map Key | Number of Records | Direction/ Distance (m) | Elev/Diff (m) | Site | DB |
|---|--------------------------|------------------------------------|--------------------------|-------------|-----------|
| Layer: | | 3 | | | |
| Color: | | | | | |
| General Color: | | | | | |
| Mat1: | | 15 | | | |
| Most Common Material: | | LIMESTONE | | | |
| Mat2: | | | | | |
| Other Materials: | | | | | |
| Mat3: | | | | | |
| Other Materials: | | | | | |
| Formation Top Depth: | | 29 | | | |
| Formation End Depth: | | 105 | | | |
| Formation End Depth UOM: | | ft | | | |
| Formation ID: | | 931010206 | | | |
| Layer: | | 4 | | | |
| Color: | | 8 | | | |
| General Color: | | BLACK | | | |
| Mat1: | | 17 | | | |
| Most Common Material: | | SHALE | | | |
| Mat2: | | 18 | | | |
| Other Materials: | | SANDSTONE | | | |
| Mat3: | | | | | |
| Other Materials: | | | | | |
| Formation Top Depth: | | 105 | | | |
| Formation End Depth: | | 115 | | | |
| Formation End Depth UOM: | | ft | | | |
| <u>Method of Construction & Well Use</u> | | | | | |
| Method Construction ID: | | 961508638 | | | |
| Method Construction Code: | | 1 | | | |
| Method Construction: | | Cable Tool | | | |
| Other Method Construction: | | | | | |
| <u>Pipe Information</u> | | | | | |
| Pipe ID: | | 10579242 | | | |
| Casing No: | | 1 | | | |
| Comment: | | | | | |
| Alt Name: | | | | | |
| <u>Construction Record - Casing</u> | | | | | |
| Casing ID: | | 930053975 | | | |
| Layer: | | 2 | | | |
| Material: | | 4 | | | |
| Open Hole or Material: | | OPEN HOLE | | | |
| Depth From: | | | | | |
| Depth To: | | 115 | | | |
| Casing Diameter: | | 4 | | | |
| Casing Diameter UOM: | | inch | | | |
| Casing Depth UOM: | | ft | | | |
| Casing ID: | | 930053974 | | | |
| Layer: | | 1 | | | |
| Material: | | 1 | | | |
| Open Hole or Material: | | STEEL | | | |
| Depth From: | | | | | |
| Depth To: | | 30 | | | |
| Casing Diameter: | | 4 | | | |
| Casing Diameter UOM: | | inch | | | |
| Casing Depth UOM: | | ft | | | |

| <i>Map Key</i> | <i>Number of Records</i> | <i>Direction/ Distance (m)</i> | <i>Elev/Diff (m)</i> | <i>Site</i> | <i>DB</i> |
|----------------|--------------------------|--------------------------------|----------------------|-------------|-----------|
|----------------|--------------------------|--------------------------------|----------------------|-------------|-----------|

Results of Well Yield Testing

Pump Test ID: 991508638
Pump Set At:
Static Level: 38
Final Level After Pumping: 48
Recommended Pump Depth:
Pumping Rate: 6
Flowing Rate:
Recommended Pump Rate:
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN: 0
Flowing: N

Water Details

Water ID: 933463247
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 70
Water Found Depth UOM: ft

Water ID: 933463248
Layer: 2
Kind Code: 1
Kind: FRESH
Water Found Depth: 112
Water Found Depth UOM: ft

Unplottable Summary

Total: 20 Unplottable sites

| DB | Company Name/Site Name | Address | City | Postal |
|-----|----------------------------------|--|----------------|--------|
| CA | City of Ottawa | Bayshore Station to Pinecrest Road | Ottawa ON | |
| CA | CAMPEAU CORP. | PINECREST OFFICE PARK | OTTAWA CITY ON | |
| CA | R.M. OF OTTAWA-CARLETON | PINECREST RD., WEST TRANSITWAY | NEPEAN CITY ON | |
| CA | REG.MUN.OF OTTAWA-CARLETON | QUEENSWAY N. | OTTAWA ON | |
| CA | SAKTO DEVELOPMENTS | PRESTON ST. QUEENSWAY CENTRE | OTTAWA CITY ON | |
| CA | City of Ottawa | Bayshore Transit Station to Pinecrest Road | Ottawa ON | |
| CA | R.M. OF OTTAWA-CARLETON | MCEWEN AVE./PINECREST COLL. | OTTAWA CITY ON | |
| CA | CAMPEAU CORP. | PINECREST OFFICE PARK | OTTAWA CITY ON | |
| EBR | Laurent Leblanc Ltd., | Watson Road, Lot 13, Concession 4, formerly the Township of Cumberland (geographic township). CITY OF OTTAWA | ON | |
| SPL | OTTAWA STRUCTURAL CONCRETE SER | GRAHAM CREEK AT QUEENSWAY FROM BAYSHORE SHOPP'G CTRE. | NEPEAN CITY ON | |
| SPL | | Watson Mill Dam - Manitec | Ottawa ON | |
| SPL | TRANSPORT TRUCK | QUEENSWAY MOTOR VEHICLE (OPERATING FLUID) | OTTAWA CITY ON | |
| SPL | TRANSPORT TRUCK | EAST SIDE OF QUEENSWAY (HIGHWAY 417) BETWEEN MOODIE & EAGLESON ROADS. TRANSPORT TRUCK (CARGO) | NEPEAN CITY ON | |
| SPL | City of Ottawa | Bike path north of Hurdman/Queensway Bridge | Ottawa ON | |
| SPL | Loblaws Company East<UNOFFICIAL> | Queensway, from Greenbank Exit to 1735 Iris Road (Pine Crest Shopping Centre - in front of IKEA)<UNOFFICIAL> | Ottawa ON | |
| SPL | BUS | RAMSEY CRESCENT AND DU MAURIER INTERSECTION. MOTOR VEHICLE (OPERATING FLUID) | OTTAWA CITY ON | |
| SPL | OTTAWA-CARLETON TRANSIT | MOODIE BETWEEN QUEENSWAY AND | OTTAWA CITY ON | |

| | | | |
|-----|---------------|--|----------------|
| | | CARLING AVE, CARLING E AND W TO CORKSTOWN ROAD | |
| SPL | TANK TRUCK | QUEENSWAY (EASTBOUND) BETWEEN EAGLESON AND MOODY TANK TRUCK (CARGO) | NEPEAN CITY ON |
| SPL | O.C. TRANSPOR | PINECREST STATION IN QUEENSDALE OTTAWA SITE 1500 ST. LAURENT BOULEVARD | OTTAWA CITY ON |
| SPL | UNKNOWN | BLAIR STATION AND QUEENSWAY | OTTAWA CITY ON |

Unplottable Report

Site: *City of Ottawa
Bayshore Station to Pinecrest Road Ottawa ON*

Database:
CA

Certificate #: 2842-7AQRZZ
Application Year: 2008
Issue Date: 1/30/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: *CAMPEAU CORP.
PINECREST OFFICE PARK OTTAWA CITY ON*

Database:
CA

Certificate #: 3-1380-85-006
Application Year: 85
Issue Date: 11/15/85
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: *R.M. OF OTTAWA-CARLETON
PINECREST RD., WEST TRANSITWAY NEPEAN CITY ON*

Database:
CA

Certificate #: 3-0011-99-
Application Year: 99
Issue Date: 2/22/1999
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: *REG.MUN.OF OTTAWA-CARLETON
QUEENSWAY N. OTTAWA ON*

Database:
CA

Certificate #: 3-0468-85-006
Application Year: 85

Issue Date: 6/4/85
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: **SAKTO DEVELOPMENTS**
PRESTON ST. QUEENSWAY CENTRE OTTAWA CITY ON

Database:
CA

Certificate #: 7-1268-88-
Application Year: 88
Issue Date: 8/16/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: **City of Ottawa**
Bayshore Transit Station to Pinecrest Road Ottawa ON

Database:
CA

Certificate #: 9001-776HB6
Application Year: 2007
Issue Date: 9/18/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: **R.M. OF OTTAWA-CARLETON**
MCEWEN AVE./PINECREST COLL. OTTAWA CITY ON

Database:
CA

Certificate #: 3-1219-93-
Application Year: 93
Issue Date: 10/26/1993
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: CAMPEAU CORP.
PINECREST OFFICE PARK OTTAWA CITY ON

Database:
CA

Certificate #: 7-1039-85-006
Application Year: 85
Issue Date: 11/15/85
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name::
Client Address::
Client City::
Client Postal Code::
Project Description::
Contaminants::
Emission Control::

Site: Laurent Leblanc Ltd.,
Watson Road, Lot 13, Concession 4, formerly the Township of Cumberland (geographic township). CITY OF
OTTAWA ON

Database:
EBR

Company Name: Laurent Leblanc Ltd.,
EBR Registry No.: IB06E2033
Ministry Ref. No.: FSD KEM 02/06
Notice Type: Instrument Decision
Notice Date: March 22, 2016
Proposal Date: May 01, 2006
Year: 2006
Proponent Address: 3000 Navan Road, Gloucester Ontario, K1C 7G4
Instrument Type: (ARA s. 13 (2)) - Add, rescind, or vary a condition of a licence
Location Other:

Location:

Watson Road, Lot 13, Concession 4, formerly the Township of Cumberland (geographic township). CITY OF OTTAWA

Site: OTTAWA STRUCTURAL CONCRETE SER
GRAHAM CREEK AT QUEENSWAY FROM BAYSHORE SHOPP'G CTRE. NEPEAN CITY ON

Database:
SPL

| | |
|--|--|
| Ref No: 74243 | Discharger Report: |
| Site No: | Material Group: |
| Incident Dt: 7/27/1992 | Client Type: |
| Year: | Sector Type: |
| Incident Cause: OTHER CAUSE (N.O.S.) | Source Type: |
| Incident Event: | Nearest Watercourse: |
| Contaminant Code: | Site Name: |
| Contaminant Name: | Site Address: |
| Contaminant Limit 1: | Site District Office: |
| Contam Limit Freq 1: | Site County/District: |
| Contaminant UN No 1: | Site Postal Code: |
| Contaminant Qty: | Site Region: |
| Environment Impact: CONFIRMED | Site Municipality: 20104 |
| Nature of Impact: Water course or lake | Site Lot: |
| Receiving Medium: WATER | Site Conc: |
| Receiving Env: | Northing: |
| Health/Env Conseq: | Easting: REGION OF OTTAWA-CARLTON |
| MOE Response: | Site Geo Ref Accu: |
| Dt MOE Arvl on Scn: | Site Geo Ref Meth: |
| MOE Reported Dt: 7/27/1992 | Site Map Datum: |
| Dt Document Closed: | |
| SAC Action Class: | |
| Incident Reason: NEGLIGENCE (APPARENT) | |
| Incident Summary: OTTAWA STRUCT'L CONCRETE -WASHED OUT CONTAINERS IN STORM DRAIN. | |

Site: Watson Mill Dam - Manitec Ottawa ON

Database:
SPL

| | | | |
|-----------------------------|---|------------------------------|--------------------------|
| Ref No: | 4685-7ETJRK | Discharger Report: | |
| Site No: | | Material Group: | |
| Incident Dt: | | Client Type: | |
| Year: | | Sector Type: | Pleasure Craft |
| Incident Cause: | Ship's Tank / Bilge Pumping | Source Type: | |
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | 12 | Site Name: | Ottawa River<UNOFFICIAL> |
| Contaminant Name: | GASOLINE | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | Ottawa |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | other - see incident description | Site Region: | |
| Environment Impact: | Possible | Site Municipality: | Ottawa |
| Nature of Impact: | Surface Water Pollution | Site Lot: | |
| Receiving Medium: | | Site Conc: | |
| Receiving Env: | | Northing: | |
| Health/Env Conseq: | | Easting: | |
| MOE Response: | | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 5/20/2008 | Site Map Datum: | |
| Dt Document Closed: | 5/23/2008 | | |
| SAC Action Class: | Watercourse Spills | | |
| Incident Reason: | Spill | | |
| Incident Summary: | Ottawa River: Gas spill from pleasure craft | | |

Site: TRANSPORT TRUCK
QUEENSWAY MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
SPL

| | | | |
|-----------------------------|--|------------------------------|-----------------|
| Ref No: | 224201 | Discharger Report: | |
| Site No: | | Material Group: | |
| Incident Dt: | 4/19/2002 | Client Type: | |
| Year: | | Sector Type: | |
| Incident Cause: | OTHER TRANSPORTATION ACCIDENT | Source Type: | |
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | | Site Name: | |
| Contaminant Name: | | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | | Site Region: | |
| Environment Impact: | CONFIRMED | Site Municipality: | 20107 |
| Nature of Impact: | Soil contamination | Site Lot: | |
| Receiving Medium: | LAND | Site Conc: | |
| Receiving Env: | | Northing: | |
| Health/Env Conseq: | | Easting: | OPP-KANATA; MTO |
| MOE Response: | | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 4/19/2002 | Site Map Datum: | |
| Dt Document Closed: | | | |
| SAC Action Class: | | | |
| Incident Reason: | ERROR | | |
| Incident Summary: | LOBLAWS: 450L DIESEL FROMTRUCK TO ROAD ONLY; OPP; MTO. | | |

Site: TRANSPORT TRUCK
EAST SIDE OF QUEENSWAY (HIGHWAY 417) BETWEEN MOODIE & EAGLESON ROADS. TRANSPORT TRUCK
(CARGO) NEPEAN CITY ON

Database:
SPL

| | | | |
|--------------------------|----------------------|-----------------------------|--|
| Ref No: | 76887 | Discharger Report: | |
| Site No: | | Material Group: | |
| Incident Dt: | 9/28/1992 | Client Type: | |
| Year: | | Sector Type: | |
| Incident Cause: | OTHER CONTAINER LEAK | Source Type: | |
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | | Site Name: | |

| | | | |
|-----------------------------|--|------------------------------|-----------|
| Contaminant Name: | | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | | Site Region: | |
| Environment Impact: | NOT ANTICIPATED | Site Municipality: | 20104 |
| Nature of Impact: | Soil contamination | Site Lot: | |
| Receiving Medium: | LAND | Site Conc: | |
| Receiving Env: | | Northing: | |
| Health/Env Conseq: | | Easting: | F.D., MTO |
| MOE Response: | | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 9/28/1992 | Site Map Datum: | |
| Dt Document Closed: | | | |
| SAC Action Class: | | | |
| Incident Reason: | UNKNOWN | | |
| Incident Summary: | TRANSPORT TRUCK-30 L DIESEL FUEL TO DITCH. | | |

| | | | |
|-----------------------------|---|------------------------------|---|
| Site: | City of Ottawa Bike path north of Hurdman/Queensway Bridge Ottawa ON | Database: | SPL |
| Ref No: | 7517-7QRMF9 | Discharger Report: | |
| Site No: | | Material Group: | |
| Incident Dt: | | Client Type: | |
| Year: | | Sector Type: | Sewer |
| Incident Cause: | Unknown | Source Type: | |
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | | Site Name: | City Storm Sewer Outfall to Rideau River- Bike Path<UNOFFICIAL> |
| Contaminant Name: | OIL (PETROLEUM BASED, NOT SPECIFIED) | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | | Site Region: | |
| Environment Impact: | Not Anticipated | Site Municipality: | Ottawa |
| Nature of Impact: | | Site Lot: | |
| Receiving Medium: | | Site Conc: | |
| Receiving Env: | | Northing: | |
| Health/Env Conseq: | | Easting: | |
| MOE Response: | Planned Field Response | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 4/3/2009 | Site Map Datum: | |
| Dt Document Closed: | | | |
| SAC Action Class: | Pollution Incident Reports (PIRs) and ¿Other¿ calls | | |
| Incident Reason: | | | |
| Incident Summary: | Ottawa Rideau River - oily sheen water from storm outfall | | |

| | | | |
|-----------------------------|--|------------------------------|--|
| Site: | Loblaws Company East<UNOFFICIAL> Queensway, from Greenbank Exit to 1735 Iris Road (Pine Crest Shopping Centre - in front of IKEA)<UNOFFICIAL> Ottawa ON | Database: | SPL |
| Ref No: | 6833-6H4GWP | Discharger Report: | 0 |
| Site No: | | Material Group: | Oil |
| Incident Dt: | 10/12/2005 | Client Type: | |
| Year: | | Sector Type: | Other Motor Vehicle |
| Incident Cause: | Pipe Or Hose Leak | Source Type: | |
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | | Site Name: | Queensway, from Greenbank Exit to 1735 Iris Road |
| Contaminant Name: | DIESEL FUEL | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | Ottawa |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | | Site Region: | |
| Environment Impact: | Not Anticipated | Site Municipality: | Ottawa |
| Nature of Impact: | | Site Lot: | |
| Receiving Medium: | Land | Site Conc: | |

Receiving Env:
Health/Env Conseq:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 10/12/2005
Dt Document Closed:
SAC Action Class: Land Spills
Incident Reason: Unknown - Reason not determined
Incident Summary: Loblaws: 10 to 15 L diesel to road/parking lot

Northing:
Easting:
Site Geo Ref Accu:
Site Geo Ref Meth:
Site Map Datum:

Site: **BUS**
RAMSEY CRESCENT AND DU MAURIER INTERSECTION. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
SPL

Ref No: 119082
Site No:
Incident Dt: 9/29/1995
Year:
Incident Cause: OTHER CONTAINER LEAK
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Contaminant Qty:
Environment Impact: NOT ANTICIPATED
Nature of Impact:
Receiving Medium: LAND
Receiving Env:
Health/Env Conseq:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 9/29/1995
Dt Document Closed:
SAC Action Class:
Incident Reason: EQUIPMENT FAILURE
Incident Summary: SCHOOL BUS-MOTOR OIL TO ROAD & INTERSECTION.

Discharger Report:
Material Group:
Client Type:
Sector Type:
Source Type:
Nearest Watercourse:
Site Name:
Site Address:
Site District Office:
Site County/District:
Site Postal Code:
Site Region:
Site Municipality: 20101
Site Lot:
Site Conc:
Northing:
Easting: OTTAWA CITY WORKS
Site Geo Ref Accu:
Site Geo Ref Meth:
Site Map Datum:

Site: **OTTAWA-CARLETON TRANSIT**
MOODIE BETWEEN QUEENSWAY AND CARLING AVE, CARLING E AND W TO CORKSTOWN ROAD OTTAWA CITY ON

Database:
SPL

Ref No: 223236
Site No:
Incident Dt: 3/13/2002
Year:
Incident Cause: PIPE/HOSE LEAK
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Contaminant Qty:
Environment Impact: POSSIBLE
Nature of Impact: Soil contamination
Receiving Medium: LAND
Receiving Env:
Health/Env Conseq:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 3/13/2002
Dt Document Closed:
SAC Action Class:
Incident Reason: UNKNOWN
Incident Summary: O/C TRANSIT BUS: LOST COOLENT ONTO ROADS. SEWER-MATIC CLEANING UP.

Discharger Report:
Material Group:
Client Type:
Sector Type:
Source Type:
Nearest Watercourse:
Site Name:
Site Address:
Site District Office:
Site County/District:
Site Postal Code:
Site Region:
Site Municipality: 20107
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Geo Ref Meth:
Site Map Datum:

Site: TANK TRUCK
QUEENSWAY (EASTBOUND) BETWEEN EAGLESON AND MOODY TANK TRUCK (CARGO) NEPEAN CITY ON

Database:
SPL

Ref No: 95884
Site No:
Incident Dt: 1/30/1994
Year:
Incident Cause: OTHER CONTAINER LEAK
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Contaminant Qty:
Environment Impact: NOT ANTICIPATED
Nature of Impact:
Receiving Medium: LAND
Receiving Env:
Health/Env Conseq:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 1/30/1994
Dt Document Closed:
SAC Action Class:
Incident Reason: UNKNOWN
Incident Summary: TANK TRUCK: 15 L FURNACE OIL TO ROAD

Discharger Report:
Material Group:
Client Type:
Sector Type:
Source Type:
Nearest Watercourse:
Site Name:
Site Address:
Site District Office:
Site County/District:
Site Postal Code:
Site Region:
Site Municipality: 20104
Site Lot:
Site Conc:
Northing:
Easting: FIRE DEPARTMENT, OPP
Site Geo Ref Accu:
Site Geo Ref Meth:
Site Map Datum:

Site: O.C. TRANSP
PINECREST STATION IN QUEENSDALE OTTAWA SITE 1500 ST. LAURENT BOULEVARD OTTAWA CITY ON

Database:
SPL

Ref No: 118820
Site No:
Incident Dt: 9/22/1995
Year:
Incident Cause: UNDERGROUND TANK LEAK
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Contaminant Qty:
Environment Impact: CONFIRMED
Nature of Impact: Soil contamination
Receiving Medium: LAND
Receiving Env:
Health/Env Conseq:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 9/22/1995
Dt Document Closed:
SAC Action Class:
Incident Reason: UNKNOWN
Incident Summary: O.C. TRANSP:DIESEL FUEL LEAK FOUND DURING LEAK DETECTION TESTING.

Discharger Report:
Material Group:
Client Type:
Sector Type:
Source Type:
Nearest Watercourse:
Site Name:
Site Address:
Site District Office:
Site County/District:
Site Postal Code:
Site Region:
Site Municipality: 20101
Site Lot:
Site Conc:
Northing:
Easting: MCCR
Site Geo Ref Accu:
Site Geo Ref Meth:
Site Map Datum:

Site: UNKNOWN
BLAIR STATION AND QUEENSWAY OTTAWA CITY ON

Database:
SPL

Ref No: 239018
Site No:
Incident Dt: 9/11/2002
Year:
Incident Cause: UNKNOWN

Discharger Report:
Material Group:
Client Type:
Sector Type:
Source Type:

| | | | |
|-----------------------------|--|------------------------------|-------|
| Incident Event: | | Nearest Watercourse: | |
| Contaminant Code: | | Site Name: | |
| Contaminant Name: | | Site Address: | |
| Contaminant Limit 1: | | Site District Office: | |
| Contam Limit Freq 1: | | Site County/District: | |
| Contaminant UN No 1: | | Site Postal Code: | |
| Contaminant Qty: | | Site Region: | |
| Environment Impact: | POSSIBLE | Site Municipality: | 20107 |
| Nature of Impact: | Water course or lake | Site Lot: | |
| Receiving Medium: | LAND, WATER | Site Conc: | |
| Receiving Env: | | Northing: | |
| Health/Env Conseq: | | Easting: | |
| MOE Response: | | Site Geo Ref Accu: | |
| Dt MOE Arvl on Scn: | | Site Geo Ref Meth: | |
| MOE Reported Dt: | 9/11/2002 | Site Map Datum: | |
| Dt Document Closed: | | | |
| SAC Action Class: | | | |
| Incident Reason: | UNKNOWN | | |
| Incident Summary: | SOURCE UNK: UNK VOLUME OF ANTIFREEZE IN THE STORMSEWER, CLEANING | | |

Appendix: Database Descriptions

Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

The Ontario Ministry of Natural Resources maintains a database of all active pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Sep 2017

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Nov 2016

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Jan 31, 2018

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2014

Certificates of Approval:

Provincial

[CA](#)

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Commercial Fuel Oil Tanks:

Provincial [CFOT](#)

Since May 2002, Ontario developed a new act where it became mandatory for fuel oil tanks to be registered with Technical Standards & Safety Authority (TSSA). This data would include all commercial underground fuel oil tanks in Ontario with fields such as location, registration number, tank material, age of tank and tank size.

Government Publication Date: Feb 28, 2017

Chemical Register:

Private [CHEM](#)

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2018

Compressed Natural Gas Stations:

Private [CNG](#)

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 31, 2012

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial [COAL](#)

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial [CONV](#)

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Apr 2018

Certificates of Property Use:

Provincial [CPU](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994-Apr 30, 2018

Drill Hole Database:

Provincial [DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886-Nov 30, 2017

Dry Cleaning Facilities:

Federal [DRYCLEANERS](#)

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2016

Environmental Activity and Sector Registry:

Provincial [EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval), Please see our ECA database.

Government Publication Date: Oct 2011-Jun 30, 2018

Environmental Registry:

Provincial **EBR**

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994-Apr 30, 2018

Environmental Compliance Approval:

Provincial **ECA**

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Jun 30, 2018

Environmental Effects Monitoring:

Federal **EEM**

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private **EHS**

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Feb 28, 2018

Environmental Issues Inventory System:

Federal **EIIS**

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial **EMHE**

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Dec 31, 2016

List of TSSA Expired Facilities:

Provincial **EXP**

List of facilities with removed tanks which were once registered with the Fuels Safety Program of the Technical Standards and Safety Authority (TSSA). Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc. Tanks which have been removed automatically fall under the expired facilities inventory held by TSSA.

Government Publication Date: Feb 28, 2017

Federal Convictions:

Federal **FCON**

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government.

Government Publication Date: Jun 2000-May 2018

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2017

Fuel Storage Tank:

Provincial

FST

The Technical Standards & Safety Authority (TSSA), under the Technical Standards & Safety Act of 2000 maintains a database of registered private and retail fuel storage tanks in Ontario with fields such as location, tank status, license date, tank type, tank capacity, fuel type, installation year and facility type.

Government Publication Date: Feb 28, 2017

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-December 31, 2017

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO2 eq).

Government Publication Date: 2013-Dec 2016

TSSA Historic Incidents:

Provincial

HINC

This database will cover all incidences recorded by TSSA with their older system, before they moved to their new management system. TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. The TSSA works to protect the public, the environment and property from fuel-related hazards such as spills, fires and explosions. This database will include spills and leaks from pipelines, diesel, fuel oil, gasoline, natural gas, propane and hydrogen recorded by the TSSA.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

TSSA Incidents:

Provincial **INC**

TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Includes incidents from fuel-related hazards such as spills, fires and explosions. This database will include spills and leaks from diesel, fuel oil, gasoline, natural gas, propane and hydrogen recorded by the TSSA.

Government Publication Date: Feb 28, 2017

Landfill Inventory Management Ontario:

Provincial **LIMO**

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the ministry compiles new and updated information. The inventory will include small and large landfills. Additionally, each year the ministry will request operators of the larger landfills complete a landfill data collection form that will be used to update LIMO and will include the following information from the previous operating year. This will include additional information such as estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills will include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Dec 31, 2013

Canadian Mine Locations:

Private **MINE**

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Environmental Penalty Annual Report:

Provincial **MISA PENALTY**

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2017

Mineral Occurrences:

Provincial **MNR**

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Jan 2018

National Analysis of Trends in Emergencies System (NATES):

Federal **NATE**

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial **NCPL**

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2016

National Defense & Canadian Forces Fuel Tanks:

Federal **NDFT**

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Mar 31, 2018

National Energy Board Wells:

Federal

NEBW

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003*

National PCB Inventory:

Federal

NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008*

National Pollutant Release Inventory:

Federal

NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017

Oil and Gas Wells:

Private

OGW

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-April 30, 2018

Ontario Oil and Gas Wells:

Provincial

OGGW

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-May 2018

Inventory of PCB Storage Sites:

Provincial [OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013

Orders:

Provincial [ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994-Apr 30, 2018

Canadian Pulp and Paper:

Private [PAP](#)

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal [PCFT](#)

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial [PES](#)

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: 1988-Mar 2018

TSSA Pipeline Incidents:

Provincial [PINC](#)

TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. This database will include spills, strike and leaks from recorded by the TSSA.

Government Publication Date: Feb 28, 2017

Private and Retail Fuel Storage Tanks:

Provincial [PRT](#)

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial [PTTW](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include all PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994-Apr 30, 2018

Ontario Regulation 347 Waste Receivers Summary:

Provincial [REC](#)

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-2016

| | | |
|---|------------|------|
| <u>Record of Site Condition:</u> | Provincial | RSC |
| The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). | | |
| Government Publication Date: 1997-Sept 2001, Oct 2004-Apr 2018 | | |
| <u>Retail Fuel Storage Tanks:</u> | Private | RST |
| This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks. | | |
| Government Publication Date: 1999-Jan 31, 2018 | | |
| <u>Scott's Manufacturing Directory:</u> | Private | SCT |
| Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database. | | |
| Government Publication Date: 1992-Mar 2011* | | |
| <u>Ontario Spills:</u> | Provincial | SPL |
| This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. | | |
| Government Publication Date: 1988-Feb 2018 | | |
| <u>Wastewater Discharger Registration Database:</u> | Provincial | SRDS |
| Information under this heading is combination of the following 2 programs. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment maintained a database of all direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation; Mining; Petroleum Refining; Organic Chemicals; Inorganic Chemicals; Pulp & Paper; Metal Casting; Iron & Steel; and Quarries. All sampling information is now collected and stored within the Sample Result Data Store (SRDS). | | |
| Government Publication Date: 1990-Dec 31, 2016 | | |
| <u>Anderson's Storage Tanks:</u> | Private | TANK |
| The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only. | | |
| Government Publication Date: 1915-1953* | | |
| <u>Transport Canada Fuel Storage Tanks:</u> | Federal | TCFT |
| List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type. | | |
| Government Publication Date: 1970-Aug 2017 | | |
| <u>TSSA Variances for Abandonment of Underground Storage Tanks:</u> | Provincial | VAR |
| List of variances granted for abandoned tanks. Under the Technical Standards and Safety Authority (TSSA) Liquid Fuels Handling Code and Fuel Oil Code, all underground storage tanks must be removed within two years of disuse. If removal of a tank is not feasible, an application may be sought for a variance from this code requirement. | | |
| Government Publication Date: Feb 28, 2017 | | |
| <u>Waste Disposal Sites - MOE CA Inventory:</u> | Provincial | WDS |
| The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database. | | |
| Government Publication Date: Oct 2011-Jun 30, 2018 | | |

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31, 2017

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

Appendix C

TSSA Correspondence

From: Public Information Services
To: [Luke Lopers](mailto:Luke.Lopers@ghd.com)
Subject: RE: Environmental Assessment - TSSA Records Search Request ~COR-11181273-E1~
Date: Friday, August 10, 2018 1:15:21 PM
Attachments: [image001.jpg](#)

No Records Found

Hello,

Thank you for your request for confirmation of public information.

- We confirm that there are **no fuel storage tanks records** in our database at the subject address(es).

For copies of documents, please complete the Release of Public Information form, found at <https://www.tssa.org/en/about-tssa/resources/Release-of-Records-form--Jan-2018Final.pdf> and email the completed form to publicinformationsservices@tssa.org or through mail along with the appropriate fee. TSSA's fee schedule can be found at: https://www.tssa.org/en/about-tssa/resources/Documents/Public-Information-Fee-Schedule_Jan_2018.pdf. Fees are payable with a credit card (Visa or MasterCard) or by a cheque made payable to TSSA.

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind regards,
Connie

From: Luke.Lopers@ghd.com <Luke.Lopers@ghd.com>

Sent: August 8, 2018 3:48 PM

To: Public Information Services <publicinformationsservices@tssa.org>

Cc: filing@croworld.com

Subject: Environmental Assessment - TSSA Records Search Request ~COR-11181273-E1~

Good Afternoon,

Could you please search the TSSA database for records of fuel storage tanks, spills, incidents or infractions for the following addresses located in the **City of Ottawa (formerly Nepean)**, ON:

- 2821, 2829, 2831, 2850, 2851, 2865, 2891 DuMaurier Avenue
- 1085 Grenon Avenue

Thank you for your time,

Luke Lopers, P.Eng.
Project Manager

GHD

Direct Line: +1 613 288 1723 | Ottawa Office: +1 613 727 0510 | Email: Luke.Lopers@ghd.com
179 Colonnade Road South Suite 400 Ottawa Ontario K2E 7J4 Canada | www.ghd.com
[WATER](#) | [ENERGY & RESOURCES](#) | [ENVIRONMENT](#) | [PROPERTY & BUILDINGS](#) | [TRANSPORTATION](#)



Please consider our environment before printing this email

CONFIDENTIALITY NOTICE: This email, including any attachments, is confidential and may be privileged. If you are not the intended recipient please notify the sender immediately, and please delete it; you should not copy it or use it for any purpose or disclose its contents to any other person. GHD and its affiliates reserve the right to monitor and modify all email communications through their networks.


This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

This e-mail has been scanned for viruses

Appendix D
Ministry of Environment Freedom of Information
Correspondence

Freedom of Information Request


This form is for requesting documents which are in the Ministry's files on environmental concerns related to properties. Please refer to the guide on the completion and use of this form. Our fax no. is (416) 314-4285.

| Requester Data | | | For Ministry Use Only | |
|---|--|---|---|---------------------------|
| Name, Title, Company Name and Mailing Address of Requester Luke Lopers GHD Limited 179 Colonnade Drive, Suite 400 Ottawa, Ontario K2E 7J4 | | | FOI Request No. | Date Request Received |
| | | | Fee Paid \$ ~ ACCT ~ CHQ ~ VISA/MC ~ CASH | |
| Telephone/Fax Nos. Tel : 613-727-0895 Fax : 613-727-0581 | Your Project/Reference No. 11181273-E1 | Signature of Requester  | <input type="checkbox"/> CNR <input type="checkbox"/> ER <input type="checkbox"/> NOR <input type="checkbox"/> SWR <input type="checkbox"/> WCR <input type="checkbox"/> SAC <input type="checkbox"/> IEB <input type="checkbox"/> EAA <input type="checkbox"/> EMR <input type="checkbox"/> SWA | |
| Request Parameters | | | | |
| Municipal Address / Lot, Concession, Geographic Township (Municipal address essential for cities, towns or regions) 2831, 2833 2835, 2841 DuMaurier Avenue, Ottawa, Ontario (all adjacent properties with common ownership) | | | | |
| Present Property Owner(s) and Date(s) of Ownership 1248816 ONTARIO INC. (January 2001-present) | | | | |
| Previous Property Owner(s) and Date(s) of Ownership | | | | |
| Present /Previous Tenant(s), (if applicable) | | | | |
| Search Parameters | | | | Specify Year(s) Requested |
| Files older than 2 years may require \$60.00 retrieval cost. There is no guarantee that records responsive to your request will be located. | | | | |
| Environmental concerns (General correspondence, occurrence reports, abatement) | | | | All |
| Orders | | | | All |
| Spills | | | | All |
| Investigations/prosecutions ▶ Owner and tenant information must be provided | | | | All |
| Waste Generator number/classes | | | | All |
| Certificates of Approval ▶ Proponent information must be provided | | | | |
| 1987 and prior records are searched manually. Search fees in excess of \$300.00 could be incurred, depending on the types and years to be searched. Specify Certificates of Approval number (s) (if known). If supporting documents are also required, mark SD box and specify type e.g. maps, plans, reports, etc. | | | | |
| | | | SD | Specify Year(s) Requested |
| air - emissions | | | | All |
| water - mains, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster) | | | | All |
| sewage - sanitary, storm, treatment, stormwater, leachate & leachate treatment & sewage pump stations | | | | All |
| waste water - industrial discharge | | | | All |
| waste sites - disposal, landfill sites, transfer stations, processing sites, incinerator sites | | | | All |
| waste systems | - haulers: sewage, non-hazardous & hazardous waste, mobile waste processing units, PCB destruction | | | All |
| pesticides - licenses | | | | All |

A \$5.00 non-refundable application fee, payable to the Minister of Finance, is mandatory. The cost of locating on-site and/or preparing any record is \$30.00/hour and 20 cents/page for photocopying and you will be contacted for approval for fees in excess of \$30.00.

Freedom of Information Request

This form is for requesting documents which are in the Ministry's files on environmental concerns related to properties. Please refer to the guide on the completion and use of this form. Our fax no. is (416) 314-4285.

| Requester Data | | | For Ministry Use Only | | | | |
|--|---|---|--|------------------------------|------------------------------|------------------------------|------------------------------|
| Name, Title, Company Name and Mailing Address of Requester Luke Lopers GHD Limited 179 Colonnade Drive, Suite 400 Ottawa, Ontario K2E 7J4 | | | FOI Request No. | Date Request Received | | | |
| | | | Fee Paid \$ ~ ACCT ~ CHQ ~ VISA/MC ~ CASH | | | | |
| Telephone/Fax Nos. Tel : 613-727-0895 Fax : 613-727-0581 | Your Project/Reference No. 11181273-E1 | Signature of Requester  | <input type="checkbox"/> CNR | <input type="checkbox"/> ER | <input type="checkbox"/> NOR | <input type="checkbox"/> SWR | <input type="checkbox"/> WCR |
| | | | <input type="checkbox"/> SAC | <input type="checkbox"/> IEB | <input type="checkbox"/> EAA | <input type="checkbox"/> EMR | <input type="checkbox"/> SWA |
| Request Parameters | | | | | | | |
| Municipal Address / Lot, Concession, Geographic Township (Municipal address essential for cities, towns or regions) | | | | | | | |
| 2865 DuMaurier Avenue, Ottawa, Ontario | | | | | | | |
| Present Property Owner(s) and Date(s) of Ownership | | | | | | | |
| GIANT TIGER STORES LIMITED (December 2000-present) | | | | | | | |
| Previous Property Owner(s) and Date(s) of Ownership | | | | | | | |
| Present /Previous Tenant(s), (if applicable) | | | | | | | |
| Search Parameters | | | | | | Specify Year(s) Requested | |
| Files older than 2 years may require \$60.00 retrieval cost. There is no guarantee that records responsive to your request will be located. | | | | | | | |
| Environmental concerns (General correspondence, occurrence reports, abatement) | | | | | | All | |
| Orders | | | | | | All | |
| Spills | | | | | | All | |
| Investigations/prosecutions ▶ Owner and tenant information must be provided | | | | | | All | |
| Waste Generator number/classes | | | | | | All | |
| Certificates of Approval ▶ Proponent information must be provided | | | | | | | |
| 1987 and prior records are searched manually. Search fees in excess of \$300.00 could be incurred, depending on the types and years to be searched. Specify Certificates of Approval number (s) (if known). If supporting documents are also required, mark SD box and specify type e.g. maps, plans, reports, etc. | | | | | | | |
| | | | | | | SD | Specify Year(s) Requested |
| air - emissions | | | | | | | All |
| water - mains, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster) | | | | | | | All |
| sewage - sanitary, storm, treatment, stormwater, leachate & leachate treatment & sewage pump stations | | | | | | | All |
| waste water - industrial discharge | | | | | | | All |
| waste sites - disposal, landfill sites, transfer stations, processing sites, incinerator sites | | | | | | | All |
| waste systems - haulers: sewage, non-hazardous & hazardous waste, mobile waste processing units, PCB destruction | | | | | | | All |
| pesticides - licenses | | | | | | | All |

A \$5.00 non-refundable application fee, payable to the Minister of Finance, is mandatory. The cost of locating on-site and/or preparing any record is \$30.00/hour and 20 cents/page for photocopying and you will be contacted for approval for fees in excess of \$30.00.

Appendix E

City of Ottawa HLUI Correspondence

Office Use Only

| | | |
|------------------------------------|--------------------|---|
| Application Number: _____ | Ward Number: _____ | Application Received: (dd/mm/yyyy): _____ |
| Client Service Centre Staff: _____ | Fee Received: \$ | _____ |



Historic Land Use Inventory

Application Form

Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business Support Services, Planning Infrastructure and Economic Development Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 24075

Background Information

*Site Address or Location:

*Mandatory Field

Applicant/Agent Information:

Name:

Mailing Address:

Telephone: Email Address:

Registered Property Owner Information: Same as above

Name:

Mailing Address:

Telephone: Email Address:

Site Details

Legal Description and PIN:

Part of Lot 20, Concession 2, being Parts 4 to 7 and Parts 9 to 17 on Registered Plan 4R16235, Nepean, City of Ottawa
PINs: 03944-0827, 03944-0826, and 03944-0238

What is the land currently used for?

Commercial Plaza (Retail)

Lot frontage:

 m

Lot depth:

 m

Lot area: _____ m²

OR

Lot area: (irregular lot)

 m²

Does the site have Full Municipal Services: Yes No

Required Fees

Please don't hesitate to visit [the Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$100.00

Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Infrastructure and Economic Development Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3.** A site plan or key plan of the property, its location and particular features.
- 4.** Any significant dates or time frames that you would like researched.

Disclaimer
For use with HLUI Database

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to GHD Limited ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requester indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: 

Dated (dd/mm/yyyy): 10/08/2018

Per: Luke Lopers

(Please print name)

Title: Project Manager

Company: GHD Limited

August 8, 2018

Reference No. 11181273-E1

Mr. Michael Boughton, MCIP, RPP
Infrastructure Services
City of Ottawa
110 Laurier Ave. W.
4th Floor
Ottawa, ON
K1P 1J1

Re: Request for Information
Municipal Freedom and Information and Protection of Privacy Act
Historical Land Use Records
2831,2851, and 2865 DuMaurier Avenue, Ottawa, Ontario

Dear Mr. Boughton;

GHD Limited (**GHD**) has been retained to conduct a Phase One Environmental Site Assessment (ESA) of the commercial properties located at Civic Nos. 2831,2851, and 2865 DuMaurier Avenue, in Ottawa, Ontario. Please note that the Site is one continuous commercial property with multiple civic addresses.

As part of the Phase I ESA, **GHD** would like to ensure that this property is currently and was formerly in compliance with applicable municipal/city by-laws/ regulations relative to the environment. Therefore, could you please search the City of Ottawa's Historical Land Use database and provide any information regarding former or outstanding infractions, control or other orders, violation notices, permits and approvals or reported spill incidents to the above reference properties or nearby properties to **GHD**.

As this information search is urgently required, we would appreciate if you could provide a response as soon as possible (via email). Thank you in advance for your prompt attention to this matter.

Yours truly,

Signature:  _____

Name: Jean-Luc Rivard

Organization: Brigil

Address: 98 Lois Street, Gatineau, QC

Telephone: 613-355-1260



about GHD

GHD is one of the world's leading professional services companies operating in the global markets of water, energy and resources, environment, property and buildings, and transportation. We provide engineering, environmental, and construction services to private and public sector clients.

Luke Lopers

Luke.Lopers@ghd.com
613.727.0510

Kevin Emenau

Kevin.Emenau@ghd.com
613.727.0510

www.ghd.com

D.3 PHASE II ENVIRONMENTAL SITE ASSESSMENT (GHD 2019)





Phase Two Environmental Site Assessment

2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario

3223701 Canada Inc.





Executive Summary

GHD (Consultant) was retained by 3223701 Canada Inc. (Client), to complete a Phase Two Environmental Site Assessment (Phase Two ESA) in general accordance with the O. Reg. 153/04 Phase Two ESA format for the current commercial/institutional property identified as 2831, 2851, and 2865 DuMaurier in Ottawa, Ontario (Site or Phase Two Property). GHD has previously prepared a Phase I Environmental Site Assessment (Phase I ESA) (Ref No: 11181273-E1-RPT-1, dated August 16, 2018) for 3223701 Canada Inc. The Phase I ESA was conducted for environmental due diligence for potential purchase of the Site.

The Phase I ESA identified one on-Site potentially contaminating activity (PCA); the suspected historical placement of fill material during redevelopment of the Site with the present day building. This PCA was considered to represent an area of potential environmental concern (APEC) for the Site. There was one PCA identified at a neighboring property in the Phase One Study Area as part of this assessment: the presence of a former landfill to the east of DuMaurier Avenue, approximately 20 m east of the site; this off-Site PCA was also considered to represent an APEC for the subject Site.

The Phase Two Environmental Site Assessment (Phase Two ESA) was recommended based on the APECs identified as part of the Phase I ESA. The purpose of the Phase Two ESA is to assess the soil and groundwater quality at the Site. The investigation involved the advancement of five boreholes which were sampled for environmental purposes. All of the boreholes were completed with groundwater monitoring well screened in the overburden or upper bedrock.

Six soil samples were submitted for laboratory analysis of Metals, Polycyclic Aromatic Hydrocarbons (PAHs) and pH. One duplicate soil sample was submitted for analysis of Metals, PAH and pH parameters. One soil sample was also submitted for toxicity characteristic leaching procedure (TCLP) analysis to determine options for off-Site disposal. Six groundwater samples, including one duplicate sample, were submitted for laboratory analysis of a combination of Metals, VOCs, PHCs and pH. One trip blank water sample was also submitted for analysis of VOCs.

Based on the soil depths, Site setting, and the existing land uses in the vicinity of the Site, the Full depth Generic Criteria provided in O. Reg. 153/04 Table 3 (non-potable, residential/institutional, coarse texture) is be considered to be the applicable comparison. The Site is not a sensitive Site, a Surface Water Site, or a potable groundwater use Site.

Site Compliance

There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in four of the six submitted soil samples, including the duplicate QA/QC soil sample.

There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in two of the six submitted groundwater samples, including the duplicate QA/QC soil sample.

The Site is not considered to be in compliance with the O. Reg. 153/04 criteria for the proposed land use and requires soil remediation/removal or a risk assessment prior to redevelopment.



Note that a remedial action plan that includes a soil and groundwater management program may be developed as part of the Site preparation prior to the construction phase of the Site redevelopment in order to manage and dispose of the contaminated soil at the time of redevelopment.



Table of Contents

| | | |
|------|---|----|
| 1. | Introduction..... | 1 |
| 1.1 | Site Description..... | 1 |
| 1.2 | Property Ownership..... | 1 |
| 1.3 | Current and Proposed Future Uses..... | 1 |
| 1.4 | Applicable Site Condition Standard..... | 2 |
| 2. | Background Information..... | 3 |
| 2.1 | Physical Setting..... | 3 |
| 2.2 | Past Investigation..... | 4 |
| 3. | Scope of the Investigation..... | 4 |
| 3.1 | Overview of Site Investigation..... | 4 |
| 3.2 | Media Investigated..... | 6 |
| 3.3 | Phase One Conceptual Site Model..... | 7 |
| 3.4 | Deviations from Sampling and Analysis Plan..... | 8 |
| 3.5 | Impediments..... | 9 |
| 4. | Investigation Method..... | 9 |
| 4.1 | General..... | 9 |
| 4.2 | Drilling and Excavating..... | 9 |
| 4.3 | Soil Sampling..... | 10 |
| 4.4 | Field Screening Measurements..... | 11 |
| 4.5 | Ground Water: Monitoring Well Installation..... | 11 |
| 4.6 | Ground Water: Field Measurement of Water Quality Parameters..... | 12 |
| 4.7 | Ground Water: Sampling..... | 12 |
| 4.8 | Sediment Sampling..... | 12 |
| 4.9 | Analytical Testing..... | 12 |
| 4.10 | Residue Management Procedures..... | 13 |
| 4.11 | Elevation Surveying..... | 13 |
| 4.12 | Quality Assurance and Quality Control Measures..... | 13 |
| 5. | Review and Evaluation..... | 14 |
| 5.1 | Geology..... | 14 |
| 5.2 | Ground Water - Elevations and Flow Direction..... | 15 |
| 5.3 | Ground Water - Hydraulic Gradients..... | 16 |
| 5.4 | Fine-Medium or Coarse Soil Texture..... | 16 |
| 5.5 | Soil Field Screening..... | 16 |



| | | |
|------|--|----|
| 5.6 | Soil Quality | 17 |
| 5.7 | Ground Water Quality | 18 |
| 5.8 | Sediment Quality..... | 19 |
| 5.9 | Quality Assurance and Quality Control Results..... | 20 |
| 5.10 | Phase Two Conceptual Site Model..... | 21 |
| 6. | Conclusions..... | 25 |
| 7. | References | 27 |

Figure Index

| | |
|----------|------------------------|
| Figure 1 | Site Location Map |
| Figure 2 | Borehole Location Plan |

Table Index

| | | |
|------------|--|----|
| Table 4.1. | Elevations | 13 |
| Table 5.1. | Monitoring Well Installation | 15 |
| Table 5.2 | Water Table Details | 16 |
| Table 5.3 | Soil Sample Details | 17 |
| Table 1 | DNAPL/LNAPL Layers | |
| Table 2 | Summary of Soil Analysis | |
| Table 3 | Summary of Groundwater Analysis | |
| Table 4 | Maximum Soil Parameter Concentrations | |
| Table 5 | Maximum Groundwater Parameter Concentrations | |

Appendix Index

| | |
|------------|-------------------------------------|
| Appendix A | Utility Clearances |
| Appendix B | Sampling Analysis Plan |
| Appendix C | Borehole Logs |
| Appendix D | Laboratory Certificates of Analysis |



1. Introduction

1.1 Site Description

Location and Identifier

The Site is located in the Foster Farm borough within the City of Ottawa, Ontario. The Property is located on the west side of DuMaurier Avenue, within the neighbourhood that is bordered by DuMaurier Avenue to the east and west, Ramsey Crescent to the south, and Richmond Road to the north. The Civic Nos. associated with the Property are 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue in Ottawa, Ontario (Site or Property). The Site is legally described as Part of Lot 20, Concession 2, being Parts 4 to 7 and Parts 9 to 17 on Registered Plan 4R16235, Nepean, City of Ottawa. The property identification numbers associated with the Site are 03944-0827, 03944-0826, and 03944-0238.

The coordinates of the approximate center of the Site are 45° 21' 01" N by 75° 47' 37" W (UTM Coordinates 437840 m E, 5022180 m N). A Site Location Map (Figure 1) and a Borehole Location Plan (Figure 2) are provided following this report. The municipal zoning for the Site is currently General Mixed Use Zone (residential, commercial, and/or institutional).

In all aspects of this report the Phase Two property is referred to as the Site or Phase Two Property.

Size and Boundaries

The Site is rectangular in shape, covers an area of approximately 0.8 hectares (2 acres), and is located in an area that is developed for mixed use (residential, commercial, and/or institutional). The Site is occupied by a single storey slab-on-grade commercial plaza building. The Site building covers approximately 30 percent of the Site. The remainder of the Site consists of asphalt paved parking, access laneways and landscaped sections along the perimeter. Vehicular access to the Site is from DuMaurier Avenue to the east and Ramsey Crescent to the south. The topography in the Phase I Study Area is undulating with a general slope downward to the south and southwest. The property to the northwest of the Site is elevated approximately 3 to 4 m with respect to the Site, while the property to the west of the Site is elevated approximately 0.6 m with respect to the Site.

The boundaries of the Site and location of the existing buildings are shown on Figure 2, Borehole Location Plan, following the text of this report.

1.2 Property Ownership

The north portion of the Site with Civic Nos. 2831, 2833, 2835, and 2841 DuMaurier Avenue are currently owned by 1248816 Ontario Inc. The south portion of the Site, with Civic No. 2865 DuMaurier Ave. is currently owned by Giant Tiger Stores Limited.

1.3 Current and Proposed Future Uses

The current property use is mixed commercial and institutional. The Site building consists of an occupied single storey slab-on-grade commercial plaza building with tenants including: Pinecrest



Deli (2831), Halal Meat and Grocery (2833), Da Al Sahaba Association (2835), Barney's Pizza (2841), and Giant Tiger (2865).

The Site and surrounding properties are located in a predominantly residential, institutional and commercial sector of the City of Ottawa. The properties surrounding the Site consist of the following facilities and features:

- Northeast | Institutional property (Church) located at Civic No. 2821 DuMaurier Avenue.
- Northwest | Institutional property (community center and school) located at Civic No. 1085 Grenon Avenue.
- East | DuMaurier Avenue followed by parkland (baseball fields) located at 2850 DuMaurier Avenue.
- South | Ramsey Crescent followed by residential dwellings at Civic No. 2891 DuMaurier Avenue.
- West | Residential apartment and dwellings at Civic No. 2891 DuMaurier Avenue.

The Site consists of the existing plaza with associated surrounding paved parking and driveways. A landscaped area is present at the northern limits of the Site. Under Ottawa Bylaw 2008-250, the Site property has a municipal zoning designation of GM "General Mixed Use Zone".

GHD understands that the Client intends to demolish the existing structures and construct a 40-storey residential building with six underground parking levels. The Property is currently used for mixed commercial and institutional purposes and therefore requires a Record of Site Condition (RSC), required for a change in land use to more sensitive land uses. This report will also be used to support a submission to the local municipal planning department and may also be used as a supporting document for a RSC.

1.4 Applicable Site Condition Standard

The pH of the soil was tested and observed to be within the range of 5-9. There are no Areas of Natural Scientific Interest (ANSI) identified by the Ministry of Natural Resources (MNR) within 250 m of the Site. There are no areas designated by the municipality in its current official plan (Bylaw 2008-250-Zoning) as 'EP' (Environmentally Protected zoning) identified within 250 m of the Site. As the Site does not contain an area of natural significance, and properties within 30 m of the Site limits do not contain areas of natural significance, the Site is not classified as an environmentally sensitive property (O. Reg. 153/04, s41).

Drilling conducted as part of this investigation revealed that there is more than 2 m of soil in all boreholes locations advanced on the Site. The native soils encountered show a single native soil deposit consisting of a mixture of silt, clay and sand. In the absence of grain size analysis testing, the Site will be compared to the Coarse grain size condition

No natural surface water bodies were identified on the Site or within the Phase One Study Area. The nearest natural surface body is the Ottawa River, which is located approximately 1.5 km to the Northwest of the Site. There is no open surface water bodies within 30 m of the Site limits. As the property does not include all or part of a water body, and the property is not adjacent to a water body, and does not include land that is within 30 m of a water body, the Property is not considered a Surface Water site (O. Reg. 153/04, s43.1[1]).



The existing property use is mixed commercial and institutional. The proposed property use is residential. The Site is considered as being residential/parkland/institutional land use as per Section 3 of the Ontario Regulation 153/04 as amended 2011 (O. Reg. 153/04, s1[3]).

The Property, and all other properties located, in whole or in part, within 250 m of the boundaries of the property, are supplied by a municipal drinking water system. The Site is not in an area designated on the City of Ottawa official plan as an intake protection zone. The Site is not in an area designated on the City of Ottawa official plan as a well-head protection area (WHPA). The Site is not an agricultural property. The Site is considered as being non-potable water use as per Section 35 of the Ontario Regulation 153/04 as amended 2011 (O. Reg. 153/04, s35).

Grain Size analysis of the recovered soil samples was not conducted as part of this investigation; accordingly, the most conservative soil texture criteria will be applied to the Site. The Site is considered as being medium and fine grained soil texture as per Section 42 of the Ontario Regulation 153/04 as amended 2011 (O. Reg. 153/04, s42).

Based upon the above described assessments, accordingly, the full depth generic O. Reg. 153/04 Table 3 (full depth, residential/institutional land use, non-potable groundwater use, coarse grained soil texture) criteria is considered the applicable Site comparison.

2. Background Information

2.1 Physical Setting

Surface Water

No natural surface water bodies were identified on the Site or within the Phase One Study Area. The nearest natural surface water body is the Ottawa River, which is located approximately 1.5 km to the Northwest of the Site.

Topography and Drainage

The Site is relatively flat, sloping up at the northern property limits in the landscaped area, and sloping away from the Site building, directing storm water away from the buildings towards the property perimeter, and towards the central storm drain. The Site is generally elevated approximately 0.3 m with respect to the neighbouring streets to the east, and south.

The regional topography in the general area of the Site slopes down to the south and southwest.

The Phase Two ESA drilling program identified limestone bedrock between 3.2 and 3.9 meters below grade (mBG), with an upper surface described as ranging from very poor to good quality that become fair to good with depth. This material was overlain with a native soil deposit consisting of a mixture of silt, clay, and sand, covered with a fill material to provide engineered grading.

Hard surfaces at the Site include the paved parking area and driveway surrounding the existing buildings on Site. Precipitation falling on improved paved surfaces will travel by sheet flow to the Site storm drains. Precipitation falling on unimproved landscaped surfaces will infiltrate at the ground surface.



2.2 Past Investigation

The following environmental report was reviewed prior to conducting this Phase Two ESA:

- "Phase I Environmental Site Assessment, 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue, Ottawa, Ontario" Reference No. 11181273-E1-RPT-1, prepared by GHD, dated August 16, 2018

The Phase I ESA was completed for the entire Site which contains a one-storey plaza building, an associated paved parking and driveway areas, and a landscaped area at the north end of the site.

According to the historical research, the earliest developed use of the site is approximately 1980, based on information provided from the property owner's representative, listings from the City directories and observations from the aerial photographs. Based on the historical research, the Site has been used for commercial purposes since 1980 to the time of report preparation, with portions of the Site being used for institutional purposes since 2011. Based on aerial photographs, the Site was redeveloped with the present day building between 1976 and 1991.

At the time of the Phase I ESA, the Site was developed for mixed commercial and institutional uses. The Site building consists of an occupied single storey slab-on-grade plaza building with tenants including: Pinecrest Deli (2831), Halal Meat and Grocery (2833), Da Al Sahaba Association (2835), Barney's Pizza (2841), and Giant Tiger (2865).

Based on the historical research and known information of the general area of the Site, there was one suspected on-Site potentially contaminating activities (PCA); the suspected historical placement of fill material that is suspected to have occurred during the construction of the existing building, specifically for infilling previously observed drainage features at the Site. This PCA (identified as PCA#1) is considered to represent an area of potential environmental concern (APEC) for the Site (identified as APEC#1).

There was one off-Site PCA; the presence of a former landfill site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site. This PCA (identified as PCA#2) is considered to represent an APEC for the Site (identified as APEC#2).

A Phase Two ESA was recommended for the Phase I Property to assess the soil and groundwater quality at the Site as a result of the identified APECs.

3. Scope of the Investigation

3.1 Overview of Site Investigation

Underground utilities (both public and private services) were identified by GHD prior to drilling activities. Copies of the underground utility clearances are included in Appendix A.

On October 5, 2018, five boreholes (BH1/MW1, BH2/MW2, BH3S/MW3S, BH3D/MW3D, and BH4/MW4) were advanced by means of a truck mounted CME 55 power drill rig equipped for environmental soil sampling under the supervision of GHD field staff. Samples were recovered using 50 mm diameter split spoon samplers advanced to the sampling depth with a hydraulic hammer. Recovered soil samples were screened in the field for evidence of visual and olfactory evidence of



contamination. All boreholes were outfitted with groundwater monitoring wells to measure the groundwater levels and collect representative groundwater samples.

- Borehole BH1 was advanced to a depth of approximately 3.8 metres below grade (mBG), located to the west of 2829 DuMaurier Avenue. The borehole was equipped with a groundwater monitoring well screened in the overburden to intercept the shallow groundwater table. This borehole/monitoring well was located to assess the environmental soil and groundwater quality associated with the imported fill materials (APEC#1) and potential impacts from the former off-Site landfill (APEC#2).
- Borehole BH2 was advanced to a depth of approximately 4.9 mBG, near the southeast limit of the Site property boundary. The borehole was equipped with a groundwater monitoring well screened in the bedrock. This borehole/monitoring well was located to assess the environmental soil and groundwater quality associated with the imported fill materials (APEC#1) and potential impacts from the former off-Site landfill (APEC#2).
- Boreholes BH3D was advanced to a depth of approximately 5.4 mBG, near the northeast limit of the Site property boundary. The borehole was equipped with a groundwater monitoring well screened in the bedrock. This borehole/monitoring well was located to assess the environmental soil and groundwater quality associated with the imported fill materials (APEC#1) and potential impacts from the former off-Site landfill (APEC#2).
- Boreholes BH3S was advanced to a depth of approximately 3.7 mBG, approximately 0.9 m to the south of BH3D. The borehole was equipped with a groundwater monitoring well screened in the overburden. This borehole/monitoring well was located to assess the environmental groundwater quality associated with the imported fill materials (APEC#1) and potential impacts from the former off-Site landfill (APEC#2).
- Borehole BH4 was advanced to a depth of approximately 5.4 mBG, located to the east of 2829 DuMaurier Ave. The borehole was equipped with a groundwater monitoring well screened in the bedrock. This borehole/monitoring well was located to assess the environmental soil and groundwater quality associated with the imported fill materials (APEC#1) and potential impacts from the former off-Site landfill (APEC#2).

The following soil samples were submitted to the laboratory for analysis: BH1-SS3, BH2-SS5, BH3-SS3, BH4-SS2/SS3, DUP (a blind duplicate sample of BH4-SS2/SS3), and auger cuttings collected from BH3. The samples were submitted to AGAT Laboratories in Ottawa, Ontario under Chain of Custody (CoC) T075943 on October 5, 2018.

- All soil samples were analysed according to O. Reg. 153/04 requirements. All samples except the BH3 auger cuttings were tested for a combination of polycyclic aromatic hydrocarbons (PAHs), metals and inorganics and pH. The BH3 auger cuttings were not tested for metals and inorganics.
- The sample collected from the BH3 auger cuttings was also analysed for flashpoint and Toxicity Characteristic Leaching Procedure (TCLP) analysis for metals and inorganics on leachate, VOCs on leachate, and PCBs on leachate, for comparison to Ontario Regulation 558/00 to provide a waste classification of the soil.



On October 15, 2018, GHD returned to the Site to measure the static groundwater levels in all monitoring wells. The monitoring wells were then developed, with GHD purging the wells dry at least twice or a minimum of three well volumes. On October 19, 2018, GHD returned to Site to collect groundwater samples from all monitoring wells. A duplicate groundwater sample was collected from BH3S. The groundwater samples to be analysed for metals were filtered using dedicated 45 µm filters, the remainder of the samples were unfiltered. The collected groundwater samples, along with a trip blank, were submitted to the laboratory on October 19, 2018.

The groundwater samples were submitted to AGAT Laboratories in Ottawa, Ontario under Chain of Custody (CoC) T080076. The samples were analysed according to O. Reg. 153/04 requirements.

- All collected groundwater samples were analysed VOCs, metals and inorganics, and pH.
- Groundwater sample MW3S was additionally analysed for PHCs.
- Trip Blank (prepared by the laboratory on October 18, 2018) were analysed for VOCs.

On November 11, 2018 GHD surveyed the relative elevations of the advanced boreholes and monitoring wells, relative to an assigned elevation of 100.00 m of the fire hydrant on the northeast corner of the property, the location of this temporary benchmark is shown on Figure 2.

3.2 Media Investigated

Rationale for Inclusion of Various Media

Based on known historic potentially contaminating activities (PCAs) in the Phase One Study Area of the Site, it was suspected that overburden soil and groundwater have the potential to have been impacted by the PCAs. A Phase One Study Area is defined in O. Reg. 153/04 as 250 m from the Site's property limits, or any other property beyond this limit that the qualified person considers should be included.

PCAs in the Phase One Study area, which are considered to represent areas of potential environmental concern (APECs) for the Site, consisted of on-Site imported fill material of unknown quality (PCA/APEC#1), and the presence of a former landfill site, identified to the east of DuMaurier Avenue, approximately 20 m east of the Site (PCA/APEC#2). Accordingly, boreholes were placed across the Site to allow for collection of soil samples from the Site for an assessment of their environmental quality.

To assess the environmental quality of the groundwater, all of the boreholes advanced at the Site were outfitted with groundwater monitoring wells, which were screened in the overburden or the bedrock to intercept the groundwater table and possible aquifers in the bedrock. A seal was installed above the sand pack to the ground surface. The groundwater was sampled from the aforementioned monitoring wells using a peristaltic pump and Waterra tubing, following a period of stabilization, well development, and purging performed prior to the day of sampling. There were no natural surface water bodies observed at the Site during the Phase Two ESA, and therefore no sampling of surface water or sediment was conducted at the time of this investigation.



3.3 Phase One Conceptual Site Model

The Site is located in an area that is developed for mixed use (residential, commercial, and/or institutional).

The Civic Nos. associated with the Property are 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue in Ottawa, Ontario (Site or Property) and is approximately 0.8 hectares (2 acres) in area. The Site building consisted of an occupied single storey slab-on-grade commercial plaza building at the time of the Site visit. Tenants of the Site building included: Pinecrest Deli (2831), Halal Meat and Grocery (2833), Da Al Sahaba Association (2835), Barney's Pizza (2841), and Giant Tiger (2865). Based on the historical research, the Site has been used for commercial purposes since 1980 to the time of report preparation, with portions of the Site being used for institutional purposes since 2011.

No natural surface water bodies were identified on the Site or within the Phase One Study Area. The nearest natural surface body is the Ottawa River, which is located approximately 1.5 km to the Northwest of the Site. There are no open surface water bodies within 30 m of the Site limits. The Site is generally elevated approximately 0.3 m with respect to the neighbouring streets to the east, and south. The soil conditions in the vicinity of the Site are expected to consist of silt, clay, and sand type soils over limestone bedrock at approximately 3 to 4 meters below grade (mBG) and a water table, if present to be near 2 to 3 m below grade.

The historical records and use and present operations of properties located within 100 m of the subject land were considered from an environmental perspective for the purposes of this report. Properties located outside of the Phase I Study Area (100 m radius) were not considered to have had the potential to have impacted the subject land. Based on the historical research and known information of the general area of the Site, there was one suspected on-Site potentially contaminating activity (PCA): the suspected historical placement of fill material during redevelopment of the Site with the present day building. This PCA is considered to represent an area of potential environmental concern (APEC) for the Site.

There was one PCA identified for the surrounding properties in the Phase One Study Area as part of this assessment: the presence of a former landfill site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site. This PCA is considered to represent an APEC for the subject Site.

The Phase One Study area is serviced by municipal water and sewer services and is in a non-potable area within the City of Ottawa. Electrical and natural gas services are available from private utility companies. Given the location of underground services on the Site and the locations of the PCAs at the Site and neighbouring properties, the presence of underground services are considered to have the potential to have contributed to contaminant distribution on the subject land.

Subsurface Conditions

Municipal water and sewer services are supplied by underground service trenches on the east portion of the Site leading to DuMaurier Avenue. Electricity is supplied to the Site buildings from underground service trenches from the west of the building. Telecommunications are supplied to the Site building from Ramsey Crescent to the south of the Site. These service trenches are considered to have the potential to act as conduits for contaminant migration.



According to the 1987 Geological Survey of Canada, Surficial Geology Map for Ottawa (Map No.: 1506A), the natural soil consists of "Abandoned river channel deposits of silt and silty clay; commonly including lenses of sand and generally underlain at variable depth by stratified, buff, medium grained sand". The thickness of overburden is expected to be approximately 3 to 4 m and the bedrock in the general area of the Site is expected to be limestone. According to records from the water well information system and borehole databases, as presented in the results of the subcontracted Ecolog Environmental ERIS search, the overburden soil in the vicinity of the Site consists of a mixture of silt, clay, and sand type soils. The overburden soil was reportedly underlain by shale or limestone bedrock at an approximate depth ranging from 1.8 to 8.8 m below ground surface.

Regional groundwater flow direction in the overburden within the Study Area was expected to be towards the south to southwest, following regional topography.

Potentially Contaminating Activities (PCAs)

Based on the known information of the general area of the Site, there was one on-Site PCA, and one off-Site PCAs identified in the Study Area.

- PCA#1 (Item 30: Importation of Fill Material of Unknown Quality) | On-Site, importation of Fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.
- PCA#2 (Item 58: Waste Disposal and Waste Management, including thermal treatment, landfilling and transfer of waste, other than use of biosolids as soil conditioners) | Off-Site, a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site.

Areas of Potential Environmental Concern (APECs)

The potentially contaminating activities provided above are considered to represent areas of potential environmental concern for the Site.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern (CPCs) in soil and groundwater for the Site were based on the APECs identified at the Site during Phase One ESA and observations at the time of the drilling program. The following CPCs for the Site were suspected to be associated with fill material at the Site, and the off site former landfill:

1. Metals and Inorganics
2. Polycyclic Aromatic Hydrocarbons (PAHs)
3. Additionally, Volatile Organic Compounds (VOCs) were considered a CPC in the groundwater only.

3.4 Deviations from Sampling and Analysis Plan

The Sampling and Analysis Plan (SAP) proposed



- Screens in each groundwater monitoring well should have a maximum wetted length of 3.0 m and a minimum total length of 1.5 m. GHD installed screens up to 1.5 m in length based on uncertainty of the elevation of the static groundwater table. The water table was lower than anticipated in areas of the Site and higher in others, resulting in a wetted screen length less than 1.5 m and other greater than 3.0 m. This modification to the SAP did not adversely affect this assessment.
- The possible presence of hydrocarbons was noted during the groundwater sampling at the MW3S well location using olfactory observations. One groundwater sample from MW3S was submitted for analysis of Petroleum Hydrocarbons (PHCs). The analysis showed O. Reg. 153/04 Table 3 exceedances of PHCs. The groundwater samples collected from all other wells were then analysed for PHCs as well.

No other deviations were made to the Sampling and Analysis Plan (SAP). A copy of the SAP is presented in Appendix B.

3.5 Impediments

There were no impediments that prevented completion of the work plan.

4. Investigation Method

4.1 General

The investigation method took into account the surficial features of the Site, the location and observations on the Site and the PCAs and APECs identified for the Site. Based upon these conditions, GHD determined that boreholes with split spoon soil sampling, installation and sampling of four new groundwater monitoring wells were considered adequate to assess if contaminants of potential concern (CPCs) would be detected within the soil and groundwater.

The fieldwork as part of the Phase Two ESA included advancement of boreholes, and selection of soil samples for testing based upon visual and olfactory observations and combustible vapour screening. All of the boreholes were then equipped with groundwater monitoring wells to allow collection of water level data, and sample collection for testing of CPC in the groundwater. The boreholes were surveyed relative to a readily identified benchmark (top of spindle of a fire hydrant located on the northeast corner of the property).

Samples were kept in ice chilled coolers and then submitted to an accredited laboratory under Chain of Custody control for chemical analysis of CPCs. Quality control procedures, including analysis of trip blanks, were followed.

The following sections present more detailed descriptions of each activity of the investigation.

4.2 Drilling and Excavating

Advancement of BH1/MW1 through BH4/MW4 was conducted on October 5, 2018 by George Downing Estate Drilling Ltd. of Grenville Sur La Rouge, Quebec, using a truck mounted CME 55 power drill rig. Drilling was conducted under full-time supervision and direction by GHD personnel.



Soil samples were recovered using 50 mm diameter split spoon samplers advanced to the sampling depth with a hydraulic hammer, and washed with soapy water between uses to avoid cross contamination. Soil samples were collected at pre-defined intervals to the maximum proposed depth of drilling.

4.3 Soil Sampling

Equipment

Split spoon soil samples were recovered from BH1/MW1 through BH4/MW4 on October 5, 2018 using 50 mm diameter continually advanced stainless steel split spoon samplers advanced with a hydraulic hammer, and washed between uses, as stated in the SAP. Samples of soil intended for PHCs F1 range and VOCs analysis were collected using 2 cc syringes and placed in methanol vials supplied by the laboratory. Additional soil samples were collected in laboratory supplied jars. Laboratory samples were held in coolers with ice packs prior to delivery to the laboratory.

Description

The findings reflect that there are generally six main materials above the limestone bedrock:

- Asphalt
- Grass vegetation and Topsoil
- Fill (Sand and Gravel) or (Silty Clay) or (Silty Sand)
- Sandy Silt
- Silty Clay
- Peat

The subsurface soil encountered in the five borehole locations is described in the following sections, and is presented graphically on the borehole logs, in Appendix C.

Asphalt

A surface layer of asphalt was encountered in boreholes BH1, BH2, and BH4. This layer was found at the ground surface extending down approximately 0.05 mBG.

Topsoil

A surface layer of topsoil and grass was encountered in boreholes BH3D/3S. This material was described as silty sand with organics, loose, dark brown, and damp. This layer was found at the ground surface extending down approximately 0.08 mBG.

No petroleum odours or visible evidence of staining were noted within the topsoil material.

Fill

A layer fill material consisting of a mixture of silt, sand and gravel was encountered underlying the surficial materials at all borehole locations. This material was described as grey and brown, loose to compact, and damp. The thickness of the fill material ranged from approximately 1.4 m (BH2) to 3.0 m (BH2).



It is suspected that the encountered fill material was used to backfill the foundation of the existing building and provide the granular structure for the existing pavement on the Site.

Visible evidence of staining was noted within the fill materials encountered in all boreholes except BH4.

Silty Clay

Native material was encountered beneath the fill material at the BH1, BH3D, and BH4 locations.

A native deposit of silty clay was encountered beneath the fill material at the borehole BH1 location. It was described as grey, moist, and very stiff. The layer was found to be approximately 1.2 m thick.

No evidence of staining was noted in the native material.

Sandy Silt

Underlying the clay deposit was a deposit of sandy silt that was found to be greyish brown in colour, damp to moist, and loose to very dense. The deposit was found to be approximately 0.9 m thick.

A thin sandy silt deposit was encountered beneath the peat layer at the BH4 location. The sandy silt deposit was found to be approximately 0.5 m thick and was recovered in a moist to wet condition and loose to very dense.

No evidence of staining was noted in the native material.

Peat

A native deposit of peat was encountered at the BH3D and BH4 locations underlying the fill material. The peat deposit was found to be approximately 1.0 to 1.2 m thick and was recovered in a damp to wet condition and very loose to loose.

No evidence of staining was noted in the native material.

4.4 Field Screening Measurements

The soil samples were field screened using visual and olfactory observations as well as combustible vapour screening using a Photoionization Detector (PID) for the CPCs. Field observations and PID readings are provided in the borehole logs provided in Appendix C.

4.5 Ground Water: Monitoring Well Installation

Advancement of boreholes BH1/MW1 through BH4/MW4 was conducted on October 5, 2018 by George Downing Estate Drilling Ltd. of Grenville Sur La Rouge, Quebec.

All of the boreholes were equipped with 51 mm diameter temporary groundwater monitoring wells respectively identified as MW1, MW2, MW3S, MW3D, and MW4. The well screens consisted of slotted No. 10, 51 mm diameter PVC. The 51 mm PVC risers extended from the top of the screen to finish height, approximately 0.05 mBG. The risers were encased in flush mount well protectors. A PVC slip cap was installed at the base of the screen to prevent sediment infiltration. A J-plug was used in the installations at the top of the riser to prevent surface water or precipitation influence.



Each well was backfilled with clean sand to 0.3 m above the top of the screen. The remaining annular space (directly above the sand pack) was backfilled with bentonite hole plug to within approximately 0.5 m of the ground surface, then backfilled with sand and equipped with a well protector.

Each well was equipped with dedicated 12 mm LDPE Waterra™ tubing and a dedicated Waterra™ footvalve. The Waterra™ tubing/footvalve was then used to develop the well. Wells were purged dry or up to three additional well volumes were removed prior to sampling to allow the collection of fresh groundwater and stabilization of field parameters.

4.6 Ground Water: Field Measurement of Water Quality Parameters

Field measurements of groundwater quality were measured in the field using a Hanna Water Quality Meter prior to sampling. Measurements of pH, turbidity, electrical conductivity (EC), and temperature were collected during purging prior to sampling. Measurements were collected following the removal of 1 L, one well volume and each subsequent well volume until the water quality parameters stabilized (subsequent readings within 10 percent difference).

4.7 Ground Water: Sampling

Stabilized groundwater levels were recorded in each monitoring well prior to disturbance of the water column.

All wells were developed then purged dry or up to three additional well volumes prior to sampling using a footvalve with dedicated 12 mm LDPE tubing in each monitoring well. Field measurements of water quality parameters were collected, as described above, to ensure stabilization of these parameters.

Following the repeated purging of the well, a groundwater sample was collected from all monitoring wells using dedicated 12 mm LDPE Waterra tubing and a Waterra footvalve.

All groundwater samples were collected in dedicated amber glass bottles and vials prepared by the laboratory. The groundwater samples for metal analysis were field filtered; the samples for PHCs, VOCs, and pH analysis were not field filtered.

Following sampling, the groundwater samples were stored in an ice pack chilled cooler and were taken directly to the laboratory following the sampling event.

4.8 Sediment Sampling

Sediment was not sampled as part of this assessment, as no natural surface water bodies were present at the Site.

4.9 Analytical Testing

All soil and groundwater analytical testing as part of this assessment was conducted by AGAT Laboratories (AGAT). AGAT is a member of the Standards Council of Canada (SCC) and Canadian Association for Laboratory Accreditation (CALA).



4.10 Residue Management Procedures

Soil cuttings from drilling activities were containerized in metal drums and placed in designated areas of the Site. The analytical results indicated there are exceedances of the O. Reg. 153/04 Table 3 criteria, which was determined to be applicable for the Site. The cuttings should be disposed of off-Site at a facility licenced to accept contaminated, non-hazardous waste soil.

Purge water was containerized in the field and was retained on-Site in one metal drum. The purge water should be disposed of off-Site at a facility licenced to accept contaminated, non-hazardous waste water.

4.11 Elevation Surveying

Survey data of the ground surface elevation of all boreholes and elevation of the top of pipe (riser) of all groundwater monitoring wells was collected as part of this assessment. Survey elevations were based on an assumed elevation of a temporary benchmark (TBM) of 100 m for the top of spindle of a fire hydrant located on the northeast corner of the property. The assigned elevations were as follows:

Table 4.1 Elevations

| Location | Relative Grade Elevation (m) | Relative Top Of Piezometer (TOP) Elevation (m) | Remarks |
|-------------|------------------------------|--|--------------------------|
| TBM Hydrant | 100.00 | - | Assigned elevation 100 m |
| BH1/MW1 | 98.64 | 98.54 | |
| BH2/MW2 | 98.39 | 98.29 | |
| BH3D/MW3D | 99.25 | 99.15 | |
| BH3S/MW3S | 99.33 | 99.23 | |
| BH4/MW4 | 98.53 | 98.43 | |

4.12 Quality Assurance and Quality Control Measures

All soil sample jars were provided by AGAT. All PHC F1 range and BTEX soil samples were collected with laboratory provided single use 2 cc soil syringes. Each sample was given a unique identification.

Stainless steel split spoons were used to recover soil samples from the boreholes; the spoons were washed in soapy water between uses. A metal spatula was used to transfer samples from the split spoons to the sample jars; this spatula was cleaned between uses. While transferring samples from split spoons into the sample jars, GHD field staff wore nitrile gloves, which were changed prior to jarring each sample to prevent cross contamination.

To ensure laboratory quality control, a blind duplicate sample of soil was submitted for laboratory analysis of one of the six submitted soil samples. Duplicate sample DUP was submitted for laboratory analysis of metals and inorganics, and PAHs. This duplicate sample provides quality assurance and quality control of soil samples submitted as part of this assessment.



All groundwater sample jars were provided by AGAT. Each sample was given a unique identification. All groundwater samples were transferred directly from the dedicated LDPE tubing directly to the sampling containers. The bottles and vials for PHCs, BTEXs, VOCs, and general chemistry (pH) were not field filtered.

To ensure laboratory quality control, a field duplicate was submitted for laboratory analysis of one of the five collected groundwater samples. One field duplicate (DUP) was submitted for laboratory analysis of metals and inorganics, VOCs, BTEXs, and pH. A trip blank groundwater sample was submitted for laboratory analysis of VOCs for each day that sampling was completed. These duplicate and blank samples provide quality assurance and quality control of all parameter sets analysed for groundwater samples submitted as part of this assessment.

5. Review and Evaluation

5.1 Geology

Asphalt

A surface layer of asphalt was encountered in boreholes BH1, BH2, and BH4. This layer was found at the ground surface extending down approximately 0.05 mBG.

Topsoil

A surface layer of topsoil and grass was encountered in boreholes BH3D/3S. This material was described as silty sand with organics, loose, dark brown, and damp. This layer was found at the ground surface extending down approximately 0.08 mBG.

No petroleum odours or visible evidence of staining were noted within the topsoil material.

Fill

A layer fill material consisting of a mixture of silt, sand and gravel was encountered underlying the surficial materials at all borehole locations. This material was described as grey and brown, loose to compact, and damp. The thickness of the fill material ranged from approximately 1.4 (BH1) to 3.0 m (BH2).

It is suspected that the encountered fill material was used to backfill the foundation of the existing building and provide the granular structure for the existing pavement on the Site.

Visible evidence of staining was noted within the fill materials encountered in all boreholes except BH4.

Silty Clay and Sandy Silt (Native)

Native silty clay material was encountered beneath the fill material at the BH1, BH3D, and BH4 locations.

A native deposit of silty clay was encountered beneath the fill material at the borehole BH1 location. It was described as grey, moist, and very stiff. The layer was found to be approximately 1.2 m thick.



Underlying the clay deposit was a deposit of sandy silt that was found to be greyish brown in colour, damp to moist, and loose to very dense. The deposit was found to be approximately 0.9 m thick.

A native deposit of peat was encountered at the BH3D and BH4 locations underlying the fill material. The peat deposit was found to be approximately 1.0 to 1.2 m thick and was recovered in a damp to wet condition and very loose to loose.

A thin sandy silt deposit was encountered beneath the peat layer at the BH4 location. The sandy silt deposit was found to be approximately 0.5 m thick and was recovered in a moist to wet condition and loose to very dense.

No evidence of staining was noted in the native material.

5.2 Ground Water - Elevations and Flow Direction

In order to assess the environmental quality of the groundwater at the Site, five groundwater monitoring wells (MW1, MW2, MW3S, MW3D, and MW4) were installed on the subject Property as part of this assessment. Wells MW1 and MW3S were screened in the overburden. All other wells were screened in the upper surface of the bedrock aquifer. A bentonite seal above the monitoring well screen/sandpack was formed during all monitoring well installations. Monitoring well construction details are presented in Table 5.1.

Table 5.1 Monitoring Well Installation

| Well ID | Grade Elevation (m) | TOP Elevation (m) | Borehole Bottom Elevation (m) | Screen Elevation (m) | Sand Pack Elevation (m) | Bentonite Seal Elevation (m) | Well Bottom Depth (mBG) |
|---|---------------------|-------------------|-------------------------------|----------------------|-------------------------|------------------------------|-------------------------|
| BH1/MW1 | 98.64 | 98.54 | 94.8 | 96.7 to 95.2 | 97.1 to 95.2 | 98.2 to 97.1 | 3.4 |
| BH2/MW2 | 98.39 | 98.29 | 93.5 | 94.6 to 93.5 | 94.8 to 93.5 | 97.9 to 94.8 | 4.9 |
| BH3D/MW3D | 99.25 | 99.15 | 93.9 | 95.2 to 93.9 | 95.3 to 93.9 | 98.8 to 95.3 | 5.4 |
| BH3S/MW3S | 99.33 | 99.23 | 95.6 | 97.1 to 95.6 | 97.5 to 95.6 | 98.8 to 97.5 | 3.7 |
| BH4/MW4 | 98.53 | 98.43 | 93.1 | 94.2 to 93.1 | 94.3 to 93.1 | 98.0 to 94.3 | 5.4 |
| Notes: | | | | | | | |
| *Elevations are not geodetic. Relative to assigned TBM as discussed in Section 4.11 | | | | | | | |

Following a period of stabilization of the groundwater in the overburden wells, water levels were collected on October 15, 2018. Groundwater elevations were determined based on the assigned elevation of 100 m for the surveyed benchmark (fire hydrant located on the northeast corner of the Site), and the monitoring well survey and the measured groundwater level within each monitoring well. Water table elevation details are presented in Table 5.2.



Table 5.2 Water Table Details

| Well ID | Grade Elevation (m) | TOP Elevation (m) | Depth to groundwater (m below grade) | Depth to Groundwater (m below TOP) | Water Table Elevation (m) |
|-----------|---------------------|-------------------|--------------------------------------|------------------------------------|---------------------------|
| BH1/MW1 | 98.64 | 98.54 | 2.07 | 1.97 | 96.57 |
| BH2/MW2 | 98.39 | 98.29 | 3.21 | 3.11 | 95.18 |
| BH3D/MW3D | 99.25 | 99.15 | 1.37 | 1.27 | 97.88 |
| BH3S/MW3S | 99.33 | 99.23 | 1.26 | 1.16 | 98.07 |
| BH4/MW4 | 98.53 | 98.43 | 1.28 | 1.18 | 97.25 |

Free product was not identified during any monitoring. The results of the LNAPL/DNAPL investigation are presented in Table 1.

Three groundwater monitoring wells are required to triangulate groundwater elevations and provide a direction of groundwater flow. Five wells were installed as part of this investigation. BH1/MW1 BH3S/MW3S were installed in the overburden. All other wells were installed in the upper bedrock. These wells were used to determine a direction of groundwater flow and hydraulic gradient. Based on the water table elevations recorded in the monitoring wells installed as part of this investigation on the Site, the direction of groundwater flow in the vicinity of the boreholes was determined to be towards the south. This direction of groundwater flow is logical based on the surficial topography observed at the Site and neighbouring properties.

5.3 Ground Water - Hydraulic Gradients

The hydraulic gradient was calculated by dividing the difference in hydraulic head by the lateral distance between monitoring locations. Based on the recorded groundwater elevations in Table 5.2 above, the horizontal hydraulic gradient is approximately 0.025 m/m.

5.4 Fine-Medium or Coarse Soil Texture

Borehole advancement has identified a native deposit consisting of a mixture of silt, clay, and sand. A significant layer of fill material was also encountered as part of the borehole drilling program. As no grain size analysis was completed as part of this assessment, the Coarse textured soil conditions will be applied, as this provides a conservative comparison of contaminant concentrations to their criteria.

5.5 Soil Field Screening

The soil samples were field screened for the olfactory and visible presence of CPCs and for combustible vapour. The combustible vapour readings for the soil samples collected as part of this assessment were negligible.



5.6 Soil Quality

Location and Depth of Sampling

The locations of the boreholes and sampling locations are indicated on Figure 2: Borehole Location Plan, in the Figures section of this report. During the investigation, soil layers were sampled for metals, PAHs, pH, Flashpoint, and TCLP for metals and inorganics, VOCs, and PCBs, as follows:

Table 5.3 Soil Sample Details

| Sample ID | Submitted Sample | Sample depth | Parameters |
|------------------------------|----------------------|--------------|---|
| BH1-SS3 | BH1-SS3 | 1.4-2.0 | metals, PAHs, pH |
| BH2-SS5 | BH2-SS5 | 2.4-3.0 | metals, PAHs, pH |
| BH3-SS3 | BH3-SS3 | 1.2-1.8 | metals, PAHs, pH |
| BH4-SS2/SS3 | BH4-SS2/SS3 | 0.6-1.8 | metals, PAHs, pH |
| BH3 (Auger Cuttings) | BH3 (Auger Cuttings) | 2.5-3.5 | PAHs, pH, TCLP metals, TCLP VOCs, TCLP PCBs, Flashpoint |
| BH5-SS3 (DUP of BH4-SS2/SS3) | BH4-SS2/SS3 | 0.6-1.8 | metals, PAHs, pH |

Comparison of Analytical Results to O. Reg. 153/04 Criteria

As determined in Section 1.4 (Applicable Site Class), full depth generic O. Reg. 153/04 Table 3 (residential/parkland land use, non-potable groundwater use, coarse grain soil texture) criteria is considered the applicable Site comparison.

Analytical testing of the aforementioned soil samples indicated the following parameters exceed the O. Reg. 153/04 Table 3 criteria (residential/parkland, coarse grained texture):

- BH2-SS5
 - Boron, Electrical Conductivity, and Sodium Adsorption Ratio
- BH1-SS3, BH2-SS5, BH4-SS2/SS3, BH5-SS3 (DUP of BH4-SS2/SS3)
 - Electrical Conductivity, and Sodium Adsorption Ratio

A complete summary of the analytical soil testing conducted as part of this Phase Two ESA and comparison to O. Reg. 153/04 criteria are present in Table 2. The maximum soil concentrations detected as part of this investigation are presented in Table 4, following the text of this report. A copy of the laboratory certificates of analysis for the soil samples are presented in Appendix D.

Contaminants of Concern

The contaminants of potential concern (CPC) in soil for the Site were based on the APECs identified at the Site during the Phase One ESA:

- PCA#1 (on-Site, fill of an unknown origin)/APEC #1 (various locations) | metals and PAHs
- PCA#2 (off-Site, a former landfill)/APEC #2 (approx. 20 m east of Site) | metals and PAHs



Comparison of TCLP Analytical Results to O. Reg. 558/00 Schedule IV Criteria

A soil sample was collected for leachate testing and was analyzed using the toxicity characteristic leaching procedure (TCLP). The results of the submitted TCLP sample are shown on the laboratory Certificate of Analysis – AGAT #18Z394508 in Appendix D. The results of the TCLP testing were compared to O. Reg. 558/00 criteria. The TCLP results are in compliance with the O. Reg. 558/00 criteria. In the event that the Site soil cannot be handled as clean fill, the Site soil can be considered solid non-hazardous waste.

Chemical or Biological Transformations

Parameters related to chemical or biological transformations of CPCs were not suspected to be present and were not detected in the analytical results as part of this investigation.

Soil Acting as a Contaminant Mass Contributing to Other Media

Based on the laboratory results of the analysed soil samples, there is no soil on the Site which is acting as a contaminant mass contributing to other media.

LNAPL/DNAPL

Light Non Aqueous Phase Liquids (LNAPL) and Dense Non Aqueous Phase Liquids (DNAPL) were not suspected to be present in the groundwater at the Site as a result of the identified PCAs/APECs. Free product was not detected in the groundwater recovered from the monitoring wells.

5.7 Ground Water Quality

Location and Depth of Sampling

The depths of the screens are indicated in Table 5.1 in Section 5.2 of this report; the screened intervals were situated in the upper (weathered) portion of the limestone bedrock or in the overburden, straddling the shallow static groundwater table.

Field Filtering

Field filtering is not conducted under standard field protocols for groundwater sampling of PHCs, VOCs, BTEXs, PAHs, or pH.

Samples intended for metal analysis were field filtered using a 45 µm filter.

Contaminants of Concern

The contaminants of potential concern (CPC) in groundwater for the Site were based on the APECs identified at the Site during the Phase One ESA:

- PCA#1 (on-Site, fill of an unknown origin)/APEC #1 (various locations) | metals and inorganics, BTEXs, PHCs
- PCA#2 (off-Site, a former landfill)/APEC #2 (approx. 20 m east of Site) | metals and inorganics, VOCs



Comparison of Analytical Results to O. Reg. 153/04 Criteria

As determined in Section 1.4 (Applicable Site Class), full depth generic O. Reg. 153/04 Table 3 (residential/parkland land use, non-potable groundwater use, coarse soil texture) criteria is considered the applicable Site comparison.

Analytical testing of the aforementioned groundwater samples indicated the following parameters exceed the O. Reg. 153/04 Table 3 criteria (residential/parkland, coarse grained texture):

- MW2
 - Chloride
- MW3S
 - PHCs (F2 and F3)

A complete summary of the analytical groundwater testing conducted as part of this Phase Two ESA and comparison to O. Reg. 153/04 criteria are present in Table 3, following the text of this report. The maximum groundwater concentrations detected as part of this investigation are presented in Table 5, following the text of this report. A copy of the laboratory certificates of analysis for the groundwater samples are presented in Appendix D.

Chemical or Biological Transformations

Parameters related to chemical or biological transformations of the CPCs were not suspected to be present and were not detected in the analytical results as part of this investigation.

LNAPL/DNAPL

Light Non Aqueous Phase Liquids (LNAPL) and Dense Non Aqueous Phase Liquids (DNAPL) were not considered to have the potential to be present in the groundwater at the Site as a result of the identified PCAs/APECs.

There were detections of PHCs (F2 and F3 range) in the analyzed groundwater sample collected from MW3S, which was reported at concentrations in exceedance of O. Reg. 153/04 Table 3 Site criteria.

There were detection of VOCs parameters in the analyzed groundwater sample collected from MW1, MW3S, MW4, and MW6 (a duplicate sample of MW3S), at concentrations in compliance with O. Reg. 153/04 Table 3 Site criteria.

Free product was not detected in the groundwater recovered from the monitoring wells.

5.8 Sediment Quality

Natural Surface Water Bodies were not present on the Site; as such sediment sampling was not conducted at the Site as part of the Phase Two ESA.



5.9 Quality Assurance and Quality Control Results

Quality Control

One field duplicate soil sample (BH5-SS3, a duplicate of sample BH4-SS2/SS3) was submitted for laboratory analysis of metals, PAHs, and pH. This duplicate analysis provides quality assurance and quality control of parameter sets analysed in the six soil samples submitted as part of this assessment. In general the relative percent differences (RPDs) were less than 40 percent for the duplicate soil samples. This range of RPDs is typically greater than that which would indicate consistency in laboratory results, however, given the low level concentrations of parameters which were generally detected in the analysed soil sample duplicates, the level of variability among results is considered acceptable to indicate that the duplicate soil results do indicate general consistency in the laboratory data.

One blind field duplicate groundwater sample (MW6, a duplicate of MW3S) was submitted for laboratory analysis of metals, VOCs, PHCs, and pH. This duplicate provides quality assurance and quality control of parameter sets analysed in the six groundwater samples submitted as part of this assessment. The relative percent differences (RPDs) were less than 70 percent for the duplicate groundwater samples. This range of RPDs is typically greater than that which would indicate consistency in laboratory results, however, given the low level concentrations of parameters which were generally detected in the analysed soil sample duplicates, the level of variability among results is considered acceptable to indicate that the duplicate soil results do indicate general consistency in the laboratory data.

One trip blank samples (one for each day of groundwater sampling) was submitted for laboratory analysis of VOCs in groundwater. This trip blanks provides quality assurance and quality control of volatile parameter sets analysed for groundwater samples submitted as part of this assessment. No contaminants concentrations were detected in the analyzed trip blank sample.

Handling and Transport

All samples were delivered to the laboratory in laboratory supplied containers. Samples were hand delivered to the laboratory in coolers, equipped with ice packs and trip blanks. All samples were delivered to the Laboratory within the mandated holding time and temperature requirements.

Analytical Documentation

The documentation provided from the laboratory meets the requirements of O. Reg. 153/04 Section 47(3). Documentation for each laboratory submitted sample has been included as an appendix to this report. Full documentation, including the laboratory certificates of analysis, is provided in Appendix D.

Analytical Qualifiers

No analytical qualifiers were reported on laboratory report 18Z394508 (soil samples) or report 18Z399894 (groundwater samples) with respect to submissions as part of this assessment.



General Comments on Field Data

For the purposes of this investigation, the quality of the field data:

- Meets the objectives of the investigation.
- Did not affect the decision making process.

5.10 Phase Two Conceptual Site Model

Potentially Contaminating Activities (PCAs)

Based on the known information of the general area of the Site, there was one on-Site PCA, and one off-Site PCA identified in the Study Area.

- PCA#1 (Item 30: Importation of Fill Material of Unknown Quality) | On-Site, importation of Fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.
- PCA#2 (Item 58: Waste Disposal and Waste Management, including thermal treatment, landfilling and transfer of waste, other than use of biosolids as soil conditioners) | Off-Site, a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site.

Areas of Potential Environmental Concern (APECs)

The potentially contaminating activities considered to represent areas of potential environmental concern for the Site are:

- APEC#1 (Item 30: Importation of Fill Material of Unknown Quality) | On-Site, importation of Fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.
- APEC#2 (Item 58: Waste Disposal and Waste Management, including thermal treatment, landfilling and transfer of waste, other than use of biosolids as soil conditioners) | Off-Site, a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern (CPCs) in soil and groundwater for the Site were based on the APECs identified at the Site during Phase I ESA and observations at the time of the drilling program. The following CPCs for the Site were suspected to be associated with fill material at the Site, and the off-Site former landfill:

1. Petroleum Hydrocarbons ranges F1-F4 (PHCs) and Benzene, Toluene, Ethylbenzene, and Xylenes (BTEXs)
2. Volatile Organic Compounds (VOCs) – in groundwater only
3. Metals and Inorganics
4. Polycyclic Aromatic Hydrocarbons (PAHs)



An assessment of the CPCs for the Site was completed as part of the Phase Two ESA analytical submission program. Soil and groundwater samples were submitted for a combination of the CPCs dependent on borehole/monitoring well locations with respect to the APECs.

Subsurface Conditions

Municipal water and sewer services are supplied by underground service trenches on the east portion of the Site leading to DuMaurier Avenue. Electricity is supplied to the Site buildings from underground service trenches from the west of the building. The phone line is supplied to the Site building from Ramsey Crescent to the south of the Site. These service trenches are considered to have the potential to act as conduits for contaminant migration.

According to the 1987 Geological Survey of Canada, Surficial Geology Map for Ottawa (Map No.: 1506A), the natural soil consists of "Abandoned river channel deposits of silt and silty clay; commonly including lenses of sand and generally underlain at variable depth by stratified, buff, medium grained sand". The thickness of overburden is expected to be approximately 3 to 4 m thick and the bedrock in the general area of the Site is expected to be limestone. According to records from the water well information system and borehole databases, as presented in the results of the subcontracted Ecolog Environmental ERIS search, the overburden soil in the vicinity of the Site consist of a mixture of silt, clay, and sand type soils. The overburden soil was reportedly underlain by shale or limestone bedrock at an approximate depth ranging from 1.8 to 8.8 m below ground surface.

Physical Setting - Stratigraphy

As presented in the Borehole Logs in Appendix C, the investigation identified seven materials within the depth investigated, namely:

- Asphalt
- Grass vegetation and Topsoil
- Fill (Sand and Gravel) or (Silty Clay) or (Silty Sand)
- Sandy Silt
- Silty Clay
- Peat
- Limestone bedrock

Physical Setting – Hydrogeological

The interpretation of groundwater flow was based upon the generally known geology, the location and flow direction of surface water bodies and the static water levels collected from monitoring wells completed on the Site as part of this assessment. The overburden/weathered upper bedrock groundwater flows to the south. Based on the recorded groundwater elevations in Table 5.2, and a lateral separation distance between monitoring well locations, the horizontal hydraulic gradient is approximately 0.025 m/m. The hydraulic gradient is expected to vary with seasonal and weather conditions.



Based on the geology observed at the Site, the overburden/weathered upper bedrock aquifer is considered as unconfined.

Physical Setting – Bedrock

Limestone bedrock was encountered in boreholes BH2, BH3D, and BH4 at the Site, generally at depths ranging between 3.2 and 3.9 mBG. In general, the upper surface (top 0.5-1.5 m) of the bedrock was revealed to be very poor to good quality, becoming to fair to good rock quality with increasing depth.

Physical Setting – Groundwater Table

The static groundwater table in overburden wells installed by GHD, were measured at depths ranging from approximately 1.3 to 2.1 mBG on October 15, 2018.

The groundwater table in the wells installed in the upper bedrock were measured at depths ranging from approximately 1.3 to 3.2 mBG.

Groundwater flow direction was interpreted to be towards the south with a calculated hydraulic gradient of 0.025 m/m, based on measured relative groundwater elevations.

The water table details are summarized in Table 5.2. It should be noted that the water table elevation is expected to vary with seasonal and weather conditions.

Physical Setting – Sensitive or Shallow or Surface Water

The pH of the soil was tested and observed to be within the range of 5-9. There are no Areas of Natural Scientific Interest (ANSI) identified by the Ministry of Natural Resources (MNR) within 250 m of the Site. There are no areas designated by the municipality in its current official plan (Bylaw 2008-250-Zoning) as 'EP' (Environmentally Protected zoning) identified within 250 m of the Site. As the Site does not contain an area of natural significance, and properties within 30 m of the Site limits do not contain areas of natural significance, the Site is not classified as an environmentally sensitive property (O. Reg. 153/04, s41).

No natural surface water bodies were identified on the Site or within the Phase One Study Area. The nearest natural surface body is the Ottawa River, which is located approximately 1.5 km to the Northwest of the Site. There is no open surface water bodies within 30 m of the Site limits. As the property does not include all or part of a water body, and the property is not adjacent to a water body, and does not include land that is within 30 m of a water body, the Property is not considered a Surface Water site (O. Reg. 153/04, s43.1[1]).

Drilling conducted as part of this investigation revealed that there is more than 2 m of soil in all boreholes locations advanced on the Site. The native soils encountered show a single native soil deposit consisting of a mixture of silt, clay and sand; coarse grained soils were assumed as a conservative comparison approach. The full depth generic criteria of Tables 3 of O. Reg. 153/04 is considered applicable.

The Property, and all other properties located, in whole or in part, within 250 m of the boundaries of the property, are supplied by a municipal drinking water system. The Site is not in an area designated on the City of Ottawa official plan as an intake protection zone (IPZ). The Site is not in an area designated on the City of Ottawa official plan as a well-head protection area (WHPA). The Site



is not an agricultural property. The Site is considered as being non-potable water use as per Section 35 of the Ontario Regulation 153/04 as amended 2011 (O. Reg. 153/04, s35).

The existing property use is mixed commercial and institutional. The proposed property use will be residential. The Site is considered as being residential/parkland/institutional land use as per Section 3 of the Ontario Regulation 153/04 as amended 2011 (O. Reg. 153/04, s1[3]).

Accordingly, the appropriate Site classification under O. Reg. 153/04 will be full depth generic non-potable residential land use (O. Reg. 153/04, Table 3).

Physical Setting – Fill

A layer fill material consisting of a mixture of silt, sand and gravel was encountered underlying the surficial materials at all borehole locations. This material was described as grey and brown, loose to compact, and damp. The thickness of the fill material ranged from approximately 1.4 (BH1) to 3.0 m (BH2).

It is suspected that the encountered fill material was used to backfill the foundation of the existing building and provide the granular structure for the existing pavement on the Site.

Visible evidence of staining was noted within the fill materials encountered in all boreholes except BH4.

In addition to the fill material identified in the Phase Two ESA drilling program, it is expected that underground services on the property are bedded in imported granular material. It is expected that the construction of the foundations of the existing on-Site building included backfill, and material from off-Site. Backfill around the existing structures and services was not investigated as part of the Phase Two ESA.

Physical Setting – Existing and Proposed Structures

At the time of report preparation:

- The current property use is mixed commercial and institutional
- The existing building on Site is surrounded by asphalt paved parking area that is accessed from Dumaurier Avenue to the east and Ramsey Crescent to the south.
- The north portion of the Site is a landscaped area.

GHD understands that the Client intends to demolish the existing structures and construct a 40-storey residential building with six underground parking levels. The Property is currently used for mixed commercial and institutional purposes and therefore requires a Record of Site Condition (RSC), required for a change in land use to more sensitive land uses. This report will also be used to support a submission to the local municipal planning department.

Contamination

Soil samples were collected from the boreholes advanced on October 5, 2018 and were analysed for a combination of PAHs, metals and inorganics, and pH.

Four soil samples, BH1-SS3 (1.4-2.0 mBG), BH2-SS5 (2.4-3.0 mBG), BH4-SS2/SS3 (0.6-1.8 mBG) and BH5-SS3 (a duplicate sample of BH4-SS2/SS3) presented O. Reg. 153/04 Table 3



exceedances of electrical conductivity and sodium adsorption ratio. The soil sample BH2-SS5 also presented exceedances of Boron.

The sample BH1-SS3 was collected from the native silty clay deposit. All other samples were collected from fill material at various locations around the site. It is suspected that areas of contaminated soil are present across the Site and in localized areas where poor quality fill material was used for grading and/or backfill for the foundations of the existing on-site building. It is suspected that there may be additional contaminated soil present in other localised areas of the Site.

Groundwater was sampled on October 19, 2018 and analysed for Metals, VOCs, BTEX, and PHCs. Groundwater sample, MW2 presented O. Reg. 153/04 Table 3 exceedances of Chloride. Sample MW3S presented O. Reg. 153/04 Table 3 exceedances of PHCs (F2 and F3). The PHC contamination appears to be localized in the area of MW3S as PHCs were not detected in the analysis of the groundwater samples collected from the other well locations.

A remedial action plan and groundwater management program will be developed for the Client in order to manage and dispose of the contaminated soil and groundwater at the time of redevelopment.

6. Conclusions

Soil samples were collected from the boreholes advanced on October 5, 2018 and were analysed for a combination of Metals, PAHs, and pH.

Four soil samples, BH1-SS3 (1.4-2.0 mBG), BH2-SS5 (2.4-3.0 mBG), BH4-SS2/SS3 (0.6-1.8 mBG) and BH5-SS3 (a duplicate sample of BH4-SS2/SS3) presented O. Reg. 153/04 Table 3 exceedances of electrical conductivity and sodium adsorption ratio. The soil sample BH2-SS5 also presented exceedances of Boron.

The sample BH1-SS3 was collected from the native silty clay deposit. All other samples were collected from fill material at various locations around the site. It is suspected that areas of contaminated soil are present across the Site and in localized areas where poor quality fill material was used for grading and/or backfill for the foundations of the existing on-site building. It is suspected that there may be additional contaminated soil present in other localised areas of the Site.

Groundwater was sampled on October 19, 2018 and analysed for Metals, VOCs, BTEX, and PHCs. Groundwater sample, MW2 presented O. Reg. 153/04 Table 3 exceedances of Chloride. Sample MW3S presented O. Reg. 153/04 Table 3 exceedances of PHCs (F2 and F3). The PHC contamination appears to be localized in the area of MW3S as PHCs were not detected in the analysis of the groundwater samples collected from the other well locations.

A remedial action plan and groundwater management program will be developed for the Client in order to manage and dispose of the contaminated soil and groundwater at the time of redevelopment.

Site Compliance

There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in four of the six submitted soil samples, including the duplicate QA/QC soil sample.



There were O. Reg. 153/04 Table 3 (residential land use, coarse soil texture) criteria exceedances in two of the six submitted groundwater samples, including the duplicate QA/QC soil sample.

The Site is not considered to be in compliance with the O. Reg. 153/04 criteria for the proposed land use and requires soil and groundwater remediation/removal or a risk assessment.



7. References

Ontario Regulation 153/04

Phase I Environmental Site Assessment, 2831, 2833, 2835, 2841 and 2865 DuMaurier Avenue, Ottawa, Ontario. Reference No. 11181273-E1 (1), prepared by GHD Ltd., dated August 16, 2018

Certificate of Analysis – AGAT #18Z394508 – Soil and TCLP– October 15, 2018

Certificate of Analysis – AGAT #18Z399894 – Groundwater – October 30, 2018




All of Which is Respectfully Submitted,


GHD

Ryan Vanden Tillaart, EIT

Luke Lopers, P. Eng.

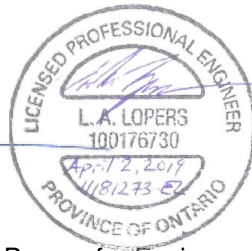

Luke Lopers, P. Eng., Qualified Person for Environmental Site Assessment under O. Reg. 153/04, confirms the carrying out of the Phase Two Environmental Site Assessment and the findings and conclusions of this report.

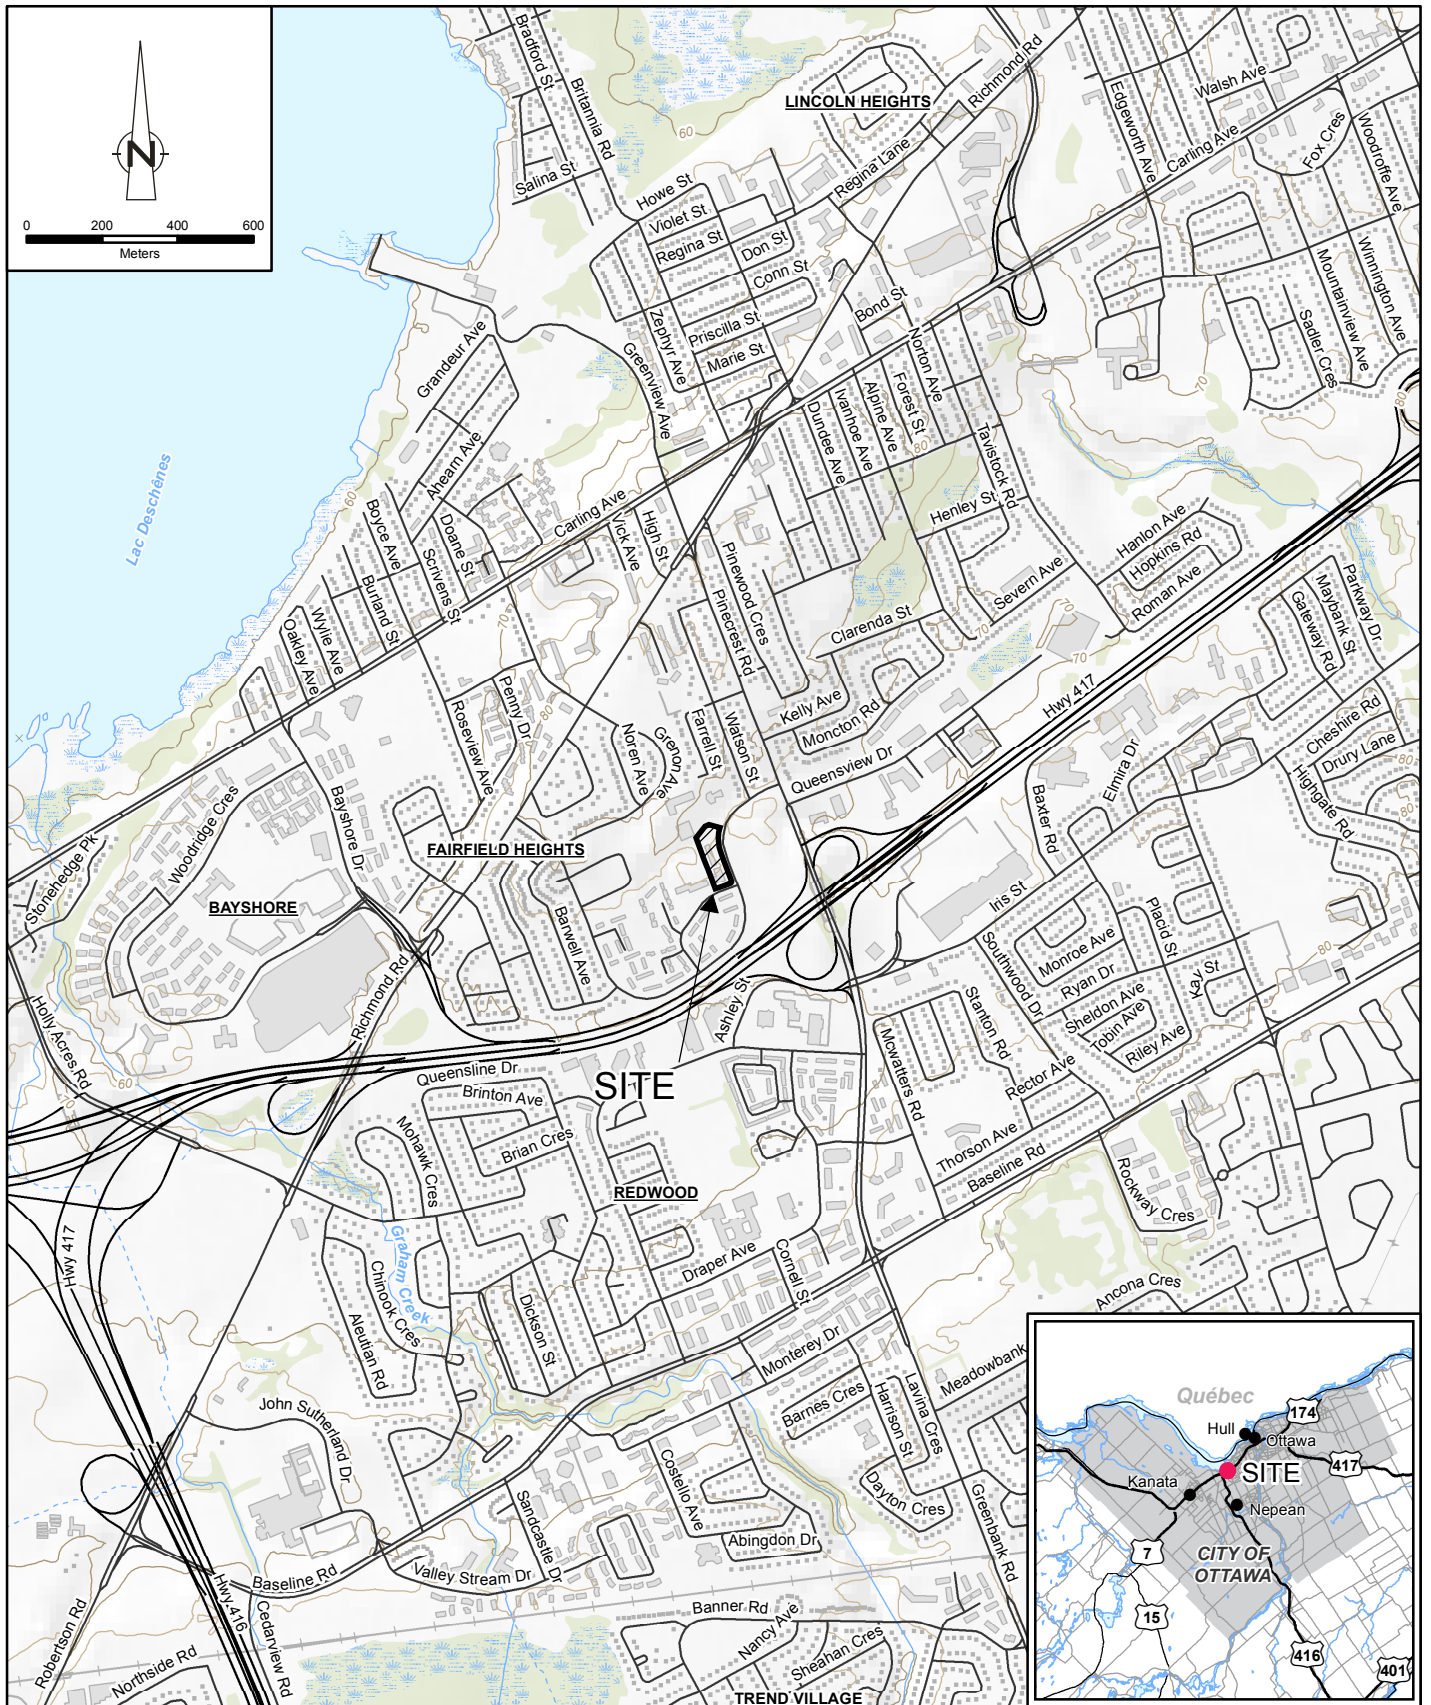

Source: MNRF NRVIS, 2018. Produced by GHD under licence from Ontario Ministry of Natural Resources and Forestry, © Queen's Printer 2018.
 Coordinate System: NAD 1983 UTM Zone 18N




3223701 CANADA INC.
 2831, 2833, 2835, 2841 AND 2865 DUMAURIER AVENUE, OTTAWA, ONTARIO
 TWO ENVIRONMENTAL SITE ASSESSMENT

11181273-E2
 Nov 6, 2018

SITE LOCATION MAP

FIGURE 1

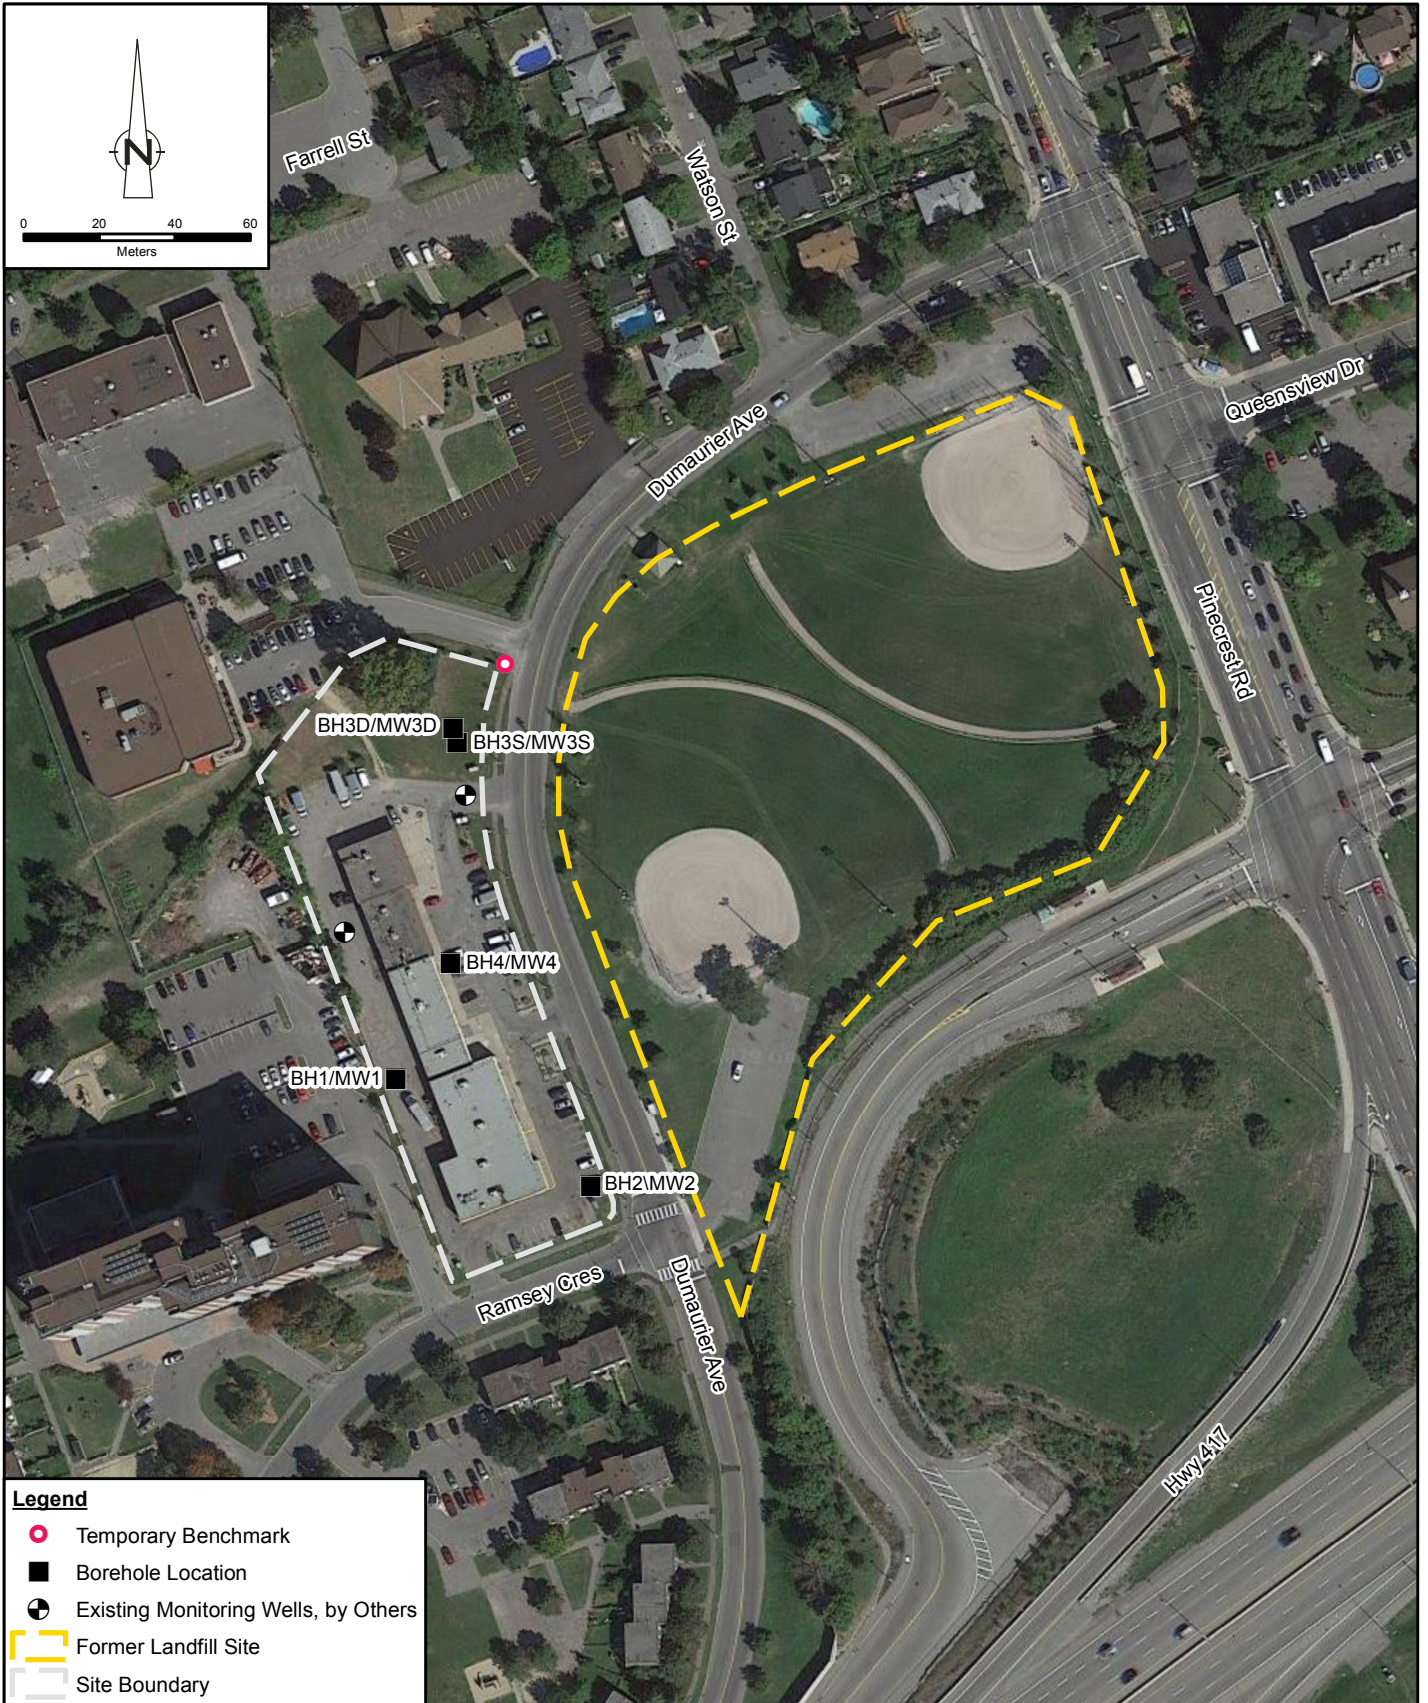

3223701 CANADA INC.
 2831, 2833, 2835, 2841 AND 2865 DUMAURIER AVENUE, OTTAWA, ONTARIO
 PHASE TWO ENVIRONMENTAL SITE ASSESSMENT

11181273-E2
 Mar 29, 2019



BOREHOLE LOCATION PLAN

FIGURE 2

Table 1

**DNAPL/LNAPL Layers
Phase Two Environmental Site Assessment
2831, 2851, 2865 DuMaurier Avenue
Ottawa, Ontario**

| WELL ID | Grade Elevation (m) | TOP Elevation (m) | Bottom Depth (m below grade) | Bottom Elevation (m) | September 8, 2017 Depth to Watertable (m below grade) | September 8, 2017 Elevation Watertable (m) | Thickness of LNAPL (m) | Thickness of DNAPL (m) |
|-----------|------------------------|----------------------|---------------------------------|-------------------------|---|--|---------------------------|---------------------------|
| BH1/MW1 | 98.64 | 98.54 | 3.84 | 94.80 | 2.07 | 96.57 | 0.00 | 0.00 |
| BH2/MW2 | 98.39 | 98.29 | 4.89 | 93.50 | 3.21 | 95.18 | 0.00 | 0.00 |
| BH3D/MW3D | 99.25 | 99.15 | 5.35 | 93.90 | 1.37 | 97.88 | 0.00 | 0.00 |
| BH3S/MW3S | 99.33 | 99.23 | 3.73 | 95.60 | 1.26 | 98.07 | 0.00 | 0.00 |
| BH4/MW4 | 98.53 | 98.43 | 5.43 | 93.10 | 1.28 | 97.25 | 0.00 | 0.00 |

Elevation relative to Site BM=100.00 m, assigned to Top of Spindle of Hydrant on the northeast corner of the Site

Table 2

Summary of Soil Analysis
Phase Two Environmental Site Assessment
2831, 2851, 2865 DuMaurier Avenue
Ottawa, Ontario

| Parameter | Units | MDL | O.Reg.153/04 Table 1 | O.Reg.153/04 Table 3 | BH1 | BH2 | BH3D | BH4 | BH5 (duplicate of BH4) |
|----------------------------|----------|-------|-----------------------------------|---|------------------------|------------------|------------------|------------------|------------------------|
| | | | Background residential/industrial | Full Depth non-potable, coarse grained residential/ parkland/ institutional | 1.4-2.0 mBG Silty Clay | 2.4-3.0 mBG Fill | 1.2-1.8 mBG Fill | 0.6-1.8 mBG Fill | 0.6-1.8 mBG Fill |
| Metals | | | | | | | | | |
| Antimony | ug/g dry | 0.8 | 1.3 | 7.5 | <0.8 | <0.8 | <0.8 | <0.8 | <0.8 |
| Arsenic | ug/g dry | 1 | 18 | 18 | 2 | 5 | 2 | 2 | 2 |
| Barium | ug/g dry | 2 | 220 | 390 | 94 | 118 | 56 | 91 | 91 |
| Beryllium | ug/g dry | 0.5 | 2.5 | 4 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 |
| Boron | ug/g dry | 5 | 36 | 120 | 6 | 9 | <5 | 6 | 6 |
| Boron (Hot Water Soluble) | ug/g dry | 0.1 | NV | 1.5 | 0.27 | 1.54 | 0.37 | 0.34 | 0.32 |
| Cadmium | ug/g dry | 0.5 | 1.2 | 1.2 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 |
| Chromium | ug/g dry | 2 | 70 | 160 | 37 | 22 | 15 | 29 | 31 |
| Cobalt | ug/g dry | 0.5 | 21 | 22 | 8.2 | 6.1 | 4.7 | 6.9 | 7.3 |
| Copper | ug/g dry | 1 | 92 | 140 | 14 | 105 | 19 | 17 | 18 |
| Lead | ug/g dry | 1 | 120 | 120 | 11 | 61 | 28 | 5 | 6 |
| Molybdenum | ug/g dry | 0.5 | 2 | 6.9 | <0.5 | 1.4 | <0.5 | <0.5 | 0.5 |
| Nickel | ug/g dry | 1 | 82 | 100 | 18 | 21 | 10 | 18 | 19 |
| Selenium | ug/g dry | 0.4 | 1.5 | 2.4 | <0.4 | 0.5 | <0.4 | 0.7 | <0.4 |
| Silver | ug/g dry | 0.2 | 0.5 | 20 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 |
| Thallium | ug/g dry | 0.4 | 1 | 1 | <0.4 | <0.4 | <0.4 | <0.4 | <0.4 |
| Uranium | ug/g dry | 0.5 | 2.5 | 23 | 1.3 | 0.9 | 0.5 | 1 | 1.2 |
| Vanadium | ug/g dry | 1 | 86 | 86 | 41 | 21 | 21 | 32 | 33 |
| Zinc | ug/g dry | 5 | 290 | 340 | 58 | 183 | 124 | 36 | 36 |
| Chromium VI | ug/g dry | 0.2 | 0.66 | 8 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 |
| Cyanide | ug/g dry | 0.04 | 0.051 | 0.051 | <0.040 | <0.040 | <0.040 | <0.040 | <0.040 |
| Mercury | ug/g dry | 0.1 | 0.27 | 0.27 | <0.10 | 0.23 | <0.10 | <0.10 | <0.10 |
| Electrical Conductivity | ug/g dry | 0.005 | 0.57 | 0.7 | 1.87 | 1.01 | 0.372 | 0.929 | 0.913 |
| Sodium Adsorption Ratio | ug/g dry | NA | 2.4 | 5 | 15.5 | 11.2 | 1.88 | 13.6 | 8.98 |
| PAHs | | | | | | | | | |
| Naphthalene | ug/g dry | 0.05 | 0.09 | 0.6 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Acenaphthylene | ug/g dry | 0.05 | 0.093 | 0.15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Acenaphthene | ug/g dry | 0.05 | 0.072 | 7.9 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Fluorene | ug/g dry | 0.05 | 0.12 | 62 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Phenanthrene | ug/g dry | 0.05 | 0.69 | 6.2 | <0.05 | 0.16 | 0.06 | 0.06 | 0.06 |
| Anthracene | ug/g dry | 0.05 | 0.16 | 0.67 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Fluoranthene | ug/g dry | 0.05 | 0.56 | 0.69 | <0.05 | 0.25 | 0.11 | <0.05 | <0.05 |
| Pyrene | ug/g dry | 0.05 | 1 | 78 | <0.05 | 0.21 | 0.09 | <0.05 | <0.05 |
| Benz(a)anthracene | ug/g dry | 0.05 | 0.36 | 0.5 | <0.05 | 0.11 | 0.06 | <0.05 | <0.05 |
| Chrysene | ug/g dry | 0.05 | 2.8 | 7 | <0.05 | 0.14 | 0.06 | <0.05 | <0.05 |
| Benzo(b)fluoranthene | ug/g dry | 0.05 | 0.47 | 0.78 | <0.05 | 0.16 | 0.07 | <0.05 | <0.05 |
| Benzo(k)fluoranthene | ug/g dry | 0.05 | 0.48 | 0.78 | <0.05 | 0.06 | <0.05 | <0.05 | <0.05 |
| Benzo(a)pyrene | ug/g dry | 0.05 | 0.3 | 0.3 | <0.05 | 0.1 | 0.06 | <0.05 | <0.05 |
| Indeno(1,2,3-cd)pyrene | ug/g dry | 0.05 | 0.23 | 0.38 | <0.05 | 0.05 | <0.05 | <0.05 | <0.05 |
| Dibenz(a,h)anthracene | ug/g dry | 0.05 | 0.1 | 0.1 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 |
| Benzo(g,h,i)perylene | ug/g dry | 0.05 | 0.68 | 6.6 | <0.05 | 0.07 | 0.05 | <0.05 | <0.05 |
| 2-and 1-methyl Naphthalene | ug/g dry | 0.05 | 0.59 | 0.99 | <0.05 | <0.05 | <0.05 | 0.09 | 0.1 |
| pH | NA | NA | NA | NA | 6.82 | 7.23 | 7.44 | 7.78 | 7.49 |
| Lab ID | - | - | - | - | 9610083 | 9610085 | 9610086 | 9610087 | 9610088 |
| Sample Date | - | - | - | - | 5-Oct-18 | 5-Oct-18 | 5-Oct-18 | 5-Oct-18 | 5-Oct-18 |
| Notes | | | | | | | | | |

BOLD - Table 3 (non-potable, residential land use, fine grained soil) criteria not Analysed by laboratory

Table 3
Summary of Groundwater Analysis
Phase Two Environmental Site Assessment
2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario

| Parameter | Units | MDL | O.Reg.153/04 Table 1 | | O.Reg.153/04 Table 3 | | MW1 | MW2 | MW3S | MW3D | MW4 | MW6 (Duplicate of MW3S) | TRIP BLANK |
|-----------------------------|-------|------|----------------------|-----------------------------|----------------------|---------|---------|---------|--------|---------|-------|-------------------------|------------|
| | | | background | non-potable, coarse grained | | | | | | | | | |
| | | | | | | | | | | | | | |
| Metals | | | | | | | | | | | | | |
| Antimony | µg/L | 1 | 1.5 | 20000 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | - |
| Arsenic | µg/L | 1 | 13 | 1900 | 7.2 | 1.2 | 3.1 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | - |
| Barium | µg/L | 2 | 610 | 29000 | 747 | 1190 | 680 | 493 | 1110 | 688 | | | - |
| Beryllium | µg/L | 0.5 | 0.5 | 67 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | - |
| Boron | µg/L | 10 | 1700 | 45000 | 26.3 | 240 | 58.4 | 20 | 76.9 | 62.8 | | | - |
| Cadmium | µg/L | 0.2 | 0.5 | 2.7 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | - |
| Chromium | µg/L | 2 | 11 | 810 | 31.4 | 5.9 | 12.6 | 14.5 | | 10 | | | - |
| Cobalt | µg/L | 0.5 | 3.8 | 66 | 2.2 | 1.8 | 1.2 | <0.5 | 0.5 | 1.3 | | | - |
| Copper | µg/L | 1 | 5 | 87 | 1.1 | 1.2 | <1.0 | 2.2 | <1.0 | <1.0 | <1.0 | <1.0 | - |
| Lead | µg/L | 0.5 | 1.9 | 25 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 | - |
| Molybdenum | µg/L | 0.5 | 23 | 9200 | 0.6 | 0.8 | 1.5 | 1.3 | 1 | 1.8 | | | - |
| Nickel | µg/L | 1 | 14 | 490 | 1.5 | 1.1 | <1.0 | 1 | <1.0 | <1.0 | <1.0 | <1.0 | - |
| Selenium | µg/L | 1 | 5 | 63 | 1.8 | 1.7 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | - |
| Silver | µg/L | 0.2 | 0.3 | 1.5 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 | - |
| Thallium | µg/L | 0.3 | 0.5 | 510 | <0.3 | <0.3 | <0.3 | <0.3 | <0.3 | <0.3 | <0.3 | <0.3 | - |
| Uranium | µg/L | 0.5 | 8.9 | 420 | 0.8 | <0.5 | <0.5 | 1.5 | <0.5 | <0.5 | <0.5 | <0.5 | - |
| Vanadium | µg/L | 0.4 | 3.9 | 250 | 4.7 | 1.1 | 3.3 | 4.1 | 4.7 | 2.8 | | | - |
| Zinc | µg/L | 5 | 160 | 1100 | <5.0 | 6.3 | <5.0 | <5.0 | <5.0 | 6 | | | - |
| Mercury | µg/L | 0.02 | 0.1 | 0.29 | <0.02 | <0.02 | <0.02 | <0.02 | <0.02 | <0.02 | <0.02 | <0.02 | - |
| Chromium VI | µg/L | 5 | 25 | 140 | <5 | <5 | <5 | <5 | <5 | <5 | <5 | <5 | - |
| Cyanide | µg/L | 2 | 5 | 66 | <2 | <2 | <2 | <2 | <2 | <2 | <2 | <2 | - |
| Sodium | µg/L | 2500 | 490000 | 2300000 | 651000 | 1150000 | 384000 | 606000 | 214000 | 385000 | | | - |
| Chloride | µg/L | 1000 | 790000 | 2300000 | 1830000 | 2350000 | 1150000 | 1400000 | 472000 | 1130000 | | | - |
| Electrical Conductivity | µg/L | 2 | NA | NA | 5560 | 7260 | 3630 | 4580 | 2000 | 3640 | | | - |
| VOCs | | | | | | | | | | | | | |
| Dichlorodifluoromethane | µg/L | 0.2 | 590 | 4400 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Vinyl Chloride | µg/L | 0.17 | 0.5 | 0.5 | <0.17 | <0.68 | <0.17 | <0.17 | <0.17 | <0.17 | <0.17 | <0.17 | <0.17 |
| Bromomethane | µg/L | 0.2 | 0.89 | 5.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Trichlorofluoromethane | µg/L | 0.4 | 150 | 2500 | <0.40 | <1.60 | <0.40 | <0.40 | <0.40 | <0.40 | <0.40 | <0.40 | <0.40 |
| Acetone | µg/L | 1 | 2700 | 130000 | <1.0 | <4.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 |
| 1,1-Dichloroethylene | µg/L | 0.3 | 0.5 | 1.6 | <0.30 | <1.20 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 |
| Methylene Chloride | µg/L | 0.3 | 5 | 610 | <0.30 | <1.20 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 |
| trans- 1,2-Dichloroethylene | µg/L | 0.2 | 1.6 | 1.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Methyl tert-butyl ether | µg/L | 0.2 | 15 | 190 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| 1,1-Dichloroethane | µg/L | 0.3 | 0.5 | 320 | <0.30 | <1.20 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 |
| Methyl Ethyl Ketone | µg/L | 1 | 400 | 470000 | <1.0 | <4.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 |
| cis- 1,2-Dichloroethylene | µg/L | 0.2 | 1.6 | 1.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Chloroform | µg/L | 0.2 | 2 | 2.4 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| 1,2-Dichloroethane | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| 1,1,1-Trichloroethane | µg/L | 0.3 | 0.5 | 640 | <0.30 | <1.20 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 |
| Carbon Tetrachloride | µg/L | 0.2 | 0.2 | 0.79 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Benzene | µg/L | 0.2 | 0.5 | 44 | <0.20 | <0.80 | 0.49 | <0.20 | <0.20 | 0.85 | | | <0.20 |
| 1,2-Dichloropropane | µg/L | 0.2 | 0.5 | 16 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Trichloroethylene | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Bromodichloromethane | µg/L | 0.2 | 2 | 85000 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Methyl Isobutyl Ketone | µg/L | 1 | 6400 | 140000 | <1.0 | <4.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 | <1.0 |
| 1,1,2-Trichloroethane | µg/L | 0.2 | 0.5 | 4.7 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| Toluene | µg/L | 0.2 | 0.8 | 18000 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | 0.32 | <0.20 |
| Dibromochloromethane | µg/L | 0.1 | 2 | 82000 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| Ethylene Dibromide | µg/L | 0.1 | 0.2 | 0.25 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| Tetrachloroethylene | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| 1,1,1,2-Tetrachloroethane | µg/L | 0.1 | 1.1 | 3.3 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| Chlorobenzene | µg/L | 0.1 | 0.5 | 630 | <0.10 | <0.40 | 0.64 | <0.10 | <0.10 | 1.3 | | | <0.10 |
| Ethylbenzene | µg/L | 0.1 | 0.5 | 2300 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| Bromoform | µg/L | 0.1 | 5 | 380 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| Styrene | µg/L | 0.1 | 0.5 | 1300 | 0.23 | <0.40 | <0.10 | <0.10 | 0.54 | <0.10 | <0.10 | <0.10 | <0.10 |
| 1,1,1,2,2-Tetrachloroethane | µg/L | 0.1 | 0.5 | 3.2 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| 1,3-Dichlorobenzene | µg/L | 0.1 | 0.5 | 9600 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 | <0.10 |
| 1,4-Dichlorobenzene | µg/L | 0.1 | 0.5 | 8 | <0.10 | <0.40 | 0.79 | <0.10 | <0.10 | 1.6 | | | <0.10 |
| 1,2-Dichlorobenzene | µg/L | 0.1 | 0.5 | 4600 | <0.10 | <0.40 | <0.10 | <0.10 | <0.10 | 0.14 | | | <0.10 |
| 1,3-Dichloropropene | µg/L | 0.3 | 0.5 | 5.2 | <0.30 | <1.20 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 | <0.30 |
| Xylene Mixture | µg/L | 0.2 | 72 | 4200 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |

Table 3
Summary of Groundwater Analysis
Phase Two Environmental Site Assessment
2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario

| Parameter | Units | MDL | O.Reg.153/04 Table 1 | O.Reg.153/04 Table 3 | MW1 | MW2 | MW3S | MW3D | MW4 | MW6 (Duplicate of MW3S) | TRIP BLANK |
|--------------------------------|-------|-----|----------------------|-----------------------------|-----------|-----------|------------|-----------|-----------|-------------------------|------------|
| | | | background | non-potable, coarse grained | | | | | | | |
| n-Hexane | µg/L | 0.2 | 5 | 51 | <0.20 | <0.80 | <0.20 | <0.20 | <0.20 | <0.20 | <0.20 |
| PHCs / BTEX | | | | | | | | | | | |
| F1 (C6 - C10) | µg/L | 25 | NA | NA | <25 | <25 | <25 | <25 | <25 | <25 | - |
| F1 (C6 to C10) minus BTEX | µg/L | 25 | 420 | 750 | <25 | <25 | <25 | <25 | <25 | <25 | - |
| F2 (C10 to C16) | µg/L | 100 | 150 | 150 | <100 | <100 | 170 | <100 | <100 | <100 | - |
| F3 (C16 to C34) | µg/L | 100 | 500 | 500 | <100 | <100 | 860 | <100 | <100 | <100 | - |
| F4 (C34 to C50) | µg/L | 100 | 500 | 500 | <100 | <100 | 170 | <100 | <100 | <100 | - |
| Gravimetric Heavy Hydrocarbons | µg/L | 500 | 500 | 500 | NA | NA | NA | NA | NA | NA | - |
| pH | NA | NA | NA | NA | 6.8 | 7.26 | 7.09 | 7.57 | 7.34 | 7.12 | - |
| Lab ID | | | | | 9641620 | 9641666 | 9641876 | 9641877 | 9641878 | 9641879 | 9641881 |
| Sample Date | | | | | 19-Oct-18 | 19-Oct-18 | 19-Oct-18 | 19-Oct-18 | 19-Oct-18 | 19-Oct-18 | 19-Oct-18 |
| Notes | | | | | | | | | | | |
| BOLD | | | | | | | | | | | |
| BOLD | | | | | | | | | | | |
| NA | | | | | | | | | | | |

- concentration meets or exceeds O.Reg. 153/04 Table 1 (non-agricultural) criteria
- concentration meets or exceeds O.Reg. 153/04 Table 3 (non-potable, any land use, fine grained soil) criteria
- Parameter not Analysed by laboratory

**Maximum Soil Parameter Concentrations
Phase Two Environmental Site Assessment
2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario**

| Parameter | Units | MDL | O.Reg.153/04 Table 1 | O.Reg.153/04 Table 3 | Maximum Soil Concentration | sample location | sample depth (mBG) |
|----------------------------|--|-------|-----------------------------------|---|----------------------------|---------------------------|--------------------|
| | | | Background residential/industrial | Full Depth non-potable, coarse grained residential/ parkland/ institutional | | | |
| Metals | | | | | | | |
| Antimony | ug/g dry | 0.8 | 1.3 | 7.5 | <0.8 | all | - |
| Arsenic | ug/g dry | 1 | 18 | 18 | 5 | BH2-SS5 | 2.4-3.0 mBG |
| Barium | ug/g dry | 2 | 220 | 390 | 118 | BH2-SS5 | 2.4-3.0 mBG |
| Beryllium | ug/g dry | 0.5 | 2.5 | 4 | <0.5 | all | - |
| Boron | ug/g dry | 5 | 36 | 120 | 9 | BH2-SS5 | 2.4-3.0 mBG |
| Boron (Hot Water Soluble) | ug/g dry | 0.1 | NV | 1.5 | 1.54 | BH2-SS5 | 2.4-3.0 mBG |
| Cadmium | ug/g dry | 0.5 | 1.2 | 1.2 | <0.5 | all | - |
| Chromium | ug/g dry | 2 | 70 | 160 | 37 | BH1-SS3 | 1.4-2.0 mBG |
| Cobalt | ug/g dry | 0.5 | 21 | 22 | 8.2 | BH1-SS3 | 1.4-2.0 mBG |
| Copper | ug/g dry | 1 | 92 | 140 | 105 | BH2-SS5 | 2.4-3.0 mBG |
| Lead | ug/g dry | 1 | 120 | 120 | 61 | BH2-SS5 | 2.4-3.0 mBG |
| Molybdenum | ug/g dry | 0.5 | 2 | 6.9 | 1.4 | BH2-SS5 | 2.4-3.0 mBG |
| Nickel | ug/g dry | 1 | 82 | 100 | 21 | BH2-SS5 | 2.4-3.0 mBG |
| Selenium | ug/g dry | 0.4 | 1.5 | 2.4 | 0.7 | BH4-SS2/SS3 | 0.6-1.8 mBG |
| Silver | ug/g dry | 0.2 | 0.5 | 20 | <0.2 | all | - |
| Thallium | ug/g dry | 0.4 | 1 | 1 | <0.4 | all | - |
| Uranium | ug/g dry | 0.5 | 2.5 | 23 | 1.3 | BH1-SS3 | 1.4-2.0 mBG |
| Vanadium | ug/g dry | 1 | 86 | 86 | 41 | BH1-SS3 | 1.4-2.0 mBG |
| Zinc | ug/g dry | 5 | 290 | 340 | 183 | BH2-SS5 | 2.4-3.0 mBG |
| Chromium VI | ug/g dry | 0.2 | 0.66 | 8 | <0.2 | all | - |
| Cyanide | ug/g dry | 0.04 | 0.051 | 0.051 | <0.04 | all | - |
| Mercury | ug/g dry | 0.1 | 0.27 | 0.27 | 0.23 | BH2-SS5 | 2.4-3.0 mBG |
| Electrical Conductivity | ug/g dry | 0.005 | 0.57 | 0.7 | 1.87 | BH1-SS3 | 1.4-2.0 mBG |
| Sodium Adsorption Ratio | ug/g dry | NA | 2.4 | 5 | 15.5 | BH1-SS3 | 1.4-2.0 mBG |
| PAHs | | | | | | | |
| Naphthalene | ug/g dry | 0.05 | 0.09 | 0.6 | <0.05 | all | - |
| Acenaphthylene | ug/g dry | 0.05 | 0.093 | 0.15 | <0.05 | all | - |
| Acenaphthene | ug/g dry | 0.05 | 0.072 | 7.9 | <0.05 | all | - |
| Fluorene | ug/g dry | 0.05 | 0.12 | 62 | <0.05 | all | - |
| Phenanthrene | ug/g dry | 0.05 | 0.69 | 6.2 | 0.16 | BH2-SS5 | 2.4-3.0 mBG |
| Anthracene | ug/g dry | 0.05 | 0.16 | 0.67 | <0.05 | all | - |
| Fluoranthene | ug/g dry | 0.05 | 0.56 | 0.69 | 0.25 | BH2-SS5 | 2.4-3.0 mBG |
| Pyrene | ug/g dry | 0.05 | 1 | 78 | 0.21 | BH2-SS5 | 2.4-3.0 mBG |
| Benz(a)anthracene | ug/g dry | 0.05 | 0.36 | 0.5 | 0.11 | BH2-SS5 | 2.4-3.0 mBG |
| Chrysene | ug/g dry | 0.05 | 2.8 | 7 | 0.14 | BH2-SS5 | 2.4-3.0 mBG |
| Benzo(b)fluoranthene | ug/g dry | 0.05 | 0.47 | 0.78 | 0.16 | BH2-SS5 | 2.4-3.0 mBG |
| Benzo(k)fluoranthene | ug/g dry | 0.05 | 0.48 | 0.78 | 0.06 | BH2-SS5 | 2.4-3.0 mBG |
| Benzo(a)pyrene | ug/g dry | 0.05 | 0.3 | 0.3 | 0.1 | BH2-SS5 | 2.4-3.0 mBG |
| Indeno(1,2,3-cd)pyrene | ug/g dry | 0.05 | 0.23 | 0.38 | 0.05 | BH2-SS5 | 2.4-3.0 mBG |
| Dibenz(a,h)anthracene | ug/g dry | 0.05 | 0.1 | 0.1 | <0.05 | all | - |
| Benzo(g,h,i)perylene | ug/g dry | 0.05 | 0.68 | 6.6 | 0.07 | BH2-SS5 | 2.4-3.0 mBG |
| 2-and 1-methyl Naphthalene | ug/g dry | 0.05 | 0.59 | 0.99 | 0.1 | 3H5 (dup. of BH4-SS2/SS3) | 0.6-1.8 mBG |
| Lab ID | | | | | | | |
| Sample Date | | | | | | | |
| Notes | | | | | | | |
| BOLD | - concentration meets or exceeds O.Reg. 153/04 Table 3 (non-potable, residential land use, fine grained soil) criteria | | | | | | |

Table 5

**Maximum Groundwater Parameter Concentrations
Phase Two Environmental Site Assessment
2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario**

| Parameter | Units | MDL | O.Reg.153/04 Table 1 Background | O.Reg.153/04 Table 3 Non-Porable Course grained | Maximum groundwater concentration | Sample ID | Location |
|-----------------------------|-------|------|------------------------------------|---|--------------------------------------|--------------------|--------------------|
| Metals | | | | | | | |
| Antimony | µg/L | 1 | 1.5 | 20000 | <1.0 | all | all |
| Arsenic | µg/L | 1 | 13 | 1900 | 7.2 | MW1 | MW1 |
| Barium | µg/L | 2 | 610 | 29000 | 1190 | MW2 | MW2 |
| Beryllium | µg/L | 0.5 | 0.5 | 67 | <0.5 | all | all |
| Boron | µg/L | 10 | 1700 | 45000 | 240 | MW2 | MW2 |
| Cadmium | µg/L | 0.2 | 0.5 | 2.7 | <0.2 | all | all |
| Chromium | µg/L | 2 | 11 | 810 | 31.4 | MW1 | MW1 |
| Cobalt | µg/L | 0.5 | 3.8 | 66 | 2.2 | MW1 | MW1 |
| Copper | µg/L | 1 | 5 | 87 | 2.2 | MW3D | MW3D |
| Lead | µg/L | 0.5 | 1.9 | 25 | <0.5 | all | all |
| Molybdenum | µg/L | 0.5 | 23 | 9200 | 1.8 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| Nickel | µg/L | 1 | 14 | 490 | 1.5 | MW1 | MW1 |
| Selenium | µg/L | 1 | 5 | 63 | 1.8 | MW1 | MW1 |
| Silver | µg/L | 0.2 | 0.3 | 1.5 | <1.0 | all | all |
| Thallium | µg/L | 0.3 | 0.5 | 510 | <0.2 | all | all |
| Uranium | µg/L | 0.5 | 8.9 | 420 | 1.5 | MW3D | MW3D |
| Vanadium | µg/L | 0.4 | 3.9 | 250 | 4.7 | MW4 | MW4 |
| Zinc | µg/L | 5 | 160 | 1100 | 6.3 | MW2 | MW2 |
| Mercury | µg/L | 0.02 | 0.1 | 0.29 | <0.02 | all | all |
| Chromium VI | µg/L | 5 | 25 | 140 | <5 | all | all |
| Cyanide | µg/L | 2 | 5 | 66 | <2 | all | all |
| Sodium | µg/L | 2500 | 490000 | 2300000 | 1150000 | MW2 | MW2 |
| Chloride | µg/L | 1000 | 790000 | 2300000 | 2350000 | MW2 | MW2 |
| Electrical Conductivity | µg/L | 2 | NA | NA | 7260 | MW2 | MW2 |
| VOCs | | | | | | | |
| Dichlorodifluoromethane | µg/L | 0.2 | 590 | 4400 | <0.20 | all | all |
| Vinyl Chloride | µg/L | 0.17 | 0.5 | 0.5 | <0.17 | all | all |
| Bromomethane | µg/L | 0.2 | 0.89 | 5.6 | <0.20 | all | all |
| Trichlorofluoromethane | µg/L | 0.4 | 150 | 2500 | <0.40 | all | all |
| Acetone | µg/L | 1 | 2700 | 130000 | <1.0 | all | all |
| 1,1-Dichloroethylene | µg/L | 0.3 | 0.5 | 1.6 | <0.30 | all | all |
| Methylene Chloride | µg/L | 0.3 | 5 | 610 | <0.30 | all | all |
| trans- 1,2-Dichloroethylene | µg/L | 0.2 | 1.6 | 1.6 | <0.20 | all | all |
| Methyl tert-butyl ether | µg/L | 0.2 | 15 | 190 | <0.20 | all | all |
| 1,1-Dichloroethane | µg/L | 0.3 | 0.5 | 320 | <0.30 | all | all |
| Methyl Ethyl Ketone | µg/L | 1 | 400 | 470000 | <1.0 | all | all |
| cis- 1,2-Dichloroethylene | µg/L | 0.2 | 1.6 | 1.6 | 0.27 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| Chloroform | µg/L | 0.2 | 2 | 2.4 | <0.20 | all | all |
| 1,2-Dichloroethane | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | all | all |
| 1,1,1-Trichloroethane | µg/L | 0.3 | 0.5 | 640 | <0.30 | all | all |
| Carbon Tetrachloride | µg/L | 0.2 | 0.2 | 0.79 | <0.20 | all | all |
| Benzene | µg/L | 0.2 | 0.5 | 44 | 0.85 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| 1,2-Dichloropropane | µg/L | 0.2 | 0.5 | 16 | <0.20 | all | all |
| Trichloroethylene | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | all | all |
| Bromodichloromethane | µg/L | 0.2 | 2 | 85000 | <0.20 | all | all |
| Methyl Isobutyl Ketone | µg/L | 1 | 640 | 140000 | <1.0 | all | all |
| 1,1,2-Trichloroethane | µg/L | 0.2 | 0.5 | 4.7 | <0.20 | all | all |
| Toluene | µg/L | 0.2 | 0.8 | 18000 | 0.32 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| Dibromochloromethane | µg/L | 0.1 | 2 | 82000 | <0.10 | all | all |
| Ethylene Dibromide | µg/L | 0.1 | 0.2 | 0.25 | <0.10 | all | all |
| Tetrachloroethylene | µg/L | 0.2 | 0.5 | 1.6 | <0.20 | all | all |
| 1,1,1,2-Tetrachloroethane | µg/L | 0.1 | 1.1 | 3.3 | <0.10 | all | all |
| Chlorobenzene | µg/L | 0.1 | 0.5 | 630 | 1.3 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| Ethylbenzene | µg/L | 0.1 | 0.5 | 2300 | <0.10 | all | all |
| Bromoform | µg/L | 0.1 | 5 | 380 | <0.10 | all | all |
| Styrene | µg/L | 0.1 | 0.5 | 1300 | 0.54 | MW4 | MW4 |
| 1,1,2,2-Tetrachloroethane | µg/L | 0.1 | 0.5 | 3.2 | <0.10 | all | all |
| 1,3-Dichlorobenzene | µg/L | 0.1 | 0.5 | 9600 | <0.10 | all | all |
| 1,4-Dichlorobenzene | µg/L | 0.1 | 0.5 | 8 | 1.6 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |
| 1,2-Dichlorobenzene | µg/L | 0.1 | 0.5 | 4600 | 0.14 | MW6 (dup. of MW3S) | MW6 (dup. of MW3S) |

Table 5

Maximum Groundwater Parameter Concentrations
Phase Two Environmental Site Assessment
2831, 2851, and 2865 DuMaurier Avenue
Ottawa, Ontario

| Parameter | Units | MDL | O.Reg.153/04 Table 1 Background | O.Reg.153/04 Table 3 Non-Porable Course grained | Maximum groundwater concentration | Sample ID | Location |
|--------------------------------|-------|-----|------------------------------------|---|--------------------------------------|-----------|----------|
| 1,3-Dichloropropene | µg/L | 0.3 | 0.5 | 5.2 | <0.30 | all | all |
| Xylene Mixture | µg/L | 0.2 | 72 | 4200 | <0.20 | all | all |
| n-Hexane | µg/L | 0.2 | 5 | 51 | <0.20 | all | all |
| PHCs / BTEX | | | | | | | |
| F1 (C6 - C10) | µg/L | 25 | NA | NA | <25 | MW3S | MW3S |
| F1 (C6 to C10) minus BTEX | µg/L | 25 | 420 | 750 | <25 | MW3S | MW3S |
| F2 (C10 to C16) | µg/L | 100 | 150 | 150 | 170 | MW3S | MW3S |
| F3 (C16 to C34) | µg/L | 100 | 500 | 500 | 860 | MW3S | MW3S |
| F4 (C34 to C50) | µg/L | 100 | 500 | 500 | 170 | MW3S | MW3S |
| Gravimetric Heavy Hydrocarbons | µg/L | 500 | 500 | 500 | NA | MW3S | MW3S |

Notes

BOLD

- concentration meets or exceeds O.Reg. 153/04 Table 1 (non-agricultural) criteria

BOLD

- concentration meets or exceeds O.Reg. 153/04 Table 3 (non-potable, any land use, fine grained soil) criteria

Appendices

Appendix A

Utility Clearances

Monique Larocque

From: Solutions@on1call.com
Sent: Wednesday, September 19, 2018 10:51 AM
To: moniquel@usl-1.com
Subject: Request 20183813706
Attachments: MapSelection_19092018_10492764.png; GHD.2831_Du_Maurier.png

<<https://www.on1call.com/wp-content/themes/ooc/images/ooc-logo-2.png>> LOCATE REQUEST CONFIRMATION

TICKET #: 20183813706 REQUEST PRIORITY: STANDARD REQUEST TYPE: REGULAR WORK TO BEGIN DATE:
09/26/2018

Update of Ticket # Project # Transmit date: 09/19/2018 10:51:00 AM

REQUESTOR'S CONTACT INFORMATION

Contractor ID#: 202 Company Phone #: (613) 226-8750
Contact Name: JACQUES DESJARDINS Cell #:
Alternate Contact Name: JEFF FORRESTER Fax #: (613) 226-8677
Company name: U S L Email: moniquel@usl-1.com
Address: 775 TAYLOR CREEK DR Alternate Contact #:

DIG INFORMATION

Region/County: OTTAWA Type of work: BORE HOLES Mark & Fax: NO
Community: Max Depth: 32.81 FT Area is not marked: NO
City: OTTAWA Machine Dig: YES Area is marked: YES
Address: 2831, DUMAURIER AVE To 2865 Hand Dig: NO Site Meet Req.: NO
Directional Drilling: NO Work being done for: GHD
Intersecting Street 1: RAMSEY CRES Public Property: YES
Intersecting Street 2: WATSON ST Private Property: YES

DETAILED DESCRIPTION OF WORK REMARKS

CORLOT=U Drilling throughout properties. Clear all of 2831 to 2865 Dumaurier Ave to all property lines and to sidewalk edge on Dumaurier Ave. Civic # 2831, 2833, 2835, 2865.

MEMBERS NOTIFIED: The following owners of underground infrastructure in the area of your excavation site have been notified.

| Member name | Station Code | Initial Status |
|---|--------------|-------------------|
| HYDRO OTTAWA (HOT1) | HOT1 | Notification sent |
| PROMARK FOR ENBRIDGE GAS (ENOE01) | ENOE01 | Notification sent |
| CITY OF OTTAWA WATER/SEWER (OTWAWS01) | OTWAWS01 | Notification sent |
| BLACK AND MC DONALD FOR CITY OF OTTAWA STREET LIGHTS (OTWASL01) | OTWASL01 | Notification sent |
| CLI FOR ROGERS (ROGOTT01) | ROGOTT01 | Notification sent |
| PROMARK FOR BELL CANADA (BCOE01) | BCOE01 | Notification sent |

MAP SELECTION: Map Selection provided by the excavator through Ontario One Call's map tool or through agent interpretation by phone

CONTRACTOR'S SKETCH: A file provided directly by the excavator, not generated by Ontario One Call:

IMPORTANT INFORMATION: Please read.

Defining "NC" - Non-Compliant

- Non-compliant members have not met their obligations under section 5 of the Ontario Underground Infrastructure Notification Act. ON1Call has notified these members to ensure they are aware of your excavation. In this circumstance, should the member not respond, the excavator should contact the member directly to obtain their locates or request a status. ON1Call will not be provided with a locate status from the member regarding this ticket and therefore, cannot provide further information at this time. For locate status contact information please refer to our website.

You have a valid locate when...

- You have reviewed your locate request information for accuracy. CONTACT Ontario One Call (ON1Call) IMMEDIATELY if changes are needed and obtain a corrected locate request confirmation.
- You have obtained locates or clearances from all ON1Call members listed in this ticket before beginning your dig.

You've met your obligations when...

- In addition to this locate request, you have DIRECTLY contacted all owners of infrastructure who ARE NOT current members of ON1Call (such as owned buried infrastructure on private property), as well as arranged for contract locates for your private lines on your private property - where applicable. For a list of locate status contacts visit www.on1call.com.
- You respect the marks and instructions provided by the locators and dig with care; the marks and locator instructions MUST MATCH.
- You have obtained any necessary permits from the municipality in which you are excavating.

What does "Cleared" mean in the "Initial Status" section?

1. The information that you have provided about your dig will not affect that member's underground infrastructure and they have provided you with a clearance, if anything about your excavation changes, please ensure that you update your ticket immediately.

What are the images under "Map Selection":

1. A drawing created by an excavator directly within Ontario One Call's web ticket tool, this is expected to be an accurate rendition of the dig site, and it is the excavator's responsibility to ensure the location matches the information they provide under the 'Dig Location' section OR;
2. A drawing created by an Ontario One Call agent, this drawing is based on a verbal description by phone of the area by the excavator. Agents may create drawings that are larger than the proposed dig to minimize risk of interpretation. It is the excavator's responsibility to review these map selections for accuracy. Changes can be made by the excavator through the web ticket tool, to learn how visit www.on1call.com/contractors.
3. All drawings dictate which members are notified.

| | | | | |
|------------------------|----------------------|------------------------------|--------|---|
| PR MARK TELECOM | | Primary Locate Sheet | | UNION GAS EMERGENCY # 1-877-869-0899 |
| Phone: 613-723-9888 | Fax: 613-723-9277 | Toll free: 1-800-371-8866 | Email: | Request # 20183813706 NORMAL |

| | | | | |
|--|-----------------|--|---|--|
| Utilities Located: <input checked="" type="checkbox"/> Bell <input checked="" type="checkbox"/> Gas <input checked="" type="checkbox"/> Hydro Ottawa <input type="checkbox"/> Hydro One <input type="checkbox"/> Videotron <input type="checkbox"/> Lakefront Utilities <input type="checkbox"/> Veridian Connections | | Revised Excavation Date <div style="text-align: center; font-size: 24px;">N/A</div> <small>mm/dd/yyyy</small> | Excavation Date 10/01/2018 00:00:00 <small>mm/dd/yyyy</small> | Status STANDARD |
| Requested by: JACQUES DESJARDINS | Company: USL | Phone: (613)-226-8750 ext. | Fax/email: (613)-226-8677 ext. | Homeowner <input type="checkbox"/> Contractor <input checked="" type="checkbox"/> Project <input type="checkbox"/> |

| | | |
|---|---|---|
| Appt Date: <div style="text-align: center; font-size: 24px;">N/A</div> <small>mm/dd/yyyy</small> | Received Date: 09/19/2018 <small>mm/dd/yyyy</small> | Locate Address: 2831 to 2865, DUMAURIER AVE 1st Inters.: RAMSEY CRES 2nd Inters.: WATSON ST |
|---|---|---|

| | |
|-----------------------------|-----------------|
| Type of work: BORE HOLES | City: OTTAWA |
|-----------------------------|-----------------|

Caller's Remarks:
 CIVIC # 2831, 2833, 2835, 2865.
 MACH. DIG
 CORLOT-U DRILLING THROUGHOUT PROPERTIES. CLEAR ALL OF 2831 TO 2865 DUMAURIER AVE TO ALL PROPERTY LINES AND TO SIDEWALK EDGE ON DUMAURIER AVE.
 -75.793498, 45.350469, NB_SEGMENTS::2, NO_PLAN:613 828, B00E01, R00T01, OTWASL01, OTWAWSD1, ENOB01, HOT1

| | | | | | | | | |
|-------------------|---------------------------|---------------------------|------------------------------|------------------------|------------------------|-----------------------|------------------------|------------------------|
| Bell Mark Clear | Enbridge Gas Mark Clear | Hydro Ottawa Mark Clear | Street Lighting Mark Clear | Lakefront Mark Clear | Hydro One Mark Clear | Veridian Mark Clear | Union Gas Mark Clear | Videotron Mark Clear |
| 1 | 1 | 1 | | | | | | |

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE.

| | |
|--|--|
| Records Reference: _ Map _ Network X # <input checked="" type="checkbox"/> G-MOBILE _ Byers <input checked="" type="checkbox"/> Datapak <input checked="" type="checkbox"/> LAC Multiviewer Field Notes: CPU1389 NE123 Other: 6N592-1, 6N4012-6 DPT Remarks: | _ Third Party Notification _____ <div style="border: 2px solid black; padding: 10px; text-align: center;"> <p>***DANGER DO NOT PROCEED***</p> <p>Buried high voltage cables within 1.5M of the located area. You MUST send locate to HOLsupervisions@hydroottawa.com or contact Hydro Ottawa at 613-738-6418 for further information.</p> <p>AFTER HOURS *EMERGENCY* NUMBER IS 613-738-6422</p> </div> <p style="text-align: center;">Apply Sticker Here if Required</p> |
|--|--|

Excavator shall notify & receive a clearance from Utility prior to excavation for the following:
 Telecon High Priority Cable Central Office Vicinity N/A

Method of Field Marking: Paint Stakes Flags Offset Flags Other (Telecom=Orange, Gas=Yellow, Hydro Ott. =Red)

Caution: Locates are VOID after 30 days. Hydro One valid for 60 days. See Disclaimer for the specific Facility Owner's Guidelines.

Caution: Any changes to location or nature of work require new locate. The Excavator must not work outside the Located Area without a new locate. Privately owned services within the located area have not been marked - check with service/property owner. For all Locate requests including remarks contact: Ontario One Call at 1-800-460-2255 or www.on1call.com.

| | | |
|--------------------------------|-------------------------|---|
| Locator Name: <u>ROOTS DAN</u> | Start Time: <u>9:00</u> | <input type="checkbox"/> Mark & Fax <input type="checkbox"/> Left on Site <input checked="" type="checkbox"/> Emailed |
| ID #: <u>1717</u> | End Time: <u>14:00</u> | Print: <u>N/A</u> |
| Date: <u>09/28/2018</u> | Total Hours: <u>5HR</u> | Signature: <u>N/A</u> |

A copy of this Primary Locate Sheet and Auxiliary Locate Sheet(s) must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas HydroOttawa Hydro One Videotron Pael Fibre Veridian connections

Date Located:
09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) N/A

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: N.AE OF SW OF RAMSAY CRES

TO: S.BL2 OF 2831-2865 DUMAURIER AVE


FROM: E.BL3 OF 2831-2865 DUMAURIER AVE

TO: W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.

LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL
 - Fence Line — FL
 - Face of Curb — FC
 - Road Edge — RE
 - Property Line — PL
 - ASPHALT EDGE — AE
 - Driveway — DW
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable — B
 - Conduit — C
 - Buried Service Wire — BSW
 - Manhole
 - Fibre Optic Cable — FO
 - Bell Hydro Service — HS
 - Gas Main — GM
 - Gas Service — GS
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro — H
 - Hydro Pole
 - Street Light Cable — SL
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

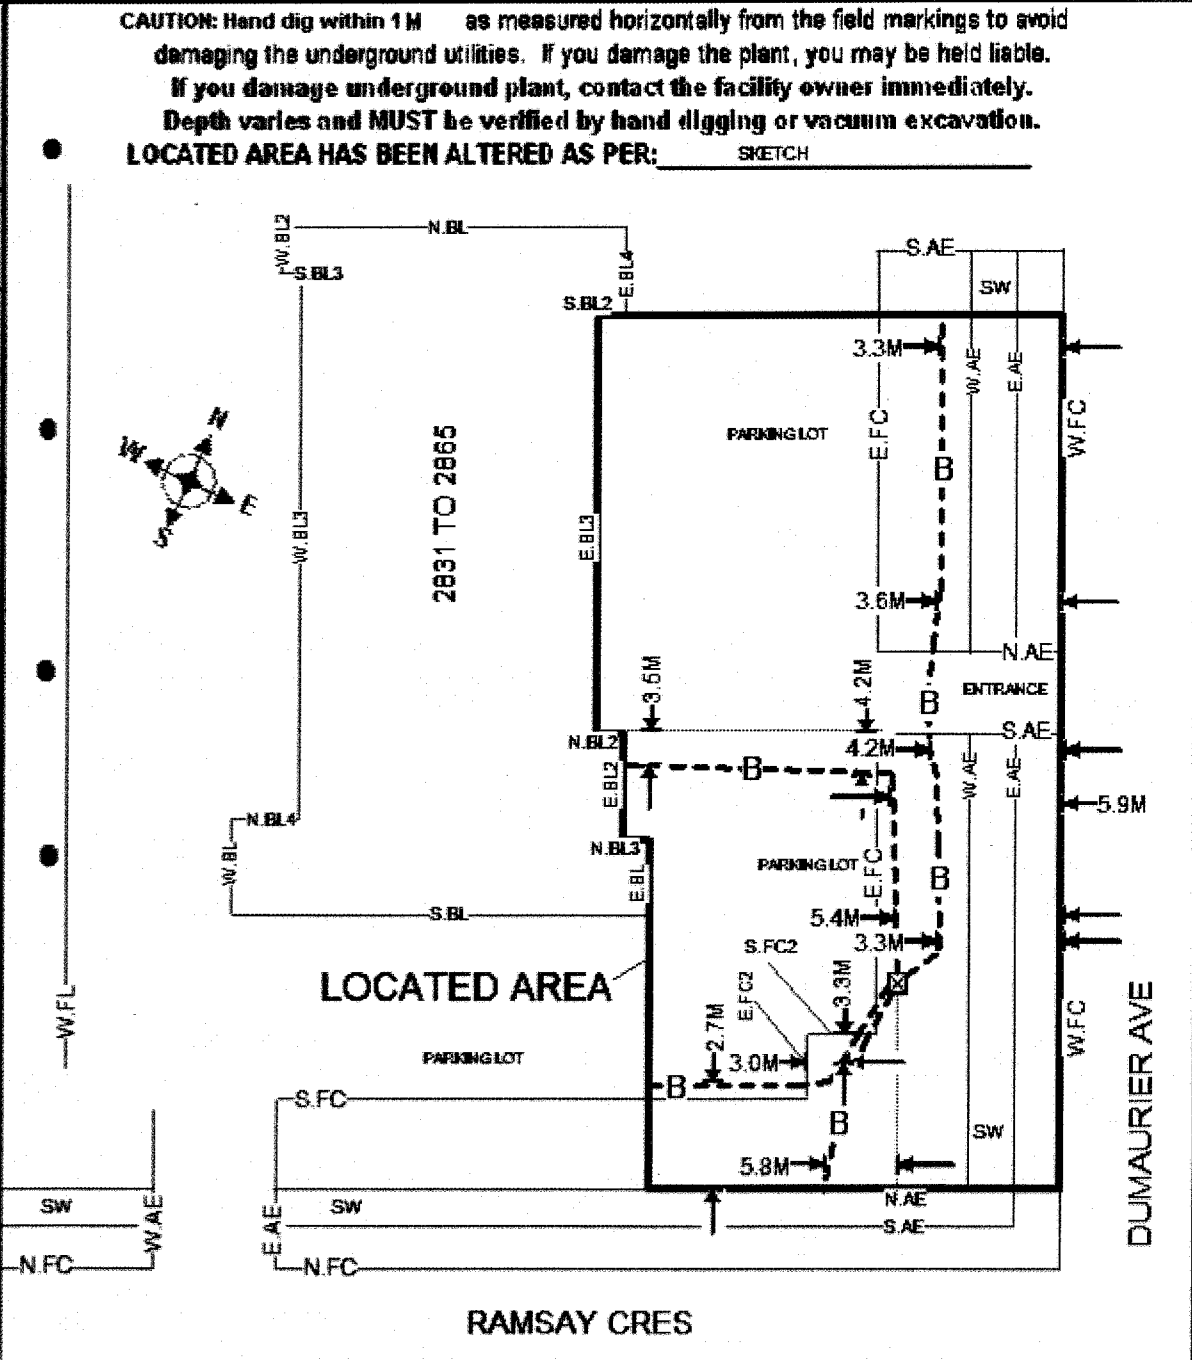

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.

Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-989-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas HydroOttawa Hydro One
 Videotron Peel Fibre Veridian connections

Date Located:
mm/dd/yyyy 09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) (0)

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: N.AE OF SW OF RAMSAY CRES

TO: S.BL2 OF 2831-2865 DUMAURIER AVE


FROM: E.BL3 OF 2831-2865 DUMAURIER AVE

TO: W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.

LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL
 - Fence Line — FL
 - Face of Curb — FC
 - Road Edge — RE
 - Property Line — PL
 - ASPHALT EDGE -AE
 - Driveway — DW
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable — B
 - Conduit — C
 - Buried Service Wire — BSW
 - Manhole
 - Fibre Optic Cable — FO
 - Bell Hydro Service — HS
 - Gas Main — GM
 - Gas Service — GS
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro — H
 - Hydro Pole X
 - Street Light Cable — SL
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

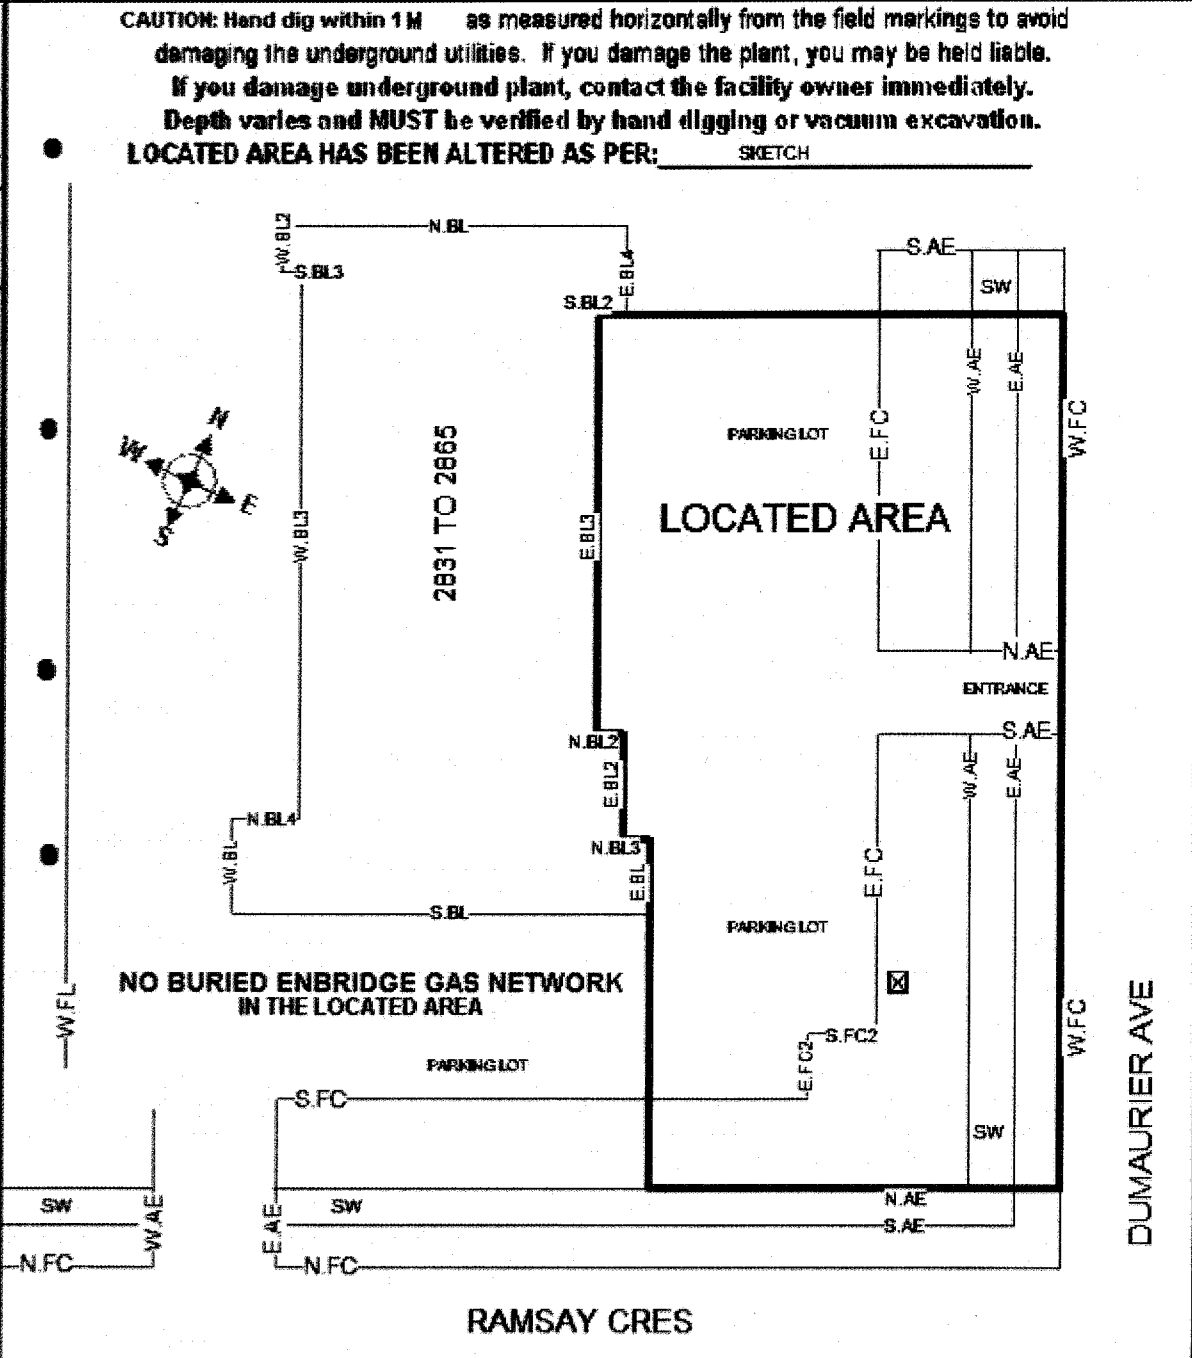

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.

Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Bell Gas Hydro Ottawa Street Lighting
 Located: Blink Peel Fibre

Date Located
mm/dd/yyyy 09/28/2018

Request # 20183813706

Number of Services marked: (Specify building/house numbers) N/A

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: N.AE OF SW OF RAMSAY CRES

TO: S.BL2 OF 2831-2865 DUMAURIER AVE


FROM: E.BL3 OF 2831-2865 DUMAURIER AVE

TO: W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1.5M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.

LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL—
 - Fence Line — FL—
 - Face of Curb — FC—
 - Road Edge — RE—
 - Property Line — PL—
 - ASPHALT EDGE -AE
 - Driveway — DW—
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable — B—
 - Conduit — C—
 - Buried Service Wire — BSW—
 - Manhole
 - Fibre Optic Cable — FO—
 - Gas Main — GM—
 - Gas Service — GS—
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro Ottawa — H—
 - Hydro Pole X
 - Street Light Cable — SL—
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

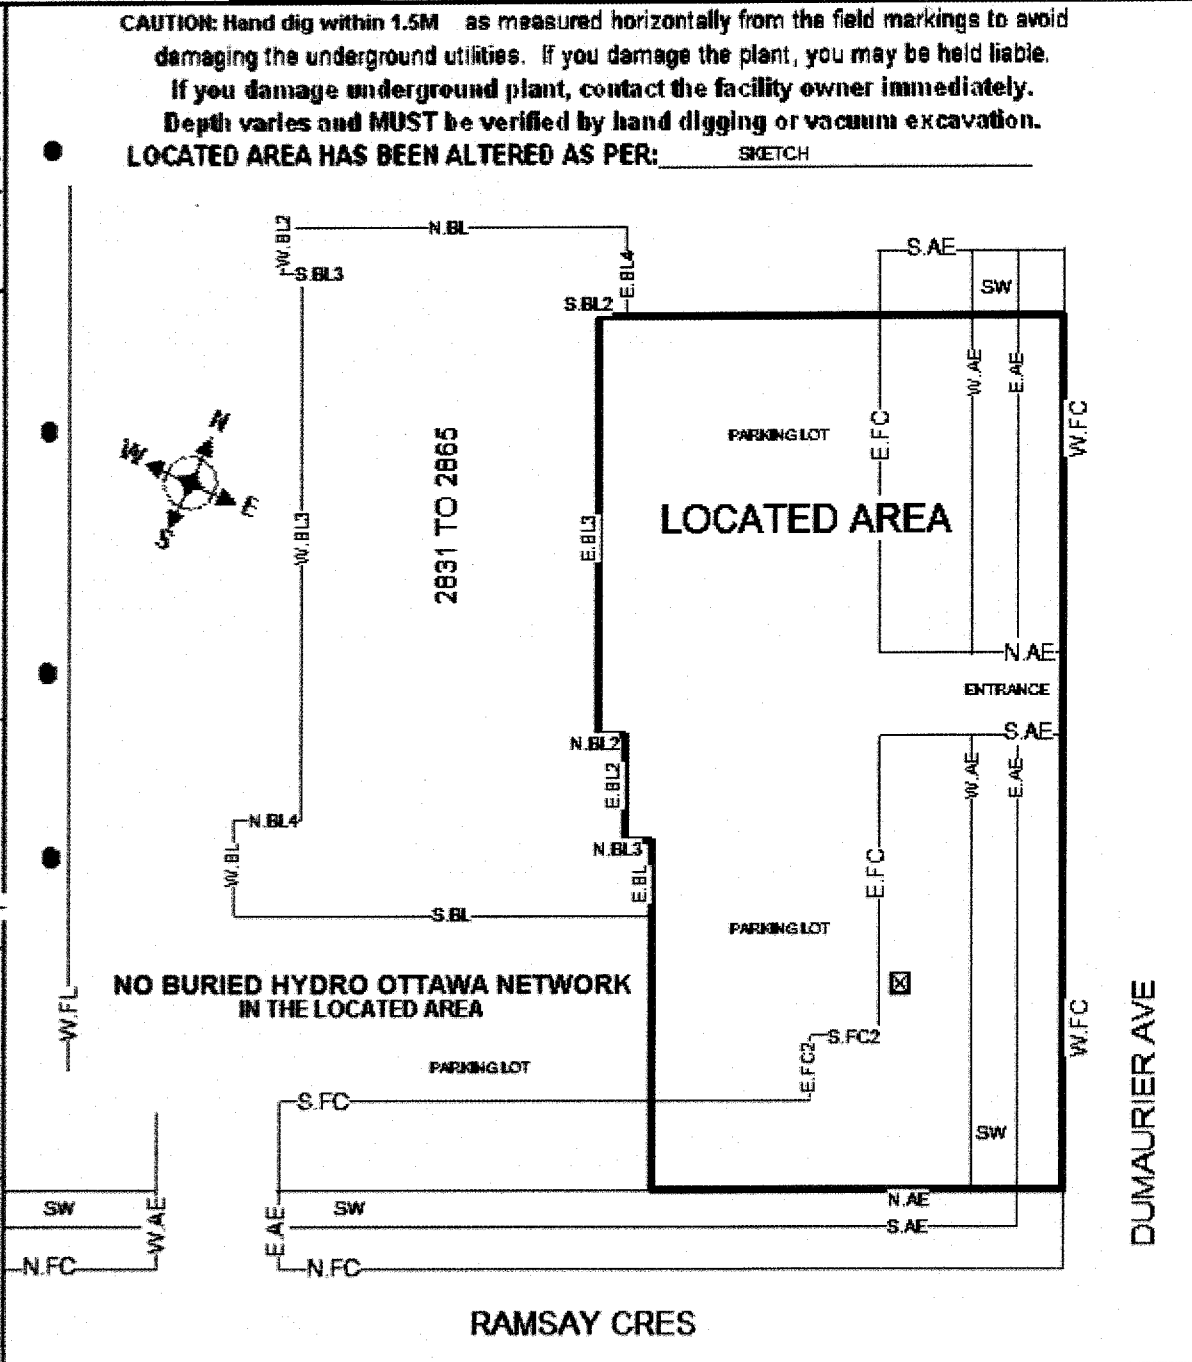

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.

Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas Hydro Ottawa Hydro One Videotron Past Fibre Veridian connections

Date Located:
mm/dd/yyyy 09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) N/A

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: W.FL OF 2831-2865 DUMAURIER AVE


TO: W.BL3 OF 2831-2865 DUMAURIER AVE

FROM: S.BL OF 2831-2865 DUMAURIER AVE

TO: S.BL3 OF 2831-2865 DUMAURIER AVE

CAUTION: Hand dig within 1M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.
LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL
 - Fence Line — FL
 - Face of Curb — FC
 - Road Edge — RE
 - Property Line — PL
 - ASPHALT EDGE — AE
 - Driveway — DW
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable — B
 - Conduit — C
 - Buried Service Wire — BSW
 - Manhole
 - Fibre Optic Cable — FO
 - Bell Hydro Service — HS
 - Gas Main — GM
 - Gas Service — GS
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro — H
 - Hydro Pole X
 - Street Light Cable — SL
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

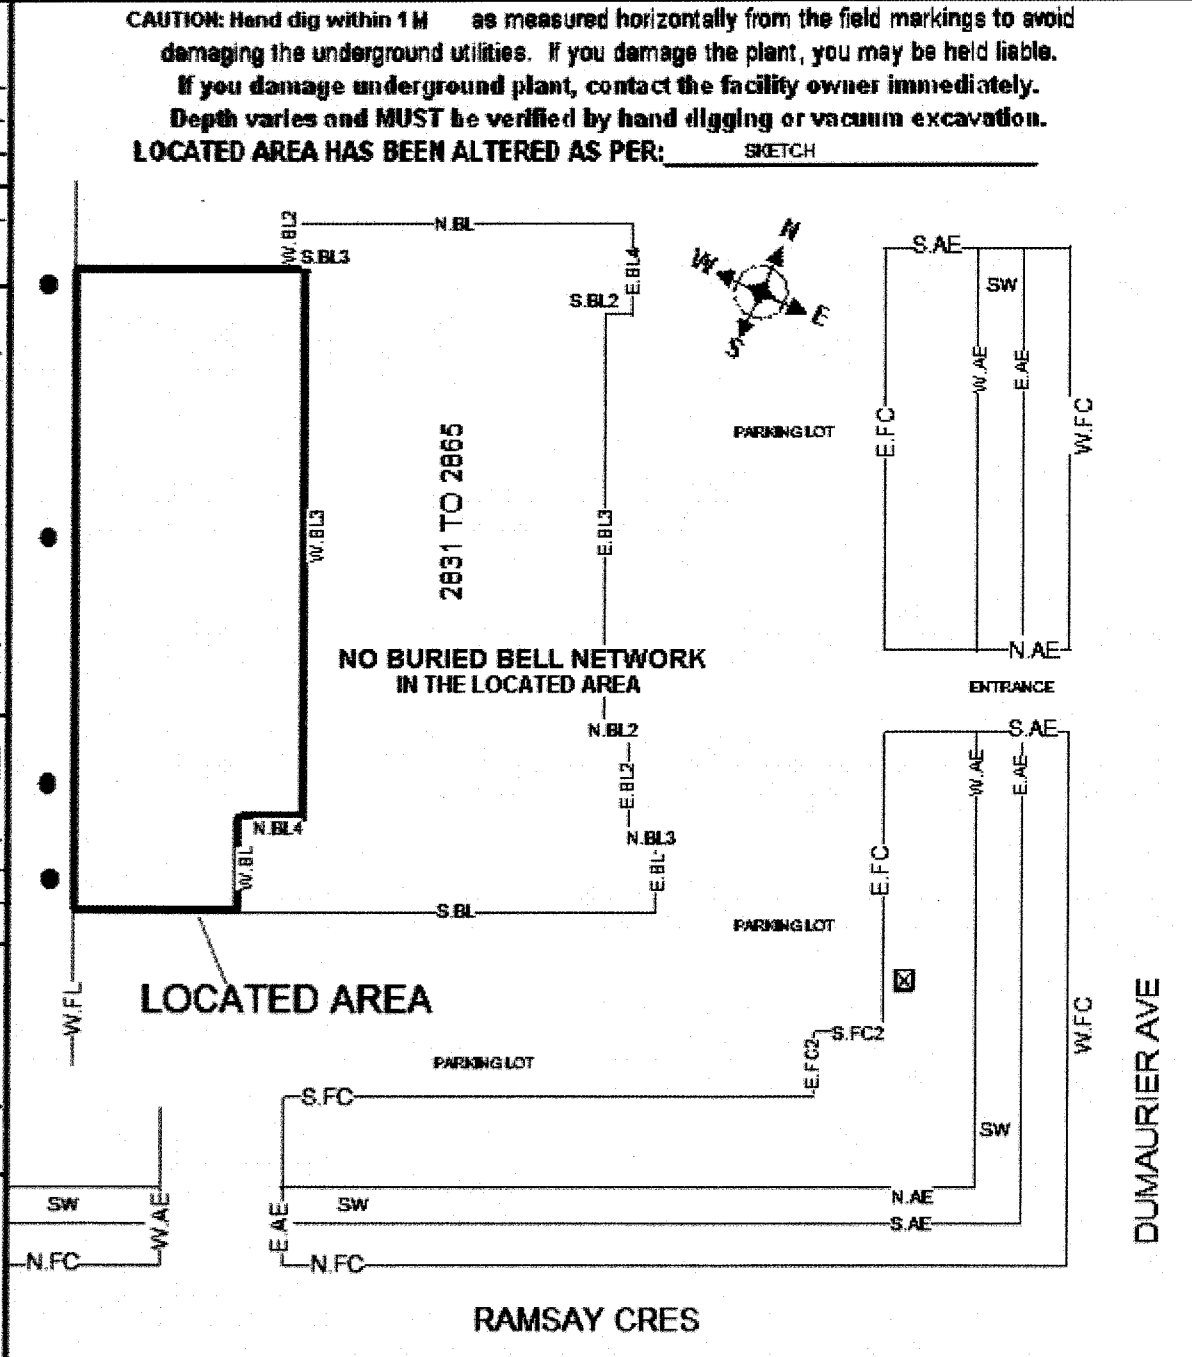

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.
Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas HydroOttawa Hydro One Videotron Paet Fibre Veridian connections

Date Located:
mm/dd/yyyy 09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) (0)

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: W.FL OF 2831-2865 DUMAURIER AVE


TO: W.BL3 OF 2831-2865 DUMAURIER AVE

FROM: S.BL OF 2831-2865 DUMAURIER AVE

TO: S.BL3 OF 2831-2865 DUMAURIER AVE

CAUTION: Hand dig within 1M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.
LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL
 - Fence Line — FL
 - Face of Curb — FC
 - Road Edge — RE
 - Property Line — PL
 - ASPHALT EDGE -AE
 - Driveway — DW
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable — B
 - Conduit — C
 - Buried Service Wire — BSW
 - Manhole
 - Fibre Optic Cable — FO
 - Bell Hydro Service — HS
 - Gas Main — GM
 - Gas Service — GS
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro — H
 - Hydro Pole X
 - Street Light Cable — SL
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

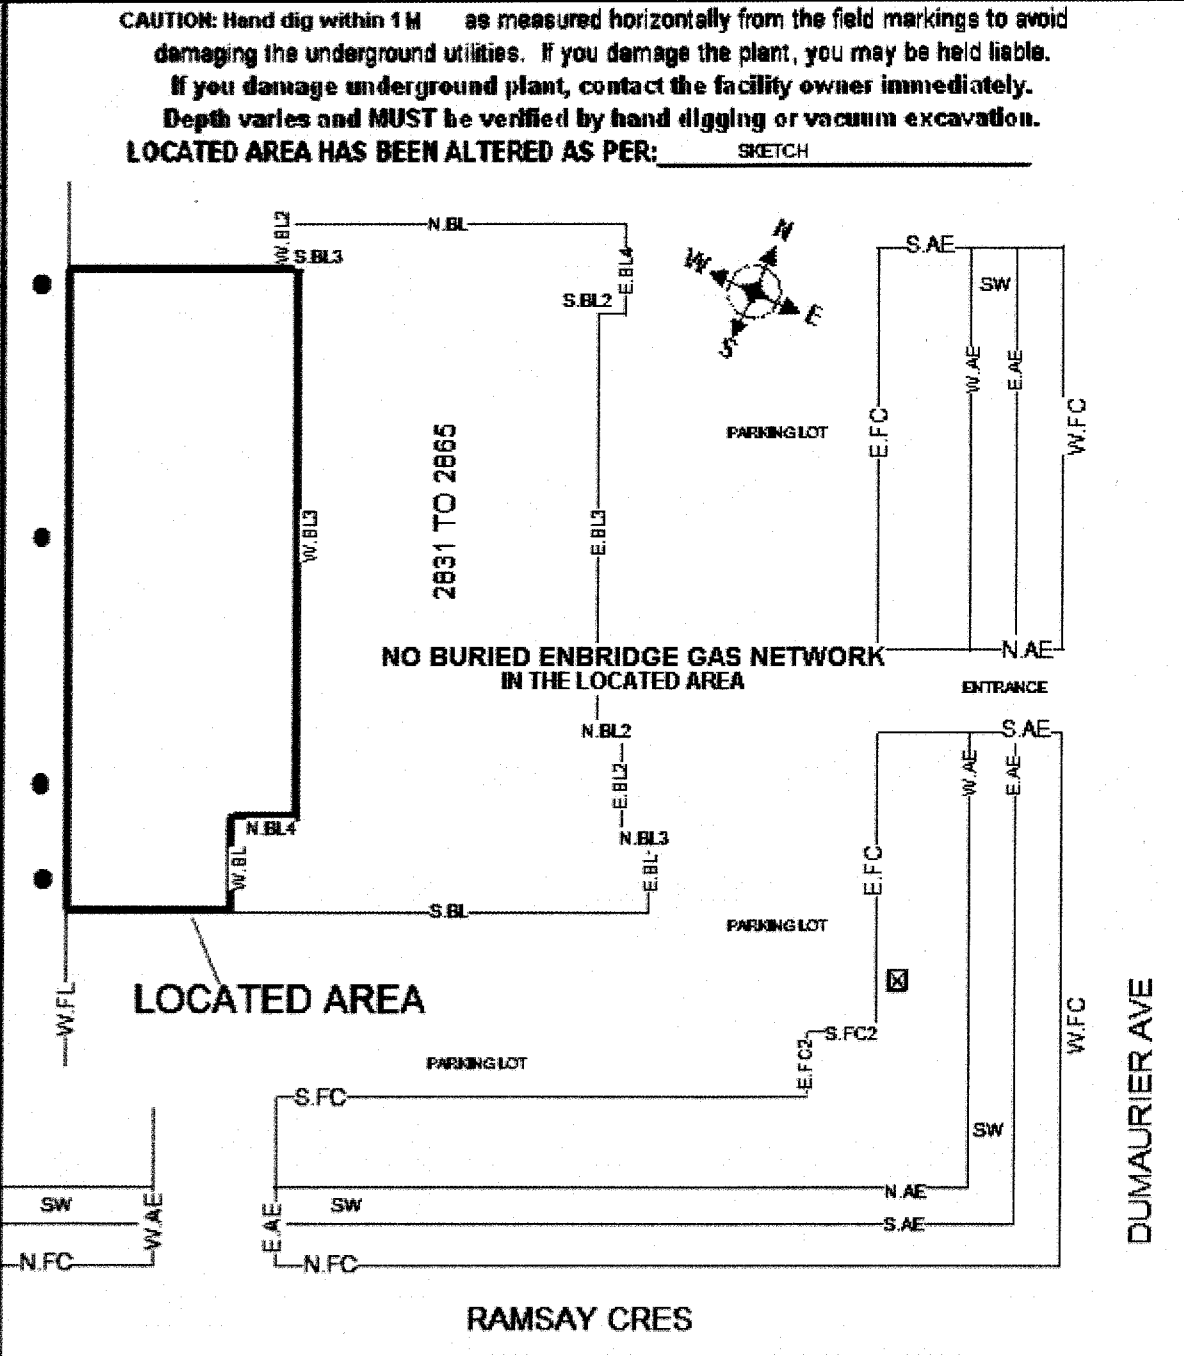

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.
Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency # 1-877-999-0990

Phone: 613-723-9888

Fax: 613-723-9277

Toll free: 1-800-371-8866

Email

Utilities Bell Gas Hydro Ottawa Street Lighting

Date Located: 09/28/2018

Request # 20183813706

Located: Blink Peel Fibre

Number of Services marked: (Specify building/house numbers) N/A

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: W.FL OF 2831-2865 DUMAURIER AVE


TO: W.BL3 OF 2831-2865 DUMAURIER AVE

FROM: S.BL OF 2831-2865 DUMAURIER AVE

TO: S.BL3 OF 2831-2865 DUMAURIER AVE

CAUTION: Hand dig within 1.5M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation. LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend
Building Line - BL
Fence Line - FL
Face of Curb - FC
Road Edge - RE
Property Line - PL
ASPHALT EDGE - AE
Driveway - DW
Catch Basin - CB
Sidewalk - SW
Demarcation - DM
Railway
Pole
Flush to Grade Pedestal
Pedestal
Buried Cable - B
Conduit - C
Buried Service Wire - BSW
Manhole - MH
Fibre Optic Cable - FO
Gas Main - GM
Gas Service - GS
Gas Valve
Hydrant
Transformer
Hydro Ottawa - H
Hydro Pole - X
Street Light Cable - SL
Street Light
North - N.
South - S.
East - E.
West - W.

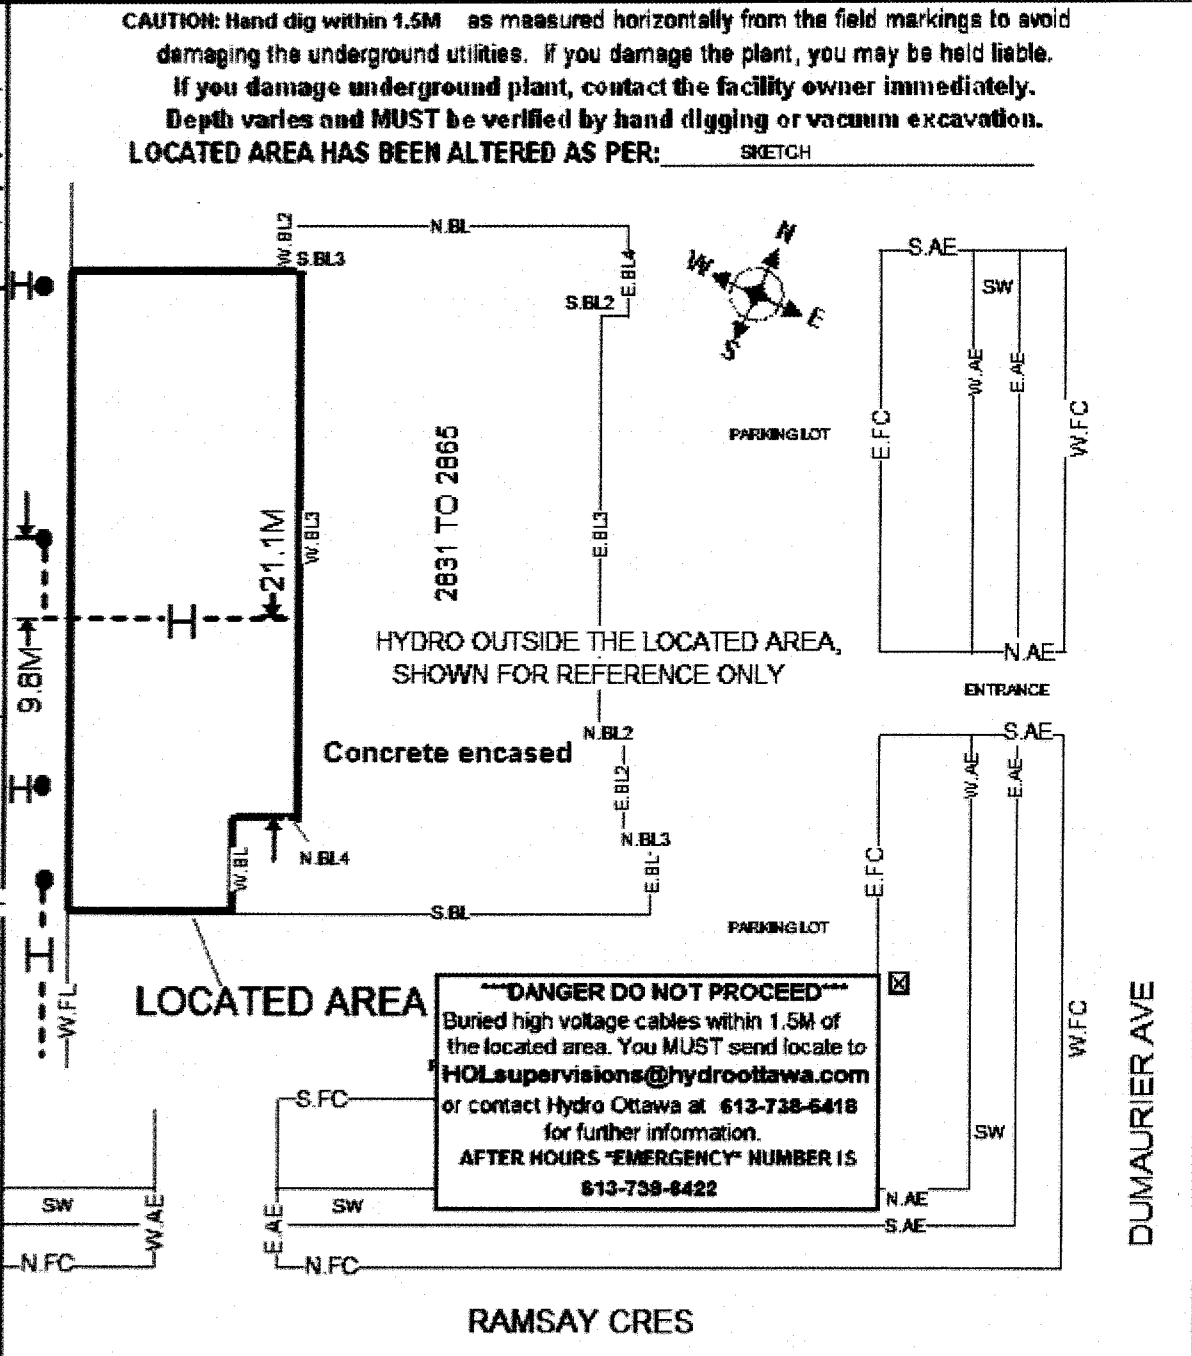

DANGER DO NOT PROCEED
Buried high voltage cables within 1.5M of the located area. You MUST send locate to HOLsupervisions@hydroottawa.com or contact Hydro Ottawa at 613-738-6418 for further information. AFTER HOURS 'EMERGENCY' NUMBER IS 613-739-6422

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale. Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas HydroOttawa Hydro One
 Videotron Peel Fibre Veridian connections

Date Located: 09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) N/A

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: 27.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE


TO: 6.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE

FROM: W.FC OF DUMAURIER AVE

TO: 25.0M WEST OF W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1 M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation. LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL —
 - Fence Line — FL —
 - Face of Curb — FC —
 - Road Edge — RE —
 - Property Line — PL —
 - ASPHALT EDGE — AE —
 - Driveway — DW —
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Fole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable
 - Conduit
 - Buried Service Wire
 - Manhole
 - Fibre Optic Cable
 - Bell Hydro Service
 - Gas Main
 - Gas Service
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro
 - Hydro Pole
 - Street Light Cable
 - Street Light
 - North
 - South
 - East
 - West

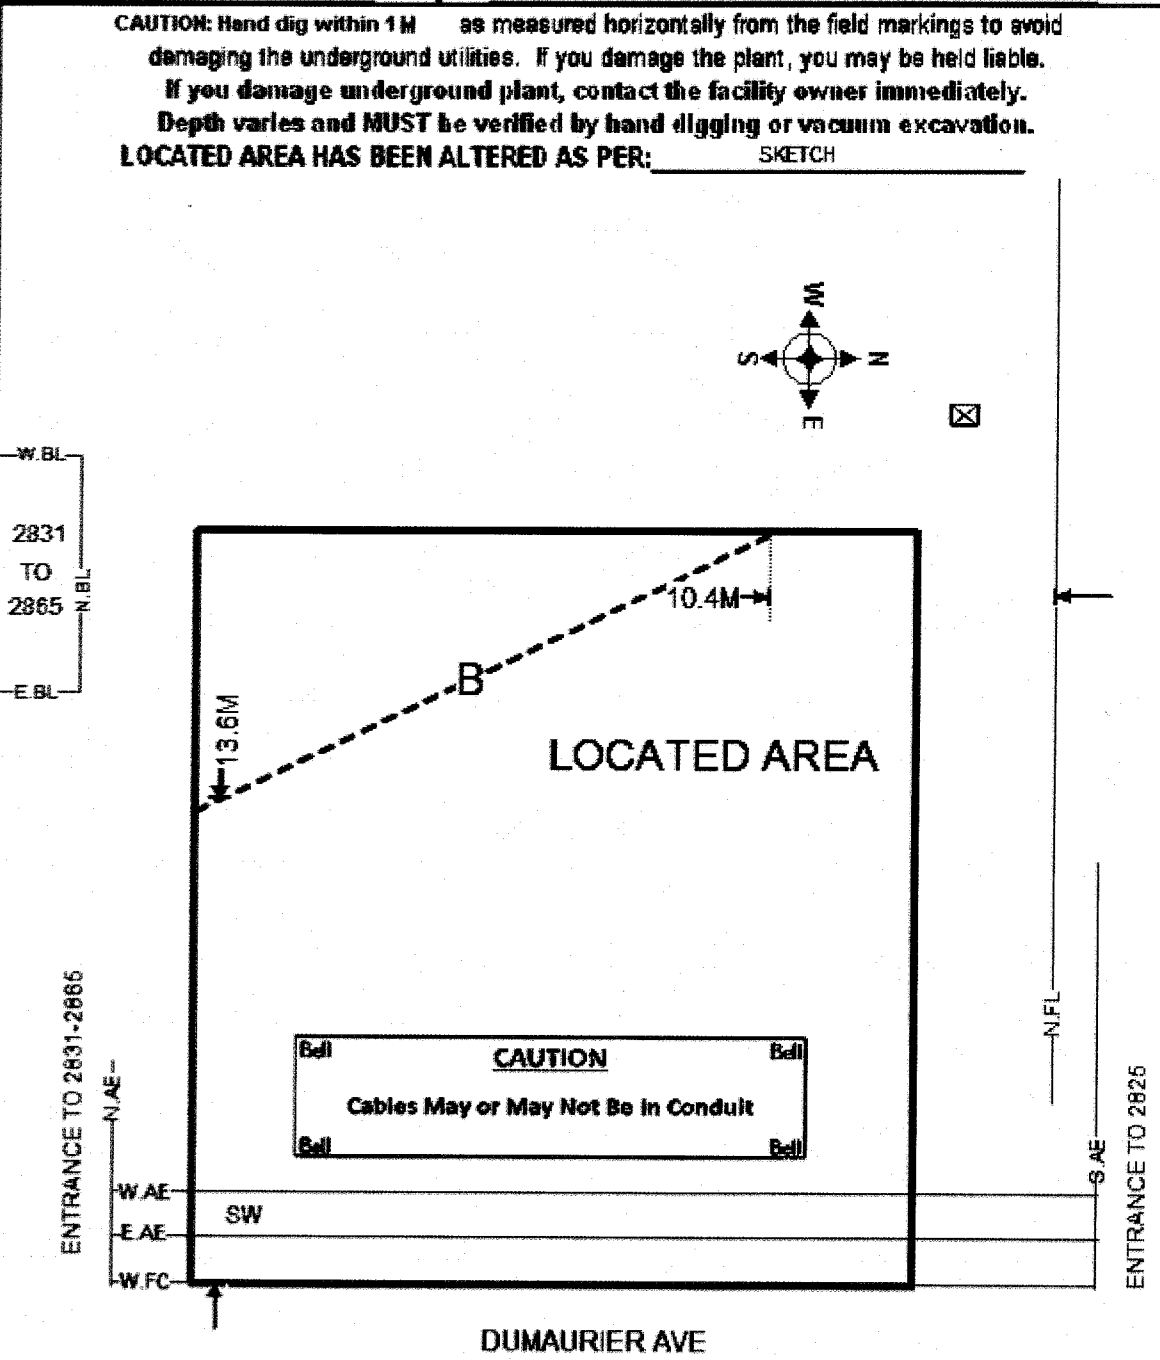

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale. Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-969-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Located: Bell Gas HydroOttawa Hydro One
 Videotron Peel Fibre Veridian connections

Date Located:
mm/dd/yyyy 09/28/2018

Request #
20183813706

Number of Services marked: (Specify building/house numbers) (0)

LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: 27.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE



TO: 6.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE

FROM: W.FC OF DUMAURIER AVE

TO: 25.0M WEST OF W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation. LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL —
 - Fence Line — FL —
 - Face of Curb — FC —
 - Road Edge — RE —
 - Property Line — PL —
 - ASPHALT EDGE — AE —
 - Driveway — DW —
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable
 - Conduit
 - Buried Service Wire
 - Manhole
 - Fibre Optic Cable
 - Bell Hydro Service
 - Gas Main
 - Gas Service
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro
 - Hydro Pole
 - Street Light Cable
 - Street Light
 - North
 - South
 - East
 - West

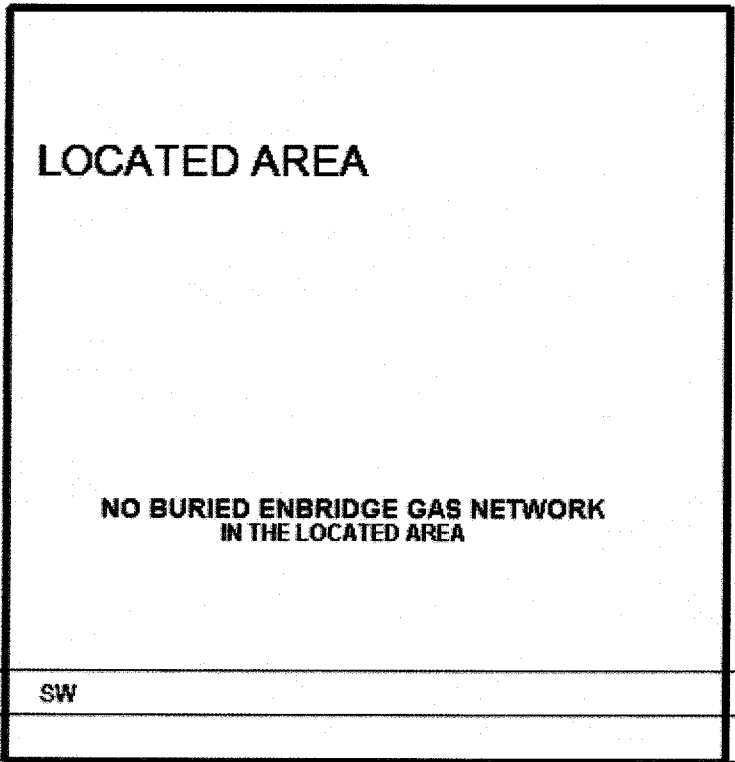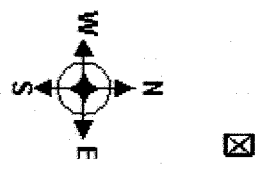

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale. Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



Auxiliary Locate Sheet

Union Gas Emergency #
1-877-999-0999

Phone:
613-723-9888

Fax:
613-723-9277

Toll free:
1-800-371-8866

Email

Utilities Bell Gas Hydro Ottawa Street Lighting
 Located: Blink Peel Fibre

Date Located:
mm/dd/yyyy 09/28/2018

Request # 20183813706

Number of Services marked: (Specify building/house numbers) N/A



LOCATED AREA: EXCAVATOR SHALL NOT WORK OUTSIDE THE LOCATED AREA WITHOUT OBTAINING ANOTHER LOCATE

FROM: 27.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE
 FROM: W.FC OF DUMAURIER AVE

TO: 6.0M SOUTH OF N.FL OF 2831-2865 DUMAURIER AVE
 TO: 25.0M WEST OF W.FC OF DUMAURIER AVE

CAUTION: Hand dig within 1.5M as measured horizontally from the field markings to avoid damaging the underground utilities. If you damage the plant, you may be held liable. If you damage underground plant, contact the facility owner immediately. Depth varies and MUST be verified by hand digging or vacuum excavation.
LOCATED AREA HAS BEEN ALTERED AS PER: SKETCH

- Legend**
- Building Line — BL —
 - Fence Line — FL —
 - Face of Curb — FC —
 - Road Edge — RE —
 - Property Line — PL —
 - ASPHALT EDGE — AE —
 - Driveway — DW —
 - Catch Basin
 - Sidewalk
 - Demarcation
 - Railway
 - Pole
 - Flush to Grade Pedestal
 - Pedestal
 - Buried Cable Conduit — B —
 - Buried Service Wire — BSW —
 - Manhole
 - Fibre Optic Cable — FO —
 - Gas Main — GM —
 - Gas Service — GS —
 - Gas Valve
 - Hydrant
 - Transformer
 - Hydro Ottawa Hydro Pole X
 - Street Light Cable — SL —
 - Street Light
 - North N.
 - South S.
 - East E.
 - West W.

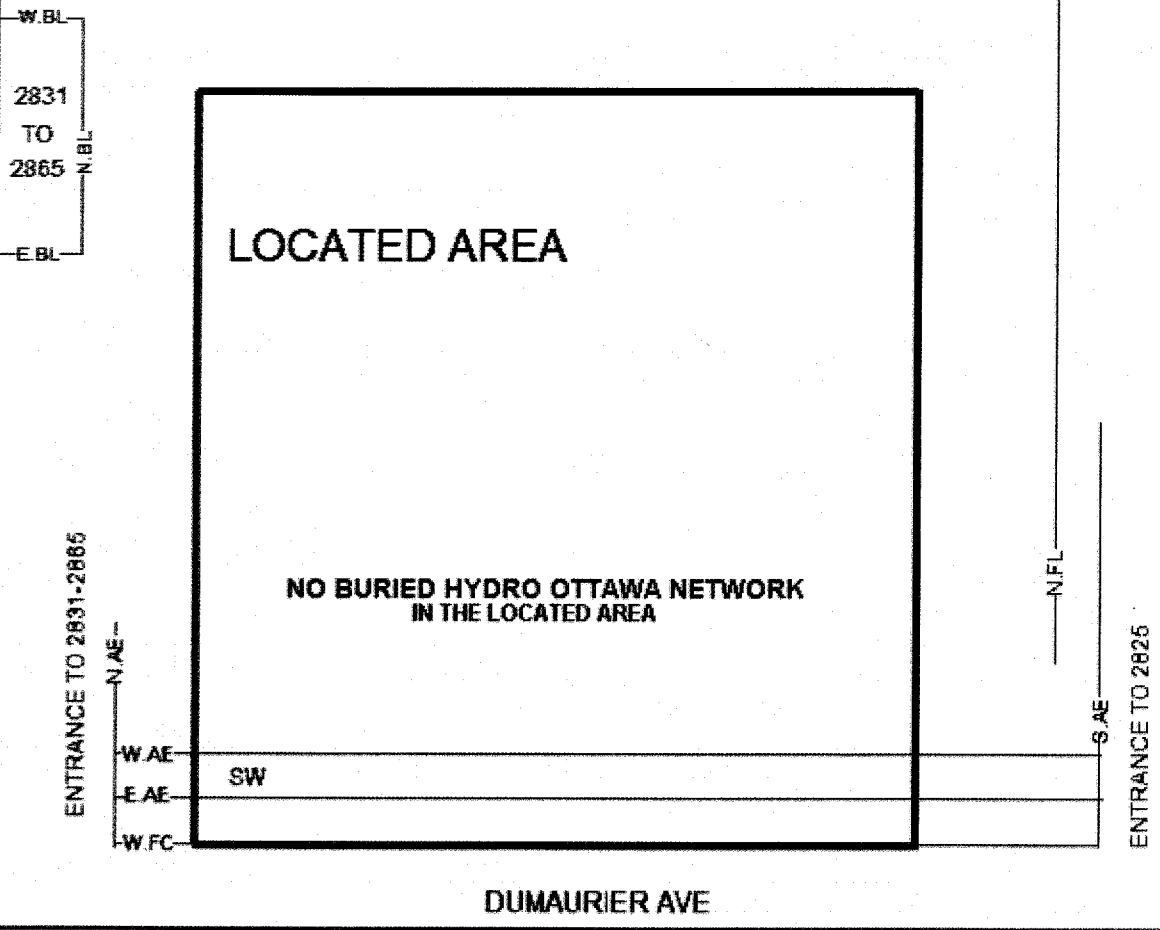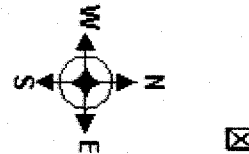

THIS FORM VALID ONLY WITH Primary Locate Form. This sketch is not to scale.
 Any privately owned services within the located area have not been marked- check with service/property owner.

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. If sketch and markings do not coincide, the Excavator must obtain a new locate.



MESSAGE REGARDING REQUESTED LOCATE

Dear Excavator,

Hydro One has completed your locate request based on the information you provided to Ontario One Call. The underground facility locate on our **Distribution system** is valid for **60 days** from the date shown on the Underground Cable Stakeout Report attached. The 60 day validity does not include Transmission locate requests. Please be aware new underground facilities can be installed any time after this locate was completed. It is your responsibility to contact Ontario One Call for a new locate if any changes are known or suspected or for a Relocate if excavation continues beyond 60 days.

Hydro One expects excavators to protect and preserve the paint marks and flags placed at the time of the original locate ticket. If markings are removed due to weather or excavation work, the excavator is expected to recreate the markings based on the tie-in measurements provided on the original locate ticket. However, if an excavator would like Hydro One to refresh their markings, please contact Ontario One Call at 1-800-400-2255 to request a Remark.

WARNINGS AND DISCLAIMERS:

Hand dig cautiously 1 meter around Hydro One's Red Paint Markings as indicated on the Underground Cable Stakeout Report. It is understood that the attached information has been provided from our records, and represents our knowledge of the approximate location of **Hydro One** plant only: the contractor must request stakeouts from other utilities to establish the location of their plant. The company or contractor must exercise extreme caution where mechanical equipment is used in the vicinity of the underground cable plant and where necessary to locate by hand its actual position. Liability for damages rests with the company or contractor.

Thank you,
Hydro One

20183922522

Bell

Dear Excavator:

We are in receipt of your recent request for a Bell relocate.

Please be advised that the original locate(s) issued for the request in question will remain valid for the duration of your project. If any of the exceptions below apply and you would like the site remarked for Bell or you would like to discuss your relocate request, please contact us during business hours at **1-844-225-5550, Option # 8:**

- The excavator did not start their work within 60 days of the original locate completion date
- Tie in's/offsets used as measurements on the original Bell locate are no longer there
- The excavator suspects new Bell plant has been added in the locate area since the original locate
- The excavator has lost control of the site for an extended period of time (i.e. the excavation begins however the excavator has left site and did not return for 60 days or more)
- There is a sticker on your locate indicating there is a Bell Hydro line in the locate area and you're entitled to a Relocate of that area.

Bell expects excavators will protect and preserve the paint marks placed at the time of their original locate. If markings are removed due to weather or ongoing excavation work, the excavator is expected to recreate the markings based on the tie-in measurements provided on the original locate sheet.

If an excavator would like their markings refreshed they can contact the Bell LSP (Locate Service Provider) directly and arrange for this at the excavator's expense. The LSP contact information is available on the original locate sheet.

Sincerely,

Bell Screening Centre

DISCLAIMER

Warning!

The Excavator must have a copy of this locate on the job site during excavation.

Located Area: The Excavator must not work outside the area indicated by the Located Area in the Diagram without a further locate by the Company

Locate the plant: The plant location information provided is the best we have available but constitutes only an estimate. Depth of underground plant varies and the exact location must be determined by hand digging prior to excavation with mechanical equipment.

Mechanical equipment must not be used within one metre of the estimated location of the plant.

Hydro Ottawa must be notified prior to excavation and inspector on site

Expose the plant: Once the plant has been located by hand digging, it must be exposed along its length adjacent to or in the immediate vicinity of the proposed excavation. For this purpose, mechanical equipment must not be used within 0.5 metres of the plant.

Digging around the exposed plant: When the plant has been exposed, any further excavation within 0.3 metres, must only be done by hand digging and not with mechanical equipment.

Support Requirements: If the underground plant is exposed over a distance of more than 1.25 metres, the Facility Owner must be notified. Underground plant must be supported at all times.

O. Reg. 210/01 Oil and Gas Pipeline systems EXCERPTS

9. (1) No person shall dig, bore, trench, grade, excavate or break ground with mechanical equipment or explosives without first ascertaining the location of any pipeline that may be interfered with.

10. No person shall interfere with or damage any pipeline without authority to do so.

Technical Standards & Safety Act 2000 EXCERPT

37 (1) Every person who contravenes or fails to comply with any provision of this act or the regulations; etc... is guilty of an offense and on conviction is liable to a fine of not more than \$50,000 or to imprisonment for a term of not more than one year, or to both.

Caution: The markings may disappear or be misplaced. Should sketch and markings not coincide, Excavator must obtain a new locate. This is based on information given at the time. Any changes to location or nature of work require a new locate. The Excavator must not work outside the indicated Located Area without a further locate. Privately owned services within the located area have not been marked - check with service/property owner.

Locate is VOID after 30 days.

For remarks contact Ontario One Call 1-800-400-2255.
or www.on1call.com



DISCLAIMER

Warning!

The Excavator must have a copy of this locate on the job site during excavation.

Located Area: The Excavator must not work outside the area indicated by the Located Area in the Diagram without a further locate by the Company

Locate the plant: The plant location information provided is the best we have available but constitutes only an estimate. Depth of underground plant varies and the exact location must be determined by hand digging prior to excavation with mechanical equipment.

Mechanical equipment must not be used within one metre of the estimated location of the plant.

Hydro Ottawa must be notified prior to excavation and inspector on site

Expose the plant: Once the plant has been located by hand digging, it must be exposed along its length adjacent to or in the immediate vicinity of the proposed excavation. For this purpose, mechanical equipment must not be used within 0.5 metres of the plant.

Digging around the exposed plant: When the plant has been exposed, any further excavation within 0.3 metres, must only be done by hand digging and not with mechanical equipment.

Support Requirements: If the underground plant is exposed over a distance of more than 1.25 metres, the Facility Owner must be notified. Underground plant must be supported at all times.

O. Reg. 210/01 Oil and Gas Pipeline systems EXCERPTS

9. (1) No person shall dig, bore, trench, grade, excavate or break ground with mechanical equipment or explosives without first ascertaining the location of any pipeline that may be interfered with.

10. No person shall interfere with or damage any pipeline without authority to do so.

Technical Standards & Safety Act 2000 EXCERPT

37 (1) Every person who contravenes or fails to comply with any provision of this act or the regulations; etc... is guilty of an offense and on conviction is liable to a fine of not more than \$50,000 or to imprisonment for a term of not more than one year, or to both.

Caution: The markings may disappear or be misplaced. Should sketch and markings not coincide, Excavator must obtain a new locate. This is based on information given at the time. Any changes to location or nature of work require a new locate. The Excavator must not work outside the indicated Located Area without a further locate. Privately owned services within the located area have not been marked - check with service/property owner.

Locate is VOID after 30 days.

For remarks contact Ontario One Call 1-800-400-2255.
or www.on1call.com




City of Ottawa Locate Report – Water and Sewer Utilities
Rapport de localisation des conduites d'eau et d'égout d'Ottawa



For more information / Pour de plus amples renseignements : 3-1-1 or/ou (613) 580-2424, ext. (poste) 22336.

| | |
|---|--|
| Date : 26/9/18 | Work Order # / No d'ordre de travail : 11668505 |
| Location of Work / Lieu de travail : 2865 DUMaurier Ave. | ON1CALL # / No d'appel ON1 : 201838137061 |
| Type of Work / Type de travail : bore holes | <input type="checkbox"/> ArcView attached Plan ArcView ci-joint |
| Contractor / Entrepreneur : USL | Fax / Télécopieur : |

Sketch Not To Scale / Le croquis n'est pas à l'échelle

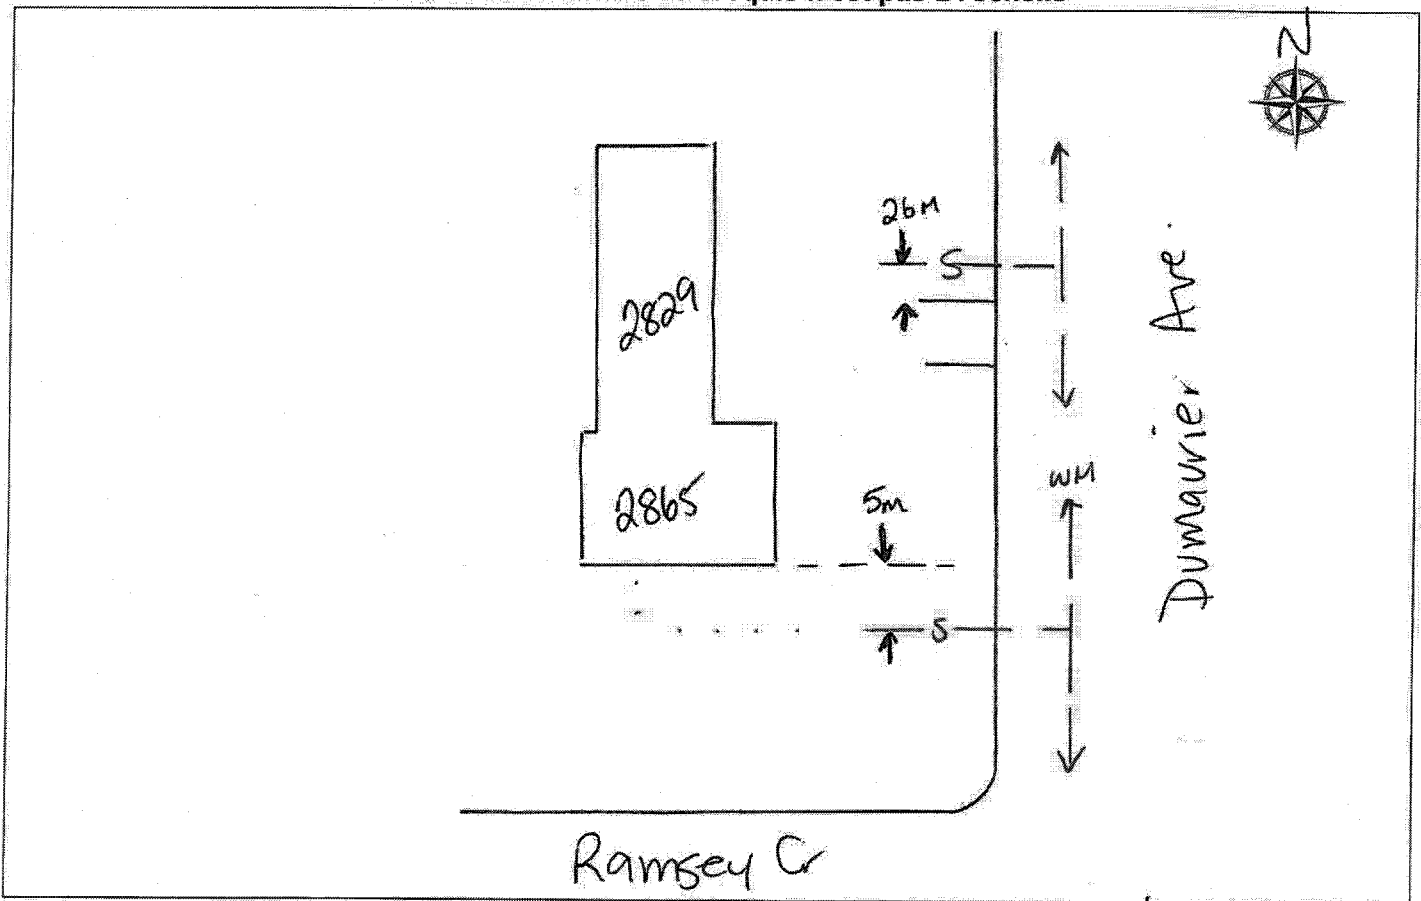

Contractor signature
Signature de l'entrepreneur

J Riddell
Locator (please print)
Marqueurs [en lettres moulées]

Method of marking / Méthode de marquage

- Flags / Drapeaux
- Paint / Peinture
- Other (specify) / Autre [précisez] :

Remarks / Commentaires : Cars in lot blocking valves

Office copy : White
Copie du bureau : Blanc

Contractor copy: Yellow
Copie de l'entrepreneur : Jaune

Void after 60 days.
Périmé après 60 jours.

Monique Larocque

From: ESD-Locate / SE-Localiser <esd-locate@ottawa.ca>
Sent: Thursday, September 27, 2018 8:01 AM
To: 'moniquel@usl-1.com'
Cc: ESD-Locate / SE-Localiser
Subject: Locate: DUMAURIER AVE - 20183813706
Attachments: 11668505.pdf; City of Ottawa Disclaimer - ville d'Ottawa avis de non-responsabilité - Copy - Copy.pdf

Please find attached the locate for DUMAURIER AVE.

Thank you,

Axel Grissa

City of Ottawa

Technology, Innovation & Engineering Support Services Public Works & Environmental Services Department

(613)-580-2424 x22336

<<http://ottawa.ca/en>>

Please note: City of Ottawa locates are only valid for sixty (60) days.



DISCLAIMER

The excavator must have a copy of this locate on the job site during excavation.

Locate area: The excavator must not work outside the area indicated in the location of work or located area in the diagram without an updated locate. Stakes or markings may disappear or be displaced. If any delays occur in acting on the stakeout information, or if markings become unclear, a new locate must be obtained.

Locating the plant: The plant location information provided is only an estimate. Depth of underground plant varies and the exact location must be determined by hand digging prior to excavation with mechanical equipment.

Warning: Do not use mechanical equipment within one (1) metre of the estimated location of the water or sewer plant. If the plant is larger than 406mm, mechanical equipment must not be used within three (3) meters.

Digging around exposed plants: Must do any further excavation within 0.3 metres of an exposed water or sewer plant by hand.

Contractors are to perform all work in accordance with applicable City of Ottawa By-laws and any applicable federal and provincial legislation or regulations, including but not limited to the *Public Utilities Act, R.S.O. 1990, c. P.52, s. 56(1)*; *Ontario Regulation 210/01 under the Technical Safety Standards Act, 2000, S.O. 2000 c. 16*; *Ontario Regulation 213/91 under the Occupational Health and Safety Act, R.S.O. 1990, c. O.1.*

AVIS DE NON-RESPONSABILITÉ

L'opérateur de l'excavatrice doit avoir en sa possession ce rapport de localisation pendant l'excavation.

Zone de localisation : l'opérateur de l'excavatrice ne doit pas creuser en dehors de la zone indiquée sur l'ordre de travail ni à l'extérieur de la zone indiquée sur le diagramme, à moins d'avoir en sa possession un rapport de localisation actualisé. Les piquets ou les marques peuvent disparaître ou être déplacés. S'il y a un retard à intervenir sur la base des données de surveillance ou si le marquage devient imprécis, il faut obtenir un nouveau rapport de localisation.

Déterminer l'emplacement des conduites : les renseignements sur l'emplacement des conduites sont approximatifs. Pour déterminer l'emplacement et la profondeur, on doit creuser manuellement avant d'utiliser une excavatrice.

Avertissement : n'utilisez pas d'équipement mécanique [excavatrice] à moins d'un [1] mètre de l'emplacement supposé de la conduite d'eau ou d'égout. Si la conduite compte plus de 406 mm de diamètre, aucun équipement mécanique ne doit être utilisé à moins [3] de trois mètres de celle-ci.

Creuser autour des conduites exposées : toute excavation à moins de 0,3 m d'une conduite d'eau ou d'égout doit se faire manuellement.

Les entrepreneurs doivent exécuter tous les travaux conformément aux règlements de la Ville d'Ottawa et aux lois et règlements fédéraux ou provinciaux applicables, y compris, mais sans s'y limiter, la *Loi sur les services publics, L.R.O. 1990, chap. P.52, art. 56[1]*; le *Règlement 210/01 de l'Ontario en vertu de la Loi de 2000 sur les normes techniques et la sécurité, L.O. 2000, chap. 16*; et le *Règlement 213/91 de l'Ontario en vertu de la Loi sur la santé et la sécurité au travail L.R.O. 1990, chap. O.1.*

GHD



ROGERS Primary Locate Sheet

ON 1 Call Ticket # :
20183813706

Ph: (905)479-5674 Email: ontario@canadianlocators.com

| | | | |
|---|----------------------------------|--|------------------------------|
| Contractor / Excavator : U S I | | Contact Name : JACQUES DESJARDINS | |
| Tel : 613-226-8750 | Alt. Phone : | Email : monique1@usi-1.com | |
| Received Date : Sep 20 2018 | Excavation Date : Sep 26 2018 | Revised Excavation Date : | Type of Work : BORE HOLES |
| Locate Address : 2831-2865 DUMAURIER AVE | | City / Municipality : OTTAWA, ONTARIO | |

Nearest Intersection :
RAMSEY CREE & WATSON ST

Method of Field Marking : Paint Stakes Flags

Caller's Remarks (Additional Info) :
CORLOT-U Drilling throughout properties. Clear all of 2831 to 2865 Dumaurier Ave to all property lines and to sidewalk edge on Dumaurier Ave.//Civic # 2831, 2833, 2835, 2865.

| | | | | | | |
|--------------------|---|--|-----|--|--|---|
| Utilities Marked : | <input checked="" type="checkbox"/> Coaxial Plant | <input checked="" type="checkbox"/> Fibre Optics Plant | | | | This locate has multiple work areas which are greater than 100 m apart : <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Total Length : | 205 m | Total Length : | 5 m | | | |

Field sketch and Located Area shown on auxiliary locate sheet(s)

This locate is for ROGERS plant infrastructure ONLY!

Apply sticker here if required

CAUTION : Locate is VOID after 60 days !

CAUTION : Hand dig within one (1) meter or 3.28 feet of markings. The Located Area defined on the Auxiliary Locate Sheet(s) contains all known ROGERS infrastructure. Any changes to excavation area or nature of work requires a new locate.

**For all cut cable, please call :
1-800-265-9501**

Locator's Comments :
160 X 50

Locator's Name : (Please Print)
Jason Vanslyke

| | | |
|----------------------|--------------------------|-----------------------|
| Date : Oct 2 2018 | Start Time : 12:30 PM | End Time : 1:30 PM |
|----------------------|--------------------------|-----------------------|

A copy of this Primary Locate Sheet and Auxiliary Locate Sheet(s) must be on site and in the hands of the machine operator during work operations. Should sketch and markings not coincide, a new locate MUST be obtained.

Ph: (905) 479-5674 Email: ontario@canadianlocators.com

Utilities Marked :

Coaxial Plant 205 m Fibre Optics Plant 5 m

Number of Services Marked : (specify building/house numbers)

LOCATED AREA CONTAINS ALL KNOWN ROGERS INFRASTRUCTURE

FROM :
N/FL 2831-2865 DUMAURIER AVENUE


TO :
5m N/N/RE RAMSEY CRESCENT

FROM :
W/FL 2831-2865 DUMAURIER AVENUE

TO :
W/RE DUMAURIER AVENUE

Hand dig within 1 meter or 3.28 feet as measured horizontally from the field markings to avoid damaging the underground utilities.
If you damage the utilities, you may be held liable. For all cut cable, please call: 1-800-265-9501 immediately!
Depth of cable plant varies and MUST be determined by hand digging or vacuum excavation.

LOCATED AREA ALTERED AS PER :

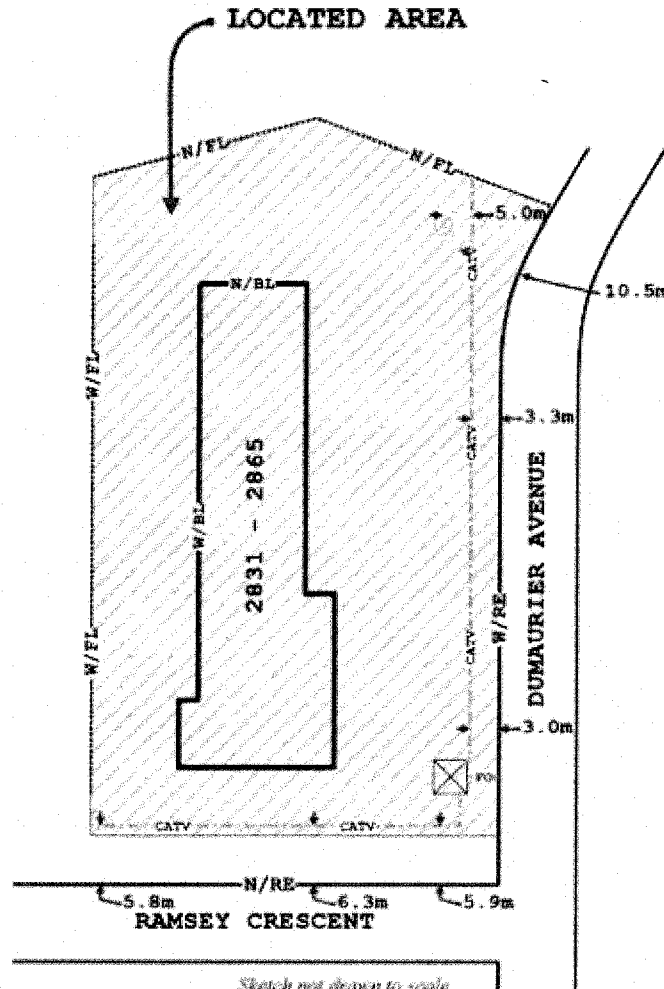

Sketch not drawn to scale

LEGEND :

| | | | | | |
|-----------------------|------------------------|----------------------|---------------------|------------------------|------------------------|
| Fibre Optic — FO — | Road Edge — RE — | Property Line — PL — | Tree — [Symbol] | Transformer — [Symbol] | Streetlight — [Symbol] |
| Cable / T.V. — CATV — | Bldg Line — BL — | Lot Line — LL — | Pedestal — [Symbol] | Manhole — [Symbol] | Hand Hole — [Symbol] |
| Conduit — C — | North Direction — N — | Face of Curb — FC — | Pole — [Symbol] | Catch Basin — [Symbol] | Hydrant — [Symbol] |
| Railway — [Symbol] | Sidewalk — SW — | Driveway — DW — | Valve — [Symbol] | North N | East E |
| Work Area — [Symbol] | Measurement — [Symbol] | Fence Line — FL — | Vault — [Symbol] | South S | West W |

A copy of this Auxiliary Locate Sheet(s) and the Primary Locate Sheet must be on site and in the hands of the machine operator during work operations. Should sketch and markings not coincide, a new locate MUST be obtained.

GHD



City of Ottawa Street Light Locate

Ontario One Call TF

NOTICE OF INTENT TO EXCAVATE

Header Code: STANDARD

Request Type: NORMAL

Ticket No: 20183813706

Original Call Date: 09/19/2018 10:51:27 AM

Work To Begin Date: 09/26/2018

Company: U S L

Contact Name: JACQUES DESJARDINS

Pager:

Contact Phone: (613)-226-8750 ext.

Cell:

Fax: (613)-226-8677 ext.

Alternate Contact: JEFF FORRESTER

Alt. Phone:

Place: OTTAWA

Street: 2831 DUMAURIER AVE

Nearest Intersecting Street: RAMSEY CRES

Second Intersecting Street: WATSON ST

Subdivision: OTTAWA

Additional Dig Information:

CIVIC # 2831, 2833, 2835, 2865. CORLOT=U DRILLING THROURHOUT PROPERTIES. CLEAR ALL OF 2831 TO 2865 DUMAURIER AVE TO ALL PROPERTY LINES AND TO SIDEWALK EDGE ON DUMAURIER AVE. NO_PLAN:613 828

WO/JOB #: ANYTIME

Type Of Work: BORE HOLES

Remarks:

-75.793499 45.350499 NB_SEGMENTS::2 BCOE01 ROGOTT01 OTWASL01 OTWAWS01 ENOE01 HOT1

| | |
|-----------------------|------------------------|
| On1 Call # | 20183813706 |
| Date Requested | 09/19/2018 10:51:27 AM |

City of Ottawa Street Light Locate


Dispatcher: Lisa Bisailon
Phone: 613-526-1226



| | |
|---------------------|---------------------|
| Company | U S L |
| Name | JACQUES DESJARDINS |
| Phone | (613)-226-8750 ext. |
| FAX | (613)-226-8677 ext. |
| Site Contact | JEFF FORRESTER |
| Phone | |

Instructions
 2831 to 2865, DUMAURIER AVE
 CIVIC # 2831, 2833, 2835, 2865. CORLOT=U DRILLING TRHOURLHOUT
 PROPERTIES. CLEAR ALL OF 2831 TO 2865 DUMAURIER AVE TO ALL
 PROPERTY LINES AND TO SIDEWALK EDGE ON DUMAURIER AVE.
 NO_PLAN::613 828

LOCATOR SKETCH

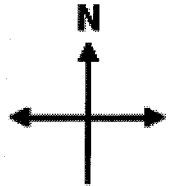

Clear

No City of Ottawa Street
 Light assets in dig area

CLEAR PAST SIDEWALK

- Underground Street Light Cable
- Overhead/Aerial Wires
- Source/Transformer
- Street Light
- Globe/Decorative Light
- Hydro Pole

Locator Notes/Comments:

Locate is valid for 60 days. If sketch is different from markings, location or nature of work changes, a new locate must be requested. Hand dig within 1 m (3.28ft) on either side of markings. Depth of buried plant varies.

Cette fiche n'est pas valide 60 jours de calendrier apres le reperege. Si les marques ne concordent pas avec celles sur le croquis, un nouveau reperege est requis. Tout changement a l'emplacement ou a la nature du travail necessite un nouveau reperege. Creuser a la main un metre (3.28 pieds) du repere. La profondeur des installation varie d'un endroit a l'autre.

| | |
|---------------------|---------------|
| Date Located | 09/21/2018 |
| Time of day | |
| Located by | JUSTIN VAVROS |
| Signature | |
| Page | 2 of 2 |

Disclaimer

Black & McDonald

Warning!

The Excavator must have a copy of this locate on the job site during excavation.

Located Area: The Excavator must not work outside the area indicated, by the located area in the diagram, without a further locate completed by **Black & McDonald Limited**.

Locate the Plant: The plant location information provided is the best we have available, but constitutes only an estimate. Depth of underground plant varies and the exact location must be determined by hand digging prior to excavation with mechanical equipment.

Mechanical equipment must not be used within 1.0 meter of the estimated location of the plant.

Valid Documentation: This locate is valid only for the Agency accepting it. Other parties must obtain and accept their respective underground locate from **Ontario 1 Call**.

Excavator Alterations: Under no circumstance shall an Excavator touch or move an underground power cable. Arrangements must be made to have qualified personnel relocate any such cable.

Expose the plant: Once the plant has been located by hand digging, it must be exposed along its length adjacent to or in the immediate vicinity of the proposed excavation. For this purpose, mechanical equipment must not be used within 0.5 meters of the plant.

Digging around the Exposed Plant: When the plant has been exposed, any further excavation within 0.3 meters, must only be done by hand digging and not with mechanical equipment.

Support Requirements: If the underground plant is exposed over a distance of more than 1.25 meters, the Facility Owner must be notified. Underground plant must be supported at all times.

Private Cables: Please be advised that **Black & McDonald Limited** is not responsible for and does not locate private cables

New Cables: Be aware that new cables could be installed at any time after the locate has been completed. It is the Excavator's responsibility to call for new locates if any changes are known or suspected.

Caution: The markings may disappear or be misplaced. Should sketch and markings not coincide, the Excavator must obtain a new locate. This is based on the information given at the time. Any changes to location or nature of work require a new locate. The Excavator must not work outside the indicated located area without a further locate. Privately owned services within the located area have not been marked- check with service/property owner.

Liability: Any person or Excavator who interferes with or damages any underground electrical cable without having obtained a valid locate/clearance from **Black & McDonald Limited**, shall be liable for all cost incurred during the repair of the cable as well as any resulting legal actions.

This locate has been given as accurately as possible, but no locate is guaranteed. Excavators must always dig with extreme caution to prevent the possibility of damaging electrical cables and endangering safety.

Locate is void after 60 days

For remarks contact **Ontario One Call** 1-800-400-2255 or www.on1call.com



ONE-CALL SYSTEMS INC.
775 TAYLOR CREEK DRIVE
OTTAWA, ON, K4A 0Z9


1 OF 3
PHONE (613) 226-8750
FAX (613) 226-8677

CUSTOMER: *GHD* REQUESTED BY: *RYAN*

LOCATION OF WORK: *2865 DuMAURIER AVE* LIMITS OF WORK: *AS PER MAP*

| | | | | | |
|--------------------|----------|-------------|------------------|----------------|-----------------|
| HYDRO | -- H -- | CABLE T.V. | -- TV -- | STEAM | -- STEAM -- |
| GAS | -- G -- | SANITARY | (SAN) | ELECTRICAL | (EL) |
| BELL | -- B -- | STORM | (ST) | COMMUNICATIONS | -- COM -- |
| UNIDENTIFIED CABLE | -- UC -- | FIBER OPTIC | -- FOC -- | OTHER: | |
| WATER | -- W -- | | | | |

LOCATES ONLY APPLICABLE TO INFO ABOVE - LOCATES VOID AFTER 30 DAYS!

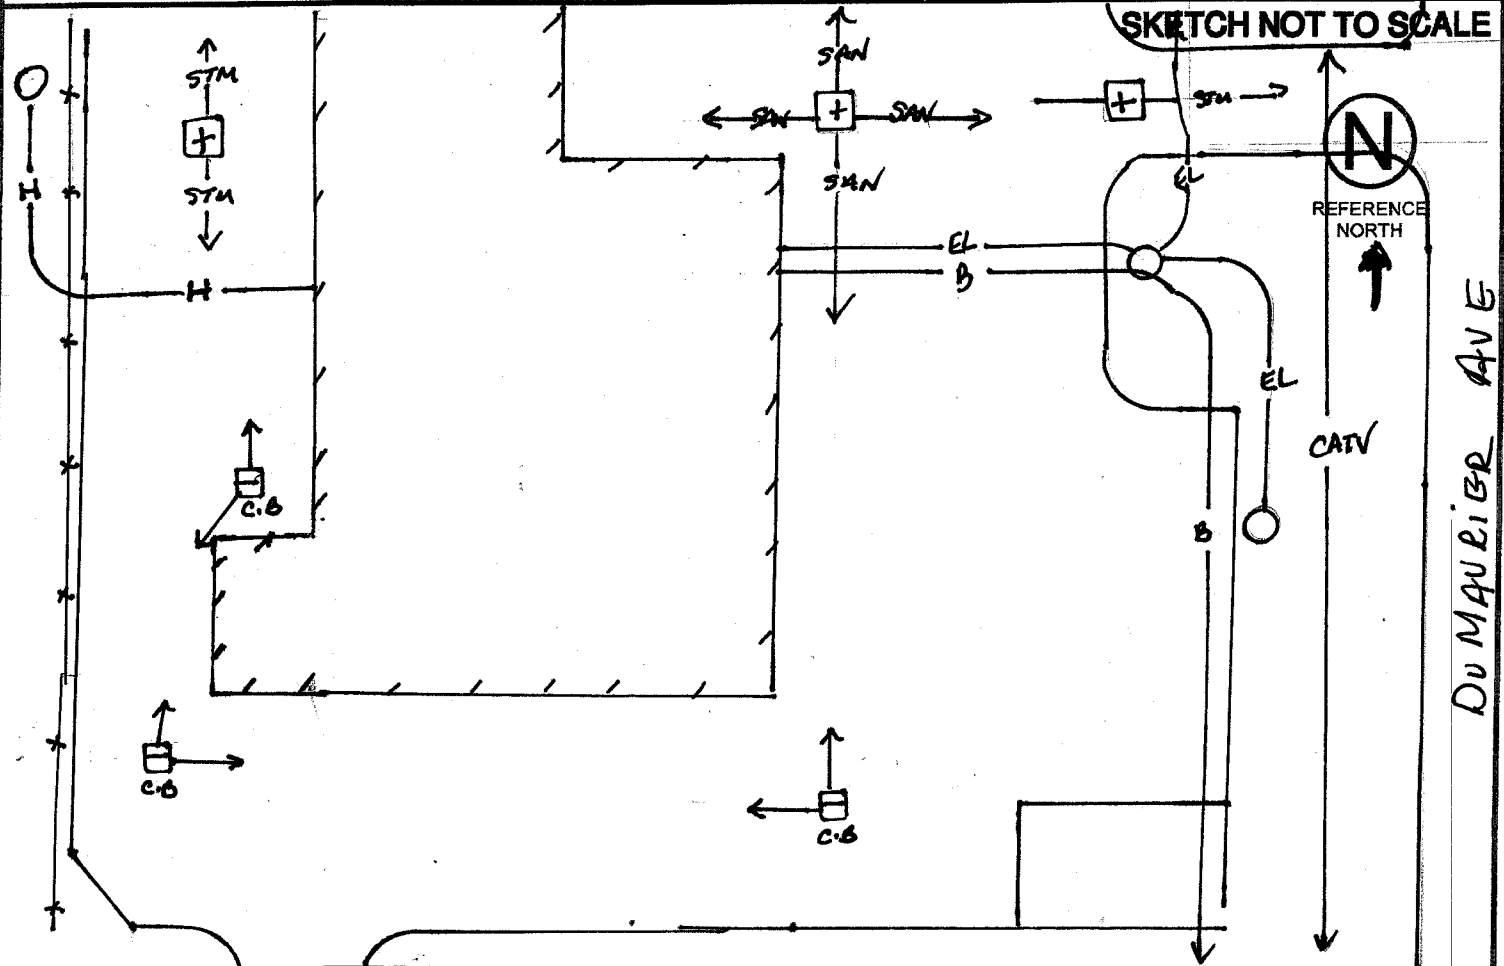

USL-1 as a Private utility locator, is not permitted to locate Publicly owned utilities. In some cases, Public utilities may be noted on a sketch, but are FOR REFERENCE ONLY, and under no circumstances shall be used for excavation purposes. It is the contractor's responsibility to verify any Public utilities noted on the USL-1 sketch by referring to the Public utility locate sheets for physical LOCATION AND ACCURACY. USL-1 DOES NOT ASSUME LIABILITY FOR PUBLIC LOCATE INNACCURACIES.

If the proposed work area is on Private property, it does NOT mean that all buried utilities are Private. Regardless of when you are digging, and what the proposed depth of excavation is, it is the law to notify Ontario One Call (or Info-Excavation in Quebec) to obtain Public utility locates.

COMMENTS: *NO OTHER PRIVATE UTILITIES DETECTED*

THIS SKETCH IS NOT A PUBLIC UTILITY LOCATE/DOCUMENT. PUBLIC UTILITIES SHOWN ARE FOR REFERENCE ONLY. REFER TO USL-1 DISCLAIMER - FORM 101. CONTRACTOR IS RESPONSIBLE TO ENSURE THEY HAVE PUBLIC UTILITY LOCATES BEFORE COMMENCING WORK.

LOCATORS NAME: *CHRIS WHARTON* SIGNATURE: *[Signature]*

LOCATE RECEIVED AND REVIEWED BY _____ Print Name _____ Signature _____

CAUTION: HAND DIG WITHIN 1.5 METERS OF MARKINGS

ONE-CALL SYSTEMS INC.
775 TAYLOR CREEK DRIVE
OTTAWA, ON, K4A 0Z9


20F3
PHONE (613) 226-8750
FAX (613) 226-8677

CUSTOMER: *GHD* REQUESTED BY: *RYAN*

LOCATION OF WORK: *2865 Du MAURIER AVE* LIMITS OF WORK: *AS PER MAP*

| | | |
|-----------------------------|---------------------------|----------------------------|
| HYDRO -- H -- | CABLE T.V. -- T.V. -- | STEAM -- STEAM -- |
| GAS -- G -- | SANITARY (SAN) | ELECTRICAL (EL) |
| BELL -- B -- | STORM (ST) | COMMUNICATIONS -- COM -- |
| UNIDENTIFIED CABLE -- UC -- | FIBER OPTIC -- FOC -- | OTHER: |
| WATER -- W -- | | |

LOCATES ONLY APPLICABLE TO INFO ABOVE - LOCATES VOID AFTER 30 DAYS!

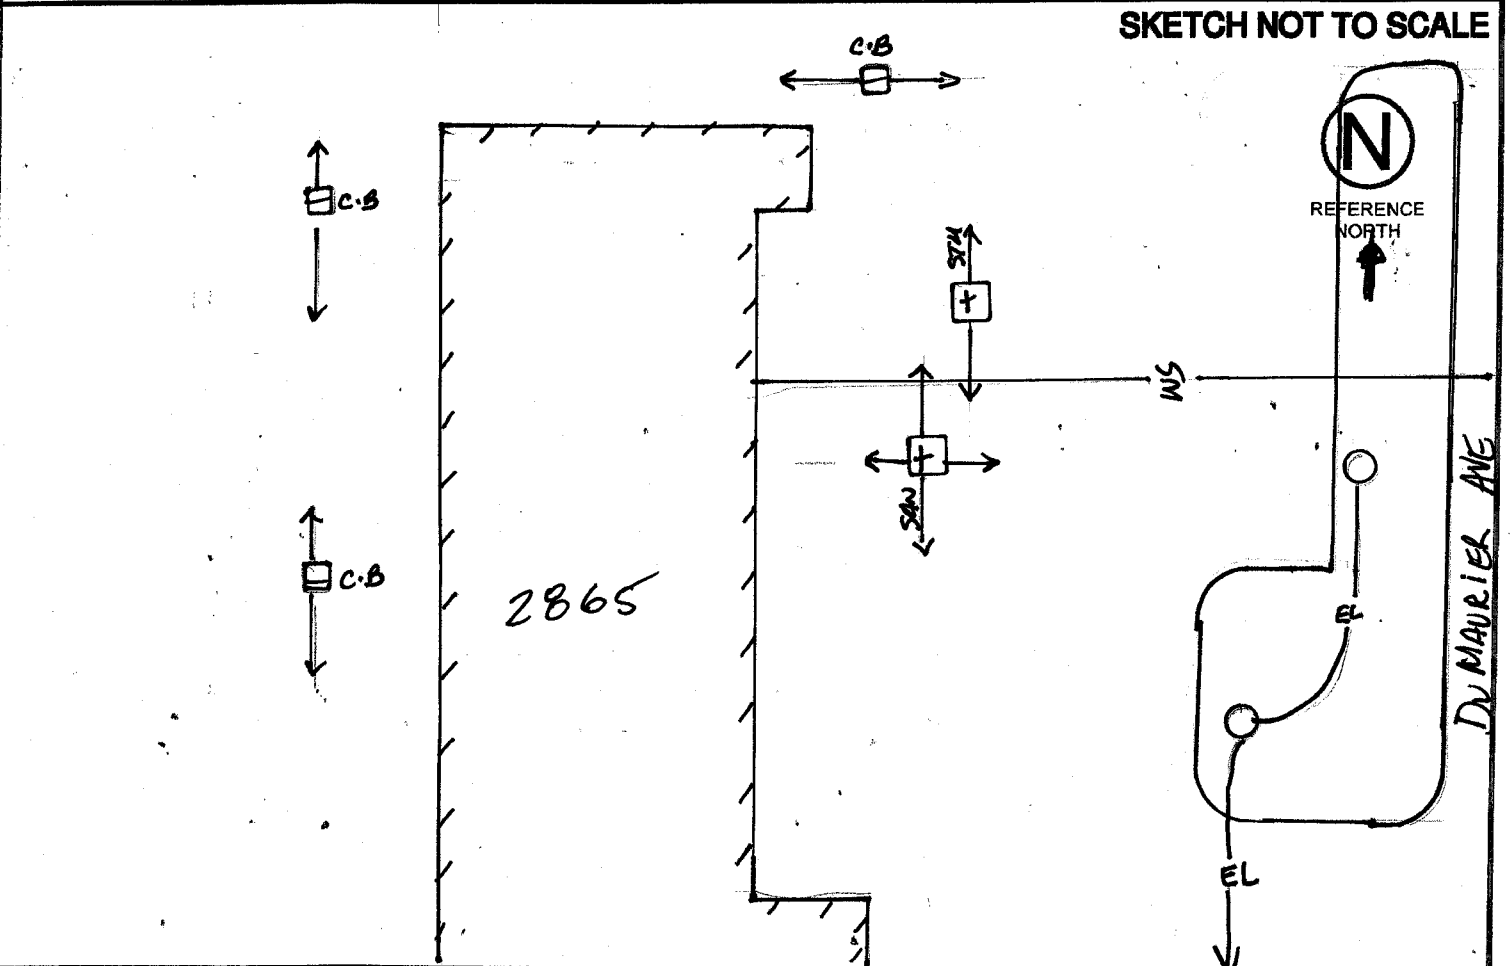

- USL-1 as a Private utility locator, is not permitted to locate Publicly owned utilities. In some cases, Public utilities may be noted on a sketch, but are FOR REFERENCE ONLY, and under no circumstances shall be used for excavation purposes. It is the contractor's responsibility to verify any Public utilities noted on the USL-1 sketch by referring to the Public utility locate sheets for physical LOCATION AND ACCURACY. USL-1 DOES NOT ASSUME LIABILITY FOR PUBLIC LOCATE INNACCURACIES.
- If the proposed work area is on Private property, it does NOT mean that all buried utilities are Private. Regardless of when you are digging, and what the proposed depth of excavation is, it is the law to notify Ontario One Call (or Info-Excavation in Quebec) to obtain Public utility locates.

COMMENTS: *NO OTHER PRIVATE UTILITIES DETECTED*

THIS SKETCH IS NOT A PUBLIC UTILITY LOCATE/DOCUMENT. PUBLIC UTILITIES SHOWN ARE FOR REFERENCE ONLY. REFER TO USL-1 DISCLAIMER - FORM 101. CONTRACTOR IS RESPONSIBLE TO ENSURE THEY HAVE PUBLIC UTILITY LOCATES BEFORE COMMENCING WORK.

LOCATORS NAME: *CHRIS WHARTON* SIGNATURE: *[Signature]*

LOCATE RECEIVED AND REVIEWED BY _____ Print Name _____ Signature _____

CAUTION: HAND DIG WITHIN 1.5 METERS OF MARKINGS

UNDERGROUND SERVICE LOCATORS - PRIVATE UTILITY REPORT DATE: 10-04-2018

ONE-CALL SYSTEMS INC.
775 TAYLOR CREEK DRIVE
OTTAWA, ON, K4A 0Z9


3 of 3
 PHONE (613) 226-8750
 FAX (613) 226-8677

CUSTOMER: *BHD* REQUESTED BY: *RYAN*

LOCATION OF WORK: *2865 DU MAURIER AVE* LIMITS OF WORK: *AS PER MAP*

| | | | | | |
|--------------------|----------|-------------|------------|----------------|-------------|
| HYDRO | -- H -- | CABLE T.V. | -- T.V. -- | STEAM | -- STEAM -- |
| GAS | -- G -- | SANITARY | -- SAN -- | ELECTRICAL | -- E -- |
| BELL | -- B -- | STORM | -- ST -- | COMMUNICATIONS | -- COM -- |
| UNIDENTIFIED CABLE | -- UC -- | FIBER OPTIC | -- FOC -- | OTHER: | |
| WATER | -- W -- | | | | |

LOCATES ONLY APPLICABLE TO INFO ABOVE - LOCATES VOID AFTER 30 DAYS!

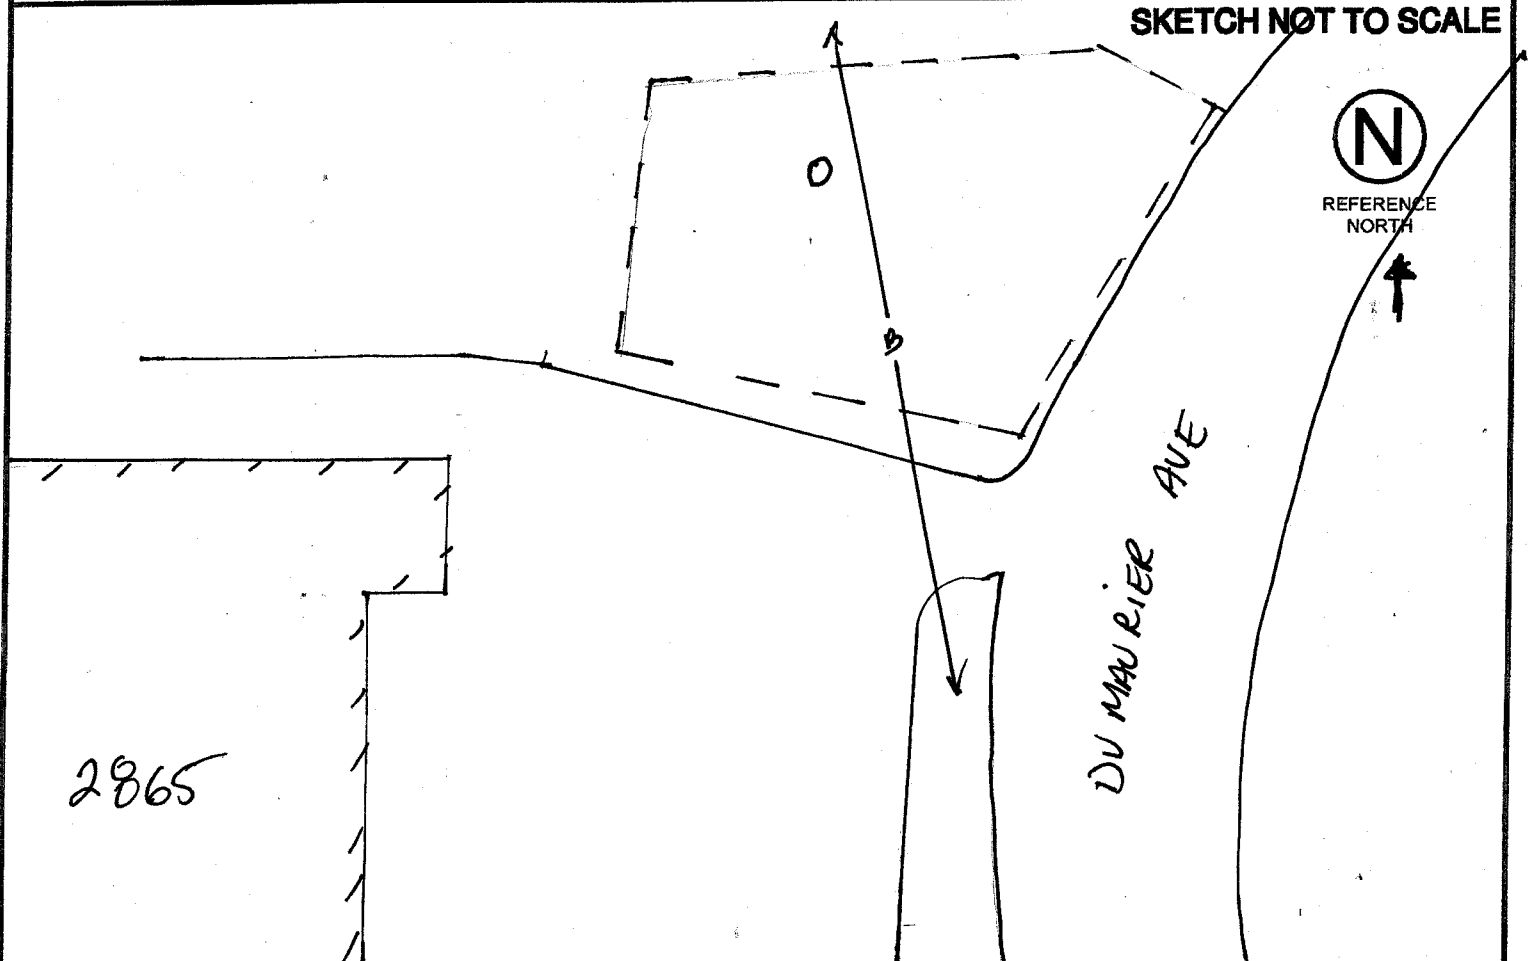

- USL-1 as a Private utility locator, is not permitted to locate Publicly owned utilities. In some cases, Public utilities may be noted on a sketch, but are FOR REFERENCE ONLY, and under no circumstances shall be used for excavation purposes. It is the contractor's responsibility to verify any Public utilities noted on the USL-1 sketch by referring to the Public utility locate sheets for physical LOCATION AND ACCURACY. USL-1 DOES NOT ASSUME LIABILITY FOR PUBLIC LOCATE INNACCURACIES.
- If the proposed work area is on Private property, it does NOT mean that all buried utilities are Private. Regardless of when you are digging, and what the proposed depth of excavation is, it is the law to notify Ontario One Call (or Info-Excavation in Quebec) to obtain Public utility locates.

COMMENTS: *NO OTHER PRIVATE UTILITIES DETECTED*

THIS SKETCH IS NOT A PUBLIC UTILITY LOCATE/DOCUMENT. PUBLIC UTILITIES SHOWN ARE FOR REFERENCE ONLY. REFER TO USL-1 DISCLAIMER - FORM 101. CONTRACTOR IS RESPONSIBLE TO ENSURE THEY HAVE PUBLIC UTILITY LOCATES BEFORE COMMENCING WORK.

LOCATORS NAME: *CHRIS WHARTON* SIGNATURE: *[Signature]*

LOCATE RECEIVED AND REVIEWED BY _____
 Print Name Signature

CAUTION: HAND DIG WITHIN 1.5 METERS OF MARKINGS

USL-1 DISCLAIMER - FORM 101

- It is our Clients responsibility to fully read and understand this document, prior to any ground disturbance taking place. Should any questions or clarifications be required, contact USL-1 before commencing work
- Locate is VOID after 30 days from the date the locate was completed. Contact USL-1 for remarks and/or new ticket requests, with a minimum notice of 5 business days
- If the scope of work, locate area, or site information changes, contact USL-1 before continuing work. In certain instances, a new ticket request may be required
- Any work within 1.5 metres laterally of a marked utility, must be hand dug or daylighted. Utility depths vary, as does the accuracy of the locate equipment, and therefore depths are typically not provided and should not be used for excavation purposes. Depth of utilities should also be verified by hand digging or daylighting. The best information is provided at the time of the locate, however the accuracy of field markings can vary with regard to equipment accuracy and external interference
- If the paint markings or flags on site differ from that of the sketch provided, please contact USL-1 before commencing work. If possible, the issue will be clarified by USL-1 and/or a site meet may be requested with the appropriate parties
- The "Excavator" is responsible for keeping a current copy of the locates on site, with the operators and in/on the excavation equipment AT ALL TIMES
- It is the "Excavator/Contractor's" responsibility to read ALL locate sheets, both public and private, to ensure they understand what potential hazards or buried utilities exist in their work area
- Special purpose locates such as sewer sounding, locate surveys, tunnel identification, conduit identification, ground fault detections, ground penetrating radar, well cap location, concrete scanning, or anything else that requires use of more than Radiodetection equipment, must be identified at the time of the original locate request. Should a USL-1 locator identify any special needs services during a normal Private utility locate, the client will be notified for the appropriate course of action
- Not all buried utilities can be traced. In many instances, water and sewer lines, irrigation systems, grounding cables, fibre optic cables, heating cables, protection cables, and communication cables may not be traceable. Typically, sewer lines will be painted and lined up directionally from manhole to manhole where possible. It may not be possible to detect bends in the sewer lines between manholes. If tracer wires have been buried with the utility, they will be used to locate the buried utility where possible. If a buried utility cannot be traced, it will be noted on the USL-1 report. USL-1 is not liable for damage to untraceable utilities
- Public utility locators have maps, plans and as-built diagrams for reference to work from. Private utility locators, for the most part, do not. USL-1 will attempt to locate any Private utilities on a site, using as-built plans provided to them. Building access is mandatory and must be arranged by our client. Any conduits or utilities noted entering or exiting a building will be traced if possible, as well as any other visible utilities observed on site. It is the responsibility of the contractor to provide any and all buried utility information and site contacts that they have. There is no guarantee that USL-1 can find all buried utilities if the property owner does not have records or information regarding their own buried utilities
- USL-1 cannot be held liable for damage to Private water and/or sewer laterals unless building access is granted, and the utility is locatable
- Thick snow and ice, frozen manhole lids, live traffic, parked cars, construction debris and activities etc, are all factors that can interfere with USL-1's ability to perform Private utility locates. USL-1 cannot guaranty location of all buried utilities when such factors impede the locate process. It is the contractor's responsibility to ensure that the work areas are safe and accessible for locates, prior to USL-1's arrival to site
- USL-1 as a Private utility locator, is not permitted to locate Publicly owned utilities. In some cases, Public utilities may be noted on a sketch, but are FOR REFERENCE ONLY, and under no circumstances shall be used for excavation purposes. It is the contractor's responsibility to verify any Public utilities noted on the USL-1 sketch by referring to the Public utility locate sheets for physical LOCATION AND ACCURACY. USL-1 DOES NOT ASSUME LIABILITY FOR PUBLIC LOCATE INNACCURACIES
- If the proposed work area is on Private property, it does NOT mean that all buried utilities are Private. Regardless of where you are digging, and what the proposed depth of excavation is, it is the law to notify Ontario One Call (or Info-Excavation in Quebec) to obtain Public utility locates
- NCC PROPERTY - assuming the contractor has been issued a Land Access Permit from the NCC, it is typically indicated within the permit that it is the contractor's responsibility to contact NCC for utility locates of their buried utilities

USL-1 - January 2016

Appendix B

Sampling Analysis Plan



Table of Contents

| | | |
|-----|---|---|
| 1. | Background | 1 |
| 2. | Specific Objectives | 1 |
| 3. | Utility Service Clearances | 2 |
| 4. | Specific Requirements | 2 |
| 4.1 | Media for Investigation | 2 |
| 4.2 | Locations and Depths for Sampling | 2 |
| 4.3 | Parameters for Laboratory Analysis | 3 |
| 5. | Quality Assurance/Quality Control | 4 |
| 5.1 | Decontamination of Sampling Equipment | 4 |
| 5.2 | Field Duplicates | 4 |
| 5.3 | Trip Blanks | 4 |
| 5.4 | Soil Vapour Screening | 4 |
| 6. | Standard Operating Procedures | 5 |
| 6.1 | Well Development | 5 |
| 6.2 | Borehole Locating | 5 |
| 6.3 | Elevation Survey | 5 |
| 6.4 | Groundwater Elevation Survey | 5 |
| 6.5 | Groundwater Sampling | 5 |

Table Index

| | | |
|------------|----------------------------|---|
| Table 4.1. | Soil Sampling | 3 |
| Table 4.2. | Groundwater Sampling | 4 |

Attachment Index

Attachment A Proposed Borehole/Monitoring Well Locations



1. Background

A Phase Two Environmental Site Assessment is to be completed for the mixed commercial/institutional property identified as 2831, 2851, and 2865 DuMaurier Avenue in Ottawa, Ontario ("Site") to investigate the areas of potential environmental concern (APECs) identified by the Phase One ESA.

The Phase One ESA identified

- PCA#1 / APEC#1 (Item 30: Importation of Fill Material of Unknown Quality) | On-Site, importation of Fill material of unknown environmental quality used for grading the Site, specifically, for infilling previously observed drainage features at the Site.
- PCA#2 / APEC#2 (Item 58: Waste Disposal and Waste Management, including thermal treatment, landfilling and transfer of waste, other than use of biosolids as soil conditioners) | Off-Site, a former landfill Site was identified to the east of DuMaurier Avenue, approximately 20 m east of the Site.

The contaminants of potential concern (CPCs) to be assessed as part of the Phase Two Environmental Site Assessment in the soil and groundwater are:

- APEC#1 | VOCs, Metals, PAHs
- APEC#2 | VOCs, Metals, PAHs

Select boreholes/monitoring wells placed in locations of the Site will be sampled to provide an assessment of the Contaminants of Potential Concern (CPCs) in the vicinity of each APEC.

Should additional contaminants be suspected during the course of the drilling program, additional sampling should be discussed with the project manager to determine appropriate analytical testing.

2. Specific Objectives

The following are the specific objectives of the planning of the site investigation component this Phase Two Environmental Site Assessment, as stated in O. Reg. 153/04:

1. Plan an investigation that will achieve the general objectives of a Phase Two Environmental Site Assessment:
 - Through the use of appropriate and complete information base concerning the Phase Two property.
 - Through the conduct of an investigation based both on information obtained before the Phase Two Environmental Site Assessment begins and on the incorporation of information obtained during the Phase Two Environmental Site Assessment.
2. To develop a sampling and analysis plan that will adequately assess all areas of the Phase Two property where contaminants may be present in land or water on, in or under the property.



3. To develop a quality assurance program that is designed to effectively limit errors and bias in sampling and analysis through implementation of assessment and control measures that will ensure data are useful, appropriate and accurate in the determination of whether the Phase Two property, meets applicable site condition criteria.

3. Utility Service Clearances

Public and private utility service clearances will be provided to the field technician prior to commencing the drilling program. The project manager must be contacted immediately should any conflicts arise during the drilling program with the locations of underground services and the proposed borehole locations. Service clearances are included with the field instructions.

4. Specific Requirements

4.1 Media for Investigation

- Overburden soil sampling will be conducted on the day(s) of drilling.
- Groundwater monitoring wells will be installed during the drilling program to facilitate the collection of groundwater samples at a later date.
- No sediment is present on the Site, as such; sediment sampling will not be conducted as part of this investigation.
- No surface water bodies are present on the Site, as such; surface water sampling will not be conducted as part of this investigation.

4.2 Locations and Depths for Sampling

Locations

The proposed seven borehole locations are illustrated on the Proposed Borehole Location Plan sketch attached as Attachment A.

- Five boreholes advanced to practical auger refusal
- Approximately 1.5 m coring of bedrock at three borehole locations following refusal
- Install groundwater monitoring wells in all borehole locations including one nested well

The approximate locations and labelling of the boreholes/monitoring wells are indicated on the provided plan.

Depths

Continuous soil samples will be collected from the boreholes in 0.6 m intervals using stainless steel split spoons. Soil sampling will be conducted from ground surface down to proposed drilling depth (bedrock refusal).



Three of the groundwater monitoring wells will be screened screens within the upper layers of the bedrock. Two of the wells will be screened in the overburden material. Screens should be limited to a maximum wetted length of 3.0 m and a minimum total length of 1.5 m. The base of monitoring well screens used to assess PHCs should extend approximately 1.0 m below the expected groundwater table based on field observations. If additional drilling is required to intercept the groundwater table, please contact the project manager. Screens shall have a sand pack that extends a minimum of 0.15 m above the screen and must be sealed with a bentonite hole plug with a thickness of at least 0.6 m. If the depth of the groundwater and maximum screen length permits, monitoring well screens should straddle the groundwater table interface.

4.3 Parameters for Laboratory Analysis

Soil

A total of five original samples plus one duplicate sample will be selected for lab analysis. The following soil samples from the suggested depths below are suggestions for submittal for laboratory analysis of the specified analytical parameters:

Table 4.1 Soil Sampling

| Location | Analytical Parameter | Approximate Depth/Stratigraphy |
|------------------|--|---|
| All Boreholes | Metals, PAHs, pH | Sample <ul style="list-style-type: none"> Near water table interface, or Just above impermeable layer or Fill layer, or Area of obvious contamination |
| Duplicate Sample | DUP-1 | Any material sampled for Metals, PAHs, and pH |
| Worst Case | Reg. 558 – laflesche unknown petroleum package | Select 1 sample for leachate (TCLP) Metal, Flashpoint, PAH, VOC, and PAH testing from borehole with most evident contamination. Bulk sample from the same borehole should be worst case soil followed by TCLP sample. |

Should contamination be detected in other locations or evident contamination requiring vertical delineation is suspected in any borehole, this should be discussed with the project manager immediately.

Soil Jarring requirements:

- Metals, PAHs, pH – one large soil jar and one vial
- Reg. 558 TCLP – three large soil jars

Should any visually or olfactory observations be made with respect to the potential presence of contaminants in the soil at a specific depth in a particular borehole location, the soil sample with the suspected contaminants will be submitted for laboratory analysis in lieu of the sample depth referenced in the table above.



Groundwater

The following groundwater samples from the screened intervals will be submitted for laboratory analysis of the specified analytical parameters:

Table 4.2 Groundwater Sampling

| Location | Analytical Parameters | Approximate Depth of Sample |
|------------|---|-----------------------------|
| All wells | Metals, VOCs, BTEX, pH | Screened Interval |
| Duplicate | DUP-1-Duplicate of Metals, VOCs, BTEX, pH | 1/10 samples |
| Trip Blank | VOC | 1/cooler |

Should contamination be detected in other locations or evident contamination, this should be discussed with the project manager immediately.

5. Quality Assurance/Quality Control

5.1 Decontamination of Sampling Equipment

All non-dedicated sampling equipment such as stainless steel split spoons will be washed between uses.

Water level monitoring equipment, including water level meters and interface probes will be decontaminated with Alconox and rinsed with deionized water between water level readings to prevent cross contamination.

5.2 Field Duplicates

Field duplicate samples shall be collected in each medium (soil and groundwater) being sampled. At least one field duplicate sample will be submitted for laboratory analysis for every ten samples submitted for laboratory analysis.

Field duplicates will be selected from samples which have the greatest probability of environmental contamination (i.e., where field observations indicate potential contamination is present). A duplicate sample will be selected should the presence of contamination be suspected in any of the soil or groundwater samples.

5.3 Trip Blanks

One laboratory prepared trip blank shall be analyzed for VOC when submitting groundwater samples for analysis.

5.4 Soil Vapour Screening

All soil samples will be screened for organic vapours in the field using a Photoionization detector (PID) in the field. Soil samples with notably elevated combustible gas concentrations should be discussed with the Project Manager and may be selected for laboratory analysis.



6. Standard Operating Procedures

GHD standard operating procedures (SOP) shall be used during borehole drilling and soil sampling. Deviations to the SOP shall be discussed with the project manager.

6.1 Well Development

Groundwater monitoring wells will be developed on the day of drilling. At least three and up to ten well volumes will be removed from the monitoring wells in order to remove all sediment from the wells. In cases where the monitoring well goes dry prior to purging three well volumes, the well should be purged dry a minimum of three times, waiting approximately 30 minutes between purging events. Waterra tubing should be removed from the monitoring wells following well development.

6.2 Borehole Locating

The locations of all boreholes and monitoring wells must be measured in the field on the day of drilling. Borehole locations should be measured with respect to building corners or known property boundaries and shown on a plan.

6.3 Elevation Survey

An elevation survey of all boreholes and monitoring wells will be conducted following the completion of the drilling program. A fixed temporary benchmark should be used as a reference elevation; the top of the spindle of a fire hydrant is preferred for this purpose as geodetic elevations can be obtained for these points. The ground surface elevation of all boreholes should be surveyed. The top of riser of each monitoring well should also be surveyed; this will ensure maximum accuracy in the interpretation of groundwater elevations.

6.4 Groundwater Elevation Survey


Following a period of stabilization (one week is recommended) a groundwater elevation survey will be completed for all monitoring wells. The depth to groundwater is recorded prior to disturbance of the water column and is recorded with respect to the top of riser of the monitoring well.

6.5 Groundwater Sampling

Groundwater sampling is conducted following the collection of groundwater elevations. A peristaltic pump or Waterra tubing and footvalve are used for groundwater sampling. The wells are purged of standing water by removing at least one well volume. Samples are collected in dedicated bottles prepared by the laboratory. Samples are field filtered in the case of metals sampling.

Attachment A

Proposed Borehole/Monitoring Well Locations

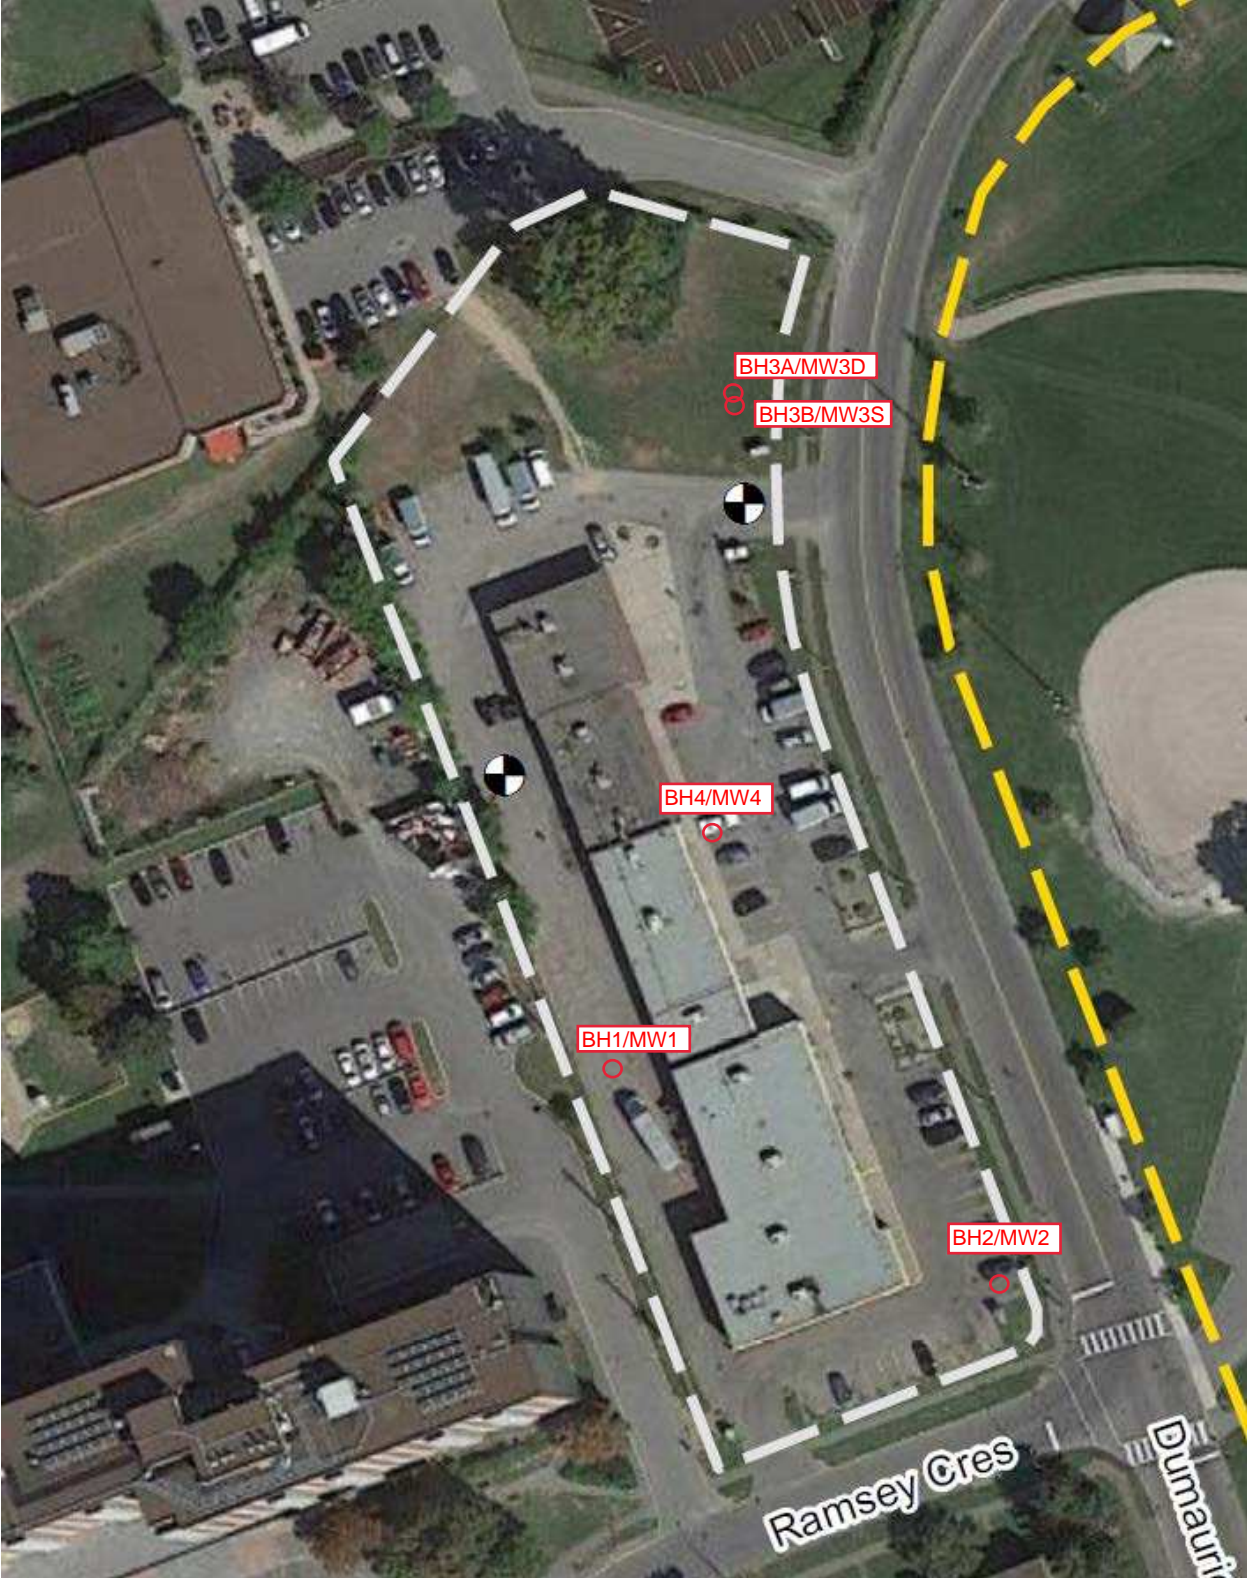

Appendix C

Borehole Logs



BOREHOLE No.: BH1 / MW1
ELEVATION: 98.64 m

BOREHOLE LOG

Page: 1 of 1

CLIENT: 3223701 Canada Inc.
 PROJECT: Geotechnical Investigation
 LOCATION: 2831, 2851, and 2865 DuMaurier Ave.
 DESCRIBED BY: S. Wheeler CHECKED BY: L. Lopers
 DATE (START): 5 October 2018 DATE (FINISH): 5 October 2018

- LEGEND**
- ☒ SS Split Spoon
 - ▬ GS Auger Sample
 - ▨ ST Shelby Tube
 - ▽ Water Level
 - Water content (%)
 - ┌ Atterberg limits (%)
 - N Penetration Index based on Split Spoon sample
 - N Penetration Index based on Dynamic Cone sample
 - △ Cu Shear Strength based on Field Vane
 - Cu Shear Strength based on Lab Vane
 - S Sensitivity Value of Soil
 - ▲ Shear Strength based on Pocket Penetrometer

| SCALE | | STRATIGRAPHY | | MONITOR WELL | SAMPLE DATA | | | |
|-----------|---------------|---|---------------------------------|--------------|-----------------|----------|-----|-------------------------|
| Depth BGS | Elevation (m) | Stratigraphy | DESCRIPTION OF SOIL AND BEDROCK | | Type and Number | Recovery | OVC | Penetration Index / FQD |
| meters | 98.64 | | GROUND SURFACE | | | % | ppm | N |
| 98.6 | | ASPHALT | | 98.54 | | | | |
| 0.5 | | FILL - Sand and gravel, grey, dry, compact | | Sand | SS1 | 67 | 2.2 | 32 |
| | | | | 0.41 | | | | |
| 1.0 | | FILL - Silty clay, grey, damp, loose | | Bentonite | | | | |
| | | Black staining encountered at 0.8 mbgs | | Riser | SS2 | 17 | 1.9 | 6 |
| 1.5 | | SILTY CLAY- grey, moist, very stiff | | 1.52 | | | | |
| | | Black staining encountered from 1.4 to 2.2 mbgs | | Sand | SS3 | 79 | 1.3 | 3 |
| 2.0 | | | | 1.88 | | | | |
| 2.5 | | | | WL 2.07 | | | | |
| | | | | 10/15/2018 | | | | |
| 3.0 | | SANDY SILT- greyish brown, damp to moist, loose to very dense | | Screen | SS4 | 92 | 1.7 | 10 |
| 3.5 | | Spoon and auger refusal encountered at 3.5 mbgs | | | SS5 | 83 | 1.6 | 9 |
| 3.5 | | Borehole terminated at practical auger refusal | | 3.40 | SS6 | 100 | 1.7 | 50+ |

SCALE FOR TEST RESULTS
 50kPa 100kPa 150kPa 200kPa
 10 20 30 40 50 60 70 80 90

NOTES:

mbgs: meters below ground surface
 Approximately 0.1 m of open borehole caved in prior to well installation. Well installed at 3.4 mbgs

BOREHOLE LOG 11181273-A1-BOREHOLE LOGS.GPJ INSPEC_SOL.GDT 8/11/18



BOREHOLE No.: BH2 / MW2
ELEVATION: 98.39 m

BOREHOLE LOG


Page: 1 of 1

CLIENT: 3223701 Canada Inc.
 PROJECT: Geotechnical Investigation
 LOCATION: 2831, 2851, and 2865 DuMaurier Ave.
 DESCRIBED BY: S. Wheeler CHECKED BY: L. Lopers
 DATE (START): 5 October 2018 DATE (FINISH): 5 October 2018

LEGEND

- ☒ SS Split Spoon
- ▬ GS Auger Sample
- ▨ ST Shelby Tube
- ▼ Water Level
- Water content (%)
- ┌ Atterberg limits (%)
- N Penetration Index based on Split Spoon sample
- N Penetration Index based on Dynamic Cone sample
- △ Cu Shear Strength based on Field Vane
- Cu Shear Strength based on Lab Vane
- S Sensitivity Value of Soil
- ▲ Shear Strength based on Pocket Penetrometer

| SCALE | | STRATIGRAPHY | | MONITOR WELL | SAMPLE DATA | | | |
|-----------|---------------|--|---------------------------------|--------------|-----------------|----------|-----|-------------------------|
| Depth BGS | Elevation (m) | Stratigraphy | DESCRIPTION OF SOIL AND BEDROCK | | Type and Number | Recovery | OVC | Penetration Index / RQD |
| meters | 98.39 | | GROUND SURFACE | | | % | ppm | N |
| 98.3 | | ASPHALT | | 98.29 | | | | |
| 98.0 | | FILL - Sandy gravel, grey, dry, compact | | Sand | SS1 | 100 | 3.0 | 17 |
| 0.5 | | FILL - Gravelly sand, brown, damp, compact | | 0.46 | | | | |
| 1.0 | | Becomes silty at 1.1 mbgs | | Riser | SS2 | 58 | 3.9 | 11 |
| 1.5 | | | | | SS3 | 50 | 3.2 | 13 |
| 96.6 | | FILL - Silty sandy gravel, grey and brown, damp, compact | | Bentonite | SS4 | 79 | 4.0 | 27 |
| 96.3 | | FILL - Silty sand, trace gravel, dark brown to black, damp to moist, very loose to compact Black staining and organic odour encountered | | | SS5 | 54 | 4.5 | 3 |
| 3.0 | | | | WL 3.21 | SS6 | | 1.4 | 50+ |
| 95.3 | | HIGHLY WEATHERED AND FRACTURED LIMESTONE- grey | | 10/15/2018 | | | | |
| 95.2 | | Spoon and auger refusal encountered at 3.2 mbgs | | 3.61 | RC1 | 68 | | 11 |
| 3.5 | | LIMESTONE- grey, very poor to fair quality | | Sand | | | | |
| 4.0 | | | | 3.81 | | | | |
| 4.5 | | | | Screen | RC2 | 100 | | 74 |
| 93.5 | | End of borehole | | 4.88 | | | | |



BOREHOLE LOG 11181273-A1-BOREHOLE LOGS.GPJ INSPEC_SOL.GDT 8/11/18

NOTES:
 mbgs: meters below ground surface



BOREHOLE No.: BH3D / MW3D
ELEVATION: 99.25 m


BOREHOLE LOG

Page: 1 of 1

CLIENT: 3223701 Canada Inc.
 PROJECT: Geotechnical Investigation
 LOCATION: 2831, 2851, and 2865 DuMaurier Ave.
 DESCRIBED BY: S. Wheeler CHECKED BY: L. Lopers
 DATE (START): 5 October 2018 DATE (FINISH): 5 October 2018

- LEGEND**
- ☒ SS Split Spoon
 - ▬ GS Auger Sample
 - ▨ ST Shelby Tube
 - ▽ Water Level
 - Water content (%)
 - ┌ Atterberg limits (%)
 - N Penetration Index based on Split Spoon sample
 - N Penetration Index based on Dynamic Cone sample
 - △ Cu Shear Strength based on Field Vane
 - Cu Shear Strength based on Lab Vane
 - S Sensitivity Value of Soil
 - ▲ Shear Strength based on Pocket Penetrometer

| SCALE | | STRATIGRAPHY | | MONITOR WELL | SAMPLE DATA | | | |
|-----------|---------------|--|---------------------------------|--------------|-----------------|----------|-----|-------------------------|
| Depth BGS | Elevation (m) | Stratigraphy | DESCRIPTION OF SOIL AND BEDROCK | | Type and Number | Recovery | OVC | Penetration Index / RQD |
| meters | 99.25 | | GROUND SURFACE | | | % | ppm | N |
| 99.2 | 99.2 | TOPSOIL | | 99.15 | | | | |
| 99.0 | 99.0 | FILL - Gravelly silty sand, brown, damp, compact | | Sand | SS1 | 46 | 2.8 | 25 |
| 0.5 | | FILL - Sandy gravel, brown, damp, compact | | 0.46 | | | | |
| 1.0 | | | | | SS2 | 50 | 3.0 | 19 |
| 1.5 | 98.0 | FILL - Silty sand, grey, moist to wet, very loose to loose | | Riser | | | | |
| | | Black staining encountered | | WL 1.37 | SS3 | 71 | 3.9 | 10 |
| | | | | 10/15/2018 | | | | |
| 2.0 | | | | | SS4 | 13 | 2.8 | 2 |
| 2.5 | 96.8 | PEAT - black, organics and organic odour, wet, very loose | | Bentonite | | | | |
| 3.0 | | | | | SS5 | 75 | 0 | PH |
| 3.5 | | Auger refusal encountered at 3.7 mbgs | | | SS6 | 83 | 0 | 3 |
| 4.0 | 95.6 | HIGHLY WEATHERED AND FRACTURED LIMESTONE- grey | | 4.01 | RC1 | 90 | | 0 |
| 4.5 | 94.8 | LIMESTONE- grey, poor quality | | 4.14 | | | | |
| 5.0 | | | | Screen | RC2 | 100 | | 35 |
| 5.5 | 93.9 | End of borehole | | 5.36 | | | | |



BOREHOLE LOG 11181273-A1-BOREHOLE LOGS.GPJ INSPEC_SOL.GDT 8/11/18

NOTES:
 mbgs: meters below ground surface



BOREHOLE No.: BH3S / MW3S
ELEVATION: 99.33 m

BOREHOLE LOG

Page: 1 of 1

CLIENT: 3223701 Canada Inc.
 PROJECT: Geotechnical Investigation
 LOCATION: 2831, 2851, and 2865 DuMaurier Ave.
 DESCRIBED BY: S. Wheeler CHECKED BY: L. Lopers
 DATE (START): 5 October 2018 DATE (FINISH): 5 October 2018

LEGEND

- SS Split Spoon
- GS Auger Sample
- ST Shelby Tube
- ▼ Water Level
- Water content (%)
- ┌─┐ Atterberg limits (%)
- N Penetration Index based on Split Spoon sample
- N Penetration Index based on Dynamic Cone sample
- △ Cu Shear Strength based on Field Vane
- Cu Shear Strength based on Lab Vane
- S Sensitivity Value of Soil
- ▲ Shear Strength based on Pocket Penetrometer

| SCALE | | STRATIGRAPHY | | MONITOR WELL | SAMPLE DATA | | | |
|-----------|---------------|--------------|---|--------------|-----------------|----------|-----|-------------------------|
| Depth BGS | Elevation (m) | Stratigraphy | DESCRIPTION OF SOIL AND BEDROCK | | Type and Number | Recovery | OVC | Penetration Index / RQD |
| meters | 99.33 | | GROUND SURFACE | | | % | ppm | N |
| 0.5 | | | | 99.23 Sand | | | | |
| | | | | 0.46 Riser | | | | |
| 1.0 | | | | Bentonite | | | | |
| | | | | WL 1.26 | | | | |
| | | | | 10/15/2018 | | | | |
| 2.0 | | | | 1.83 Sand | | | | |
| | | | | 2.19 | | | | |
| 3.0 | | | | Screen | | | | |
| 3.5 | | | | 3.71 | | | | |
| 4.0 | 95.6 | | Augered to practical refusal at 3.7 mbgs for direct well installation in overburden | | | | | |
| 4.5 | | | | | | | | |
| 5.0 | | | | | | | | |
| 5.5 | | | | | | | | |
| 6.0 | | | | | | | | |

SCALE FOR TEST RESULTS
 50kPa 100kPa 150kPa 200kPa
 10 20 30 40 50 60 70 80 90

BOREHOLE LOG 11181273-A1-BOREHOLE LOGS.GPJ INSPEC_SOL.GDT 8/11/18

NOTES:
 mbgs: meters below ground surface



BOREHOLE No.: BH4 / MW4
ELEVATION: 98.53 m

BOREHOLE LOG

Page: 1 of 1

CLIENT: 3223701 Canada Inc.
 PROJECT: Geotechnical Investigation
 LOCATION: 2831, 2851, and 2865 DuMaurier Ave.
 DESCRIBED BY: S. Wheeler CHECKED BY: L. Lopers
 DATE (START): 5 October 2018 DATE (FINISH): 5 October 2018

- LEGEND**
- ☒ SS Split Spoon
 - ▬ GS Auger Sample
 - ▨ ST Shelby Tube
 - ▽ Water Level
 - Water content (%)
 - ┌ Atterberg limits (%)
 - N Penetration Index based on Split Spoon sample
 - N Penetration Index based on Dynamic Cone sample
 - △ Cu Shear Strength based on Field Vane
 - Cu Shear Strength based on Lab Vane
 - S Sensitivity Value of Soil
 - ▲ Shear Strength based on Pocket Penetrometer

| SCALE | | STRATIGRAPHY | | MONITOR WELL | SAMPLE DATA | | | |
|-----------|---------------|--|---------------------------------|--------------|-----------------|----------|-----|-------------------------|
| Depth BGS | Elevation (m) | Stratigraphy | DESCRIPTION OF SOIL AND BEDROCK | | Type and Number | Recovery | OVC | Penetration Index / RQD |
| meters | 98.53 | | GROUND SURFACE | | | % | ppm | N |
| 0.5 | 98.5 | ASPHALT | | 98.43 | | | | |
| | | FILL - Sand and gravel, grey, damp, loose | | Sand | SS1 | 56 | 1.4 | 6 |
| | | | | 0.46 | | | | |
| 1.0 | 97.8 | FILL - Sandy silty clay, grey, damp, firm | | | SS2 | 83 | 2.7 | 9 |
| 1.5 | | | | WL 1.28 | SS3 | 75 | 3.5 | 2 |
| | | | | 10/15/2018 | | | | |
| 2.0 | | | | Riser | SS4 | 33 | 5.7 | 3 |
| 2.5 | 96.1 | PEAT - dark brown to black, damp, very loose to loose | | Bentonite | SS5 | 79 | 2.5 | 3 |
| 3.0 | | | | | SS6 | 88 | 3.4 | 6 |
| 3.5 | 95.1 | SANDY SILT- grey to brown, moist to wet, loose to very dense | | | SS7 | 100 | 3.1 | 50+ |
| 4.0 | | Spoon and auger refusal encountered at 3.9 mbgs | | | | | | |
| 4.5 | 94.6 | LIMESTONE- grey, good quality | | 4.22 | | | | |
| | | | | 4.32 | | | | |
| 5.0 | | | | Sand | RC1 | 90 | | 71 |
| 5.5 | 93.1 | | | Screen | | | | |
| 6.0 | | | | 5.39 | | | | |

SCALE FOR TEST RESULTS
 50kPa 100kPa 150kPa 200kPa
 10 20 30 40 50 60 70 80 90

BOREHOLE LOG 11181273-A1-BOREHOLE LOGS.GPJ INSPEC_SOL.GDT 8/11/18

NOTES:
 mbgs: meters below ground surface

Appendix D

Laboratory Certificates of Analysis



CLIENT NAME: GHD LIMITED
455 Phillip St
WATERLOO, ON N2V1C2
(519) 884-0510

ATTENTION TO: LUKE LOPERS

PROJECT: 11181273-E2 (PO#73513391)

AGAT WORK ORDER: 18Z394508

SOIL ANALYSIS REVIEWED BY: Amanjot Bhela, Inorganic Supervisor

TRACE ORGANICS REVIEWED BY: Oksana Gushyla, Trace Organics Lab Supervisor

DATE REPORTED: Oct 15, 2018

PAGES (INCLUDING COVER): 16

VERSION*: 1

Should you require any information regarding this analysis please contact your client services representative at (905) 712-5100

*NOTES

All samples will be disposed of within 30 days following analysis. Please contact the lab if you require additional sample storage time.



Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 153(511) - Metals & Inorganics (Soil)

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | BH1 | BH2 | BH3 | BH4 | BH5 |
|--------------------------------------|----------|-------|-------|---------------|---------------|-------------|-------------|-------------|---------------|-------------|
| | | | | | | SS3-10-5-18 | SS5-10-5-18 | SS3-10-5-18 | SS2/3-10-5-18 | SS3-10-5-18 |
| SAMPLE DESCRIPTION: | | | | | | Soil | Soil | Soil | Soil | Soil |
| SAMPLE TYPE: | | | | | | Soil | Soil | Soil | Soil | Soil |
| DATE SAMPLED: | | | | | | 2018-10-05 | 2018-10-05 | 2018-10-05 | 2018-10-05 | 2018-10-05 |
| | | | | | | 9610083 | 9610085 | 9610086 | 9610087 | 9610088 |
| Antimony | µg/g | | 0.8 | 2018-10-12 | 2018-10-12 | <0.8 | <0.8 | <0.8 | <0.8 | <0.8 |
| Arsenic | µg/g | | 1 | 2018-10-12 | 2018-10-12 | 2 | 5 | 2 | 2 | 2 |
| Barium | µg/g | | 2 | 2018-10-12 | 2018-10-12 | 94 | 118 | 56 | 91 | 91 |
| Beryllium | µg/g | | 0.5 | 2018-10-12 | 2018-10-12 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 |
| Boron | µg/g | | 5 | 2018-10-12 | 2018-10-12 | 6 | 9 | <5 | 6 | 6 |
| Boron (Hot Water Soluble) | µg/g | | 0.10 | 2018-10-11 | 2018-10-11 | 0.27 | 1.54 | 0.37 | 0.34 | 0.32 |
| Cadmium | µg/g | | 0.5 | 2018-10-12 | 2018-10-12 | <0.5 | <0.5 | <0.5 | <0.5 | <0.5 |
| Chromium | µg/g | | 2 | 2018-10-12 | 2018-10-12 | 37 | 22 | 15 | 29 | 31 |
| Cobalt | µg/g | | 0.5 | 2018-10-12 | 2018-10-12 | 8.2 | 6.1 | 4.7 | 6.9 | 7.3 |
| Copper | µg/g | | 1 | 2018-10-12 | 2018-10-12 | 14 | 105 | 19 | 17 | 18 |
| Lead | µg/g | | 1 | 2018-10-12 | 2018-10-12 | 11 | 61 | 28 | 5 | 6 |
| Molybdenum | µg/g | | 0.5 | 2018-10-12 | 2018-10-12 | <0.5 | 1.4 | <0.5 | <0.5 | 0.5 |
| Nickel | µg/g | | 1 | 2018-10-12 | 2018-10-12 | 18 | 21 | 10 | 18 | 19 |
| Selenium | µg/g | | 0.4 | 2018-10-12 | 2018-10-12 | <0.4 | 0.5 | <0.4 | 0.7 | <0.4 |
| Silver | µg/g | | 0.2 | 2018-10-12 | 2018-10-12 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 |
| Thallium | µg/g | | 0.4 | 2018-10-12 | 2018-10-12 | <0.4 | <0.4 | <0.4 | <0.4 | <0.4 |
| Uranium | µg/g | | 0.5 | 2018-10-12 | 2018-10-12 | 1.3 | 0.9 | 0.5 | 1.0 | 1.2 |
| Vanadium | µg/g | | 1 | 2018-10-12 | 2018-10-12 | 41 | 21 | 21 | 32 | 33 |
| Zinc | µg/g | | 5 | 2018-10-12 | 2018-10-12 | 58 | 183 | 124 | 36 | 36 |
| Chromium VI | µg/g | | 0.2 | 2018-10-11 | 2018-10-11 | <0.2 | <0.2 | <0.2 | <0.2 | <0.2 |
| Cyanide | µg/g | | 0.040 | 2018-10-11 | 2018-10-11 | <0.040 | <0.040 | <0.040 | <0.040 | <0.040 |
| Mercury | µg/g | | 0.10 | 2018-10-12 | 2018-10-12 | <0.10 | 0.23 | <0.10 | <0.10 | <0.10 |
| Electrical Conductivity | mS/cm | | 0.005 | 2018-10-11 | 2018-10-11 | 1.87 | 1.01 | 0.372 | 0.929 | 0.913 |
| Sodium Adsorption Ratio | NA | | NA | 2018-10-11 | 2018-10-11 | 15.5 | 11.2 | 1.88 | 13.6 | 8.98 |
| pH, 2:1 CaCl ₂ Extraction | pH Units | | NA | 2018-10-11 | 2018-10-11 | 6.82 | 7.23 | 7.44 | 7.78 | 7.49 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard

9610083-9610088 EC & SAR were determined on the DI water extract obtained from the 2:1 leaching procedure (2 parts DI water:1 part soil). pH was determined on the 0.01M CaCl₂ extract prepared at 2:1 ratio.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:

Anamjot Bhela




Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 558 Metals and Inorganics

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | 9610090 |
|-----------------------------------|------|-------|-------|---------------|---------------|---------|
| Arsenic Leachate | mg/L | 2.5 | 0.010 | 2018-10-13 | 2018-10-13 | <0.010 |
| Barium Leachate | mg/L | 100 | 0.100 | 2018-10-13 | 2018-10-13 | 1.21 |
| Boron Leachate | mg/L | 500 | 0.050 | 2018-10-13 | 2018-10-13 | 0.102 |
| Cadmium Leachate | mg/L | 0.5 | 0.010 | 2018-10-13 | 2018-10-13 | <0.010 |
| Chromium Leachate | mg/L | 5 | 0.010 | 2018-10-13 | 2018-10-13 | <0.010 |
| Lead Leachate | mg/L | 5 | 0.010 | 2018-10-13 | 2018-10-13 | 0.196 |
| Mercury Leachate | mg/L | 0.1 | 0.01 | 2018-10-13 | 2018-10-13 | <0.01 |
| Selenium Leachate | mg/L | 1 | 0.010 | 2018-10-13 | 2018-10-13 | <0.010 |
| Silver Leachate | mg/L | 5 | 0.010 | 2018-10-13 | 2018-10-13 | <0.010 |
| Uranium Leachate | mg/L | 10 | 0.050 | 2018-10-13 | 2018-10-13 | <0.050 |
| Fluoride Leachate | mg/L | 150 | 0.05 | 2018-10-12 | 2018-10-12 | 0.08 |
| Cyanide Leachate | mg/L | 20 | 0.05 | 2018-10-12 | 2018-10-12 | <0.05 |
| (Nitrate + Nitrite) as N Leachate | mg/L | 1000 | 0.70 | 2018-10-12 | 2018-10-12 | <0.70 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard: Refers to O. Reg. 558 - Schedule IV Leachate Quality Criteria
Guideline values are for general reference only. The guidelines provided may or may not be relevant for the intended use. Refer directly to the applicable standard for regulatory interpretation.
Analysis performed at AGAT Toronto (unless marked by *)

Certified By:





Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 558 TCLP Preparation

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed |
|---------------------|----------|-------|-----|---------------|---------------|
| Analysis Start Date | | | | | 2018/10/11 |
| pH (Initial) | pH Units | | N/A | | 7.96 |
| pH (Final) | pH Units | | N/A | | 5.41 |
| Extraction Fluid | | | | | 1 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard: Refers to O. Reg. 558 - Schedule IV Leachate Quality Criteria

Guideline values are for general reference only. The guidelines provided may or may not be relevant for the intended use. Refer directly to the applicable standard for regulatory interpretation.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:

Anamjot Bhela



Certificate of Analysis

AGAT WORK ORDER: 18Z394508
PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS
SAMPLED BY: Steven Wheeler

Flash Point Analysis

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | 9610090 |
|--|-------|-------|-----|---------------|---------------|---------|
| Flash point (Pensky Martin Closed Cup) | Deg C | | NA | 2018-10-12 | 2018-10-12 | >100 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard
Analysis performed at AGAT Calgary (unless marked by *)

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 153(511) - PAHs (Soil)

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | BH1 | BH2 | BH3 | BH4 | BH5 | |
|----------------------------|------|-------------------|------|---------------|---------------|---------------------|-------------|-------------|-------------|---------------|-------------|
| | | | | | | SAMPLE DESCRIPTION: | SS3-10-5-18 | SS5-10-5-18 | SS3-10-5-18 | SS2/3-10-5-18 | SS3-10-5-18 |
| | | | | | | SAMPLE TYPE: | Soil | Soil | Soil | Soil | Soil |
| | | | | | | DATE SAMPLED: | 2018-10-05 | 2018-10-05 | 2018-10-05 | 2018-10-05 | 2018-10-05 |
| | | | | | | 9610083 | 9610085 | 9610086 | 9610087 | 9610088 | |
| Naphthalene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Acenaphthylene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Acenaphthene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Fluorene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Phenanthrene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.16 | 0.06 | 0.06 | 0.06 | |
| Anthracene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Fluoranthene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.25 | 0.11 | <0.05 | <0.05 | |
| Pyrene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.21 | 0.09 | <0.05 | <0.05 | |
| Benz(a)anthracene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.11 | 0.06 | <0.05 | <0.05 | |
| Chrysene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.14 | 0.06 | <0.05 | <0.05 | |
| Benzo(b)fluoranthene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.16 | 0.07 | <0.05 | <0.05 | |
| Benzo(k)fluoranthene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.06 | <0.05 | <0.05 | <0.05 | |
| Benzo(a)pyrene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.10 | 0.06 | <0.05 | <0.05 | |
| Indeno(1,2,3-cd)pyrene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.05 | <0.05 | <0.05 | <0.05 | |
| Dibenz(a,h)anthracene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | <0.05 | <0.05 | |
| Benzo(g,h,i)perylene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | 0.07 | 0.05 | <0.05 | <0.05 | |
| 2-and 1-methyl Naphthalene | µg/g | | 0.05 | 2018-10-15 | 2018-10-15 | <0.05 | <0.05 | <0.05 | 0.09 | 0.10 | |
| Moisture Content | % | | 0.1 | 2018-10-15 | 2018-10-15 | 24.4 | 22.9 | 15.1 | 18.3 | 20.9 | |
| Surrogate | Unit | Acceptable Limits | | | | | | | | | |
| Chrysene-d12 | % | 50-140 | | 2018-10-15 | 2018-10-15 | 109 | 106 | 106 | 110 | 91 | |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard

9610083-9610088 Results are based on the dry weight of the soil.

Note: The result for Benzo(b)Fluoranthene is the total of the Benzo(b)&j)Fluoranthene isomers because the isomers co-elute on the GC column.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z394508
PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

O. Reg. 558 - Benzo(a) pyrene

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | 9610090 |
|----------------|------|-------|-------|---------------|---------------|---------|
| Benzo(a)pyrene | mg/L | 0.001 | 0.001 | 2018-10-15 | 2018-10-15 | <0.001 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard: Refers to O. Reg. 558 - Schedule IV Leachate Quality Criteria
Guideline values are for general reference only. The guidelines provided may or may not be relevant for the intended use. Refer directly to the applicable standard for regulatory interpretation.

9610090 The sample was leached according to Regulation 558 protocol. Analysis was performed on the leachate.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By: _____



Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 558 - PCBs

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | 9610090 |
|---------------------------|------|-------------------|-------|---------------|---------------|---------|
| Polychlorinated Biphenyls | mg/L | 0.3 | 0.005 | 2018-10-12 | 2018-10-12 | <0.005 |
| Surrogate | Unit | Acceptable Limits | | | | |
| Decachlorobiphenyl | % | 60-130 | | 2018-10-12 | 2018-10-12 | 99 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard: Refers to O. Reg. 558 - Schedule IV Leachate Quality Criteria
 Guideline values are for general reference only. The guidelines provided may or may not be relevant for the intended use. Refer directly to the applicable standard for regulatory interpretation.
 9610090 The soil sample was leached using the Regulation 558 procedure. Analysis was performed on the leachate.
 Analysis performed at AGAT Toronto (unless marked by *)

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

ATTENTION TO: LUKE LOPERS

SAMPLED BY: Steven Wheeler

O. Reg. 558 - VOCs

DATE RECEIVED: 2018-10-07

DATE REPORTED: 2018-10-15

SAMPLE DESCRIPTION: BH3-10-5-18

SAMPLE TYPE: Soil

DATE SAMPLED: 2018-10-05

| Parameter | Unit | G / S | RDL | Date Prepared | Date Analyzed | 9610090 |
|----------------------|------|-------|-------|---------------|---------------|---------|
| Vinyl Chloride | mg/L | 0.2 | 0.030 | 2018-10-12 | 2018-10-15 | <0.030 |
| 1,1 Dichloroethene | mg/L | 1.4 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| Dichloromethane | mg/L | 5.0 | 0.030 | 2018-10-12 | 2018-10-15 | <0.030 |
| Methyl Ethyl Ketone | mg/L | 200 | 0.090 | 2018-10-12 | 2018-10-15 | <0.090 |
| Chloroform | mg/L | 10.0 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| 1,2-Dichloroethane | mg/L | 0.5 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| Carbon Tetrachloride | mg/L | 0.5 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| Benzene | mg/L | 0.5 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| Trichloroethene | mg/L | 5.0 | 0.020 | 2018-10-12 | 2018-10-15 | <0.020 |
| Tetrachloroethene | mg/L | 3.0 | 0.050 | 2018-10-12 | 2018-10-15 | <0.050 |
| Chlorobenzene | mg/L | 8.0 | 0.010 | 2018-10-12 | 2018-10-15 | <0.010 |
| 1,2-Dichlorobenzene | mg/L | 20.0 | 0.010 | 2018-10-12 | 2018-10-15 | <0.010 |
| 1,4-Dichlorobenzene | mg/L | 0.5 | 0.010 | 2018-10-12 | 2018-10-15 | <0.010 |

| Surrogate | Unit | Acceptable Limits | Date Prepared | Date Analyzed | 9610090 |
|------------|------------|-------------------|---------------|---------------|---------|
| Toluene-d8 | % Recovery | 60-130 | 2018-10-12 | 2018-10-15 | 79 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard: Refers to O. Reg. 558 - Schedule IV Leachate Quality Criteria
Guideline values are for general reference only. The guidelines provided may or may not be relevant for the intended use. Refer directly to the applicable standard for regulatory interpretation.

9610090 Sample was prepared using Regulation 558 protocol and a zero headspace extractor.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:

Quality Assurance

CLIENT NAME: GHD LIMITED

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

| Soil Analysis | | | | | | | | | | | | | | | |
|------------------------|-------|-----------|-----------|--------|-----|----------------|--------------|--------------------|-------|----------|--------------------|-------|--------------|-------------------|-------|
| RPT Date: Oct 15, 2018 | | | DUPLICATE | | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | MATRIX SPIKE | | |
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | Measured Value | | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper |

O. Reg. 153(511) - Metals & Inorganics (Soil)

| | | | | | | | | | | | | | | | |
|---------------------------|---------|---------|--------|--------|------|---------|------|-----|------|------|-----|------|------|-----|------|
| Antimony | 9610083 | 9610083 | < 0.8 | <0.8 | NA | < 0.8 | 98% | 70% | 130% | 107% | 80% | 120% | 74% | 70% | 130% |
| Arsenic | 9610083 | 9610083 | 2 | 2 | NA | < 1 | 101% | 70% | 130% | 112% | 80% | 120% | 103% | 70% | 130% |
| Barium | 9610083 | 9610083 | 94 | 90 | 4.3% | < 2 | 89% | 70% | 130% | 99% | 80% | 120% | 86% | 70% | 130% |
| Beryllium | 9610083 | 9610083 | < 0.5 | <0.5 | NA | < 0.5 | 80% | 70% | 130% | 112% | 80% | 120% | 105% | 70% | 130% |
| Boron | 9610083 | 9610083 | 6 | 6 | NA | < 5 | 101% | 70% | 130% | 106% | 80% | 120% | 90% | 70% | 130% |
| Boron (Hot Water Soluble) | 9610083 | 9610083 | 0.27 | 0.31 | NA | < 0.10 | 114% | 60% | 140% | 101% | 70% | 130% | 118% | 60% | 140% |
| Cadmium | 9610083 | 9610083 | < 0.5 | <0.5 | NA | < 0.5 | 102% | 70% | 130% | 102% | 80% | 120% | 97% | 70% | 130% |
| Chromium | 9610083 | 9610083 | 37 | 36 | 2.7% | < 2 | 74% | 70% | 130% | 97% | 80% | 120% | 100% | 70% | 130% |
| Cobalt | 9610083 | 9610083 | 8.2 | 8.0 | 2.5% | < 0.5 | 84% | 70% | 130% | 102% | 80% | 120% | 90% | 70% | 130% |
| Copper | 9610083 | 9610083 | 14 | 13 | 7.4% | < 1 | 84% | 70% | 130% | 113% | 80% | 120% | 92% | 70% | 130% |
| Lead | 9610083 | 9610083 | 11 | 11 | 0.0% | < 1 | 94% | 70% | 130% | 100% | 80% | 120% | 88% | 70% | 130% |
| Molybdenum | 9610083 | 9610083 | < 0.5 | <0.5 | NA | < 0.5 | 94% | 70% | 130% | 102% | 80% | 120% | 94% | 70% | 130% |
| Nickel | 9610083 | 9610083 | 18 | 18 | 0.0% | < 1 | 89% | 70% | 130% | 107% | 80% | 120% | 93% | 70% | 130% |
| Selenium | 9610083 | 9610083 | < 0.4 | <0.4 | NA | < 0.4 | 111% | 70% | 130% | 98% | 80% | 120% | 98% | 70% | 130% |
| Silver | 9610083 | 9610083 | < 0.2 | <0.2 | NA | < 0.2 | 96% | 70% | 130% | 102% | 80% | 120% | 91% | 70% | 130% |
| Thallium | 9610083 | 9610083 | < 0.4 | <0.4 | NA | < 0.4 | 86% | 70% | 130% | 93% | 80% | 120% | 92% | 70% | 130% |
| Uranium | 9610083 | 9610083 | 1.3 | 1.3 | NA | < 0.5 | 83% | 70% | 130% | 102% | 80% | 120% | 94% | 70% | 130% |
| Vanadium | 9610083 | 9610083 | 41 | 40 | 2.5% | < 1 | 78% | 70% | 130% | 96% | 80% | 120% | 74% | 70% | 130% |
| Zinc | 9610083 | 9610083 | 58 | 57 | 1.7% | < 5 | 90% | 70% | 130% | 110% | 80% | 120% | 100% | 70% | 130% |
| Chromium VI | 9610083 | 9610083 | <0.2 | <0.2 | NA | < 0.2 | 74% | 70% | 130% | 100% | 80% | 120% | 98% | 70% | 130% |
| Cyanide | 9613642 | | <0.040 | <0.040 | NA | < 0.040 | 99% | 70% | 130% | 105% | 80% | 120% | 107% | 70% | 130% |
| Mercury | 9610083 | 9610083 | < 0.10 | <0.10 | NA | < 0.10 | 97% | 70% | 130% | 97% | 80% | 120% | 91% | 70% | 130% |
| Electrical Conductivity | 9610083 | 9610083 | 1.87 | 1.88 | 0.5% | < 0.005 | 94% | 90% | 110% | NA | | | NA | | |
| Sodium Adsorption Ratio | 9610083 | 9610083 | 15.5 | 16.0 | 3.2% | NA | NA | | | NA | | | NA | | |
| pH, 2:1 CaCl2 Extraction | 9610083 | 9610083 | 6.82 | 6.77 | 0.7% | NA | 101% | 80% | 120% | NA | | | NA | | |

O. Reg. 558 Metals and Inorganics

| | | | | | | | | | | | | | | | |
|-----------------------------------|---------|---------|---------|---------|------|---------|------|-----|------|------|-----|------|------|-----|------|
| Arsenic Leachate | 9610090 | 9610090 | <0.010 | <0.010 | NA | < 0.010 | 104% | 90% | 110% | 105% | 80% | 120% | 115% | 70% | 130% |
| Barium Leachate | 9610090 | 9610090 | 1.21 | 1.20 | 0.8% | < 0.100 | 101% | 90% | 110% | 102% | 80% | 120% | 106% | 70% | 130% |
| Boron Leachate | 9610090 | 9610090 | 0.102 | 0.107 | NA | < 0.050 | 104% | 90% | 110% | 94% | 80% | 120% | 83% | 70% | 130% |
| Cadmium Leachate | 9610090 | 9610090 | <0.010 | <0.010 | NA | < 0.010 | 102% | 90% | 110% | 103% | 80% | 120% | 111% | 70% | 130% |
| Chromium Leachate | 9610090 | 9610090 | <0.010 | <0.010 | NA | < 0.010 | 101% | 90% | 110% | 111% | 80% | 120% | 114% | 70% | 130% |
| Lead Leachate | 9610090 | 9610090 | 0.196 | 0.191 | 2.6% | < 0.010 | 102% | 90% | 110% | 98% | 80% | 120% | 103% | 70% | 130% |
| Mercury Leachate | 9610090 | 9610090 | <0.01 | <0.01 | NA | < 0.01 | 99% | 90% | 110% | 101% | 80% | 120% | 103% | 70% | 130% |
| Selenium Leachate | 9610090 | 9610090 | < 0.010 | < 0.010 | NA | < 0.010 | 105% | 90% | 110% | 108% | 80% | 120% | 112% | 70% | 130% |
| Silver Leachate | 9610090 | 9610090 | <0.010 | <0.010 | NA | < 0.010 | 102% | 90% | 110% | 106% | 80% | 120% | 102% | 70% | 130% |
| Uranium Leachate | 9610090 | 9610090 | <0.050 | <0.050 | NA | < 0.050 | 108% | 90% | 110% | 101% | 80% | 120% | 111% | 70% | 130% |
| Fluoride Leachate | 9610090 | 9610090 | 0.08 | 0.08 | NA | < 0.05 | 100% | 90% | 110% | 108% | 90% | 110% | 107% | 70% | 130% |
| Cyanide Leachate | 9610090 | 9610090 | <0.05 | <0.05 | NA | < 0.05 | 92% | 90% | 110% | 104% | 90% | 110% | 84% | 70% | 130% |
| (Nitrate + Nitrite) as N Leachate | 9610090 | 9610090 | <0.70 | <0.70 | NA | < 0.70 | 98% | 80% | 120% | 97% | 80% | 120% | 100% | 70% | 130% |



Quality Assurance

CLIENT NAME: GHD LIMITED

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

Soil Analysis (Continued)

| RPT Date: Oct 15, 2018 | | | DUPLICATE | | | Method Blank | REFERENCE MATERIAL | | METHOD BLANK SPIKE | | MATRIX SPIKE | | | | |
|------------------------|-------|-----------|-----------|--------|-----|--------------|--------------------|-------------------|--------------------|----------|-------------------|-------|----------|-------------------|-------|
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | | Measured Value | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper |
| | | | | | | | | | | | | | | | |

Comments: NA signifies Not Applicable.

Duplicate Qualifier: As the measured result approaches the RL, the uncertainty associated with the value increases dramatically, thus duplicate acceptance limits apply only where the average of the two duplicates is greater than five times the RL

Certified By: _____



Quality Assurance

CLIENT NAME: GHD LIMITED

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

| Trace Organics Analysis | | | | | | | | | | | | | | | | |
|-------------------------|-------|-----------|-----------|--------|-----|----------------|--------------|--------------------|-------|----------|--------------------|-------|----------|-------------------|-------|--|
| RPT Date: Oct 15, 2018 | | | DUPLICATE | | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | | MATRIX SPIKE | | |
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | Measured Value | | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper | |

O. Reg. 153(511) - PAHs (Soil)

| | | | | | | | | | | | | | | | |
|----------------------------|---------|---------|--------|--------|----|--------|-----|-----|------|-----|-----|------|------|-----|------|
| Naphthalene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 92% | 50% | 140% | 98% | 50% | 140% | 93% | 50% | 140% |
| Acenaphthylene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 96% | 50% | 140% | 98% | 50% | 140% | 90% | 50% | 140% |
| Acenaphthene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 93% | 50% | 140% | 98% | 50% | 140% | 89% | 50% | 140% |
| Fluorene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 94% | 50% | 140% | 94% | 50% | 140% | 90% | 50% | 140% |
| Phenanthrene | 9610086 | 9610086 | 0.06 | 0.06 | NA | < 0.05 | 97% | 50% | 140% | 97% | 50% | 140% | 90% | 50% | 140% |
| Anthracene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 94% | 50% | 140% | 91% | 50% | 140% | 89% | 50% | 140% |
| Fluoranthene | 9610086 | 9610086 | 0.11 | 0.11 | NA | < 0.05 | 98% | 50% | 140% | 98% | 50% | 140% | 98% | 50% | 140% |
| Pyrene | 9610086 | 9610086 | 0.09 | 0.08 | NA | < 0.05 | 98% | 50% | 140% | 99% | 50% | 140% | 100% | 50% | 140% |
| Benz(a)anthracene | 9610086 | 9610086 | 0.06 | 0.06 | NA | < 0.05 | 97% | 50% | 140% | 95% | 50% | 140% | 102% | 50% | 140% |
| Chrysene | 9610086 | 9610086 | 0.06 | 0.06 | NA | < 0.05 | 96% | 50% | 140% | 94% | 50% | 140% | 104% | 50% | 140% |
| Benzo(b)fluoranthene | 9610086 | 9610086 | 0.07 | 0.07 | NA | < 0.05 | 98% | 50% | 140% | 97% | 50% | 140% | 88% | 50% | 140% |
| Benzo(k)fluoranthene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 98% | 50% | 140% | 88% | 50% | 140% | 97% | 50% | 140% |
| Benzo(a)pyrene | 9610086 | 9610086 | 0.06 | 0.06 | NA | < 0.05 | 97% | 50% | 140% | 95% | 50% | 140% | 91% | 50% | 140% |
| Indeno(1,2,3-cd)pyrene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 96% | 50% | 140% | 91% | 50% | 140% | 96% | 50% | 140% |
| Dibenz(a,h)anthracene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 95% | 50% | 140% | 91% | 50% | 140% | 90% | 50% | 140% |
| Benzo(g,h,i)perylene | 9610086 | 9610086 | 0.05 | 0.05 | NA | < 0.05 | 97% | 50% | 140% | 96% | 50% | 140% | 97% | 50% | 140% |
| 2-and 1-methyl Naphthalene | 9610086 | 9610086 | < 0.05 | < 0.05 | NA | < 0.05 | 95% | 50% | 140% | 91% | 50% | 140% | 90% | 50% | 140% |

O. Reg. 558 - PCBs

| | | | | | | | | | | | | | | | |
|---------------------------|---------|---------|---------|---------|----|---------|------|-----|------|-----|-----|------|----|-----|------|
| Polychlorinated Biphenyls | 9610090 | 9610090 | < 0.005 | < 0.005 | NA | < 0.005 | 103% | 60% | 130% | 95% | 60% | 130% | NA | 60% | 130% |
|---------------------------|---------|---------|---------|---------|----|---------|------|-----|------|-----|-----|------|----|-----|------|

O. Reg. 558 - VOCs

| | | | | | | | | | | | | | | | |
|----------------------|---------|---------|---------|---------|----|---------|------|-----|------|------|-----|------|----|-----|------|
| Vinyl Chloride | 9610090 | 9610090 | < 0.030 | < 0.030 | NA | < 0.030 | 73% | 60% | 140% | 79% | 60% | 140% | NA | 60% | 140% |
| 1,1 Dichloroethene | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 85% | 70% | 130% | 72% | 70% | 130% | NA | 60% | 140% |
| Dichloromethane | 9610090 | 9610090 | < 0.030 | < 0.030 | NA | < 0.030 | 96% | 70% | 130% | 85% | 70% | 130% | NA | 60% | 140% |
| Methyl Ethyl Ketone | 9610090 | 9610090 | < 0.090 | < 0.090 | NA | < 0.090 | 117% | 70% | 130% | 116% | 70% | 130% | NA | 60% | 140% |
| Chloroform | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 75% | 70% | 130% | 85% | 70% | 130% | NA | 60% | 140% |
| 1,2-Dichloroethane | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 96% | 70% | 130% | 88% | 70% | 130% | NA | 60% | 140% |
| Carbon Tetrachloride | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 85% | 70% | 130% | 94% | 70% | 130% | NA | 60% | 140% |
| Benzene | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 88% | 70% | 130% | 87% | 70% | 130% | NA | 60% | 140% |
| Trichloroethene | 9610090 | 9610090 | < 0.020 | < 0.020 | NA | < 0.020 | 99% | 70% | 130% | 74% | 70% | 130% | NA | 60% | 140% |
| Tetrachloroethene | 9610090 | 9610090 | < 0.050 | < 0.050 | NA | < 0.050 | 78% | 70% | 130% | 71% | 70% | 130% | NA | 60% | 140% |
| Chlorobenzene | 9610090 | 9610090 | < 0.010 | < 0.010 | NA | < 0.010 | 89% | 70% | 130% | 79% | 70% | 130% | NA | 60% | 140% |
| 1,2-Dichlorobenzene | 9610090 | 9610090 | < 0.010 | < 0.010 | NA | < 0.010 | 94% | 70% | 130% | 77% | 70% | 130% | NA | 60% | 140% |
| 1,4-Dichlorobenzene | 9610090 | 9610090 | < 0.010 | < 0.010 | NA | < 0.010 | 97% | 70% | 130% | 85% | 70% | 130% | NA | 60% | 140% |

O. Reg. 558 - Benzo(a) pyrene

| | | | | | | | | | | | | | | | |
|----------------|---------|---------|---------|---------|----|---------|-----|-----|------|-----|-----|------|----|-----|------|
| Benzo(a)pyrene | 9610090 | 9610090 | < 0.001 | < 0.001 | NA | < 0.001 | 95% | 70% | 130% | 94% | 70% | 130% | NA | 70% | 130% |
|----------------|---------|---------|---------|---------|----|---------|-----|-----|------|-----|-----|------|----|-----|------|

Comments: When the average of the sample and duplicate results is less than 5x the RDL, the Relative Percent Difference (RPD) will be indicated as Not Applicable (NA).

Quality Assurance

 CLIENT NAME: GHD LIMITED
 PROJECT: 11181273-E2 (PO#73513391)
 SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

 AGAT WORK ORDER: 18Z394508
 ATTENTION TO: LUKE LOPERS
 SAMPLED BY: Steven Wheeler

Trace Organics Analysis (Continued)


| | | | | | | | | | | | | | | | |
|------------------------|-------|--------------|-----------|--------|-----|-----------------|--------------------|----------------------|-------|--------------------|----------------------|-------|--------------|----------------------|-------|
| RPT Date: Oct 15, 2018 | | | DUPLICATE | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | | MATRIX SPIKE | | |
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | | Measured Value | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper |

Flash Point Analysis

| | | | | | | | | |
|--|------|---------|----|----|------|------|-----|------|
| Flash point (Pensky Martin Closed Cup) | 2424 | butanol | 35 | 35 | 0.0% | 100% | 80% | 120% |
|--|------|---------|----|----|------|------|-----|------|

Comments: If the RPD value is NA, the results of the duplicates are under 5X the RDL and will not be calculated.

Certified By: _____





Method Summary

CLIENT NAME: GHD LIMITED

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

| PARAMETER | AGAT S.O.P | LITERATURE REFERENCE | ANALYTICAL TECHNIQUE |
|--------------------------------------|--------------|---|-------------------------|
| Soil Analysis | | | |
| Antimony | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Arsenic | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Barium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Beryllium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Boron | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Boron (Hot Water Soluble) | MET-93-6104 | EPA SW 846 6010C; MSA, Part 3, Ch.21 | ICP/OES |
| Cadmium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Chromium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Cobalt | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Copper | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Lead | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Molybdenum | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Nickel | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Selenium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Silver | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Thallium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Uranium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Vanadium | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Zinc | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Chromium VI | INOR-93-6029 | SM 3500 B; MSA Part 3, Ch. 25 | SPECTROPHOTOMETER |
| Cyanide | INOR-93-6052 | MOE CN-3015 & E 3009 A; SM 4500 CN | TECHNICON AUTO ANALYZER |
| Mercury | MET-93-6103 | EPA SW-846 3050B & 6020A | ICP-MS |
| Electrical Conductivity | INOR-93-6036 | McKeague 4.12, SM 2510 B | EC METER |
| Sodium Adsorption Ratio | INOR-93-6007 | McKeague 4.12 & 3.26 & EPA SW-846 6010C | ICP/OES |
| pH, 2:1 CaCl ₂ Extraction | INOR-93-6031 | MSA part 3 & SM 4500-H+ B | PH METER |
| Arsenic Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Barium Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Boron Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Cadmium Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Chromium Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Lead Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Mercury Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Selenium Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Silver Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Uranium Leachate | MET-93-6103 | EPA SW-846 1311 & 3010A & 6020A | ICP-MS |
| Fluoride Leachate | INOR-93-6018 | EPA SW-846-1311 & SM4500-F- C | ION SELECTIVE ELECTRODE |
| Cyanide Leachate | INOR-93-6052 | EPA SW-846-1311 & MOE 3015 & SM 4500 CN- I | TECHNICON AUTO ANALYZER |
| (Nitrate + Nitrite) as N Leachate | INOR-93-6053 | EPA SW 846-1311 & SM 4500 - NO ₃ - I | LACHAT FIA |
| Analysis Start Date | | | N/A |
| pH (Initial) | LAB 4025 | EPA SW-846 1311 | PH METER |
| pH (Final) | LAB 4025 | EPA SW-846 1311 | PH METER |
| Extraction Fluid | LAB-93-4025 | EPA SW-846 1311 | N/A |

Method Summary

CLIENT NAME: GHD LIMITED

AGAT WORK ORDER: 18Z394508

PROJECT: 11181273-E2 (PO#73513391)

ATTENTION TO: LUKE LOPERS

SAMPLING SITE: DuMaurier Avenue, Ottawa, ON

SAMPLED BY: Steven Wheeler

| PARAMETER | AGAT S.O.P | LITERATURE REFERENCE | ANALYTICAL TECHNIQUE |
|--|-------------|---|--------------------------|
| Trace Organics Analysis | | | |
| Flash point (Pensky Martin Closed Cup) | TO 2210 | ASTM D93 | Pensky Martin Closed Cup |
| Naphthalene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Acenaphthylene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Acenaphthene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Fluorene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Phenanthrene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Anthracene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Fluoranthene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Pyrene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benz(a)anthracene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Chrysene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benzo(b)fluoranthene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benzo(k)fluoranthene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benzo(a)pyrene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Indeno(1,2,3-cd)pyrene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Dibenz(a,h)anthracene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benzo(g,h,i)perylene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| 2-and 1-methyl Naphthalene | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Moisture Content | ORG-91-5106 | EPA SW-846 3541 & 8270 | BALANCE |
| Chrysene-d12 | ORG-91-5106 | EPA SW846 3541 & 8270 | GC/MS |
| Benzo(a)pyrene | ORG-91-5114 | EPA SW846 3540 & 8270 | GC/MS |
| Polychlorinated Biphenyls | ORG-91-5112 | Regulation 558, EPA SW846 3510C/8082 | GC/ECD |
| Decachlorobiphenyl | ORG-91-5112 | EPA SW846 3510C/8082 | GC/ECD |
| Vinyl Chloride | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| 1,1 Dichloroethene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Dichloromethane | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Methyl Ethyl Ketone | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Chloroform | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| 1,2-Dichloroethane | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Carbon Tetrachloride | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Benzene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Trichloroethene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Tetrachloroethene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Chlorobenzene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| 1,2-Dichlorobenzene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| 1,4-Dichlorobenzene | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |
| Toluene-d8 | VOL-91-5001 | EPA SW-846 5230B & 8260 | (P&T)GC/MS |



AGAT

Laboratories

1M.L

5835 Coopers Avenue
Mississauga, Ontario L4Z 1Y2
Ph: 905.712.5100 Fax: 905.712.5122
webearth.agatlabs.com

Laboratory Use Only

Work Order #: 182394008
Cooler Quantity: one - on ice
Arrival Temperatures: 10.6 | 9.8 | 10.1
96 | 94 | 89
Custody Seal Intact: Yes No N/A
Notes:

Chain of Custody Record

If this is a Drinking Water sample, please use Drinking Water Chain of Custody Form (potable water consumed by humans)

Report Information:

Company: GHD Ltd.
Contact: Luke Lopez
Address: 179 Colonnade Rd. Suite 400
Ottawa, ON
Phone: 613 288 1723 Fax: _____
Reports to be sent to:
1. Email: Luke.Lopez@GHD.com
2. Email: Steven.Wheeler@GHD.com

Regulatory Requirements:

No Regulatory Requirement
 Regulation 153/04 Sewer Use Regulation 558
(Please check all applicable boxes)
Table _____ Indicate One
 Ind/Com Sanitary CCME
 Res/Park Storm Prov. Water Quality Objectives (PWQO)
 Agriculture Other
Soil Texture (Check One) Region _____ Indicate One
 Coarse MISA
 Fine _____ Indicate One

Turnaround Time (TAT) Required:

Regular TAT 5 to 7 Business Days
Rush TAT (Rush Surcharges Apply)
 3 Business Days 2 Business Days Next Business Day
OR Date Required (Rush Surcharges May Apply):

Project Information:

Project: 11181273-E2
Site Location: Du Maurier Avenue, Ottawa, ON
Sampled By: Steven Wheeler
AGAT Quote #: PO# 73913391 PO: _____
Please note: if quotation number is not provided, client will be billed full price for analysis.

Is this submission for a Record of Site Condition?

Yes No

Report Guideline on Certificate of Analysis

Yes No

Please provide prior notification for rush TAT
*TAT is exclusive of weekends and statutory holidays

For 'Same Day' analysis, please contact your AGAT CPM

Invoice Information:

Same as RPT info Bill To Same: Yes No
Company: _____
Contact: _____
Address: _____
Email: _____

Sample Matrix Legend

B Biota
GW Ground Water
O Oil
P Paint
S Soil
SD Sediment
SW Surface Water

Field Filtered - Metals, Hg, CrVI

| O. Reg 153 | |
|---|-----------------------------------|
| Metals and Inorganics | Field Filtered - Metals, Hg, CrVI |
| <input type="checkbox"/> All Metals <input type="checkbox"/> 153 Metals (excl. Hydrides) | |
| <input type="checkbox"/> Hydride Metals <input type="checkbox"/> 153 Metals (incl. Hydrides) | |
| ORPs: <input type="checkbox"/> B-HWS <input type="checkbox"/> Cl <input type="checkbox"/> CN | |
| <input type="checkbox"/> Cr ⁶⁺ <input type="checkbox"/> EC <input type="checkbox"/> FOC <input type="checkbox"/> Hg | |
| <input type="checkbox"/> pH <input type="checkbox"/> SAR | |
| Full Metals Scan | |
| Regulatory/Custom Metals | |
| Nutrients: <input type="checkbox"/> TP <input type="checkbox"/> NH ₃ <input type="checkbox"/> TKN | |
| <input type="checkbox"/> NO ₂ <input type="checkbox"/> NO ₃ <input type="checkbox"/> NO ₂ <input type="checkbox"/> NO ₃ + NO ₂ | |
| Volatiles: <input type="checkbox"/> VOC <input type="checkbox"/> BTEX <input type="checkbox"/> THM | |
| PHCs F1 - F4 | |
| ABNS | |
| PAHs | |
| PCBs: <input type="checkbox"/> Total <input type="checkbox"/> Aroclors | |
| Organochlorine Pesticides | |
| TCLP: <input checked="" type="checkbox"/> M&I <input type="checkbox"/> VOCs <input type="checkbox"/> ABNS <input type="checkbox"/> B(a)P <input checked="" type="checkbox"/> PCBs | |
| Sewer Use | |

| Sample Identification | Date Sampled | Time Sampled | # of Containers | Sample Matrix | Comments/ Special Instructions | Y / N |
|-----------------------|--------------|--------------|-----------------|---------------|-----------------------------------|-------|
| BH1 SS3-10-5-18 | Oct 5, 18 | | 2 | S | | |
| BH2 SS5-10-5-18 | 11 | | 2 | S | | |
| BH3 SS3-10-5-18 | 11 | | 2 | S | | |
| BH4 SS2/3-10-5-18 | 11 | | 2 | S | | |
| BH5 SS3-10-5-18 | 11 | | 2 | S | | |
| BH3-10-5-18 | 11 | | 5 | S | | |

| | | | | | |
|---|--------------------------|--------------------|--|-----------------------|--------------------|
| Samples Relinquished By (Print Name and Sign): <u>Steven Wheeler</u> <u>Steven Wheeler</u> | Date: <u>Oct 5, 2018</u> | Time: <u>6:15</u> | Samples Received By (Print Name and Sign): <u>Berthelet</u> | Date: <u>181107</u> | Time: <u>16n00</u> |
| Samples Relinquished By (Print Name and Sign): <u>LBIS - JofedEx</u> | Date: <u>10/10/18</u> | Time: <u>16n00</u> | Samples Received By (Print Name and Sign): <u>Simon</u> | Date: <u>18/10/18</u> | Time: <u>935</u> |
| Samples Relinquished By (Print Name and Sign): | Date: | Time: | Samples Received By (Print Name and Sign): | Date: | Time: |

Page 1 of 1
N°: **T075943**



CLIENT NAME: GHD LIMITED
455 Phillip St
WATERLOO, ON N2V1C2
(519) 884-0510

ATTENTION TO: LUKE LOPERS

PROJECT: 11181273 (PO# 73513391)

AGAT WORK ORDER: 18Z399894

TRACE ORGANICS REVIEWED BY: Oksana Gushyla, Trace Organics Lab Supervisor

WATER ANALYSIS REVIEWED BY: Yris Verastegui, Report Reviewer

DATE REPORTED: Nov 13, 2018

PAGES (INCLUDING COVER): 14

VERSION*: 2

Should you require any information regarding this analysis please contact your client services representative at (905) 712-5100

*NOTES

VERSION 2: Revised report issued November 13, 2018.

All samples will be disposed of within 30 days following analysis. Please contact the lab if you require additional sample storage time.



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - PHCs F1 - F4 (-BTEX) (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | Date Prepared | SAMPLE DESCRIPTION: | | MW1-101918 | MW2-101918 | MW3S-101918 | MW3D-101918 | MW4-101918 | MW6-101918 |
|--------------------------------|------|-------------------|--------|---------------|---------------------|---------|------------|------------|-------------|-------------|------------|------------|
| | | | | | Sample Type | Water | Water | Water | Water | Water | Water | |
| | | | | | DATE SAMPLED: | | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 |
| | | | | | 9641620 | 9641666 | 9641876 | 9641877 | 9641878 | 9641878 | 9641879 | 9641879 |
| F1 (C6 - C10) | µg/L | | 25 | 2018-11-08 | 2018-11-09 | <25 | <25 | <25 | <25 | <25 | <25 | <25 |
| F1 (C6 to C10) minus BTEX | µg/L | | 25 | 2018-11-08 | 2018-11-09 | <25 | <25 | <25 | <25 | <25 | <25 | <25 |
| F2 (C10 to C16) | µg/L | | 100 | 2018-11-12 | 2018-11-12 | <100 | <100 | 170 | <100 | <100 | <100 | <100 |
| F3 (C16 to C34) | µg/L | | 100 | 2018-11-12 | 2018-11-12 | <100 | <100 | 860 | <100 | <100 | <100 | <100 |
| F4 (C34 to C50) | µg/L | | 100 | 2018-11-12 | 2018-11-12 | <100 | <100 | 170 | <100 | <100 | <100 | <100 |
| Gravimetric Heavy Hydrocarbons | µg/L | | 500 | 2018-11-12 | 2018-11-12 | NA | NA | NA | NA | NA | NA | NA |
| Surrogate | Unit | Acceptable Limits | | | | | | | | | | |
| Terphenyl | % | | 60-140 | 2018-11-12 | 2018-11-12 | 100 | 120 | 85 | 84 | 93 | 100 | 100 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard

9641620-9641879 The C6-C10 fraction is calculated using Toluene response factor.
The C10 - C16, C16 - C34, and C34 - C50 fractions are calculated using the average response factor for n-C10, n-C16, and nC34.
Gravimetric Heavy Hydrocarbons are not included in the Total C16 - C50 and are only determined if the chromatogram of the C34 - C50 Hydrocarbons indicated that hydrocarbons >C50 are present.
The chromatogram has returned to baseline by the retention time of nC50.
Total C6-C50 results are corrected for BTEX contributions.
This method complies with the Reference Method for the CWS PHC and is validated for use in the laboratory.
nC6 and nC10 response factors are within 30% of Toluene response factor.
nC10, nC16 and nC34 response factors are within 10% of their average.
C50 response factor is within 70% of nC10 + nC16 nC34 average.
Linearity is within 15%.
Extraction and holding times were met for this sample.
Fractions 1-4 are quantified with the contribution of PAHs. Under Ontario Regulation 153, results are considered valid without determining the PAH contribution if not requested by the client.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - VOCs (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | SAMPLE DESCRIPTION: MW1-101918 | | MW2-101918 | | MW3S-101918 | | MW3D-101918 | |
|-----------------------------|------|-------|------|--------------------------------|---------------|------------|------------|-------------|------------|-------------|-------|
| | | | | SAMPLE TYPE: Water | | Water | | Water | | Water | |
| | | | | Date Prepared | Date Analyzed | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | | |
| | | | | 9641620 | RDL | 9641666 | RDL | 9641876 | 9641877 | | |
| Dichlorodifluoromethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Vinyl Chloride | µg/L | | 0.17 | 2018-10-24 | 2018-10-25 | <0.17 | 0.68 | <0.68 | 0.17 | <0.17 | <0.17 |
| Bromomethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Trichlorofluoromethane | µg/L | | 0.40 | 2018-10-24 | 2018-10-25 | <0.40 | 1.60 | <1.60 | 0.40 | <0.40 | <0.40 |
| Acetone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | 4.0 | <4.0 | 1.0 | <1.0 | <1.0 |
| 1,1-Dichloroethylene | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | 1.20 | <1.20 | 0.30 | <0.30 | <0.30 |
| Methylene Chloride | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | 1.20 | <1.20 | 0.30 | <0.30 | <0.30 |
| trans- 1,2-Dichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Methyl tert-butyl ether | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| 1,1-Dichloroethane | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | 1.20 | <1.20 | 0.30 | <0.30 | <0.30 |
| Methyl Ethyl Ketone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | 4.0 | <4.0 | 1.0 | <1.0 | <1.0 |
| cis- 1,2-Dichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Chloroform | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| 1,2-Dichloroethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| 1,1,1-Trichloroethane | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | 1.20 | <1.20 | 0.30 | <0.30 | <0.30 |
| Carbon Tetrachloride | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Benzene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | 0.49 | <0.20 |
| 1,2-Dichloropropane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Trichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Bromodichloromethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Methyl Isobutyl Ketone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | 4.0 | <4.0 | 1.0 | <1.0 | <1.0 |
| 1,1,2-Trichloroethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Toluene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Dibromochloromethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| Ethylene Dibromide | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| Tetrachloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| 1,1,1,2-Tetrachloroethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| Chlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | 0.64 | <0.10 |
| Ethylbenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| m & p-Xylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - VOCs (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | SAMPLE DESCRIPTION: MW1-101918 | | MW2-101918 | | MW3S-101918 | | MW3D-101918 | |
|---------------------------|------------|-------------------|--------|--------------------------------|---------------|------------|------------|-------------|------------|-------------|------------|
| | | | | Date Prepared | Date Analyzed | RDL | RDL | RDL | RDL | | |
| | | | | | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 | 2018-10-19 |
| | | | | | | 9641620 | 9641666 | 9641876 | 9641877 | | |
| Bromoform | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| Styrene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | 0.23 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| 1,1,2,2-Tetrachloroethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| o-Xylene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| 1,3-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| 1,4-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | 0.79 | <0.10 |
| 1,2-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.40 | <0.40 | 0.10 | <0.10 | <0.10 |
| 1,3-Dichloropropene | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | 1.20 | <1.20 | 0.30 | <0.30 | <0.30 |
| Xylene Mixture | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| n-Hexane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.80 | <0.80 | 0.20 | <0.20 | <0.20 |
| Surrogate | Unit | Acceptable Limits | | | | | | | | | |
| Toluene-d8 | % Recovery | | 50-140 | 2018-10-24 | 2018-10-25 | 77 | | 79 | | 80 | 73 |
| 4-Bromofluorobenzene | % Recovery | | 50-140 | 2018-10-24 | 2018-10-25 | 108 | | 90 | | 109 | 91 |

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - VOCs (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | Date Prepared | SAMPLE DESCRIPTION: | MW4-101918 | MW6-101918 | TRIP BLANK |
|-----------------------------|------|-------|------|---------------|---------------------|------------|------------|------------|
| | | | | | SAMPLE TYPE: | Water | Water | Water |
| | | | | | DATE SAMPLED: | 2018-10-19 | 2018-10-19 | 2018-10-19 |
| | | | | | | 9641878 | 9641879 | 9641881 |
| Dichlorodifluoromethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Vinyl Chloride | µg/L | | 0.17 | 2018-10-24 | 2018-10-25 | <0.17 | <0.17 | <0.17 |
| Bromomethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Trichlorofluoromethane | µg/L | | 0.40 | 2018-10-24 | 2018-10-25 | <0.40 | <0.40 | <0.40 |
| Acetone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | <1.0 | <1.0 |
| 1,1-Dichloroethylene | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | <0.30 | <0.30 |
| Methylene Chloride | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | <0.30 | <0.30 |
| trans- 1,2-Dichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Methyl tert-butyl ether | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| 1,1-Dichloroethane | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | <0.30 | <0.30 |
| Methyl Ethyl Ketone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | <1.0 | <1.0 |
| cis- 1,2-Dichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.27 | <0.20 |
| Chloroform | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| 1,2-Dichloroethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| 1,1,1-Trichloroethane | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | <0.30 | <0.30 |
| Carbon Tetrachloride | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Benzene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.85 | <0.20 |
| 1,2-Dichloropropane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Trichloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Bromodichloromethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Methyl Isobutyl Ketone | µg/L | | 1.0 | 2018-10-24 | 2018-10-25 | <1.0 | <1.0 | <1.0 |
| 1,1,2-Trichloroethane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Toluene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | 0.32 | <0.20 |
| Dibromochloromethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| Ethylene Dibromide | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| Tetrachloroethylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| 1,1,1,2-Tetrachloroethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| Chlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 1.3 | <0.10 |
| Ethylbenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| m & p-Xylene | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - VOCs (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | Date Prepared | SAMPLE DESCRIPTION: | | | |
|---------------------------|------------|-------------------|--------|---------------|---------------------|------------|------------|-------|
| | | | | | MW4-101918 | MW6-101918 | TRIP BLANK | |
| | | | | | SAMPLE TYPE: | | | |
| | | | | | DATE SAMPLED: | | | |
| | | | | | 2018-10-19 | 2018-10-19 | 2018-10-19 | |
| | | | | | 9641878 | 9641879 | 9641881 | |
| Bromoform | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| Styrene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | 0.54 | <0.10 | <0.10 |
| 1,1,2,2-Tetrachloroethane | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| o-Xylene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| 1,3-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | <0.10 | <0.10 |
| 1,4-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 1.6 | <0.10 |
| 1,2-Dichlorobenzene | µg/L | | 0.10 | 2018-10-24 | 2018-10-25 | <0.10 | 0.14 | <0.10 |
| 1,3-Dichloropropene | µg/L | | 0.30 | 2018-10-24 | 2018-10-25 | <0.30 | <0.30 | <0.30 |
| Xylene Mixture | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| n-Hexane | µg/L | | 0.20 | 2018-10-24 | 2018-10-25 | <0.20 | <0.20 | <0.20 |
| Surrogate | Unit | Acceptable Limits | | | | | | |
| Toluene-d8 | % Recovery | | 50-140 | 2018-10-24 | 2018-10-25 | 76 | 73 | 90 |
| 4-Bromofluorobenzene | % Recovery | | 50-140 | 2018-10-24 | 2018-10-25 | 107 | 107 | 81 |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard

9641666 Dilution factor=4

The sample was diluted because it was foamy. The reporting detection limit has been corrected for the dilution factor used.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - Metals & Inorganics (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | SAMPLE DESCRIPTION: | | MW1-101918 | MW2-101918 | RDL | MW3S-101918 | RDL | MW3D-101918 |
|-------------------------|----------|-------|------|---------------------|---------------|------------|------------|------|-------------|------|-------------|
| | | | | SAMPLE TYPE: | | Water | Water | | Water | | Water |
| | | | | DATE SAMPLED: | | 2018-10-19 | 2018-10-19 | | 2018-10-19 | | 2018-10-19 |
| | | | | Date Prepared | Date Analyzed | 9641620 | 9641666 | | 9641876 | | 9641877 |
| Antimony | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | <1.0 | 1.0 | <1.0 | 1.0 | <1.0 |
| Arsenic | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | 7.2 | 1.2 | 1.0 | 3.1 | 1.0 | <1.0 |
| Barium | µg/L | | 2.0 | 2018-10-25 | 2018-10-25 | 747 | 1190 | 2.0 | 680 | 2.0 | 493 |
| Beryllium | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | <0.5 | <0.5 | 0.5 | <0.5 | 0.5 | <0.5 |
| Boron | µg/L | | 10.0 | 2018-10-25 | 2018-10-25 | 26.3 | 240 | 10.0 | 58.4 | 10.0 | 20.0 |
| Cadmium | µg/L | | 0.2 | 2018-10-25 | 2018-10-25 | <0.2 | <0.2 | 0.2 | <0.2 | 0.2 | <0.2 |
| Chromium | µg/L | | 2.0 | 2018-10-25 | 2018-10-25 | 31.4 | 5.9 | 2.0 | 12.6 | 2.0 | 14.5 |
| Cobalt | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | 2.2 | 1.8 | 0.5 | 1.2 | 0.5 | <0.5 |
| Copper | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | 1.1 | 1.2 | 1.0 | <1.0 | 1.0 | 2.2 |
| Lead | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | <0.5 | <0.5 | 0.5 | <0.5 | 0.5 | <0.5 |
| Molybdenum | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | 0.6 | 0.8 | 0.5 | 1.5 | 0.5 | 1.3 |
| Nickel | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | 1.5 | 1.1 | 1.0 | <1.0 | 1.0 | 1.0 |
| Selenium | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | 1.8 | 1.7 | 1.0 | <1.0 | 1.0 | <1.0 |
| Silver | µg/L | | 0.2 | 2018-10-25 | 2018-10-25 | <0.2 | <0.2 | 0.2 | <0.2 | 0.2 | <0.2 |
| Thallium | µg/L | | 0.3 | 2018-10-25 | 2018-10-25 | <0.3 | <0.3 | 0.3 | <0.3 | 0.3 | <0.3 |
| Uranium | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | 0.8 | <0.5 | 0.5 | <0.5 | 0.5 | 1.5 |
| Vanadium | µg/L | | 0.4 | 2018-10-25 | 2018-10-25 | 4.7 | 1.1 | 0.4 | 3.3 | 0.4 | 4.1 |
| Zinc | µg/L | | 5.0 | 2018-10-25 | 2018-10-25 | <5.0 | 6.3 | 5.0 | <5.0 | 5.0 | <5.0 |
| Mercury | µg/L | | 0.02 | 2018-10-24 | 2018-10-24 | <0.02 | <0.02 | 0.02 | <0.02 | 0.02 | <0.02 |
| Chromium VI | µg/L | | 5 | 2018-10-25 | 2018-10-25 | <5 | <5 | 5 | <5 | 5 | <5 |
| Cyanide | µg/L | | 2 | 2018-10-26 | 2018-10-26 | <2 | <2 | 2 | <2 | 2 | <2 |
| Sodium | µg/L | | 5000 | 2018-10-29 | 2018-10-29 | 651000 | 1150000 | 2500 | 384000 | 2500 | 606000 |
| Chloride | µg/L | | 5000 | 2018-10-25 | 2018-10-25 | 1830000 | 2350000 | 2000 | 1150000 | 5000 | 1400000 |
| Electrical Conductivity | uS/cm | | 2 | 2018-10-25 | 2018-10-25 | 5560 | 7260 | 2 | 3630 | 2 | 4580 |
| pH | pH Units | | NA | 2018-10-25 | 2018-10-25 | 6.80 | 7.26 | NA | 7.09 | NA | 7.57 |

Certified By:

Jris Veraestegui



Certificate of Analysis

AGAT WORK ORDER: 18Z399894
PROJECT: 11181273 (PO# 73513391)

5835 COOPERS AVENUE
MISSISSAUGA, ONTARIO
CANADA L4Z 1Y2
TEL (905)712-5100
FAX (905)712-5122
<http://www.agatlabs.com>

CLIENT NAME: GHD LIMITED
SAMPLING SITE: 2865 DuMaurier

ATTENTION TO: LUKE LOPERS
SAMPLED BY: S. Wheeler

O. Reg. 153(511) - Metals & Inorganics (Water)

DATE RECEIVED: 2018-10-20

DATE REPORTED: 2018-11-13

| Parameter | Unit | G / S | RDL | SAMPLE DESCRIPTION: | | MW4-101918 | | MW6-101918 | |
|-------------------------|----------|-------|------|---------------------|---------------|------------|------|------------|-----|
| | | | | Date Prepared | Date Analyzed | RDL | RDL | RDL | RDL |
| Antimony | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | 1.0 | <1.0 | |
| Arsenic | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | 1.0 | <1.0 | |
| Barium | µg/L | | 2.0 | 2018-10-25 | 2018-10-25 | 1110 | 2.0 | 688 | |
| Beryllium | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | <0.5 | 0.5 | <0.5 | |
| Boron | µg/L | | 10.0 | 2018-10-25 | 2018-10-25 | 76.9 | 10.0 | 62.8 | |
| Cadmium | µg/L | | 0.2 | 2018-10-25 | 2018-10-25 | <0.2 | 0.2 | <0.2 | |
| Chromium | µg/L | | 2.0 | 2018-10-25 | 2018-10-25 | 14.7 | 2.0 | 10.0 | |
| Cobalt | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | 0.5 | 0.5 | 1.3 | |
| Copper | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | 1.0 | <1.0 | |
| Lead | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | <0.5 | 0.5 | <0.5 | |
| Molybdenum | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | 1.0 | 0.5 | 1.8 | |
| Nickel | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | 1.0 | <1.0 | |
| Selenium | µg/L | | 1.0 | 2018-10-25 | 2018-10-25 | <1.0 | 1.0 | <1.0 | |
| Silver | µg/L | | 0.2 | 2018-10-25 | 2018-10-25 | <0.2 | 0.2 | <0.2 | |
| Thallium | µg/L | | 0.3 | 2018-10-25 | 2018-10-25 | <0.3 | 0.3 | <0.3 | |
| Uranium | µg/L | | 0.5 | 2018-10-25 | 2018-10-25 | <0.5 | 0.5 | <0.5 | |
| Vanadium | µg/L | | 0.4 | 2018-10-25 | 2018-10-25 | 4.7 | 0.4 | 2.8 | |
| Zinc | µg/L | | 5.0 | 2018-10-25 | 2018-10-25 | <5.0 | 5.0 | 6.0 | |
| Mercury | µg/L | | 0.02 | 2018-10-24 | 2018-10-24 | <0.02 | 0.02 | <0.02 | |
| Chromium VI | µg/L | | 5 | 2018-10-25 | 2018-10-25 | <5 | 5 | <5 | |
| Cyanide | µg/L | | 2 | 2018-10-26 | 2018-10-26 | <2 | 2 | <2 | |
| Sodium | µg/L | | 2500 | 2018-10-29 | 2018-10-29 | 214000 | 2500 | 385000 | |
| Chloride | µg/L | | 1000 | 2018-10-25 | 2018-10-25 | 472000 | 2000 | 1130000 | |
| Electrical Conductivity | µS/cm | | 2 | 2018-10-25 | 2018-10-25 | 2000 | 2 | 3640 | |
| pH | pH Units | | NA | 2018-10-25 | 2018-10-25 | 7.34 | NA | 7.12 | |

Comments: RDL - Reported Detection Limit; G / S - Guideline / Standard

9641620-9641879 Elevated RDLs indicate the degree of sample dilutions prior to the analysis to keep analytes within the calibration range, reduce matrix interference and/or to avoid contaminating the instrument.

Analysis performed at AGAT Toronto (unless marked by *)

Certified By:

Jris Veraestegui

Quality Assurance

CLIENT NAME: GHD LIMITED
PROJECT: 11181273 (PO# 73513391)
SAMPLING SITE:2865 DuMaurier

AGAT WORK ORDER: 18Z399894
ATTENTION TO: LUKE LOPERS
SAMPLED BY:S. Wheeler

Trace Organics Analysis

| RPT Date: Nov 13, 2018 | | | DUPLICATE | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | | MATRIX SPIKE | | |
|---------------------------------|---------|-----------|-----------|--------|-----|--------------|--------------------|-------------------|-------|--------------------|-------------------|-------|--------------|-------------------|-------|
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | | Measured Value | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper |
| O. Reg. 153(511) - VOCs (Water) | | | | | | | | | | | | | | | |
| Dichlorodifluoromethane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 77% | 50% | 140% | 104% | 50% | 140% | 96% | 50% | 140% |
| Vinyl Chloride | 9641620 | 9641620 | < 0.17 | < 0.17 | NA | < 0.17 | 75% | 50% | 140% | 81% | 50% | 140% | 75% | 50% | 140% |
| Bromomethane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 79% | 50% | 140% | 79% | 50% | 140% | 71% | 50% | 140% |
| Trichlorofluoromethane | 9641620 | 9641620 | < 0.40 | < 0.40 | NA | < 0.40 | 71% | 50% | 140% | 107% | 50% | 140% | 87% | 50% | 140% |
| Acetone | 9641620 | 9641620 | < 1.0 | < 1.0 | NA | < 1.0 | 108% | 50% | 140% | 111% | 50% | 140% | 111% | 50% | 140% |
| 1,1-Dichloroethylene | 9641620 | 9641620 | < 0.30 | < 0.30 | NA | < 0.30 | 81% | 50% | 140% | 114% | 60% | 130% | 119% | 50% | 140% |
| Methylene Chloride | 9641620 | 9641620 | < 0.30 | < 0.30 | NA | < 0.30 | 105% | 50% | 140% | 114% | 60% | 130% | 100% | 50% | 140% |
| trans- 1,2-Dichloroethylene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 98% | 50% | 140% | 105% | 60% | 130% | 109% | 50% | 140% |
| Methyl tert-butyl ether | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 107% | 50% | 140% | 98% | 60% | 130% | 83% | 50% | 140% |
| 1,1-Dichloroethane | 9641620 | 9641620 | < 0.30 | < 0.30 | NA | < 0.30 | 110% | 50% | 140% | 102% | 60% | 130% | 115% | 50% | 140% |
| Methyl Ethyl Ketone | 9641620 | 9641620 | < 1.0 | < 1.0 | NA | < 1.0 | 75% | 50% | 140% | 112% | 50% | 140% | 115% | 50% | 140% |
| cis- 1,2-Dichloroethylene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 105% | 50% | 140% | 114% | 60% | 130% | 108% | 50% | 140% |
| Chloroform | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 119% | 50% | 140% | 113% | 60% | 130% | 107% | 50% | 140% |
| 1,2-Dichloroethane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 119% | 50% | 140% | 110% | 60% | 130% | 105% | 50% | 140% |
| 1,1,1-Trichloroethane | 9641620 | 9641620 | < 0.30 | < 0.30 | NA | < 0.30 | 109% | 50% | 140% | 116% | 60% | 130% | 80% | 50% | 140% |
| Carbon Tetrachloride | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 114% | 50% | 140% | 113% | 60% | 130% | 102% | 50% | 140% |
| Benzene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 111% | 50% | 140% | 109% | 60% | 130% | 102% | 50% | 140% |
| 1,2-Dichloropropane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 106% | 50% | 140% | 118% | 60% | 130% | 98% | 50% | 140% |
| Trichloroethylene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 106% | 50% | 140% | 112% | 60% | 130% | 87% | 50% | 140% |
| Bromodichloromethane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 109% | 50% | 140% | 116% | 60% | 130% | 95% | 50% | 140% |
| Methyl Isobutyl Ketone | 9641620 | 9641620 | < 1.0 | < 1.0 | NA | < 1.0 | 106% | 50% | 140% | 111% | 50% | 140% | 107% | 50% | 140% |
| 1,1,2-Trichloroethane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 109% | 50% | 140% | 92% | 60% | 130% | 78% | 50% | 140% |
| Toluene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 98% | 50% | 140% | 98% | 60% | 130% | 81% | 50% | 140% |
| Dibromochloromethane | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 100% | 50% | 140% | 92% | 60% | 130% | 79% | 50% | 140% |
| Ethylene Dibromide | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 101% | 50% | 140% | 92% | 60% | 130% | 81% | 50% | 140% |
| Tetrachloroethylene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 106% | 50% | 140% | 101% | 60% | 130% | 83% | 50% | 140% |
| 1,1,1,2-Tetrachloroethane | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 115% | 50% | 140% | 89% | 60% | 130% | 74% | 50% | 140% |
| Chlorobenzene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 106% | 50% | 140% | 93% | 60% | 130% | 77% | 50% | 140% |
| Ethylbenzene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 100% | 50% | 140% | 89% | 60% | 130% | 72% | 50% | 140% |
| m & p-Xylene | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 107% | 50% | 140% | 95% | 60% | 130% | 77% | 50% | 140% |
| Bromoform | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 107% | 50% | 140% | 78% | 60% | 130% | 89% | 50% | 140% |
| Styrene | 9641620 | 9641620 | 0.23 | 0.23 | NA | < 0.10 | 116% | 50% | 140% | 108% | 60% | 130% | 88% | 50% | 140% |
| 1,1,2,2-Tetrachloroethane | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 98% | 50% | 140% | 104% | 60% | 130% | 92% | 50% | 140% |
| o-Xylene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 112% | 50% | 140% | 96% | 60% | 130% | 74% | 50% | 140% |
| 1,3-Dichlorobenzene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 114% | 50% | 140% | 94% | 60% | 130% | 73% | 50% | 140% |
| 1,4-Dichlorobenzene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 110% | 50% | 140% | 91% | 60% | 130% | 79% | 50% | 140% |
| 1,2-Dichlorobenzene | 9641620 | 9641620 | < 0.10 | < 0.10 | NA | < 0.10 | 107% | 50% | 140% | 85% | 60% | 130% | 70% | 50% | 140% |
| 1,3-Dichloropropene | 9641620 | 9641620 | < 0.30 | < 0.30 | NA | < 0.30 | 95% | 50% | 140% | 86% | 60% | 130% | 81% | 50% | 140% |
| n-Hexane | 9641620 | 9641620 | < 0.20 | < 0.20 | NA | < 0.20 | 97% | 50% | 140% | 76% | 60% | 130% | 109% | 50% | 140% |

Quality Assurance

 CLIENT NAME: GHD LIMITED
 PROJECT: 11181273 (PO# 73513391)
 SAMPLING SITE: 2865 DuMaurier

 AGAT WORK ORDER: 18Z399894
 ATTENTION TO: LUKE LOPERS
 SAMPLED BY: S. Wheeler

Trace Organics Analysis (Continued)

| RPT Date: Nov 13, 2018 | | | DUPLICATE | | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | MATRIX SPIKE | | |
|------------------------|-------|-----------|-----------|--------|-----|----------------|--------------|--------------------|-------|----------|--------------------|-------|--------------|-------------------|-------|
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | Measured Value | | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper |

O. Reg. 153(511) - PHCs F1 - F4 (-BTEX) (Water)


| | | | | | | | | | | | | | | | |
|-----------------|---------|---------|-------|-------|----|-------|------|-----|------|------|-----|------|-----|-----|------|
| F1 (C6 - C10) | 9641876 | 9641876 | < 25 | < 25 | NA | < 25 | 96% | 60% | 140% | 98% | 60% | 140% | 94% | 60% | 140% |
| F2 (C10 to C16) | | TW | < 100 | < 100 | NA | < 100 | 104% | 60% | 140% | 76% | 60% | 140% | 72% | 60% | 140% |
| F3 (C16 to C34) | | TW | < 100 | < 100 | NA | < 100 | 102% | 60% | 140% | 105% | 60% | 140% | 85% | 60% | 140% |
| F4 (C34 to C50) | | TW | < 100 | < 100 | NA | < 100 | 92% | 60% | 140% | 93% | 60% | 140% | 90% | 60% | 140% |

Comments: Tap water analysis has been performed as QC sample testing for duplicate and matrix spike due to insufficient sample volume.
 When the average of the sample and duplicate results is less than 5x the RDL, the Relative Percent Difference (RPD) will be indicated as Not Applicable (NA).

O. Reg. 153(511) - PHCs F1 - F4 (-BTEX) (Water)

| | | | | | | | | | | | | | | | |
|-----------------|---------|---------|-------|-------|----|-------|-----|-----|------|------|-----|------|-----|-----|------|
| F1 (C6 - C10) | 9641879 | 9641879 | < 25 | < 25 | NA | < 25 | 99% | 60% | 140% | 88% | 60% | 140% | 94% | 60% | 140% |
| F2 (C10 to C16) | | TW | < 100 | < 100 | NA | < 100 | 92% | 60% | 140% | 78% | 60% | 140% | 77% | 60% | 140% |
| F3 (C16 to C34) | | TW | < 100 | < 100 | NA | < 100 | 94% | 60% | 140% | 105% | 60% | 140% | 95% | 60% | 140% |
| F4 (C34 to C50) | | TW | < 100 | < 100 | NA | < 100 | 86% | 60% | 140% | 101% | 60% | 140% | 90% | 60% | 140% |

Certified By: _____



Quality Assurance

 CLIENT NAME: GHD LIMITED
 PROJECT: 11181273 (PO# 73513391)
 SAMPLING SITE: 2865 DuMaurier

 AGAT WORK ORDER: 18Z399894
 ATTENTION TO: LUKE LOPERS
 SAMPLED BY: S. Wheeler

| Water Analysis | | | | | | | | | | | | | | | | |
|--|---------|-----------|-----------|--------|-------|----------------|--------------|--------------------|-------|----------|--------------------|-------|----------|-------------------|-------|--|
| RPT Date: Nov 13, 2018 | | | DUPLICATE | | | | Method Blank | REFERENCE MATERIAL | | | METHOD BLANK SPIKE | | | MATRIX SPIKE | | |
| PARAMETER | Batch | Sample Id | Dup #1 | Dup #2 | RPD | Measured Value | | Acceptable Limits | | Recovery | Acceptable Limits | | Recovery | Acceptable Limits | | |
| | | | | | | | | Lower | Upper | | Lower | Upper | | Lower | Upper | |
| O. Reg. 153(511) - Metals & Inorganics (Water) | | | | | | | | | | | | | | | | |
| Antimony | 9641620 | 9641620 | <1.0 | <1.0 | NA | < 1.0 | 101% | 70% | 130% | 101% | 80% | 120% | 100% | 70% | 130% | |
| Arsenic | 9641620 | 9641620 | 7.2 | 8.2 | 13.0% | < 1.0 | 100% | 70% | 130% | 103% | 80% | 120% | 106% | 70% | 130% | |
| Barium | 9641620 | 9641620 | 747 | 706 | 5.6% | < 2.0 | 98% | 70% | 130% | 104% | 80% | 120% | 101% | 70% | 130% | |
| Beryllium | 9641620 | 9641620 | <0.5 | <0.5 | NA | < 0.5 | 98% | 70% | 130% | 96% | 80% | 120% | 112% | 70% | 130% | |
| Boron | 9641620 | 9641620 | 26.3 | 25.1 | NA | < 10.0 | 99% | 70% | 130% | 99% | 80% | 120% | 117% | 70% | 130% | |
| Cadmium | 9641620 | 9641620 | <0.2 | <0.2 | NA | < 0.2 | 101% | 70% | 130% | 103% | 80% | 120% | 99% | 70% | 130% | |
| Chromium | 9641620 | 9641620 | 31.4 | 29.6 | 5.9% | < 2.0 | 99% | 70% | 130% | 100% | 80% | 120% | 103% | 70% | 130% | |
| Cobalt | 9641620 | 9641620 | 2.2 | 2.1 | NA | < 0.5 | 101% | 70% | 130% | 101% | 80% | 120% | 98% | 70% | 130% | |
| Copper | 9641620 | 9641620 | 1.1 | 1.2 | NA | < 1.0 | 100% | 70% | 130% | 106% | 80% | 120% | 94% | 70% | 130% | |
| Lead | 9641620 | 9641620 | <0.5 | <0.5 | NA | < 0.5 | 104% | 70% | 130% | 103% | 80% | 120% | 94% | 70% | 130% | |
| Molybdenum | 9641620 | 9641620 | 0.6 | 0.6 | NA | < 0.5 | 102% | 70% | 130% | 101% | 80% | 120% | 102% | 70% | 130% | |
| Nickel | 9641620 | 9641620 | 1.5 | 1.6 | NA | < 1.0 | 99% | 70% | 130% | 102% | 80% | 120% | 93% | 70% | 130% | |
| Selenium | 9641620 | 9641620 | 1.8 | 5.3 | NA | < 1.0 | 99% | 70% | 130% | 99% | 80% | 120% | 103% | 70% | 130% | |
| Silver | 9641620 | 9641620 | <0.2 | <0.2 | NA | < 0.2 | 101% | 70% | 130% | 110% | 80% | 120% | 96% | 70% | 130% | |
| Thallium | 9641620 | 9641620 | <0.3 | <0.3 | NA | < 0.3 | 102% | 70% | 130% | 102% | 80% | 120% | 93% | 70% | 130% | |
| Uranium | 9641620 | 9641620 | 0.8 | 0.7 | NA | < 0.5 | 107% | 70% | 130% | 100% | 80% | 120% | 91% | 70% | 130% | |
| Vanadium | 9641620 | 9641620 | 4.7 | 4.4 | 6.6% | < 0.4 | 100% | 70% | 130% | 100% | 80% | 120% | 103% | 70% | 130% | |
| Zinc | 9641620 | 9641620 | <5.0 | <5.0 | NA | < 5.0 | 101% | 70% | 130% | 99% | 80% | 120% | 92% | 70% | 130% | |
| Mercury | 9641620 | 9641620 | <0.02 | <0.02 | NA | < 0.02 | 98% | 70% | 130% | 99% | 80% | 120% | 102% | 70% | 130% | |
| Chromium VI | 9641877 | 9641877 | <5 | <5 | NA | < 5 | 102% | 70% | 130% | 101% | 80% | 120% | 101% | 70% | 130% | |
| Cyanide | 9641666 | 9641666 | <2 | <2 | NA | < 2 | 97% | 70% | 130% | 97% | 80% | 120% | 79% | 70% | 130% | |
| Sodium | 9641879 | 9641879 | 385000 | 383000 | 0.5% | < 500 | 96% | 70% | 130% | 96% | 80% | 120% | 90% | 70% | 130% | |
| Chloride | 9641878 | 9641878 | 472000 | 460000 | 2.6% | < 100 | 95% | 70% | 130% | 103% | 70% | 130% | 95% | 70% | 130% | |
| Electrical Conductivity | 9641620 | 9641620 | 5560 | 5790 | 4.1% | < 2 | 97% | 90% | 110% | | | | | | | |
| pH | 9641620 | 9641620 | 6.80 | 6.88 | 1.2% | NA | 99% | 90% | 110% | | | | | | | |

Comments: NA signifies Not Applicable.

Duplicate Qualifier: As the measured result approaches the RL, the uncertainty associated with the value increases dramatically, thus duplicate acceptance limits apply only where the average of the two duplicates is greater than five times the RL.

Certified By:



Method Summary

 CLIENT NAME: GHD LIMITED
 PROJECT: 11181273 (PO# 73513391)
 SAMPLING SITE: 2865 DuMaurier

 AGAT WORK ORDER: 18Z399894
 ATTENTION TO: LUKE LOPERS
 SAMPLED BY: S. Wheeler

| PARAMETER | AGAT S.O.P | LITERATURE REFERENCE | ANALYTICAL TECHNIQUE |
|--------------------------------|--------------|------------------------|----------------------|
| Trace Organics Analysis | | | |
| F1 (C6 - C10) | VOL-91- 5010 | MOE PHC E3421 | (P&T)GC/FID |
| F1 (C6 to C10) minus BTEX | VOL-91-5010 | MOE PHC E3421 | (P&T)GC/FID |
| F2 (C10 to C16) | VOL-91-5010 | MOE PHC E3421 | GC / FID |
| F3 (C16 to C34) | VOL-91-5010 | MOE PHC E3421 | GC / FID |
| F4 (C34 to C50) | VOL-91-5010 | MOE PHC E3421 | GC / FID |
| Gravimetric Heavy Hydrocarbons | VOL-91-5010 | MOE PHC E3421 | BALANCE |
| Terphenyl | VOL-91-5010 | | GC/FID |
| Dichlorodifluoromethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Vinyl Chloride | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Bromomethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Trichlorofluoromethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Acetone | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1-Dichloroethylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Methylene Chloride | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| trans- 1,2-Dichloroethylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Methyl tert-butyl ether | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1-Dichloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Methyl Ethyl Ketone | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| cis- 1,2-Dichloroethylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Chloroform | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,2-Dichloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1,1-Trichloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Carbon Tetrachloride | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Benzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,2-Dichloropropane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Trichloroethylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Bromodichloromethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Methyl Isobutyl Ketone | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1,2-Trichloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Toluene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Dibromochloromethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Ethylene Dibromide | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Tetrachloroethylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1,1,2-Tetrachloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Chlorobenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Ethylbenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| m & p-Xylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Bromoform | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Styrene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,1,2,2-Tetrachloroethane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| o-Xylene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,3-Dichlorobenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,4-Dichlorobenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,2-Dichlorobenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 1,3-Dichloropropene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Xylene Mixture | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| n-Hexane | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| Toluene-d8 | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |
| 4-Bromofluorobenzene | VOL-91-5001 | EPA SW-846 5030 & 8260 | (P&T)GC/MS |



Method Summary

CLIENT NAME: GHD LIMITED
 PROJECT: 11181273 (PO# 73513391)
 SAMPLING SITE: 2865 DuMaurier

AGAT WORK ORDER: 18Z399894
 ATTENTION TO: LUKE LOPERS
 SAMPLED BY: S. Wheeler

| PARAMETER | AGAT S.O.P | LITERATURE REFERENCE | ANALYTICAL TECHNIQUE |
|-------------------------|--------------|--|-------------------------|
| Water Analysis | | | |
| Antimony | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Arsenic | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Barium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Beryllium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Boron | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Cadmium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Chromium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Cobalt | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Copper | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Lead | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Molybdenum | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Nickel | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Selenium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Silver | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Thallium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Uranium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Vanadium | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Zinc | MET-93-6103 | EPA SW-846 6020A & 200.8 | ICP-MS |
| Mercury | MET-93-6100 | EPA SW-846 7470 & 245.1 | CVAAS |
| Chromium VI | INOR-93-6034 | SM 3500-Cr B | SPECTROPHOTOMETER |
| Cyanide | INOR-93-6052 | MOE METHOD CN- 3015 & SM 4500 CN- I | TECHNICON AUTO ANALYZER |
| Sodium | MET-93-6105 | EPA SW-846 6010C & 200.7 | ICP/OES |
| Chloride | INOR-93-6004 | SM 4110 B | ION CHROMATOGRAPH |
| Electrical Conductivity | INOR-93-6000 | SM 2510 B | PC TITRATE |
| pH | INOR-93-6000 | SM 4500-H+ B | PC TITRATE |



AGAT Laboratories

1 Large Black

5835 Coopers Avenue
Mississauga, Ontario L4Z 1Y2
Ph: 905.712.5100 Fax: 905.712.5122
webearth.agatlabs.com

Laboratory Use Only

Work Order #: 18Z399894

Cooler Quantity: one
Arrival Temperatures: 11.1 | 11 | 10.9
LT 2.4 | 2.6 | 2.0

Custody Seal Intact: Yes No N/A
Notes: on ice

Chain of Custody Record

If this is a Drinking Water sample, please use Drinking Water Chain of Custody Form (potable water consumed by humans)

Report Information:

Company: GHD
Contact: LUKE LOPERS
Address: 179 colonnade RD # 4000
Ottawa ON
Phone: _____ Fax: _____
Reports to be sent to:
1. Email: Luke.Lopers@GHD.com
2. Email: _____

Regulatory Requirements:

No Regulatory Requirement
(Please check all applicable boxes)

Regulation 153/04 Sewer Use Regulation 558
 Ind/Com Sanitary CCME
 Res/Park Storm Prov. Water Quality Objectives (PWQO)
 Agriculture Other
Soil Texture (Check One) Region: _____
 Coarse Fine MISA _____
Indicate One

Turnaround Time (TAT) Required:

Regular TAT 5 to 7 Business Days
Rush TAT (Rush Surcharges Apply)
 3 Business Days 2 Business Days Next Business Day
OR Date Required (Rush Surcharges May Apply): _____

Project Information:

Project: 11181273
Site Location: 2865 Dymaurier
Sampled By: S. Wheeler
AGAT Quote #: _____ PO: 73513391
Please note: if quotation number is not provided, client will be billed full price for analysis.

Is this submission for a Record of Site Condition?

Yes No

Report Guideline on Certificate of Analysis

Yes No

Please provide prior notification for rush TAT
*TAT is exclusive of weekends and statutory holidays

For 'Same Day' analysis, please contact your AGAT CPM

Invoice Information:

Company: _____ Bill To Same: Yes No
Contact: _____
Address: _____
Email: _____

Sample Matrix Legend

B Biota
GW Ground Water
O Oil
P Paint
S Soil
SD Sediment
SW Surface Water

Field Filtered - Metals, Hg, CrVI

| Metals and Inorganics | | O. Reg 153 | | Regulatory/Custom Metals | | Nutrients | | Volatiles | | PHCs F1 - F4 | | ABNs | | PAHs | | PCBs | | Organochlorine Pesticides | | TCLP | | Sewer Use | |
|---|--|-------------------------------------|--|------------------------------|--|------------------------------|--|---|-------------------------------|---|--|------|--|------|--|------|--|---------------------------|--|------|--|-----------|--|
| <input type="checkbox"/> All Metals | <input type="checkbox"/> 153 Metals (excl. Hydrides) | <input type="checkbox"/> All Metals | <input type="checkbox"/> 153 Metals (incl. Hydrides) | <input type="checkbox"/> TP | <input type="checkbox"/> NH ₃ | <input type="checkbox"/> TKN | <input type="checkbox"/> NO ₂ | <input checked="" type="checkbox"/> VOC | <input type="checkbox"/> BTEX | <input type="checkbox"/> THM | | | | | | | | | | | | | |
| <input type="checkbox"/> Hydride Metals | <input type="checkbox"/> 153 Metals | <input type="checkbox"/> B-HWS | <input type="checkbox"/> Cr | <input type="checkbox"/> Cu | <input type="checkbox"/> EC | <input type="checkbox"/> FOC | <input type="checkbox"/> Hg | <input type="checkbox"/> pH | <input type="checkbox"/> SAR | <input type="checkbox"/> Full Metals Scan | | | | | | | | | | | | | |
| | | <input type="checkbox"/> P | <input type="checkbox"/> EC | <input type="checkbox"/> FOC | <input type="checkbox"/> Hg | | | | | | | | | | | | | | | | | | |
| | | <input type="checkbox"/> SD | <input type="checkbox"/> Sediment | | | | | | | | | | | | | | | | | | | | |
| | | <input type="checkbox"/> SW | <input type="checkbox"/> Surface Water | | | | | | | | | | | | | | | | | | | | |

| Sample Identification | Date Sampled | Time Sampled | # of Containers | Sample Matrix | Comments/ Special Instructions | Y/N |
|--|--------------|--------------|-----------------|---------------|-----------------------------------|-----|
| MW1 - 101918 | 10/19/18 | | 12 | GW | Cr(VI) Not Field Filtered | |
| MW2 - 101918 | 10/19/18 | | 12 | GW | only Hg Field Filtered | |
| MW35 - 101418 | 10/14/18 | | 12 | GW | Cr(VI) Not Field Filtered | |
| MW30 - 101918 | 10/19/18 | | 12 | GW | Cr(VI) Not Field Filtered | |
| MW4 - 101918 | 10/19/18 | | 12 | GW | | |
| MW6 - 101918 | 10/19/18 | | 12 | GW | | |
| * Do not analyze for PHCs. * * except for MW35-101918 * | | | | | | |

| | | | | | |
|--|--------------------------|-----------------------|--|------------------------------|------------------------|
| Samples Relinquished By (Print Name and Sign): <u>Anthony O'Brien</u> | Date: <u>10/19/18</u> | Time: <u>6:03</u> | Samples Received By (Print Name and Sign): <u>Jeff Jones</u> | Date: <u>200918</u> | Time: <u>1:500</u> |
| Samples Relinquished By (Print Name and Sign): <u>LBK to FedEx</u> | Date: <u>18/10/22</u> | Time: <u>16h00</u> | Samples Received By (Print Name and Sign): <u>RUPINDER KAUR</u> | Date: <u>Ruk 01/23/18</u> | Time: <u>9:40am</u> |
| Page <u>1</u> of <u>1</u> No: T 080076 | | | | | |



about GHD

GHD is one of the world's leading professional services companies operating in the global markets of water, energy and resources, environment, property and buildings, and transportation. We provide engineering, environmental, and construction services to private and public sector clients.

Ryan Vanden Tillaart
Ryan.VandenTillaart@ghd.com
613.727.0510

Luke Lopers
Luke.Lopers@ghd.com
612.727.0510

www.ghd.com

D.4 PHASE I ENVIRONMENTAL SITE ASSESSMENT (LOPERS & ASSOCIATES 2021)

(Report Attached Separately)



Appendix E DRAWINGS

