PATERSON GROUP

Phase I Environmental Site Assessment

240 Bank Street
Ottawa, Ontario

Prepared for 240 Bank Street Holdings Ltd.

Report: PE6874-1R
Date: September 12, 2025

TABLE OF CONTENTS

EXECUTIVE SUMMARY ii
1.0 INTRODUCTION 1
2.0 PHASE I PROPERTY INFORMATION 2
3.0 SCOPE OF INVESTIGATION 3
4.0 RECORDS REVIEW 4
4.1 General 4
4.2 Environmental Source Information 11
4.3 Physical Setting Sources 18
5.0 INTERVIEWS 21
6.0 SITE RECONNAISSANCE 21
6.1 General Requirements 21
6.2 Specific Observations at the Phase I Property 21
7.0 REVIEW AND EVALUATION OF INFORMATION 26
7.1 Current and Past Uses 26
7.2 Conceptual Site Model 27
8.0 CONCLUSIONS 31
8.1 Assessment 31
8.2 Recommendations 32
9.0 STATEMENT OF LIMITATIONS 33
10.0 REFERENCES 34

List of Figures

Figure 1 - Key Plan
Figure 2 - Topographic Map
Drawing PE6874-1 - Site Plan
Drawing PE6874-2 - Surrounding Land Use Plan

List of Appendices

Appendix 1 Plan of Survey
Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information
MECP Well Records
TSSA Correspondence
City of Ottawa HLUI
ERIS Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by 240 Bank Street Holdings Ltd., to conduct a Phase I-Environmental Site Assessment (ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial building circa 1974. No historical potentially contaminating activities (PCAs) were identified on the Phase I Property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area were developed from primarily commercial and residential purposes. Former printers and automotive service garage were identified on the properties addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property and are considered to represent APECs on the Phase I Property. Remaining historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a six-storey commercial building with a full basement level. The ground floor houses three active retail stores, while the upper floors are utilized as office spaces by various tenants. No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area consists of primarily commercial (offices, restaurant, medical clinic, various stores, etc.) along with residential and community use. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

Recommendations

Based on the age of the subject building (circa 1974), asbestos containing building materials may be potentially present within the structure. Potential ACMs observed in the subject buildings include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster. These materials were observed to be in fair to good condition at the time of the site inspection and do not represent an immediate concern to the building's occupants. An asbestos survey of the subject building should be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, prior to any proposed demolition activities, if one has not already been conducted.

Based on the age of the subject buildings (circa 1974), lead-based paints may be present on any original or older painted surfaces. The painted surfaces within the subject buildings were generally observed to be in good condition and do not pose an immediate concern to the occupants of the building. Major work involving lead-based paint or other lead containing products must be done in accordance with O. Reg 843, under the Occupational Health and Safety Act.

It is recommended that a Designated Substance Survey (DSS) be conducted for the existing building prior to any future renovation or demolition activities.

1.0 INTRODUCTION

At the request of 240 Bank Street Holdings Ltd., Paterson Group (Paterson) conducted a Phase I-Environmental Site Assessment (Phase I-ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and properties within the Phase I Study Area to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the subject land.

Paterson was engaged to conduct this Phase I-ESA by Mr. Elliot Drazin with 240 Bank Street Holdings Ltd. Mr. Elliot Drazin can be reached by telephone at (514)-566-8826.

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared in general accordance with Ontario Regulation (O.Reg.) 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

2.0 PHASE I PROPERTY INFORMATION

Address:	240 Bank Street, Ottawa, Ontario.
Legal Description:	Lot 34 (South Lisgar Street), Registered Plan 12281, City of Ottawa.
Property Identification Number (PIN):	04114-0320.
Location:	The Phase I Property is located on the south side of the intersection of Bank Street and Lisgar Street, in the City of Ottawa, Ontario. Refer to Figure 1 - Key Plan in the Figures section following the text.
Latitude and Longitude:	45° 24’ 59.167" N, 75° 41' 51.456" W

Site Description:

Configuration:	Rectangular
Area:	0.07 ha (approximate)
Zoning:	TM H (19) – Traditional Mainstreet Zone
Current Use:	The Phase I Property is currently occupied by a six-storey commercial building.
Services:	The Phase I Property is located in a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- ❑ Determine the historical activities on the Phase I property and Study Area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies;
- ❑ Investigate the existing conditions present at the Phase I property and Study Area by conducting site reconnaissance;
- ❑ Conduct interviews with persons knowledgeable of current and historic operations on the subject properties, and if warranted, neighbouring properties;
- ❑ Present the results of our findings in a comprehensive report in general accordance with the requirements of O.Reg. 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022);
- ❑ Provide a preliminary environmental site evaluation based on our findings;
- ❑ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I-ESA Study Area Determination

A radius of approximately 250m was determined to be appropriate as a Phase I Study Area for this assignment. Properties outside the 250m radius are not considered to have impacted the subject land, based on their significant distance from the site.

First Developed Use Determination

Based on a review of available historical information, the Phase I Property was first developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial (mainly office) building in 1974.

Fire Insurance Plans (FIPs)

Fire Insurance Plans (FIPs) from 1888, 1912 and 1956 were reviewed for the area of the subject site and surrounding properties.

In the 1888 Fire Insurance Plans (FIPs), the Phase I Property consists of several smaller buildings with multiple addresses. The site is occupied by commercial structures, including stores and plumbing-related businesses. Surrounding properties feature a mix of commercial and residential developments. No environmental concerns were identified in the 1888 FIPs.

In the 1912 Fire Insurance Plans (FIPs), the Phase I Property is occupied by structures similar to those noted in the 1888 FIPs. The stores house businesses such as dyers and cleaners, a Chinese laundry, and a plumber. Given the period of operation, the former use of the property for laundry and cleaning is presumed to have operated without the use of chemicals and is therefore not considered a potentially contaminating activity (PCA). Surrounding properties feature a mix of commercial and residential developments. A machine shop, located at 431 Lisgar Street (now part of 290 Nepean Street), is situated approximately 245 meters west of the Phase I Property. Based on its separation distance with respect to the Phase I Property, the identified PCA is not considered to represent an environmental concern on the Phase I Property.

In the 1956 Fire Insurance Plans (FIPs), the Phase I Property remains occupied by structures similar to those noted in the 1912 FIPs, including uses such as office space, a beauty parlor, a plumber's shop, and a paper warehouse. Surrounding

properties within the Phase I Study Area in the 1956 FIPs are depicted as a mix of residential, commercial and industrial buildings.

Potentially contaminating activities (PCAs) identified within the Phase I Study Area from a review of the 1956 FIPs are summarized in Table 1.

Table 1 – Potentially Contaminating Activities Fire Insurance Plans (1956) Review Summary

Address	Potentially Contaminating Activity	Distance / Orientation from Site	Area of Potential Environmental Concern (Y/ N)
346 Lisgar Street (now part of 360 Lisgar Street)	Former Printing Shop	Adjacent West	Y
348 Lisgar Street (now part of 360 Lisgar Street)	Former Automotive Service Garage (with three associated USTs)	Adjacent Southwest	Y
318 Lisgar Street	Former Laundry (possibly dry cleaners)	35 m East	N
433 Cooper Street	Former Glass Industry	50 m Southwest	N
370 Lisgar Street	Former Automotive Service Garage	60 m West	N
420-446 Cooper Street	Former Dairy Company with Truck Storage and Repair (with one associated UST)	65 m South	N
300 Lisgar Street	Former Glass Industry	70 m East	N
375 Lisgar Street	Former Automotive Service Garage (with one associated UST)	75 m West	N
241 Kent Street (now part of 235 Kent Street)	Former Retail Fuel Outlet (with four associated USTs)	115 m West	N
448-456 Cooper Street (now part of 450 Cooper Street)	Former Paper Sales Ltd. with on-site Cleaning and Pressing	120 m Southwest	N
146 Nepean Street (now part of 144 Nepean Street)	Former Dry Cleaners	140 m Northeast	N
429 Somerset Street West	Former Retail Fuel Outlet (with four associated USTs)	160 m Southwest	N
387 Maclaren Street (now part of 294 Bank Street)	Former Automotive Service Garage	190 m South	N
443 Somerset Street West	Former Retail Fuel Outlet (with four associated USTs)	195 m Southwest	N
154 O'Connor Street	Former Retail Fuel Outlet (with three associated USTs)	200 m Northeast	N

Table 1 – Potentially Contaminating Activities
Fire Insurance Plans (1956) Review Summary

Address	Potentially Contaminating Activity	Distance / Orientation from Site	Area of Potential Environmental Concern (Y/ N)
324 Laurier Avenue West	Former Dry Cleaners	205 m Northwest	N
328 Kent Street (now divided in multiple addresses)	Former Retail Fuel Outlet (with four associated USTs)	225 m Southwest	N

The former printing shop addressed 346 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property and the former automotive service garage with 3 USTs addressed 348 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property are considered to represent APECs on the Phase I Property.

Based on the respective separation distances relative to the Phase I Property, the remaining off-site PCAs identified in the FIPs are not considered to represent an environmental concern on the Phase I Property.

It should be noted that civic addresses have changed over the years and those listed above may not currently exist. The respective distances of the above noted activities from the Phase I Property were determined using FIPs and the City of Ottawa electronic mapping website.

The PCAs identified during a review of the FIPs are illustrated on Drawing PE6874-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

City of Ottawa Street Directories

City directories for the Phase I Property and neighbouring properties in the Phase I Study Area were reviewed in approximate ten-year intervals, between 1900 and 2011.

The Phase I Property, encompassing 234, 236, 238, and 240 Bank Street, has been addressed 240 Bank Street collectively since 1965. Based on historical city directories, the property has predominantly been listed as commercial, with occasional residential use noted in one or more structures for brief periods.

A company, Argue & McColl Coal, was listed at the property in 1916, from 1918 to 1922, from 1928 to 1933, and in 1940. Another company, FW Ltd. Coal, was listed from 1954 to 1963. Both companies functioned as coal wholesalers, and other listings of the Phase I Property from similar years indicate that the property likely

was used as office space for coal companies during that time. The identified former use of the Phase I Property as an office space for coal wholesaler companies is not considered to represent an environmental concern on the Phase I Property.

The city directories also revealed the presence of a Chinese laundry operating on the property between 1910 and 1916, as well as a dyer listed from 1903 to 1914. As discussed in FIP section, given the period of operation, the former use of the property for laundry, dyer and cleaning is presumed to have operated without the use of chemicals and/or heavy machinery and is therefore not considered a potentially contaminating activity (PCA).

Surrounding properties in the Phase I Study Area were historically listed for residential and commercial uses. Potentially contaminating activities identified from a review of the City Directories are summarized in Table 2.

Table 2 - Potentially Contaminating Activities
City Directories Review Summary

Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Special Auto Service of Canada	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1921	Former Automotive Service Garage	Y
Lisgar Street Garage	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1931-1940	Former Automotive Service Garage	Y
Lillico Garage / City Radiator Service	348 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1946-1959	Former Automotive Service Garage	Y
Miller Print Shoppe	346 Lisgar Street (now part of 360 Lisgar Street)	Adjacent to West	1959	Former Printers	Y
Centre Laundrymaid	318 Lisgar Street	35 m East	1950-1959	Former Dry Cleaners	N
Norge Laundry & Cleaning Village	318 Lisgar Street	35 m East	1970	Former Dry Cleaners	N
Cleanaway	318 Lisgar Street	35 m East	1980-1989	Former Dry Cleaners	N
Chinese Laundry	393 Cooper Street (now part of 251 Bank Street)	40 m Southeast	1921	Former Possible Dry Cleaners	N
Houg Sing Laundry	393 Cooper Street (now part of 251 Bank Street)	40 m Southeast	1931-1940	Former Dry Cleaners	N
Capital Glass & Paint Co. Ltd.	433 Cooper Street	50 m Southwest	1931-1940	Former Glass Industry	N

Table 2 - Potentially Contaminating Activities
City Directories Review Summary

Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Consolidated Glass Industries Ltd.	433 Cooper Street	50 m Southwest	1950-1959	Former Glass Industry	N
Parker's Cleaners & Dryers Ltd.	214 Bank Street (now part of 212 Bank Street)	65 m North	1940	Former Dry Cleaners	N
Draicchio Tailoring & Cleaning	272 Bank Street	70 m Southeast	1989	Former Dry Cleaners	N
Brown's Cleaners & Tailors Ltd.	211 Bank Street (now part of 178 Nepean Street)	70 m North	1980-1989	Former Dry Cleaners	N
Brown's Cleaners	211 Bank Street (now part of 178 Nepean Street)	70 m North	2000	Former Dry Cleaners	N
Mail-o-metric direct Mail Printing	230 Nepean Street	85 m Northwest	1969	Former Printers	N
Bill's Battery Service Garage	375 Cooper Street	90 m East	1931	Former Automotive Service Garage	N
Bill's Auto Service	375 Cooper Street	90 m East	1940	Former Automotive Service Garage	N
Woo John Laundry	238 Nepean Street (now part of 235 Kent Street)	100 m Northwest	1941	Former Dry Cleaners	N
United Cleaners & Tailors	286 Bank Street (now part of 282 Bank Street)	100 m Southeast	1940-1949	Former Dry Cleaners	N
Multiple Listing	177 Nepean Street	105 m Northeast	1916-1931, 1941	Former Dry Cleaners	N
Multiple Listing	171 Nepean Street	110 m Northeast	1916, 1931-1959, 1989	Former Printers	N
De Fonteny French Cleaners	200 Bank Street (now part of 196 Bank Street)	115 m Northwest	1940	Former Dry Cleaners	N
Parker Cleaners & Dryers	287 Bank Street (now part of 271 Bank Street)	120 m Southeast	1959-1960	Former Dry Cleaners	N
Mouson's Deluxe Dry Cleaners	146 Nepean Street (now part of 144 Nepean Street)	140 m Northeast	1949-1959	Former Dry Cleaners	N
Multiple Listing	429 Somerset Street West	160 m Southwest	1947-1987	Former Retail Fuel Outlet	N
Ottawa Motor Sales	296 Bank Street (now part of 294 Bank Street)	165 m Southeast	1927	Former Automotive Storage and Sales	N

Table 2 - Potentially Contaminating Activities
City Directories Review Summary

Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Campbell Motor Sales	296 Bank Street (now part of 294 Bank Street)	165 m Southeast	1940	Former Automotive Storage and Sales	N
Long Wing Laundry	290 Kent Street (now part of 288 Kent Street)	185 m Southwest	1967	Former Dry Cleaners	N
Spic & Span Cleaners & Dryers	301 Bank Street	185 m Southeast	1959	Former Dry Cleaners	N
Multiple Listing	443 Somerset Street West	195 m Southwest	1947-2010	Former Retail Fuel Outlet & Automotive Service Garage	N
Tyrell Printers	305 Bank Street	200 m Southeast	1959	Former Printers	N
Parker Cleaners & Dryers	310 Bank Street (now part of 294 Bank Street)	200 m Southeast	1949	Former Dry Cleaners	N
Brookshire Cleaners & Dryers	310 Bank Street (now part of 294 Bank Street)	200 m Southeast	1950-1970	Former Dry Cleaners	N
Multiple Listing	154 O'Connor Street	200 m Northeast	1940-2010	Former Retail Fuel Outlet	N
Chinese Laundry	324 Laurier Avenue West	205 m Northwest	1916	Former Dry Cleaners	N
Chung Mark Laundry	324 Laurier Avenue West	205 m Northwest	1931-1941	Former Dry Cleaners	N
Brookshire Cleaners Ltd.	324 Laurier Avenue West	205 m Northwest	1949-1969	Former Dry Cleaners	N
Young's Supply Co. Auto Accessories	302-304 Laurier Avenue West (now part of 171 Bank Street)	210 m North	1941-1949	Former Automotive Storage and Sales	N
Spic & Span Cleaners	302 Laurier Avenue West (now part of 171 Bank Street)	210 m North	1941-1949	Former Dry Cleaners	N
Kent Street Shell Service Station	328 Kent Street	225 m Southwest	1947-1987	Former Retail Fuel Outlet	N

As discussed in FIP section, the former printing shop addressed 344 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property and the former automotive service garage with 3 USTs addressed 346 Lisgar Street (now part of 360 Lisgar Street), adjacent to the west of the Phase I Property are considered to represent APECs on the Phase I Property.

Based on the respective separation distances relative to the Phase I Property, the remaining off-site PCAs identified during the review of the City of Ottawa street directories are not considered to represent an environmental concern on the Phase I Property.

It should be noted that civic addresses have changed over the years and those listed above may not currently exist. The respective distances of the above noted activities from the Phase I Property were determined using the City of Ottawa electronic mapping website.

The PCAs identified during a review of the City of Ottawa street directories are illustrated on Drawing PE6874-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

Chain of Title

Based on the information obtained from the city directories, fire insurance plans, ERIS report, and HLUI response, it was determined that a chain of title search would not provide additional value to the environmental assessment of the Phase I Property. Accordingly, a chain of title search was not undertaken as part of this assessment.

Plan of Survey

A topographic plan of survey for the Phase I Properly, prepared by Annis, O'Sullivan Vollebekk Ltd. was reviewed as part of the Phase I ESA. The plan shows the Phase I Property in its current configuration. A copy of the topographic plan of survey is provided in Appendix 1.

Previous Environmental Reports

The review of previous environmental reports for surrounding properties identified two Potentially Contaminating Activities (PCAs) within the Phase I Study Area that were identified in city directories or FIP sections. The property at 232 Bank Street, located approximately 20m north of the Phase I Property, operated as a printer in 1998. The property at 345 Lisgar Street (currently part of 222 Nepean Street), about 20m northwest of the Phase I Property, operated as a printer from 1956 to 1960.

Based on the separation distance, down/cross-gradient orientation relative to the Phase I Property, and the brief operational period, both identified PCAs are not considered to pose an environmental concern to the Phase I Property.

4.2 Environmental Source Information

Environment Canada

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on January 16, 2025. No records were found in the NPRI database for properties within the Phase I Study Area.

PCB Inventory

A search of provincial PCB waste storage sites was conducted. No PCB waste storage sites were identified within the Phase I Study Area.

Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on January 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

Ministry of the Environment, Conservation and Parks Freedom of Information Request

MECP Submissions

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the Phase I Property. A response from the MECP was received on February 25, 2025, indicating that no related records were found. A copy of the response is included in Appendix 2.

MECP Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. A response from the MECP was received on February 25, 2025, indicating that no related records were found. A copy of the response is included in Appendix 2.

MECP Waste Management Records

A request was submitted to the MECP FOI office for information with respect to waste management records. A response from the MECP was received on February 25, 2025. One record was identified for the Phase I Property, related to a waste generator registration for Al's Care Pharmacy. The listed waste classes

include 261-A (pharmaceuticals) and 312-P (pathological waste). This record is not considered to represent an environmental concern for the Phase I Property.

A copy of the response is included in Appendix 2.

MECP Incident Reports

A request was submitted to the MECP FOI office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, inspections maintained by the MECP for the Phase I Property or neighbouring properties. A response from the MECP was received on February 25, 2025, indicating that no related records were found. A copy of the response is included in Appendix 2.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry (ESR) was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No record of site condition (RSC) was identified for the Phase I Property. Seven (7) RSCs were filled for properties within the Phase I Study Area.

An RSC was filled for the following properties: 433 Cooper Street (approximately 50m to the southwest), 300 Lisgar Street (approximately 70m to the east), 235-245 Kent Street (approximately 955m to the west), 287 Lisgar Street (approximately 125m to the northeast), 433 Somerset Street West (approximately 195m to the southwest), 324 Laurier Avenue West (approximately 205m to the northwest) and 360 Laurier Avenue West (approximately 220m to the northwest). According to the registry, approximately 22 m^3, 35 m^3, 2,900 m^3, 10,589 m^3, 573 m^3 and 1,300 m^3 of contaminated soil, respectively, was removed from the RSC properties. No contamination media was present on 360 Laurier Avenue West and therefore no remediation was required. Based on the separation distance of these properties from the subject site, these properties are not considered to have had the potential to have impacted the subject site.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario. No waste disposal sites were listed in the database for the Phase I Property or properties within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA, Fuels Safety Branch in Toronto, was contacted electronically on January 17, 2024, to inquire about current and former underground/aboveground storage tanks, spills, and incidents for the subject and neighbouring properties. The response from the TSSA indicated that no records were listed in the TSSA registry for the Phase I Property or surrounding properties within the Phase I Study Area.

A copy of the TSSA correspondence is included in Appendix 2.

City of Ottawa Historical Land Use Inventory (HLUI)

A request for a search of the City of Ottawa's Historical Land Use Inventory (HLUI) database was submitted to the City of Ottawa. A response was received on February 12, 2025. The response identified one record for the Phase I Property. The record pertained to a harness maker business that operated in 1920 for one year at the 238 Bank Street address. Based on the short duration and timing of its operation, the harness maker operation is not considered to represent an environmental concern for the Phase I Property.

The HLUI database identified records for surrounding properties within the Phase I Study Area. These records were reviewed, and previously unidentified PCAs are summarized in the table below.

Listing	Address	Approx. Distance from Phase I Property	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Fred H Boughton	315 Lisgar Street	50 m Northeast	Former Printers	N
The Ottawa Record Printing Co.	389 Cooper Street	60 m East	Former Printers	N
Capital Xtra/Pink Triangle Press	207 Bank Street	100 m North	Former Printers	N
Unnamed Auto Paint Shop, Ottawa Magazine & Borts Printing Shop	188 Bank Street	135 m Northwest	Former Automotive Paint Shop and Printers	N
Albert Oldham Auto Service	158 Gloucester Street	145 m North	Former Automotive Service Garage	N
Hurd's Garage	264 Kent Street	165 m Southwest	Former Automotive Service Garage	N
Capital Stamp & Stationary Co.	299 Bank Street	170 m Southeast	Former Printers	N
Hillary's Dry Cleaners	360 Laurier Avenue	225 m Northwest	Former Dry Cleaners	N

Based on the respective separation distances relative to the Phase I Property, the off-site PCAs identified during the review of the HLUI response are not considered to represent an environmental concern on the Phase I Property.

City of Ottawa Old Landfill Sites

The document prepared by Golder Associates entitled, *"Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa"*, was reviewed as part of this assessment. No former landfill sites were identified on the Phase I Property, or within a 150m radium of the Phase I Property.

City of Ottawa Former Industrial Sites

The document prepared by Intera Technologies Limited entitled, *"Mapping and Assessment of Former Industrial Sites, City of Ottawa"*, was also reviewed as part of this assessment. No former industrial sites were identified on the Phase I Property.

The property located at 175 Nepean Street (now part of 171 Nepean Street), approximately 110m northeast of the Phase I Property, was identified as the Lowe-Martin (Industrial Site #40). The site operated from 1928 to 1965, primarily engaged in printing and publishing activities. The property, along with its previous use as a printing facility, is considered a PCA. The property located at 300 Laurier Avenue West, approximately 185m northeast of the Phase I Property, was identified as the Ottawa Photo Engraving Co. (Industrial Site #84). The site operated from 1925 to 1950, primarily involved in printing and publishing activities, as well as lithography, engraving, and stereotyping. The property, along with its previous use as a printing facility, is considered a PCA. Based on the separation distances with respect to the Phase I Property, the identified PCAs are not considered to represent an environmental concern to the Phase I Property.

Environmental Risk Information Service (ERIS) Report

An Environmental Risk Information Services (ERIS) report, dated January 14, 2025, was acquired for the Phase I Property and reviewed as part of this assessment. It should be noted that the ERIS report includes information that would normally be obtained through the MECP FOI, MECP well records search as well as several other records (i.e., incident reports, waste generators, etc.). The complete ERIS report has been included in Appendix 2.

❑ *On-Site Records:*

A total of five records were identified for the Phase I Property (4 of which are previous ERIS searches). The ERIS report identified one Waste Generator record for the Phase I Property. The identified record pertains to Al's Care Pharmacy, with an approval year of 2014. The listed waste classes include pharmaceuticals and pathological wastes. This record is not considered an environmental concern for the Phase I Property.

❑ *Off-Site Records:*

A total of 427 records from various databases were identified for properties within a 250m radius of the Phase I Property (69 of which are previous ERIS searches).

The ERIS report identified two Dry cleaning Facilities records for the property addressed 272 Bank Street, approximately 70m southeast of the Phase I Property. These records identify Draicchio's Tailoring & Cleaning and Downtown Cobler as the associated businesses in 2004 and 2021, respectively. Based on the separation distance from the Phase I Property, the former dry cleaner is classified as a PCA but is not considered an APEC for the Phase I Property.

The ERIS report identified the following records for surrounding properties within the Phase I Study Area: seven delisted fuel tank records, six records from lists of expired fuel safety facilities, one record from the federal identification registry for storage tank systems, three records for fuel storage tanks - historic, and four records for private and retail fuel storage tanks. One record is associated with 300 Laurier Avenue West, located approximately 185m northeast of the Phase I Property. The record provides information about two 10,200-litre aboveground storage tanks (ASTs) located in the diesel room and a 1,217-litre AST situated in the generator room of the building. These ASTs are classified as a PCA. Two records are associated with 199 Kent Street, located approximately 205m northwest of the Phase I Property. These include information about a 1,000-litre tank with an expiry date of 1993 and an expired record for a propane refill center. The identified tank record is classified as a PCA. Based on their separation distances with respect to the Phase I Property, both identified PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining records pertain to properties already identified as PCAs and are not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified two fuel oil spills and leaks records for surrounding properties within the Phase I Study Area. A record was identified for the property located at 212 Bank Street, approximately 18m north of the Phase I Property. The

record, dated 2010, indicates fuel oil as the type of fuel involved, with a status code of "causal analysis complete." The occurrence narrative mentions the discovery of an abandoned UST. However, no further significant details are provided, such as the spill quantity, environmental contact media, or other relevant information. Based on the available information, this record is not considered to pose an environmental concern for the Phase I Property. The second identified record pertains to natural gas and is not considered an environmental concern for the Phase I Property.

The ERIS report identified 26 Scott's manufacturing directory records for surrounding properties within the Phase I Study Area. A record was identified for the property located at 231 Bank Street, approximately 25m north of the Phase I Property. The record lists the business name as "Wallack's Art & Drafting," employing 20 persons. While no establishment year is provided, the description includes items such as marking devices, pencils, crayons, and measuring tools. The business is classified as a supply store, is not considered a PCA, and does not pose an environmental concern to the Phase I Property. Three records were identified for the property located at 251 Bank Street, approximately 30m southeast of the Phase I Property. These records reference three different establishments, all operating as printers. Two records provide establishment years of 1994 and 1996, with facility sizes of 1,800 ft² and 1,000 ft², respectively. The identified former printers are classified as a PCA. However, due to their separation distance and cross-gradient orientation relative to the Phase I Property, the identified PCA is not considered to pose an environmental concern to the Phase I Property. The review of remaining records identified following PCAs: 396 Cooper Street (approximately 80m southeast - former printers), 177 Nepean Street (approximately 105m northeast - former printers), 146 Nepean Street (approximately 140m northeast - former printers), 176 Gloucester Street (approximately 145m north - former printers), 386 MacLaren Street (approximately 240m southeast – former electrical component manufacturer). Based on their separation distances with respect to the Phase I Property, these PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining Scott's manufacturing directory records identified in the ERIS report are either related to a previously identified PCA or are not considered to represent PCAs based on information contained within the records.

The ERIS report identified 27 Ontario spill records for surrounding properties within the Phase I Study Area. A 2000 record for 232 Bank Street, located approximately 20m north of the Phase I Property, documented a 5-litre oil spill to the ground, which was subsequently cleaned up. This record of minimal spill is not considered

to pose an environmental concern to the Phase I Property. A 2002 record for 340 Laurier Avenue, located approximately 175m northwest of the Phase I Property, documented an 1,800-litre ethylene glycol spill affecting the property and sewer system. This spill record is classified as a Potentially Contaminated Area (PCA). Additionally, a 1993 record for 154 O'Connor Street, situated approximately 200m northeast of the Phase I Property, reported the loss of 1,800 litres of furnace oil from an underground storage tank (UST) due to a tank leak. The associated impact was identified as soil contamination, and this record is also considered a PCA. Based on the separation distances and down/cross-gradient orientation with respect to the Phase I Property, both PCAs are not considered to represent an environmental concern to the Phase I Property. The remaining spill records consist of minimal (less than 30L) transformer oil, coolant, grease or gas leak/spills occurring at properties a minimum of 30m from the Phase I Property. Based on their respective separation distances and the nature of the spills, the records are not considered to represent an environmental concern to the phase I Property.

The ERIS report identified 186 Waste Generator records for surrounding properties within the Phase I Study Area. Five records were identified for 360 Lisgar Street, located adjacent to the west of the Phase I Property. Two records pertain to a Revenue Canada Taxation establishment, with waste classes including photo processing wastes and alkaline wastes containing heavy metals, spanning from 1994 to 2001. One record is associated with Urbandale Corporation, with waste classes including halogenated pesticides, alkaline wastes (other metals), and waste oils & lubricants, covering the years 2003 to 2005. The remaining four records relate to a Bell Canada business, with approval years from 2015 to 2018, listing waste classes such as waste oils/sludges, waste compressed gases (including cylinders), and others. Based on aerial photographs, the property is shown to be occupied by an existing office building, with all three establishments possibly using the building solely for office purposes. Given the available information, the identified records are not considered a PCA. Three records were identified for 224 Bank Street, located approximately 40 meters north of the Phase I Property. The records list petroleum distillates as the waste class for approval years spanning 1989 to 2001. The records are related to Bicycle Revival Ltd., a bicycle repair service. Given the nature of the business, these records are not classified as a PCA. Remaining waste generator records identified in the ERIS report are either related to a previously identified PCA or are not considered to represent PCAs based on information contained within the records.

The ERIS report identified five national PCB inventory records for surrounding properties within the Phase I Study Area. Four records pertain to the property at

171 Bank Street, located approximately 175m northeast of the Phase I Property. These records indicate the presence of a transformer vault on the P1 level, north side, housing two transformers containing 3,250 litres of Askarel liquid and six transformers containing 1,433 litres of Askarel/Inerteen liquid. The identified PCB records are considered a PCA. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the identified PCA is not considered to represent an environmental concern to the Phase I Property. The remaining record does not contain significant information and is not considered a PCA.

The ERIS report identified seven Record of Site Condition for surrounding properties within the Phase I Study Area. As discussed above in MECP brownfields environmental site registry section, the identified RSC properties are not considered to represent an environmental concern on the Phase I Property.

The ERIS report identified 12 certificates of approval, two environmental activity and sector registry, one environmental registry, eight environmental compliance approval, one permit to take water records for surrounding property within the Phase I Study Area. The records are limited to air, sewer and water works and are not considered to pose an environmental risk to the Phase I Property.

The ERIS report identified 34 well records and five borehole records for surrounding properties within the Phase I Study Area, which are further discussed in the water well records section of this report.

The remaining records identified in the ERIS report contain minimal or non-pertinent information and/or include details that are not considered indicative of a potential environmental concern to the Phase I Property. The complete ERIS report has been included in Appendix 1.

4.3 Physical Setting Sources

Aerial Photographs

Historical air photos from the National Air Photo Library, GeoOttawa Website and Google Earth were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1933 The Phase I Property consist of multiple small commercial building structures. Bank Street and Lisgar Street are located adjacent to the northeast and northwest of the Phase I Property, respectively. The

surrounding properties are primarily developed with a mix of residential and commercial buildings.

1949 (Poor Scale) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

1958 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

1965 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. The property adjacent to the west of the Phase I Property appears to have been redeveloped with new, smaller commercial building.

1976 (GeoOttawa) The Phase I Property appears to have undergone redevelopment, now featuring a new multi-storey commercial building in place of the previous smaller structures. Similarly, the surrounding properties exhibit significant redevelopment, with new buildings replacing the earlier smaller structures.

1984 No significant changes are apparent with regard to the Phase I Property or surrounding properties.

1991 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. Further redevelopment of surrounding properties is noted to the southeast of the Phase I Property.

2002 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

2011 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

2024 (Google Earth) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

Copies of selected aerial photographs reviewed are included in Appendix 1.

Physiographic Maps

A Physiographic Map was reviewed from the Natural Resources Canada – The Atlas of Canada website. According to this physiographic map, the site is located in the St. Lawrence Lowlands. According to the mapping description provided: “The lowlands are plain-like areas that were all affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features

associated with the ice sheets." The Phase I Property is located in the Central St. Lawrence Lowland, which is generally less than 150 m above sea level.

Topographic Maps

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the elevation of the Phase I Property is approximately 73m above sea level. The regional topography in the general area of the Phase I Property slightly slopes downward to the north and northeast. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Geological Maps

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Billings Formation. Based on the maps, the surficial geology consists of offshore marine deposits with an overburden thickness ranging from 10 to 15m.

Water Well Records

A search of the MECPs website was conducted on January 21, 2025, for all drilled well records within a 250m radius of the Phase I Property. No well records were identified for the Phase I Property.

The search identified 36 well and well cluster records associated with surrounding properties within the Phase I Study Area. Of these, 27 records pertain to monitoring wells installed between 2005 and 2021, which are assumed to have been established for geotechnical purposes and/or environmental investigations. Two records lacked significant information, while six records related to well abandonment. The remaining record pertains to a domestic supply well installed in 1948. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area. A copy of the well records has been included in Appendix 2.

In general, according to the well records, the strata in the Phase I Study Area consists of silt and sand over underlying silty clay, over shale bedrock. Shale bedrock was encountered at depths ranging from 9.33 – 19.25 mbgs in the nearby well records identified within the Phase I Study Area.

5.0 INTERVIEWS

Property Owner Representatives

Mr. Elliot Drazin, with 240 Bank Street Holdings Ltd., the current property owner was interviewed via e-mail correspondence as part of this assessment. Mr. Drazin stated that 240 Bank Street Holdings Ltd. acquired the Phase I Property in 2006. Mr. Drazin also noted that the existing building on the property was constructed in 1974 and has primarily been used for commercial purposes, mainly as an office building. Mr. Drazin stated that he was unaware of any environmental concerns on the Phase I Property.

The information obtained through the interview with Mr. Drazin is considered to be consistent with site information obtained from other sources (aerial photos, ERIS Database Report and site observations) and is considered to be valid.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site visit was conducted on January 24, 2025, by Mr. Kuldeep Panchal with the Environmental Department of Paterson Group. Weather conditions at the time of the site inspection were clear and approximately -12°C. In addition to the site, the uses of neighbouring properties within the Phase I Study Area were assessed at the time of the site visit from publicly accessible areas.

6.2 Specific Observations at the Phase I Property

Buildings and Structures

Six-storey commercial building with a full basement level is present on the Phase I Property. The commercial building was constructed circa 1974 and is currently heated with a natural gas system. The subject building is constructed with a concrete foundation and is finished on the exterior with brick and has a flat tar and gravel roof. A smaller rooftop unit, occupying a footprint proportionally smaller than the main structure, serves as a mechanical room and elevator room.

The ground floor of the commercial building consists of multiple retail spaces fronting Bank Street and Lisgar Street. Currently, three stores are occupied and operational: a comic store, a barbershop, and a cake/gift shop, while the remaining two units are vacant at the time of the site inspection. A portion of the basement, previously used as office space, is also vacant. The upper floors are designated

for office use, accommodating various tenants, with approximately half of the area unoccupied at the time of the site inspection.

Subsurface Structures and Utilities

The Phase I Property is serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property, including electrical, natural gas, water and telecommunication lines. No other subsurface structures were identified at the time of the site inspection.

Site Features

The entire portion of the subject site is currently occupied with a commercial building. The Phase I Property is considered to be at grade with respect to the adjacent roadways. The site topography is generally flat and the regional topography slightly slopes downward to the north and northeast.

Water drainage on the Phase I Property occurs via sheet drainage to catch basins located along the Bank Street and Lisgar Street. No ponded water, stressed vegetation, surficial staining, or any other indications of potential sub-surface contamination were observed on the subject site at time of the site inspection.

No drains, pits or sumps were observed on the exterior of the Phase I Property at the time of the site inspection. No evidence of current or former railway lines or spur lines on the Phase I Property was observed at the time of the site inspection.

Site features are presented on Drawing PE6874-1 – Site Plan, provided in the Figures section following the text.

Potential Environmental Concerns

❑ **Groundwater Monitoring Wells**

No monitoring wells were identified on the Phase I Property during the site assessment.

❑ **Fuels and Chemical Storage**

No above ground fuel storage tanks (ASTs), or signs of USTs were observed on the exterior of the Phase I Property at the time of the site inspection. No chemicals were found to be stored on the exterior of the Phase I Property.

❑ **Waste Management**

Solid, non-hazardous domestic waste and recyclable products are stored in plastic bins located along the western edge of the building and are collected regularly. No environmental concerns were identified with respect to waste management practices on the Phase I Property.

❑ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

No transformers were observed on the exterior of the Phase I Property.

❑ **Fill Material**

No evidence of fill material was observed on the exterior of the Phase I Property at the time of the site inspection.

Interior Assessment

A general description of the interior of the commercial building is as follows:

❒ Floors consist of concrete, carpet, laminate, ceramic tiles and vinyl floor tiles;

❒ Walls consist of drywall, concrete, plaster and concrete block;

❒ Ceilings consist of suspended tiles, plaster and stippled plaster;

❒ Lighting is provided by LED fixtures.

Potentially Hazardous Building Products

❑ **Asbestos-Containing Materials (ACMs)**

Based on the age of construction of the subject building (circa 1974), asbestos containing building materials may be present within the structure. Potentially asbestos-containing materials (ACMs) observed at the time of the site inspection include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster.

❑ **Lead-Based Paints (LBPs)**

Based on the age of construction of the subject building (circa 1974), lead-based paints (LBPs) may be present within the structure. Painted surfaces were generally observed to be in good condition at the time of the site inspection and do not pose an immediate concern.

❑ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

A hydro vault was observed in the basement of the building. The room was secured and not accessible, but the presence of transformers within the hydro vault is expected. The hydro vault is constructed with concrete floor and no staining or cracks were observed in the concrete floor outside the vault room. Based on the observations made during the site inspection, the potential presence of transformers in the building is not considered an environmental concern for the Phase I Property.

❑ **Urea Formaldehyde Foam Insulation (UFFI)**

UFFI was not observed in the subject building at the time of the site inspection, however, wall cavities were not inspected for insulation type.

Other Potential Environmental Concerns

❑ **Fuel and Chemical Storage**

No aboveground storage tanks (ASTs) or signs of underground storage tanks (USTs) were observed inside the subject building at the time of the site visit.

Chemical products stored in the subject building were observed to be limited to domestically available cleaning products and boiler water treatment chemicals, stored in their original containers. No environmental concerns were identified with respect top chemical storage practices within the subject building.

❑ **Wastewater Discharge**

Wastewater generated on the Phase I Property, including wash water and sewage, is discharged to the municipal water system.

❑ **Drains, Pits and Sumps**

One sump pit was observed within the basement of the subject building. The sump pit contained clean water with no noticeable odours or staining. No environmental concerns were identified with respect to wastewater discharges at the Phase I Property.

❑ **Ozone Depleting Substances (ODSs)**

Potential sources of ODSs observed on-site include a commercial cooler, refrigerators, air-conditioning units and fire extinguishers. These appliances

were noted to be in good condition at the time of the site inspection and should be regularly serviced by a licensed contractor.

Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible areas at the time of the site visit. Land use adjacent to the Phase I Property was as follows:

- ❑ North - Lisgar Street, followed by light commercial buildings (restaurants);
- ❑ South - Light commercial buildings (bakery, barbershop, various stores);
- ❑ East - Bank Street, followed by light commercial buildings (various stores and restaurants);
- ❑ West - Office building, followed by residential dwellings.

Land use within the Phase I Study consists of properties used residential and commercial purposes. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Both identified are considered PCAs. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6874-2 – Surrounding Land Use Plan.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

The following table indicates the current and past uses of the site as well as associated potentially contaminating activities dating back to the first developed use of the site.

Table 4 - Land Use History

Year	Property Use	Potentially Contaminating Activities (PCAs)	Area of Potential Environmental Concern (APECs)
240 Bank Street (Historical - 232, 236 and 238 Bank Street)			
Prior to 1888	Vacant or Commercial (Building Construction Year unknown)	No	None
1888 to 1974	Commercial (Multiple retail business at each address over the years)	No	None
1974 to Present	Commercial (Present Day Building with retail and office space)	No	None

Potentially Contaminating Activities (PCAs) and Areas of Potential Environmental Concern (APECs)

Based on the findings of the Phase I ESA, the following off-site PCAs (as listed in Column A, Table 2 of O.Reg.153/04) were considered to result in two APECs on the Phase I Property:

- PCA 31 – Ink Manufacturing, Processing and Bulk Storage – this PCA is associated with the historical off-site printers addressed 346 Lisgar street, adjacent to the west of the Phase I Property (APEC 1)
- PCA 28/52 – Gasoline and Associated Products in Storage in Fixed Tanks, and Storage, maintenance, fuelling and repair of equipment, vehicles, and material used to maintain transportation systems – this PCA is associated with the historical off-site automotive service garage addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property (APEC 2)

The remaining off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

All APECs are outlined on Drawing PE6874-1 – Site Plan, while all PCAs identified within the Phase I Study Area are present on PE6874-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern for the soil and/or groundwater on the Phase I Property include the following:

- ❒ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F_1-F_4);
- ❒ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ❒ Volatile Organic Compounds (VOCs);

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Billings Formation. Based on the maps, the surficial geology consists of offshore marine deposits with an overburden thickness ranging from 10 to 15m.

The topographic maps indicate that the elevation of the Phase I Property is approximately 73m above sea level. The regional topography in the general area of the Phase I Property slightly slopes downward to the north and northeast.

Fill Placement

No evidence of fill placement was observed at the time of the site inspection.

Water Bodies and Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on January 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area. The nearest body of water is the Ottawa River, approximately 900m northwest of the Phase I Property.

Potable Water Wells

A search of the MECPs website was conducted on January 21, 2025, for all drilled well records within a 250 m radius of the Phase I Property. No well records were identified for the Phase I Property. One record for domestic supply well installed in 1948 was identified within the Phase I Study Area. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

Monitoring Wells

No monitoring well records were identified for the Phase I Property. The search identified 27 monitoring well records for surrounding properties within the Phase I Study Area, installed between 2005 and 2021. The monitoring well records are assumed to have been installed for geotechnical purposes and/or as part of previous environmental investigations.

In general, according to the well records, the strata in the Phase I Study Area consists of silt and sand over underlying silty clay, over shale bedrock. Shale bedrock was encountered at depths ranging from 9.33 – 19.25 mbgs in the nearby well records identified within the Phase I Study Area.

Existing Buildings and Structures

Six-storey commercial building with a full basement level is present on the Phase I Property. The commercial building was constructed circa 1974 and is currently heated with a natural gas system. The subject building is constructed with a concrete foundation and is finished on the exterior with brick and has a flat tar and gravel roof. A smaller rooftop unit, occupying a footprint proportionally smaller than the main structure, serves as a mechanical room and elevator room.

The ground floor of the commercial building consists of multiple retail spaces fronting Bank Street and Lisgar Street. Currently, three stores are occupied and operational: a comic store, a barbershop, and a cake/gift shop, while the remaining two units are vacant at the time of the site inspection. A portion of the basement, previously used as office space, is also vacant. The upper floors are designated for office use, accommodating various tenants, with approximately half of the area unoccupied at the time of the site inspection.

Subsurface Structures and Utilities

The Phase I Property is serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property, including

electrical, natural gas, water and telecommunication lines. No other subsurface structures were identified at the time of the site inspection.

Neighbouring Land Use

Land use within the Phase I Study consists of properties used residential and commercial purposes. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Both identified are considered PCAs. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6874-2 – Surrounding Land Use Plan.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

As previously discussed in Section 7.1, two off-site PCAs are considered to result in two APECs on the Phase I Property. The PCAs, APECs and associated CPCs are summarized in Table 4.

Table 4 - Areas of Potential Environmental Concern

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I-ESA Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Former Printers	West portion of the Phase I Property	*"Item 31 – Ink Manufacturing, Processing and Bulk Storage"*	Off-site	BTEX PHCs (F_1-F_4) VOCs	Soil Groundwater
APEC 2[1] Former Automotive Service Garage	West portion of the Phase I Property	*"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"* *"Item 52 – Storage, maintenance, fuelling and repair of equipment, vehicles, and material used to maintain transportation systems"*	Off-site	BTEX PHCs (F_1-F_4) VOCs	Soil Groundwater

The remaining off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

As previously discussed in Section 7.1, all APECs are outlined on Drawing PE6874-1 – Site Plan, while all PCAs identified within the Phase I Study Area are present on PE6874-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern

As per section 7.1 of this report and Table 4, CPCs in the soil and/or groundwater beneath the Phase I Property include the following:

- ❒ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F_1-F_4);
- ❒ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ❒ Volatile Organic Compounds (VOCs);

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I- ESA is considered to be sufficient to conclude that there are former off-site PCAs that have resulted in APECs on the Phase I Property. Additional off-site PCAs identified within the Phase I Study Area are not considered to represent APECs on the Phase I Property based on their separation distance and/or cross-gradient orientation with respect to the Phase I Property.

A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by 240 Bank Street Holdings Ltd., to conduct a Phase I-Environmental Site Assessment (ESA) for 240 Bank Street, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with commercial structures sometime prior to 1888. The Phase I Property was redeveloped with the existing commercial building circa 1974. No historical potentially contaminating activities (PCAs) were identified on the Phase I Property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area were developed from primarily commercial and residential purposes. Former printers and automotive service garage were identified on the properties addressed 346 and 348 Lisgar Street, adjacent to the west of the Phase I Property and are considered to represent APECs on the Phase I Property. Remaining historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a six-storey commercial building with a full basement level. The ground floor houses three active retail stores, while the upper floors are utilized as office spaces by various tenants. No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area consists of primarily commercial (offices, restaurant, medical clinic, various stores, etc.) along with residential and community use. A tailoring and dry-cleaning establishment is located at 272 Bank Street, approximately 70m southeast of the Phase I Property. Additionally, a dry cleaner is situated at 395 Somerset Street West, approximately 130m south of the Phase I Property. Based on the separation distance with respect to the Phase I Property, these identified PCAs are not considered to represent an environmental concern on the Phase I Property.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

8.2 Recommendations

Based on the age of the subject building (circa 1974), asbestos containing building materials may be potentially present within the structure. Potential ACMs observed in the subject buildings include drywall joint compound, vinyl floor tiles, suspended ceiling tiles and stippled plaster. These materials were observed to be in fair to good condition at the time of the site inspection and do not represent an immediate concern to the building's occupants. An asbestos survey of the subject building should be conducted in accordance with Ontario Regulation 278/05, under the Occupational Health and Safety Act, prior to any proposed demolition activities, if one has not already been conducted.

Based on the age of the subject buildings (circa 1974), lead-based paints may be present on any original or older painted surfaces. The painted surfaces within the subject buildings were generally observed to be in good condition and do not pose an immediate concern to the occupants of the building. Major work involving lead-based paint or other lead containing products must be done in accordance with O. Reg 843, under the Occupational Health and Safety Act.

It is recommended that a Designated Substance Survey (DSS) be conducted for the existing building prior to any future renovation or demolition activities.

9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the Phase I property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of 240 Bank Street Holdings Ltd. Permission and notification from 240 Bank Street Holdings Ltd. and Paterson will be required to release this report to any other party.

Paterson Group Inc.

Kuldeep Panchal, M.Eng.

Michael Beaudoin, P.Eng, Q.P.$_{ESA}$

Report Distribution:

- ❑ 240 Bank Street Holdings Ltd.
- ❑ Paterson Group

10.0 REFERENCES

Federal Records
Air photos at the Energy Mines and Resources Air Photo Library.
National Archives.
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).
Natural Resources Canada – The Atlas of Canada.
Environment Canada, National Pollutant Release Inventory.
PCB Waste Storage Site Inventory.

Provincial Records
MECP Municipal Coal Gasification Plant Site Inventory, 1991.
MECP document titled “Waste Disposal Site Inventory in Ontario”.
MECP Brownfields Environmental Site Registry.
MNR Areas of Natural Significance.
MECP Water Well Record Inventory.
Maps and photographs (Geological Survey of Ontario surficial and subsurface mapping).
Chapman, L.J., and Putnam, D.F., 1984: ‘The Physiography of Southern Ontario, Third Edition’, Ontario Geological Survey Special Volume 2.

Municipal Records
geoOttawa: City of Ottawa electronic mapping website.
City of Ottawa Historical Land Use Inventory (HLUI) Database.

Local Information Sources
Personal Interviews
Chain of Title
Previous Engineering Reports
Environmental Risk Information Services (ERIS) Report, May 13, 2024

Public Information Sources
Google Earth.
Google Maps/Street View.

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE6874-1 – SITE PLAN

DRAWING PE6874-2 – SURROUNDING LAND USE PLAN

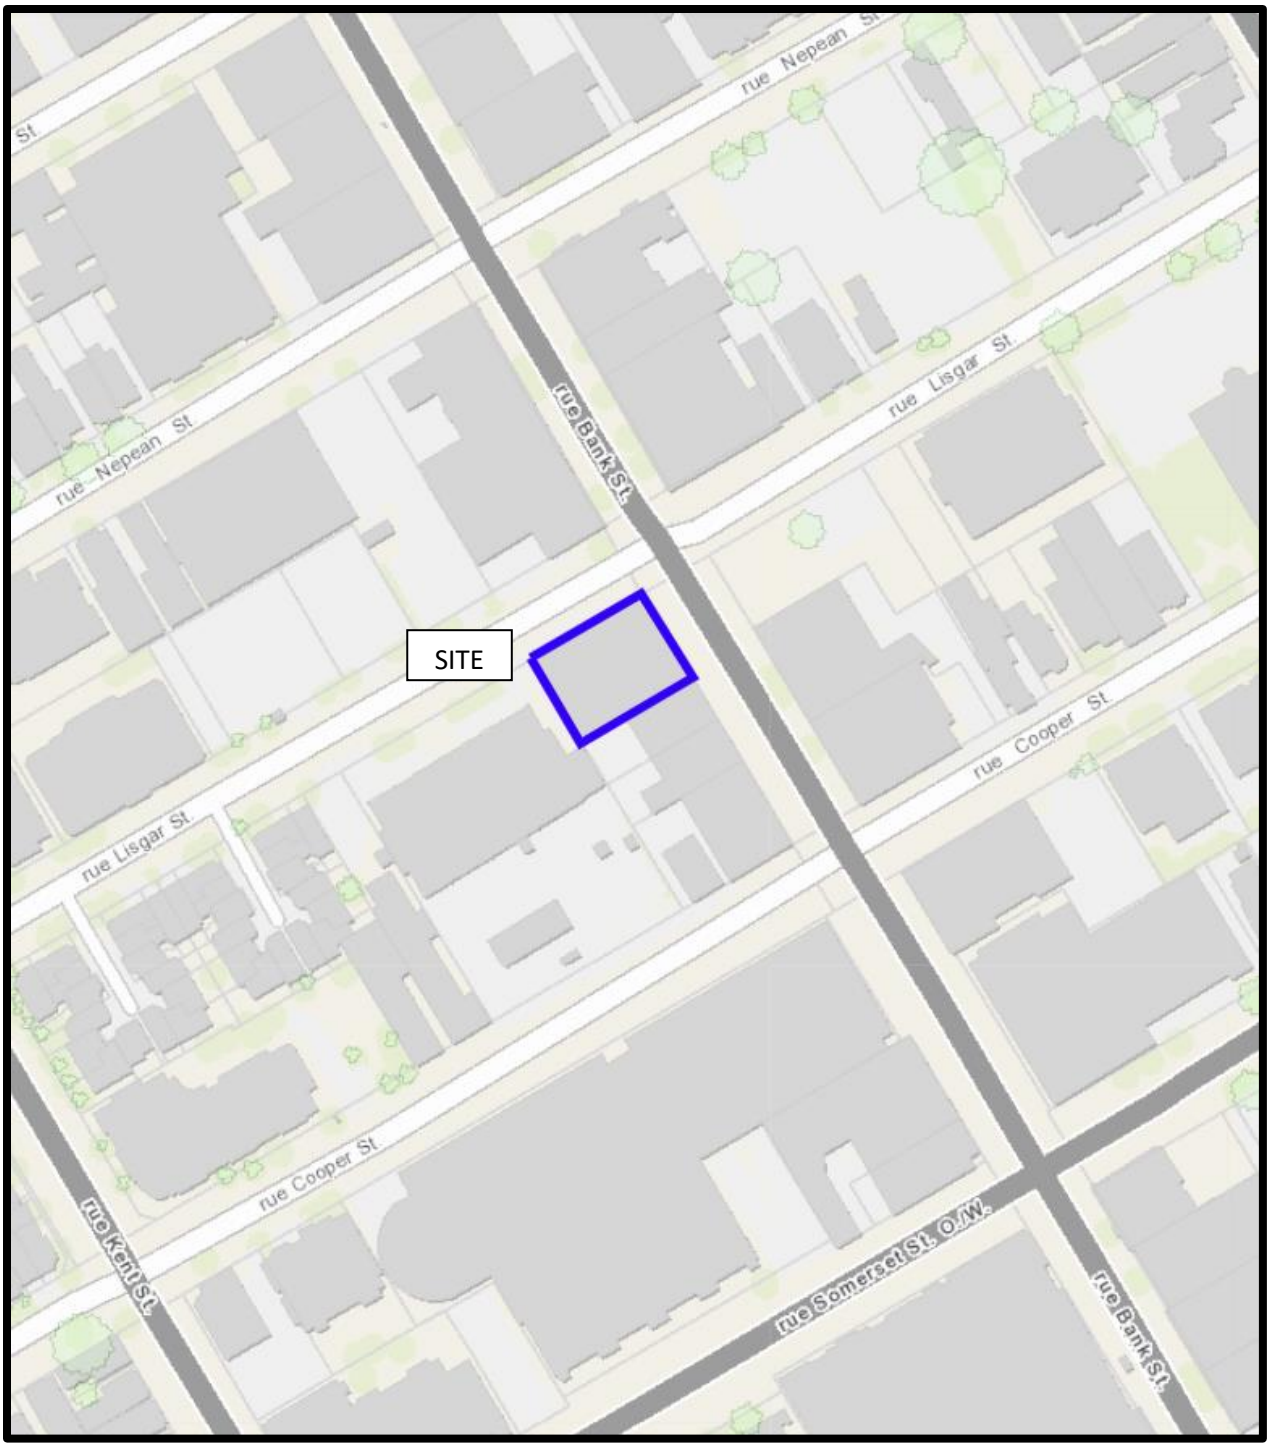

FIGURE 1

KEY PLAN

PATERSON GROUP

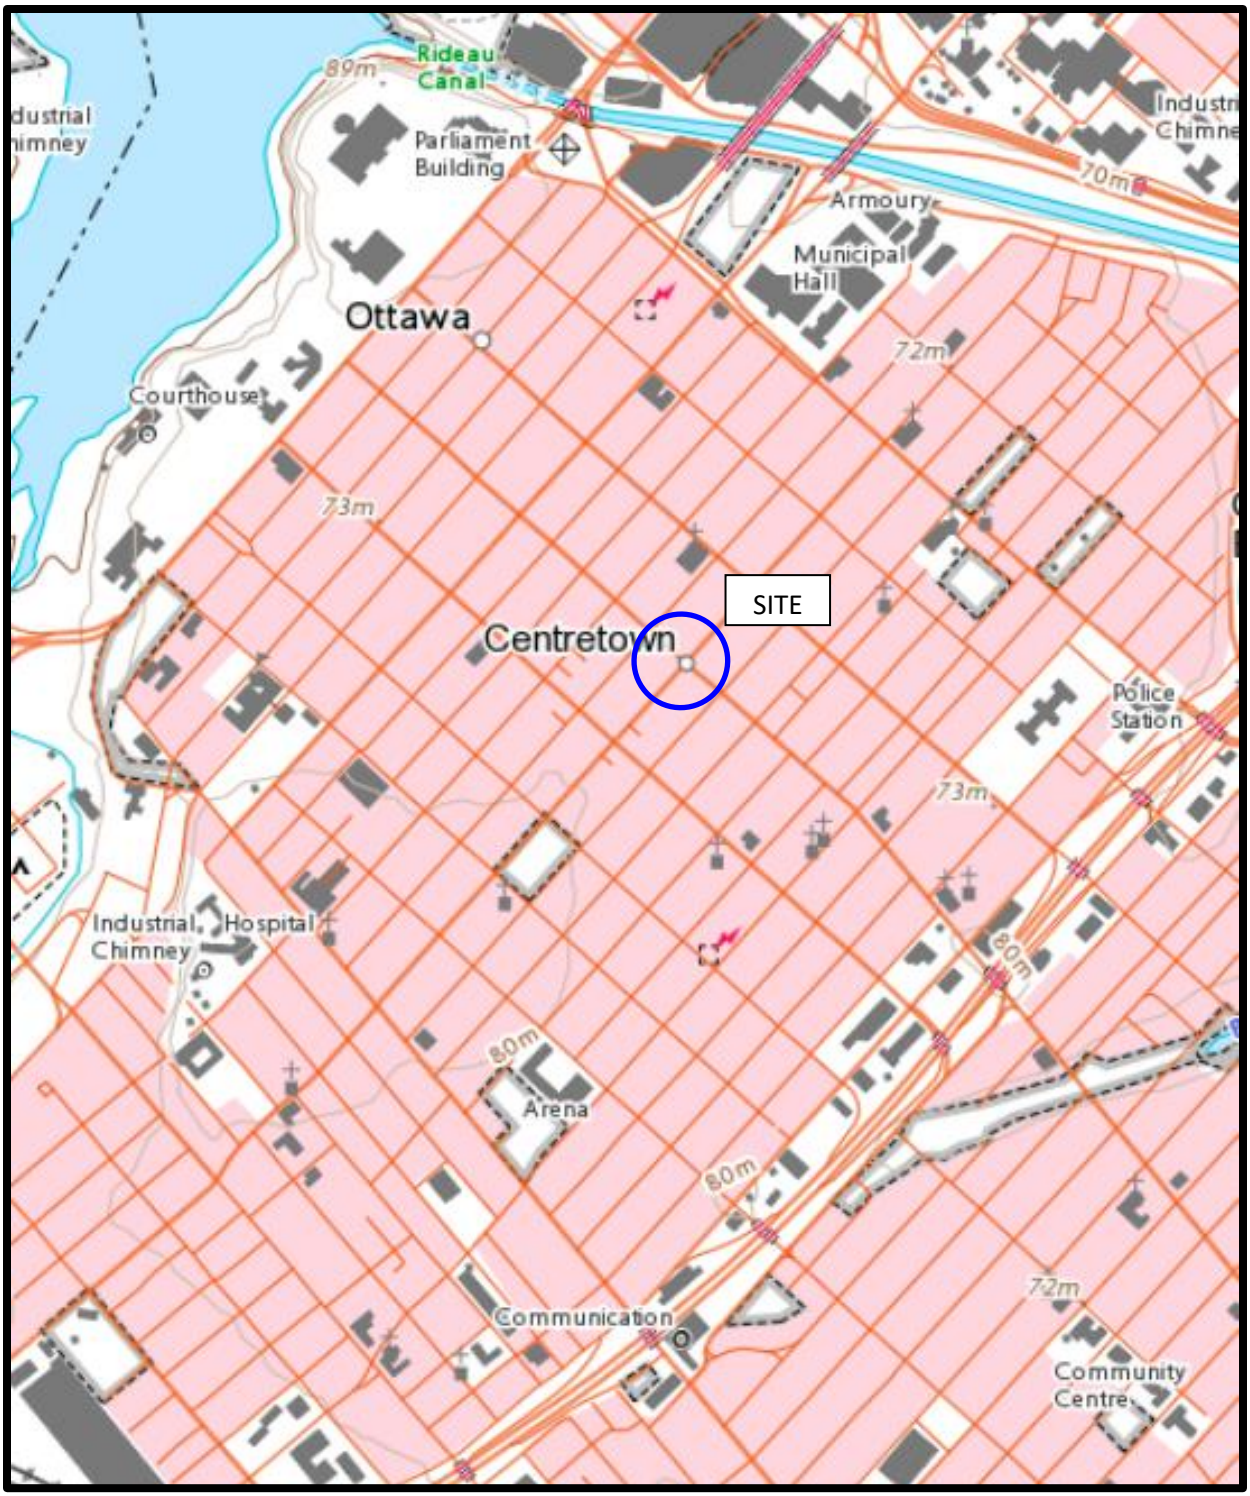

FIGURE 2

TOPOGRAPHIC MAP

365 LISGAR STREET
VACANT (PARKLING LOT)

222 NEPEAN STREET
COMMERCIAL (OFFICE SPACE)

212 BANK STREET
COMMERCIAL (RESTAURANT)

223 BANK STREET
COMMERCIAL (RETAIL/OFFICE SPACE)

SIDEWALK

LISGAR STREET

SIDEWALK

APEC 1 & 2

240 BANK STREET
SIX-STOREY COMMERCIAL/OFFICE BUILDING
(GIFT SHOP, JEWELER, COMIC BOOK STORE
AND OFFICE SPACE)

BANK STREET

318 BANK STREET
VACANT

360 LISGAR STREET
COMMERCIAL (OFFICE SPACE)

SIDEWALK

242 BANK STREET
COMMERCIAL (NAIL SALON)

243 BANK STREET
COMMERCIAL (RETAIL)

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	31	FORMER PRINTERS
2	28/52	FORMER AUTOMOTIVE SERVICE GARAGE

LEGEND:

PHASE I ESA PROPERTY BOUNDARY

SCALE: 1:250

0 1 2 3 4 5 10 15m

PATERSON GROUP
9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

240 BANK STREET HOLDINGS LTD.

PHASE I - ENVIRONMENTAL SITE ASSESSMENT
240 BANK STREET

OTTAWA, ONTARIO

Title:

SITE PLAN

Scale: 1:250	Date: 09/2025
Drawn by: ZS	Report No.: PE6874-1R
Checked by: KP	Dwg. No.: PE6874-1
Approved by: MB	Revision No.:

11x17

p:\autocad drawings\environmental\pe68xx\pe6874\pe6874-1-site plan.dwg

POTENTIALLY CONTAMINATING ACTIVITIES :

ID #	PCA ID	DESCRIPTION
1	31	FORMER PRINTERS
2	28/52	FORMER AUTOMOTIVE SERVICE GARAGE (WITH 3 USTS)
3	31	FORMER PRINTERS
4	31	FORMER PRINTERS
5	31	FORMER PRINTERS
6	37	FORMER DRY CLEANERS
7	37	FORMER DRY CLEANERS
8	29	FORMER GLASS INDUSTRY
9	52	FORMER AUTOMOTIVE SERVICE GARAGE
10	28/52	FORMER DAIRY COMPANY WITH TRUCK STORAGE AND REPAIR (WITH 1 UST)
11	37	FORMER DRY CLEANERS
12	29	FORMER GLASS INDUSTRY
13	37	FORMER AND EXISTING DRY CLEANERS
14	37	FORMER DRY CLEANERS
15	28/52	FORMER AUTOMOTIVE SERVICE GARAGE (WITH 1 UST)
16	31	FORMER PRINTERS
17	31	FORMER PRINTERS
18	52	FORMER AUTOMOTIVE SERVICE GARAGE
19	37	FORMER DRY CLEANERS
20	37	FORMER DRY CLEANERS
21	37	FORMER DRY CLEANERS AND FORMER PRINTERS
22	31	FORMER PRINTERS
23	37	FORMER DRY CLEANERS
24	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
25	31	FORMER PRINTERS
26	37	FORMER DRY CLEANERS
27	37	FORMER DRY CLEANERS AND FORMER PRINTERS
28	31	FORMER PRINTERS
29	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
30	52	FORMER AUTOMOTIVE STORAGE AND SALES
31	N/A	ETHYLENE GLYCOL SPILL
32	55	EXISTING TRANSFORMERS WITH PCB
33	37	FORMER DRY CLEANERS
34	37	FORMER DRY CLEANERS
35	28/31	FORMER PRINTERS AND EXISTING 3 ASTS
36	52	FORMER AUTOMOTIVE SERVICE GARAGE
37	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
38	28	FORMER RETAIL FUEL OUTLET (WITH 3 USTS) AND REPORTED FURNACE OIL SPILL
39	31	FORMER PRINTERS
40	37	FORMER DRY CLEANERS
41	28	FORMER AST
42	37	FORMER DRY CLEANERS
43	37/52	FORMER AUTOMOTIVE STORAGE AND SALES & FORMER DRY CLEANERS
44	28	FORMER RETAIL FUEL OUTLET (WITH 4 USTS)
45	19	FORMER ELECTRICAL COMPONENT MANUFACTURER
46	33	FORMER MACHINE SHOP
47	31	FORMER PRINTERS
48	31	FORMER PRINTERS
49	31	FORMER PRINTERS
50	10,31	FORMER AUTOMOTIVE PAINT SHOP AND PRINTERS
51	52	FORMER AUTOMOTIVE SERVICE GARAGE
52	52	FORMER AUTOMOTIVE SERVICE GARAGE
53	31	FORMER PRINTERS
54	37	FORMER DRY CLEANERS

PHASE I ENVIRONMENTAL SITE ASSESSMENT STUDY AREA

SITE

LEGEND:

PHASE I ESA PROPERTY BOUNDARY

SCALE: 1:2500

0 25 50 75 100 125 150 175m

PATERSON GROUP
9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

240 BANK STREET HOLDINGS LTD.

PHASE I - ENVIRONMENTAL SITE ASSESSMENT
240 BANK STREET

OTTAWA, ONTARIO

Title:

SURROUNDING LAND USE PLAN

Scale: 1:2500	Date: 09/2025
Drawn by: ZS	Report No.: PE6874-1R
Checked by: KP	Dwg. No.: PE6874-2
Approved by: MB	Revision No.:

p:\autocad drawings\environmental\pe68xx\pe6874\pe6874-2-surrounding land use plan.dwg

11x17

APPENDIX 1

PLAN OF SURVEY

AERIAL PHOTOGRAPHS

SITE PHOTOGRAPHS

rachel@rester.ca
Project Phoenix/15:10:2020 05:24
CONFIDENTIAL

SURVEYOR'S REAL PROPERTY REPORT
PART 1 - Plan of
LOT 34 (South Lisgar Street)
REGISTERED PLAN 12281
CITY OF OTTAWA

Surveyed by
ANNIS, O'SULLIVAN, VOLLEBEKK LTD.

Scale 1 : 150

6 4.5 3 1.5 0 3 6 Metres

Metric
DISTANCES SHOWN ON THIS PLAN ARE IN METRES AND CAN BE CONVERTED TO FEET BY DIVIDING BY 0.3048

Surveyor's Certificate
I CERTIFY THAT :

1. This survey and plan are correct and in accordance with the Surveys Act, the Surveyors Act, the Land Titles Act and the regulations made thereunder.
2. The survey was completed on the 5th day of December, 2005.

Dec. 16 2005
Date

E.H. Harveyer
Ontario Land Surveyor

PART 2
THIS PLAN MUST BE READ IN CONJUNCTION WITH SURVEY REPORT DATED December 6, 2005

ANNIS, O'SULLIVAN, VOLLEBEKK LTD. grants to Paradigm Properties Inc. ("The Client") their solicitors, mortgagees, and other related parties, permission to use original, signed, sealed copies of the Surveyor's Real Property Report in transactions involving The Client

Notes & Legend
- ⊙ Denotes Survey Monument Planted.
- ■ " Survey Monument Found.
- SIB " Standard Iron Bar.
- SSIB " Short Standard Iron Bar.
- IB " Iron Bar.
- CC " Cut Cross.
- (WIT) " Witness.
- Meas. " Measured.
- (P1) " Plan by (AOG) December 1, 2004.
- (P2) " Registered Plan 12281.
- (P3) " Plan by (647) July 20, 1965.
- (P4) " Plan by (AOG) July 27, 1983.
- (P5) " Plan by (990) October 11, 1966.
- (P6) " Plan by (632) May 26, 1965.
- (P7) " Plan by (AOG) July 10, 1995.
- (AOG) " Annis, O'Sullivan, Vollebekk Ltd.
- Bldg " Building.
- Fdn " Foundation.
- Meas " Measured.
- Acc " Accepted.
- ● " Bollard (Centre Noted).

Bearings are astronomic, derived from the northerly limit of Cooper Street as shown on Plan 4R-12112 having a bearing of N59°34'20"E.

ASSOCIATION OF ONTARIO LAND SURVEYORS PLAN SUBMISSION FORM
1613170

This PLAN IS NOT VALID UNLESS IT IS AN EMBOSSED COPY IN ACCORDANCE WITH Regulation 1026, Section 29 (3)

© Annis, O'Sullivan, Vollebekk Ltd. 2005.
"THIS PLAN IS PROTECTED BY COPYRIGHT"

ANNIS, O'SULLIVAN, VOLLEBEKK LTD.
14 Concourse Gate, Suite 500
Nepean, Ont. K2E 7S6
Phone: (613) 727-0850 / Fax: (613) 727-1079
Email: Nepean@annisott.com

Ontario Land Surveyors

Job No. 6783-05 | D
6783-05 Paradigm SRPR Lot 34 W Bank Pl 12281 Ottawa D.dwg

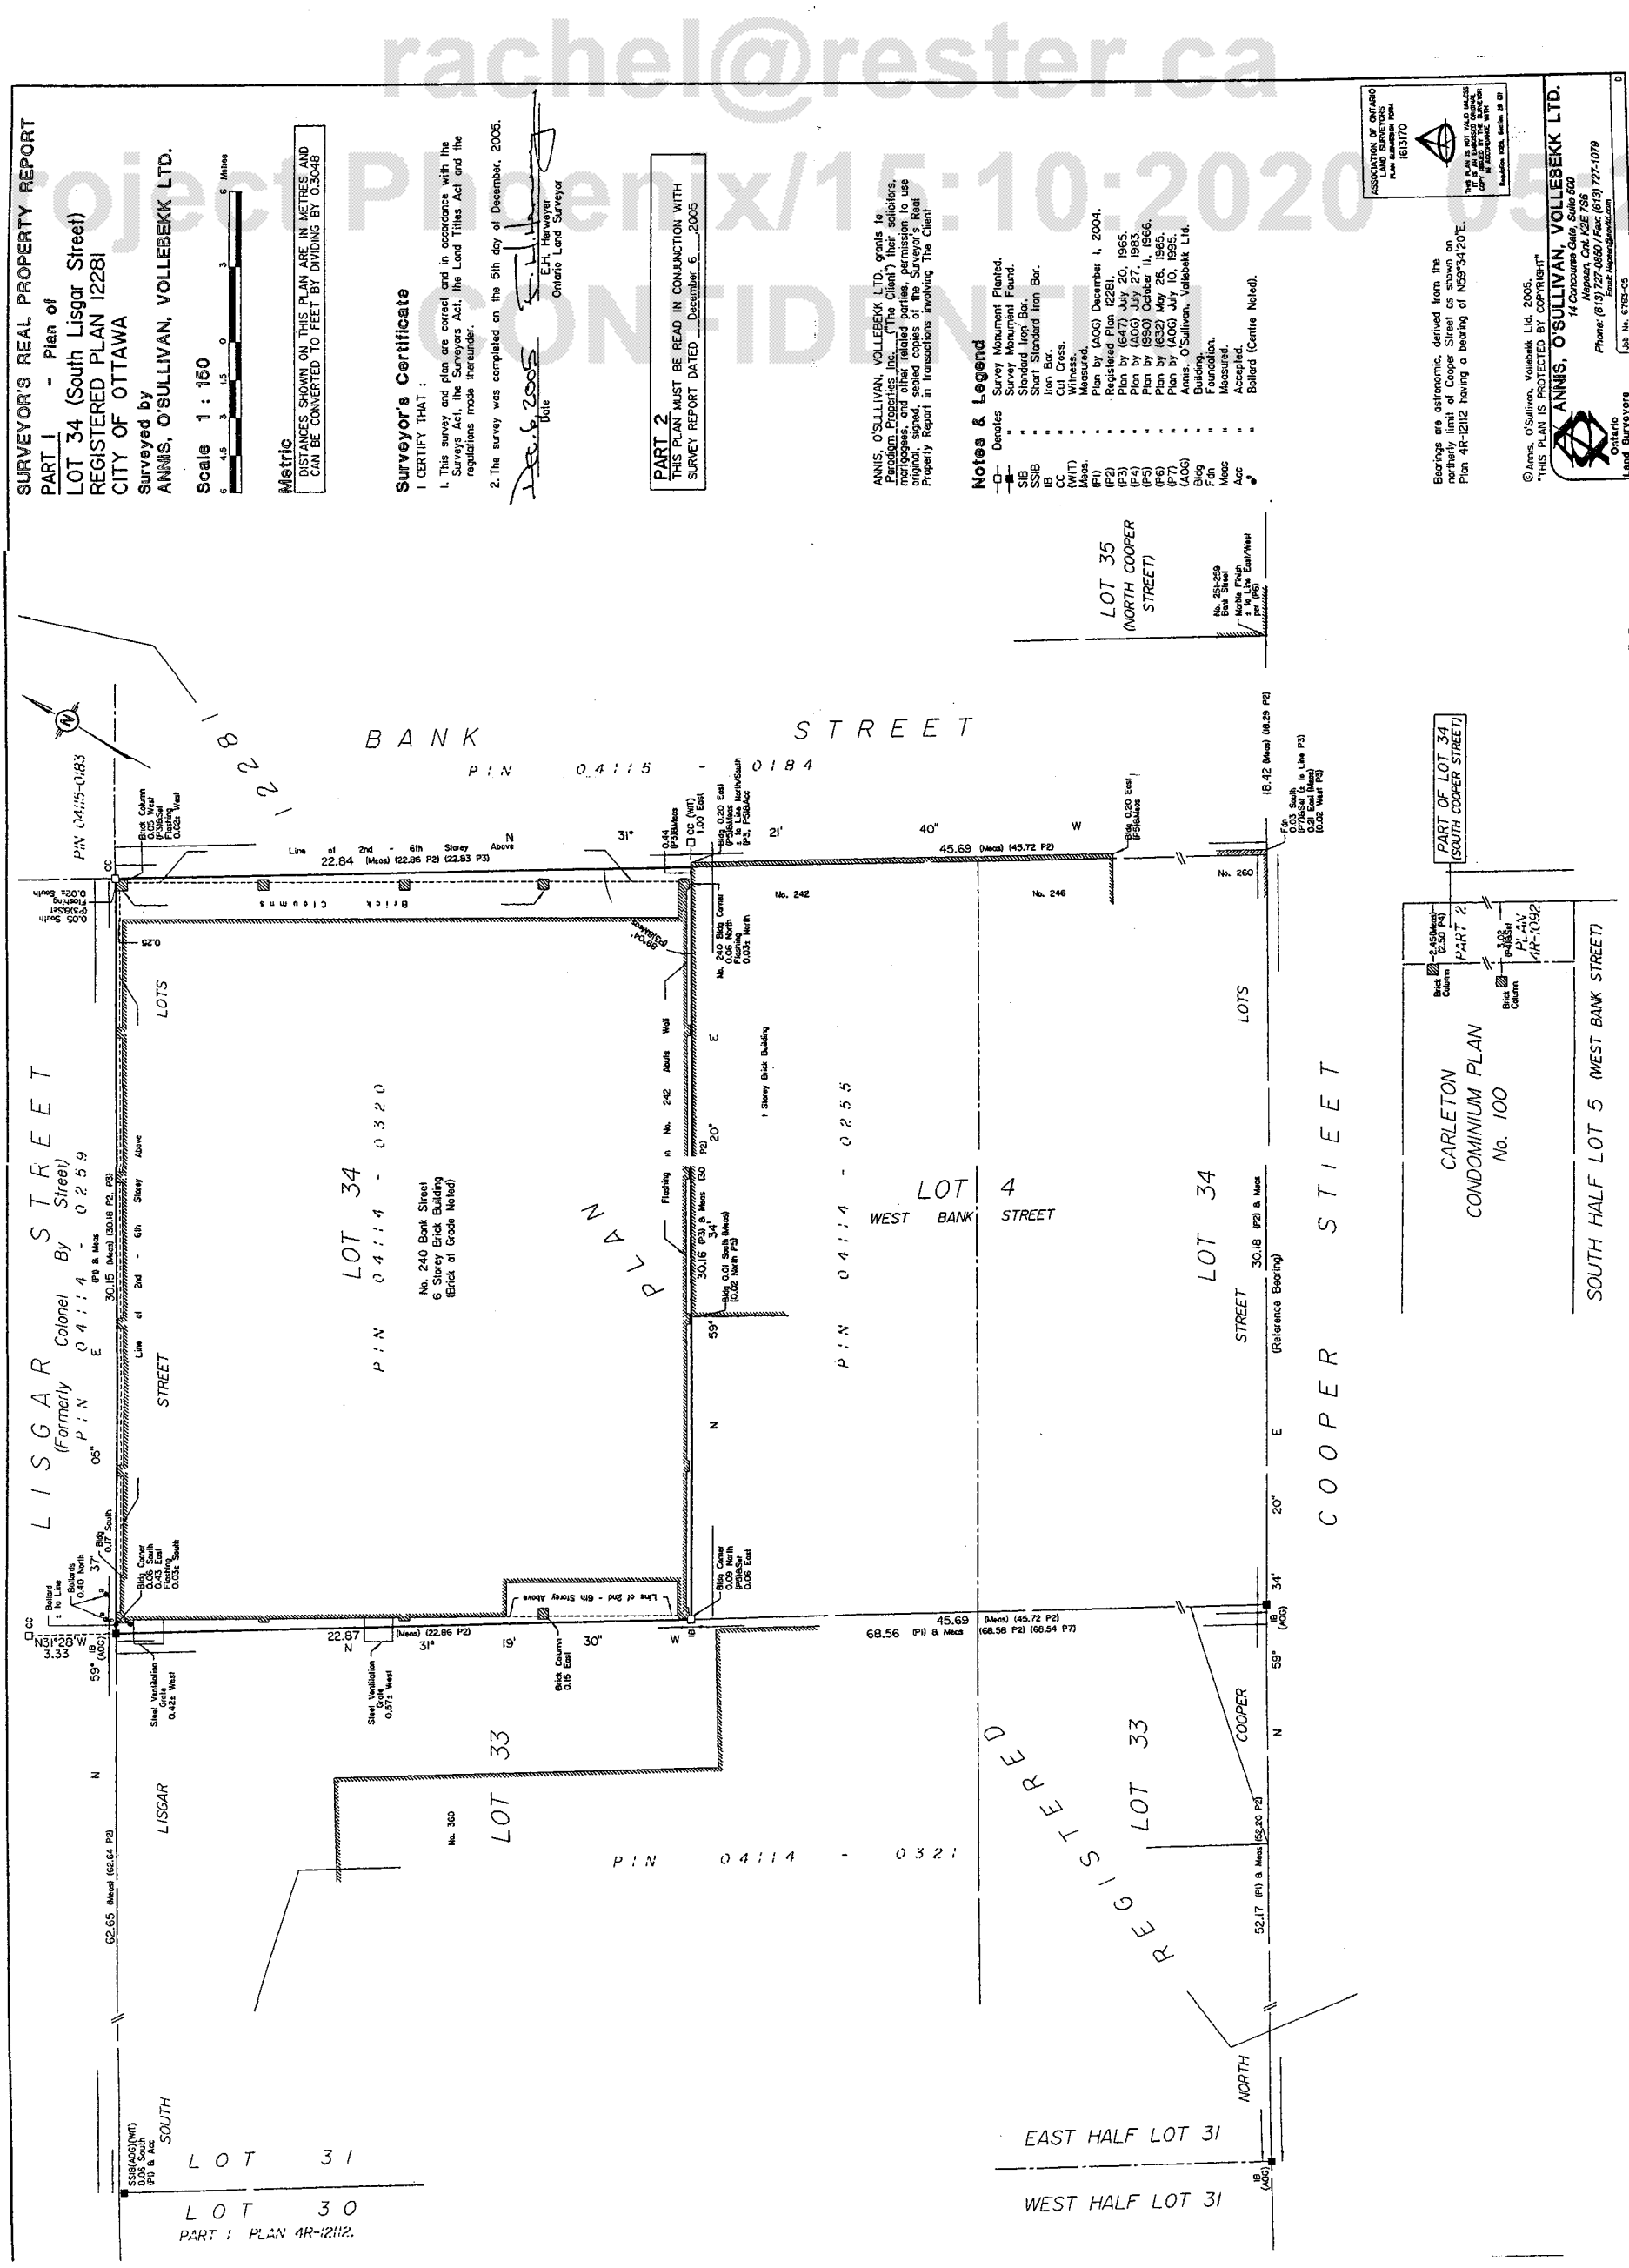

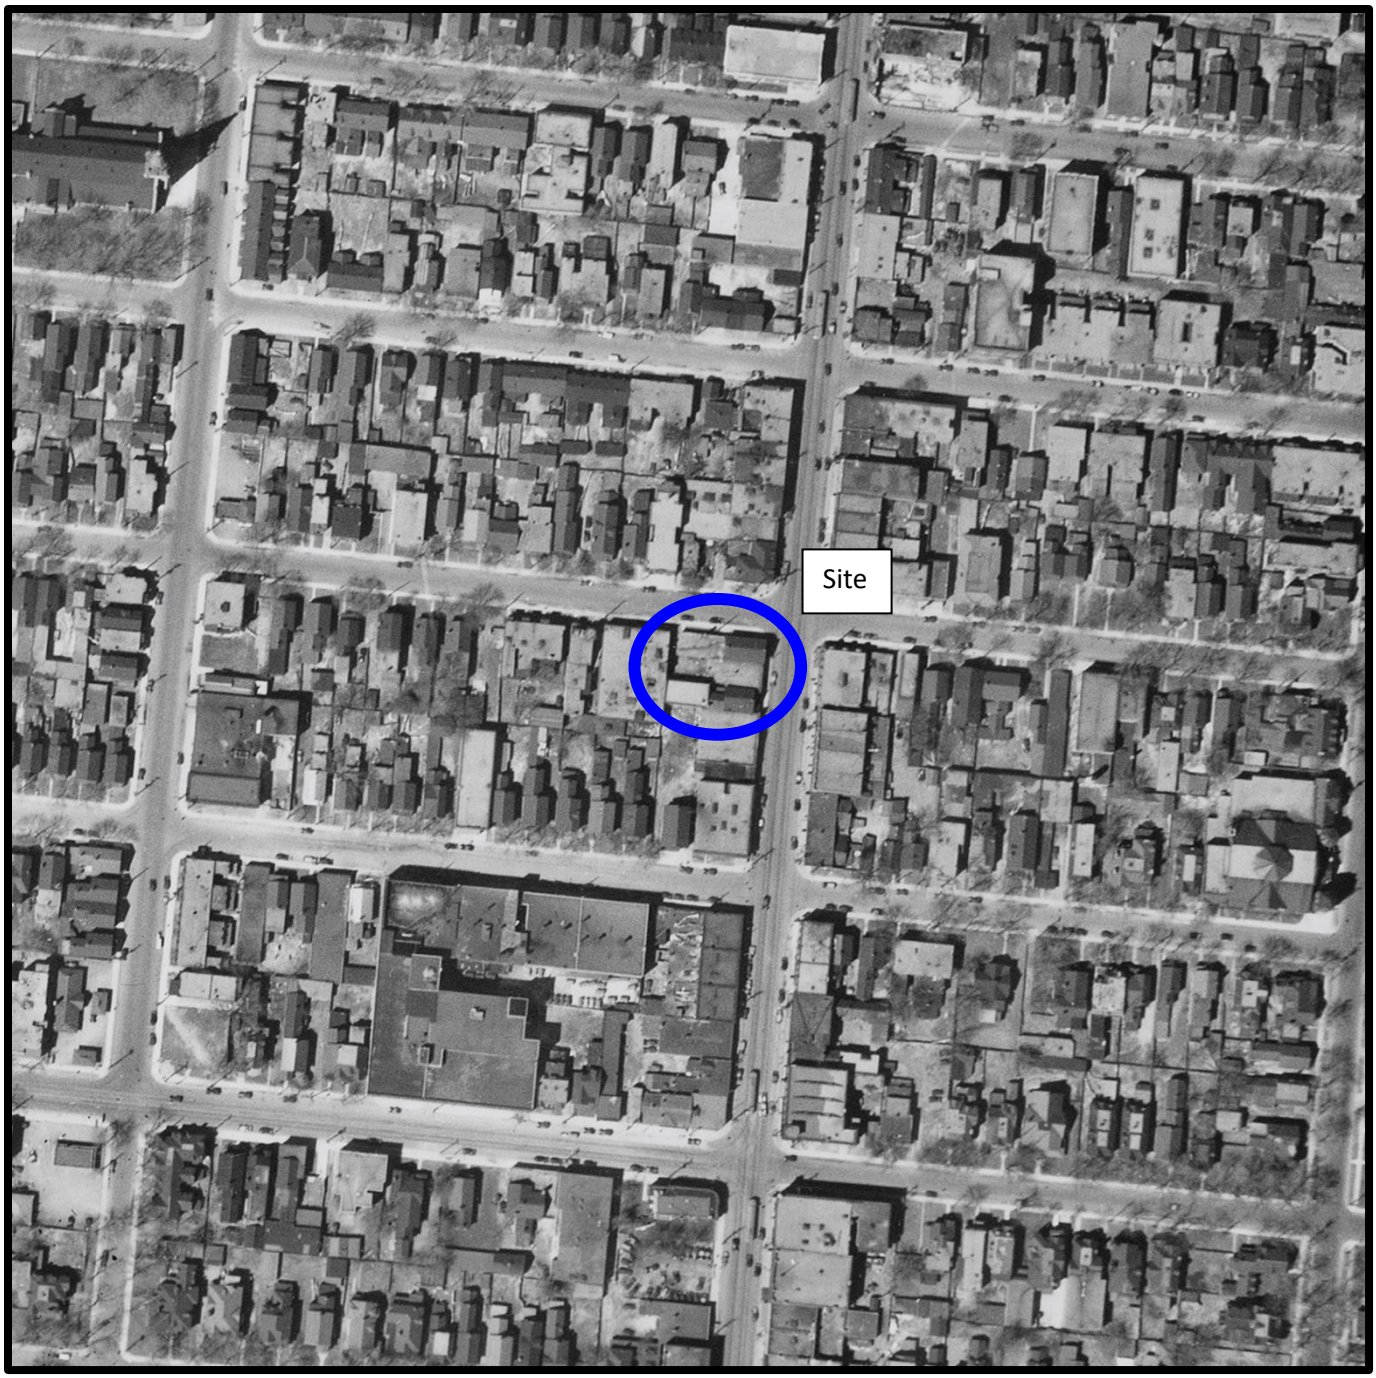

AERIAL PHOTOGRAPH
1933

PATERSON GROUP

AERIAL PHOTOGRAPH
1949

PATERSON GROUP

AERIAL PHOTOGRAPH
1958

PATERSON GROUP

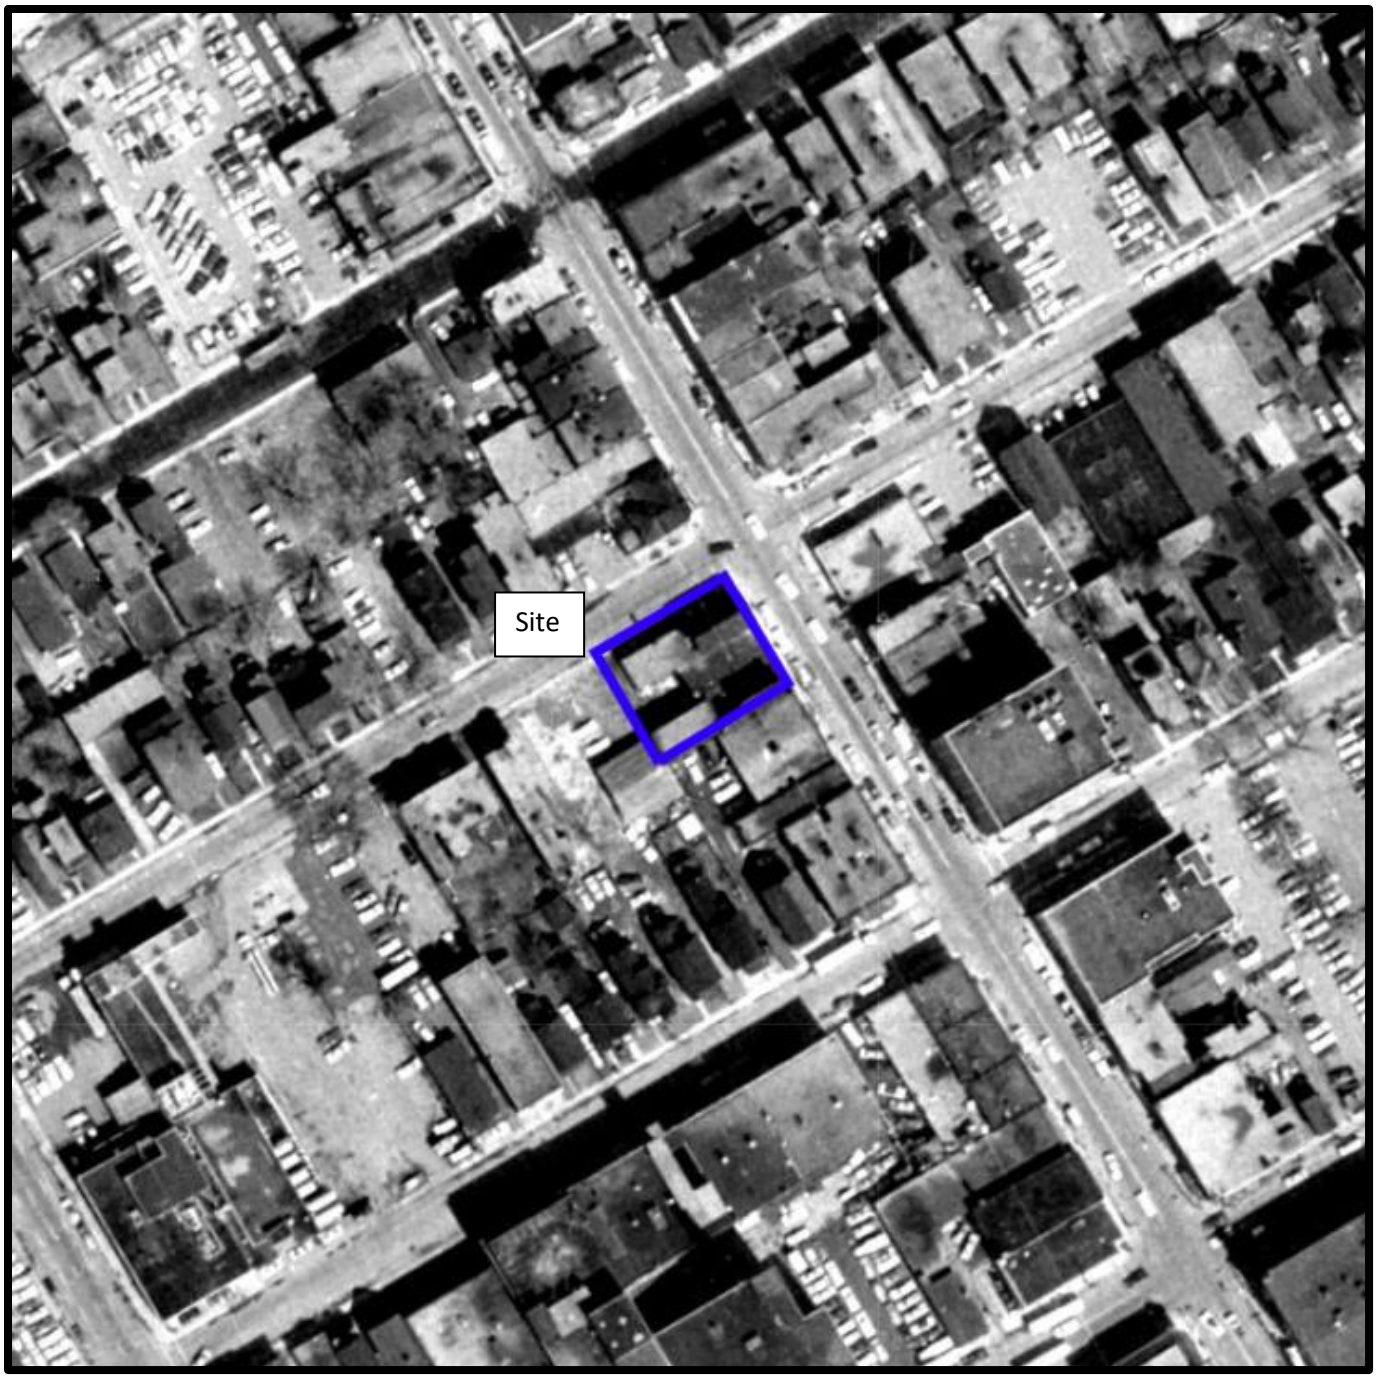

AERIAL PHOTOGRAPH
1965

PATERSON GROUP

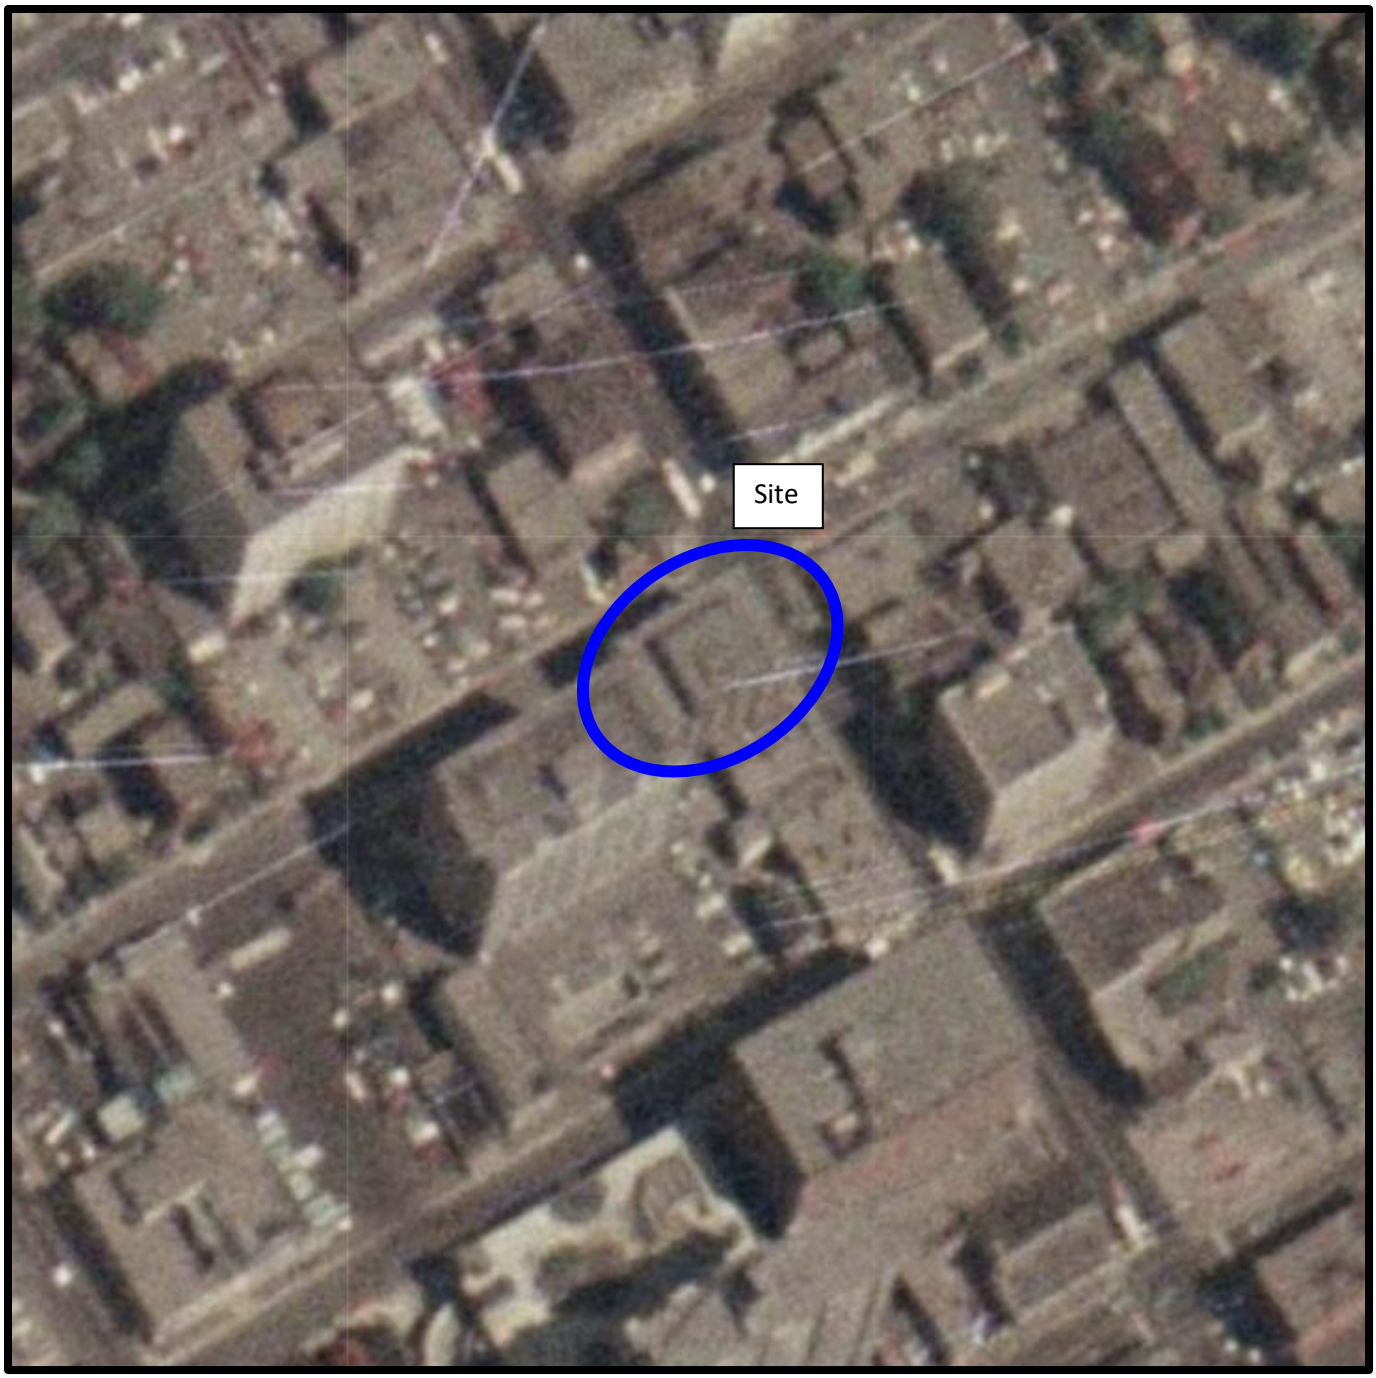

AERIAL PHOTOGRAPH
1976

PATERSON GROUP

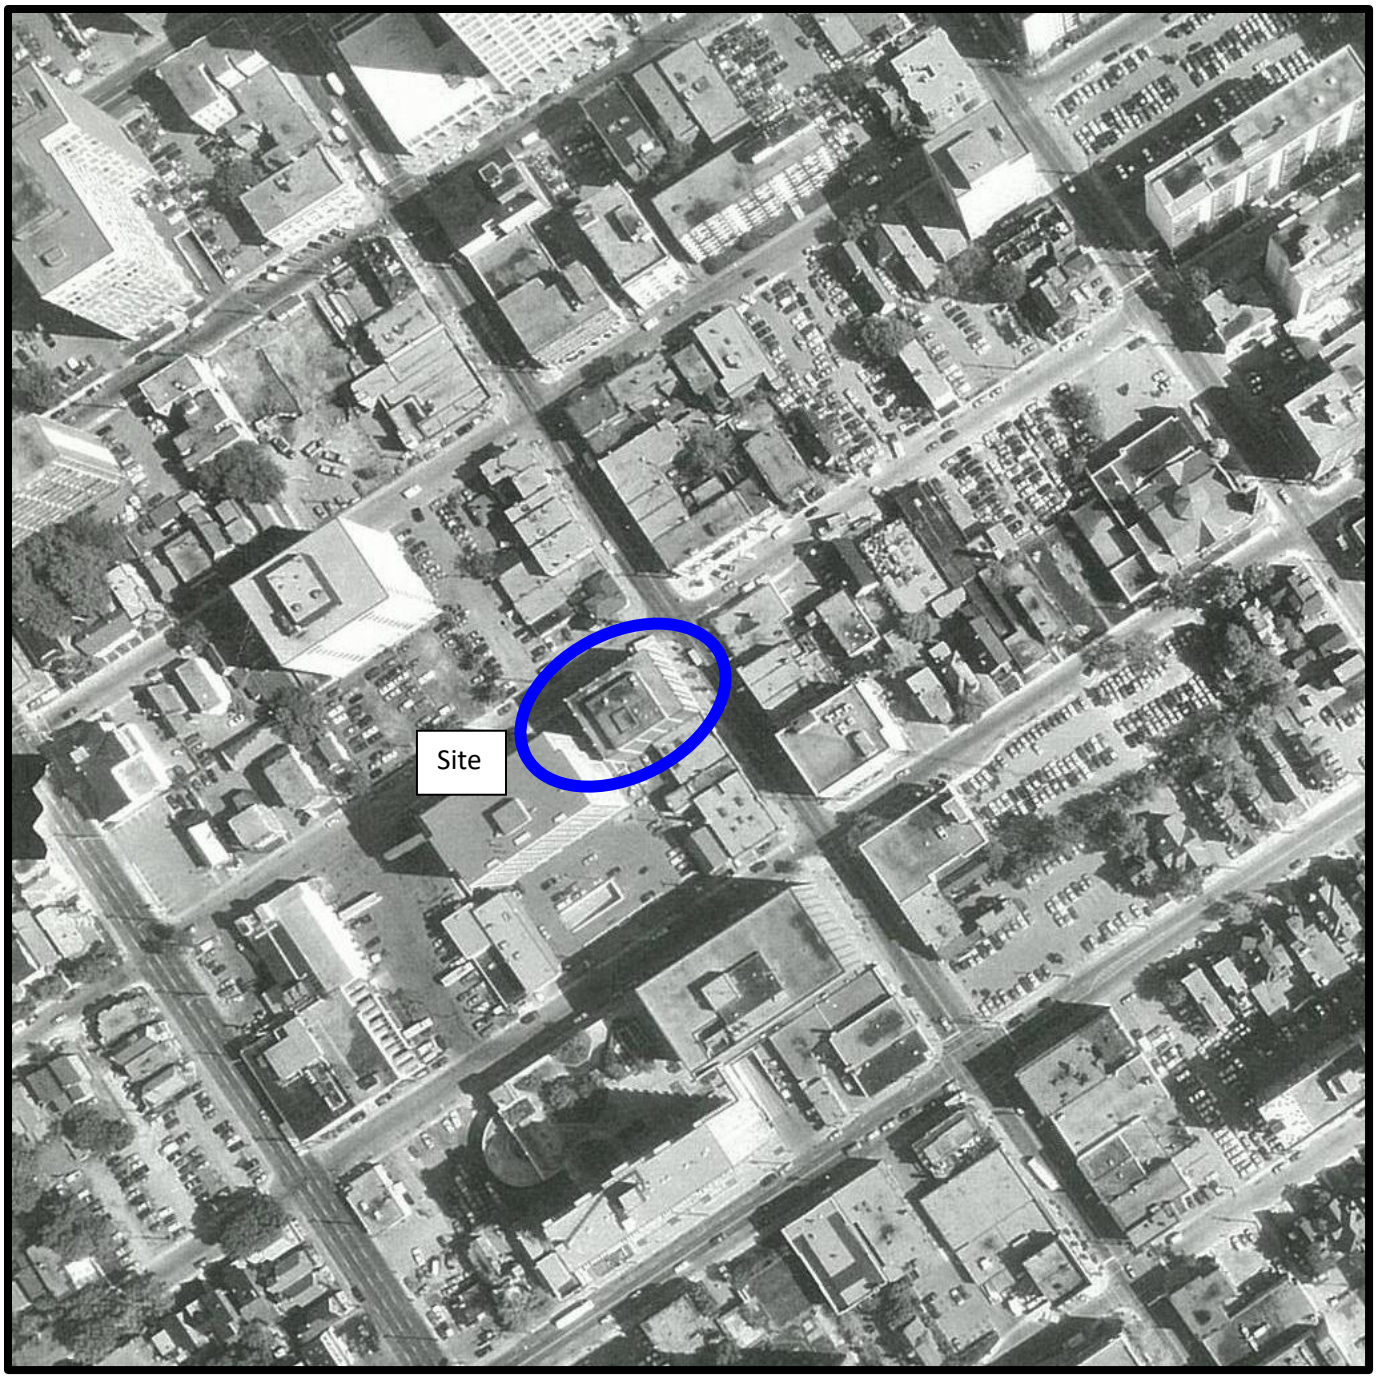

AERIAL PHOTOGRAPH
1984

PATERSON GROUP

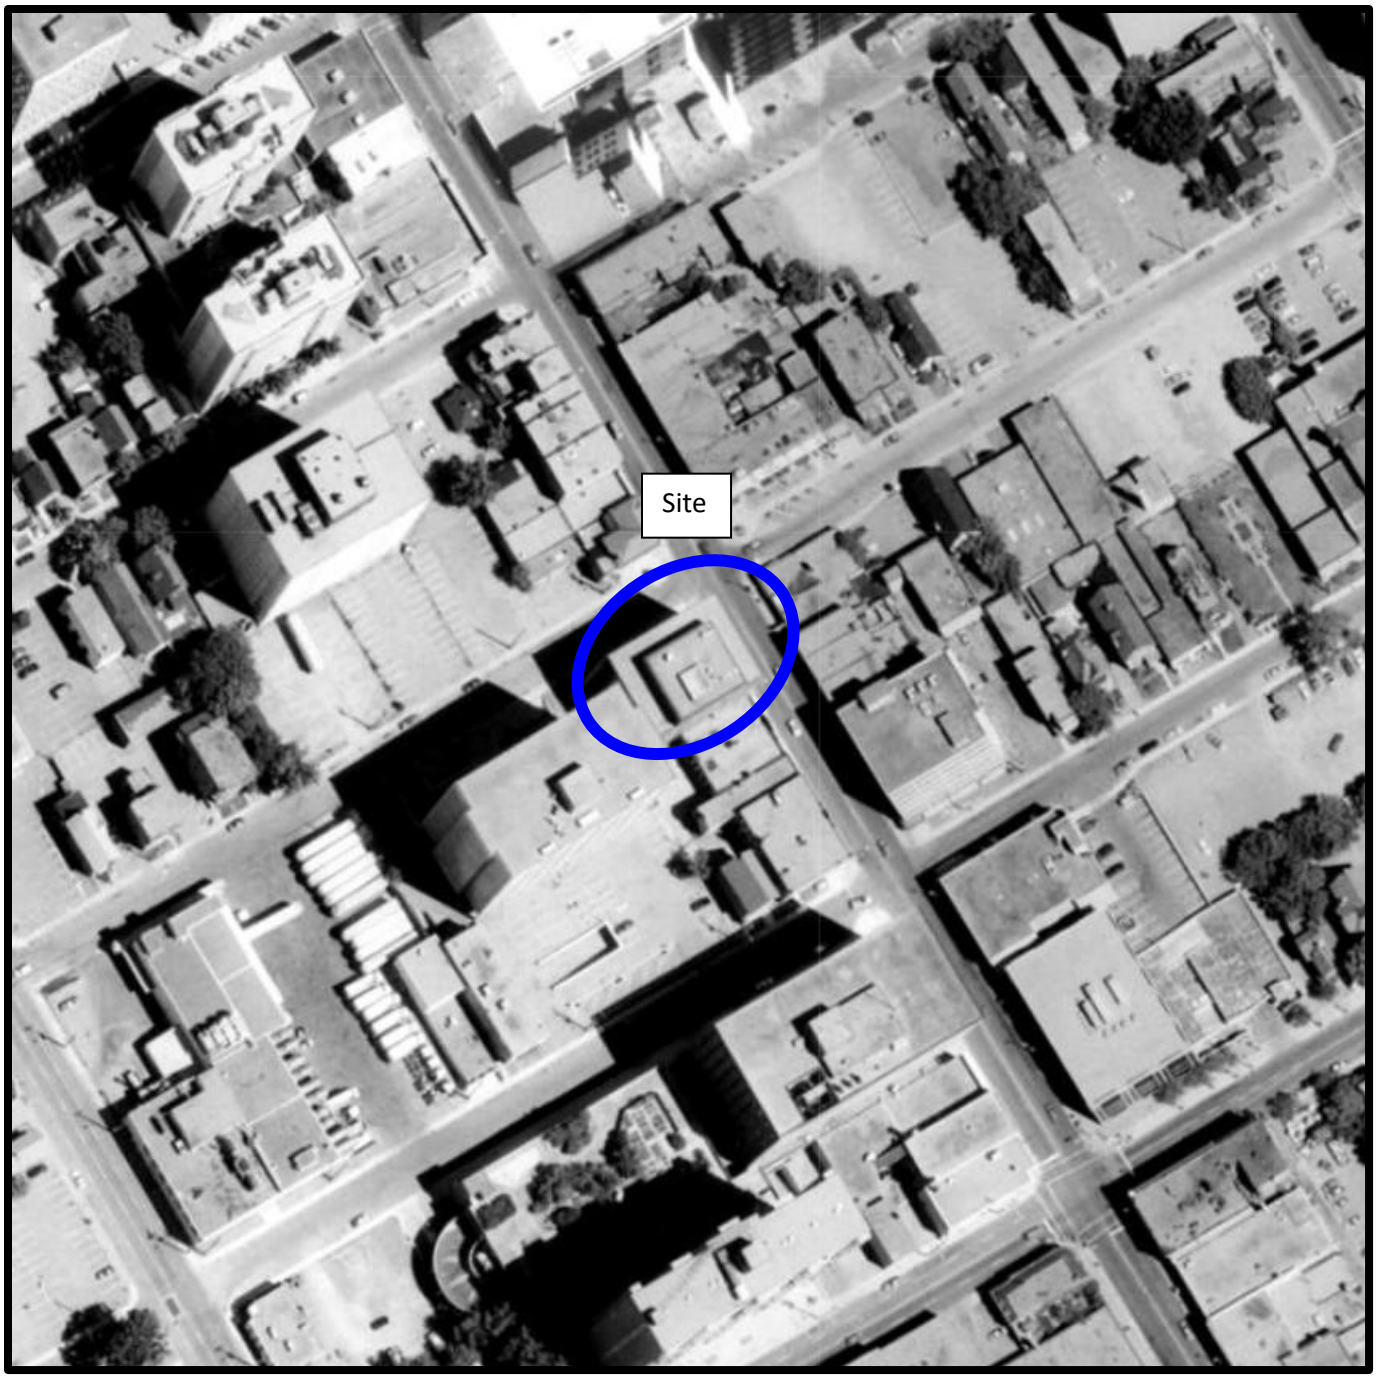

AERIAL PHOTOGRAPH
1991

PATERSON GROUP

AERIAL PHOTOGRAPH
2002

PATERSON GROUP

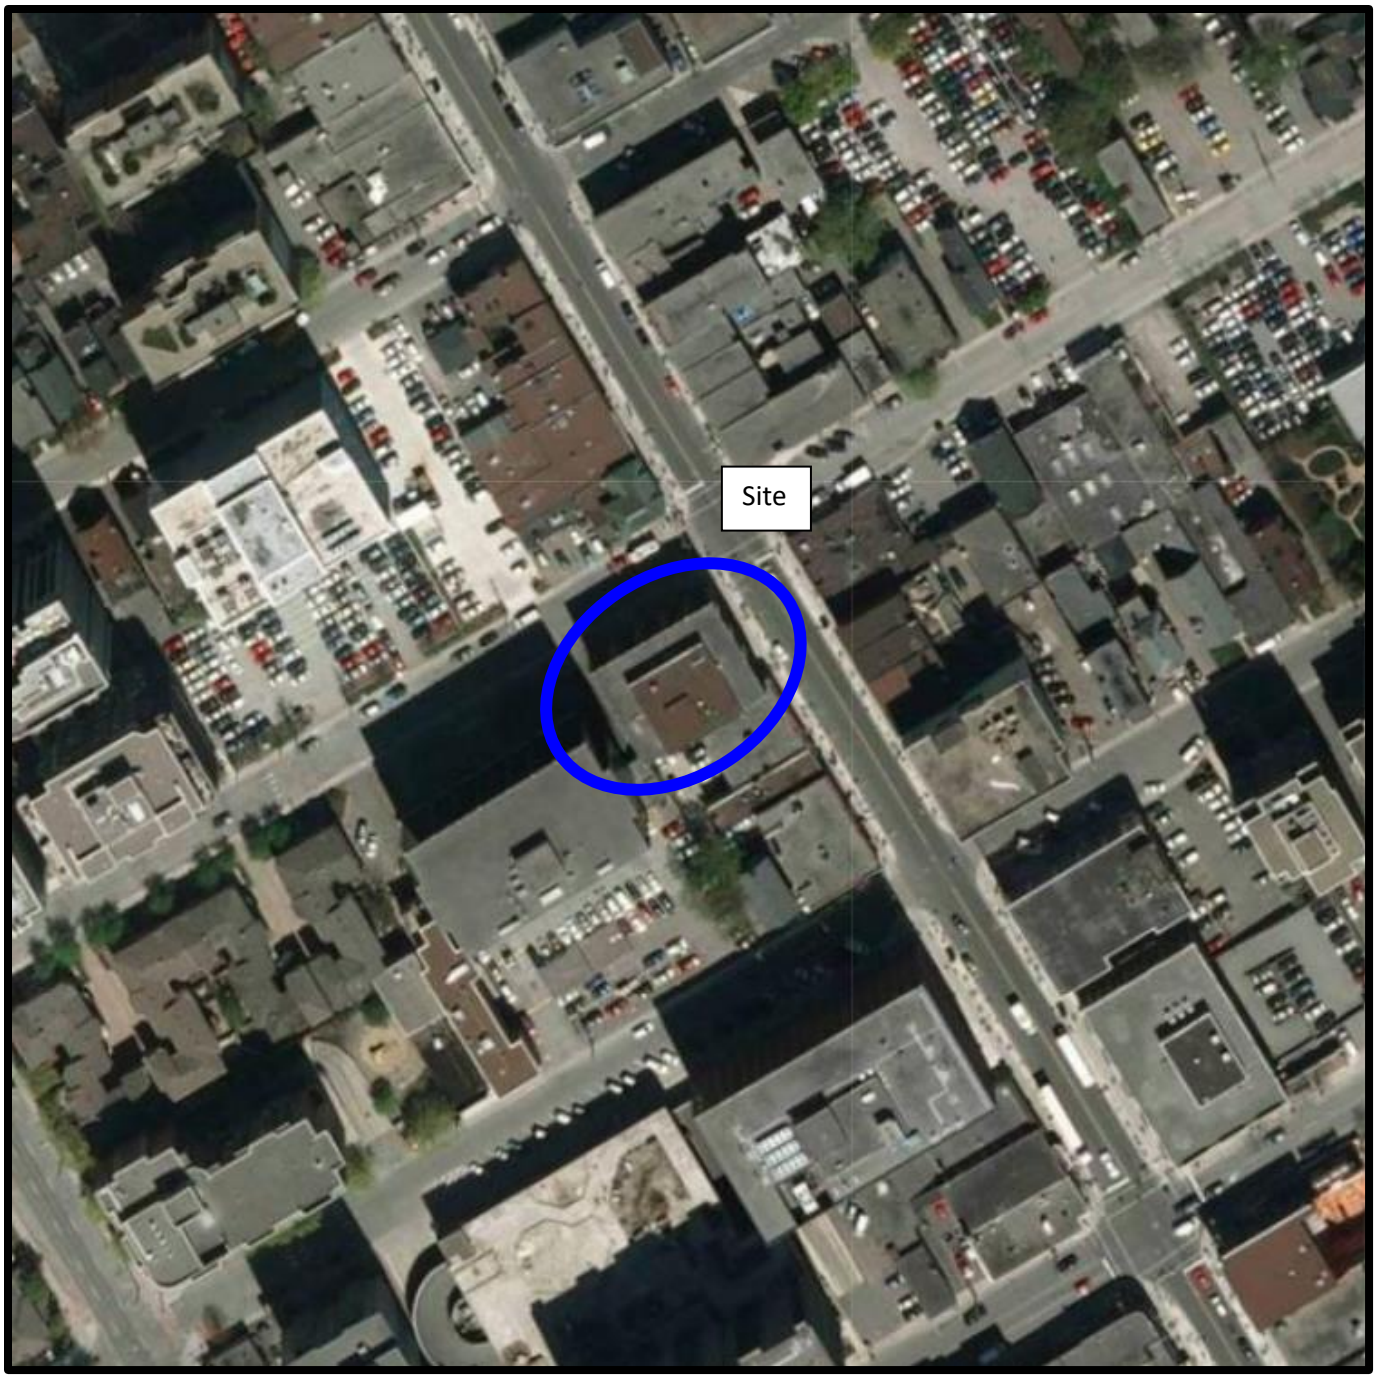

AERIAL PHOTOGRAPH
2011

PATERSON GROUP

AERIAL PHOTOGRAPH
2024

PATERSON GROUP

Site Photographs

PE6874 240 Bank Street, Ottawa ON January 24, 2025

Photograph 1: View of the Phase I Property from Bank Street, facing south.

Photograph 2: View of the Phase I Property from Lisgar Street, facing west.

APPENDIX 2

MECP FREEDOM OF INFORMATION

MECP WELL RECORDS

TSSA CORRESPONDENCE

CITY OF OTTAWA HLUI

ERIS REPORT

Ministry of the Environment, Conservation and Parks

Corporate Services Branch
40 St. Clair Avenue West
Toronto ON M4V 1M2

Ministère de l'Environnement, de la Protection de la nature et des Parcs

Direction des services ministériels
40, avenue St. Clair Ouest
Toronto ON M4V 1M2

Ontario

February 25, 2025

Mr. Kuldeep Panchal
Paterson Group
9 Auriga Drive
Ottawa, Ontario
kpanchal@patersongroup.ca

Dear Kuldeep Panchal:

RE: MECP FOI A-2025-00285, Your Reference #: PE6874 – Record Release Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to:

> 240 Bank Street (Known historic 234, 236, & 238 Bank Street), Ottawa
> Timeframe: January 1st, 1900 to January 14th, 2025

Your final fee payment was received by this office. If payment was not in Canadian dollars, please contact our office immediately.

Attached is a copy of the records.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at http://www.ipc.on.ca. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Roxanne Chambers at 807-456-3035 or roxanne.chambers@ontario.ca.

Yours truly,

Roxanne Chambers

for
Josephine DeSouza
Manager, Access and Privacy Office

Attachment

Ontario

Hazardous Waste Information

These are historical waste records from the Hazardous Waste Information Network (HWIN) and System (HWIS), operated by the Ministry of the Environment, Conservation, and Parks. As of January 1, 2023, Resource Productivity and Recovery Authority's (RPRA) Hazardous Waste Program Registry has replaced HWIN.

Generator Details (HWIN)

Registration/Notification Number
ON2848712

Legal Company Name

Primary Name:	Al's Care Pharmacy	Division Name:	N/A

Company Operating Name

Primary Name:	Al's Care Pharmace	Division Name:	N/A

Mailing Address

Division Building:	N/A	P.O. Box:	N/A
Address Line 1:	240 Bank Street	Address Line 2:	N/A
Town/City:	Ottawa	Postal/Zip Code:	K2P1X4
County (if in ON):	OTTAWA CARLTON (RM)	Province/State (if in CAN/US):	ONTARIO
County (if outside ON):	N/A	Province/State (if outside CAN/US):	N/A

Site Location

Division Building:	N/A	P.O. Box:	N/A
Address Line 1:	240 Bank Street	Address Line 2:	N/A
Town/City:	Ottawa	Postal/Zip Code:	K2P1X4
County (if in ON):	OTTAWA CARLTON (RM)	Province/State (if in CAN/US):	ONTARIO
County (if outside ON):	N/A	Province/State (if outside CAN/US):	N/A

Inactive Waste Classes (ON2848712)

No inactive waste listings.

Active Waste Classes (ON2848712)

Active Off-Site Waste Classes

Waste Class	Hazardous Waste Number (per waste stream)	Reg.347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Phsyical State	Off-Site	Status
261 - A	P001	2A	Incineration	N		Solid	Off-Site	Active
312 - P	N/A					Solid	Off-Site	Active

ASE 366

C.

15 No 3876

RECEIVED
MAR 20 1948
GEOLOGICAL BRANCH
DEPARTMENT OF MINES

UTM | 18 | Z | 445310 | E
| 9 | R | 5021930 | N
Elev. | 9 | R | 021 ~~210~~ .
Basin | 215 |

ONTARIO

The Well Drillers Act

Department of Mines, Province of Ontario

Water Well Record

[redacted] ~~I-O.F.~~ ~~24~~ OTTAWA
.....Con.....Lot.....Pt. Lot.....
~~Acres~~ epean Ave. Woodroffe Ont.
Date Completed Feb. 12, 1948 Cost of Well (not including pump) $187.50

Pipe and Casing Record

Casing diameter(s) 4"
Length(s) of casing(s) 30 ft.
Length of screen
Type of screen
Type of pump
Capacity of pump
Depth of pump setting

Pumping Test

Date Feb. 12
Developed Capacity 10 G.P.M.
Duration of Test 30 min.
Pumping Rate 10 G.P.M.
Drawdown 4 ft.
Static level of completed well 8 ft.
Is well a gravel-wall type? No

Water Record

Kind (fresh or mineral) fresh
Quality (hard, soft, contains iron, sulphur etc.) hard
Appearance (clear, cloudy, coloured) clear
For what purpose(s) is the water to be used? household
How far is well from possible source of contamination? 20 ft.
What is source of contamination? privy
Enclose a copy of any mineral analysis that has been made of water

Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises

Well Log

Drift and Bedrock Record	From	To
silt	0 ft.	28 ft.
shale	28	75

Location of Well

In diagram below show distances of well from road and lot line

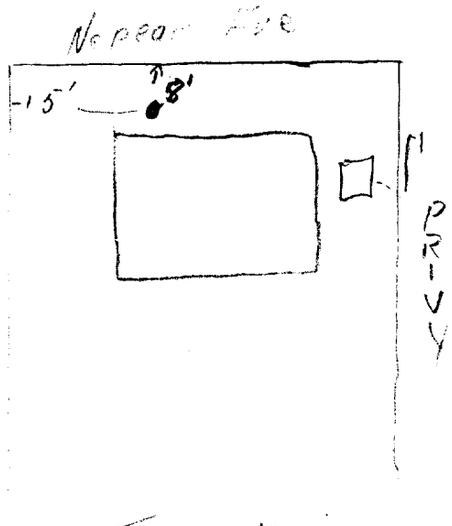

Situation: Is well on upland, in valley, or on hillside? upland
Drilling Firm F. A. McLean & Son
Address 185 James St. Ottawa
Recorded by C. D. McLean Address 185 James St. Ottawa
Date Mar. 15 1948 Licence Number

Ontario Ministry of the Environment

Well T [illegible] mber below)
A020628
A020628

Well Record
Regulation 903 Ontario Water Resources Act

page 1 of 2

Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
- All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
- Questions regarding completing this application can be directed to the Water Well Management Coordinator at 416-235-6203.
- **All metre measurements shall be reported to 1/10th of a metre.**
- Please print clearly in blue or black ink only.

Ministry Use Only
MUN | CON | LOT

[redacted]

Address of Well Location (County/District/Municipality): City of Ottawa | Township | Lot | Concession

RR#/Street Number/Name: Somerset Road way | City/Town/Village: Ottawa | Site/Compartment/Block/Tract etc.

GPS Reading: NAD 83 | Zone 18 | Easting 445557 | Northing 5029364 | Unit Make/Model: GPS Map76 Garmin | Mode of Operation: ☐ Undifferentiated ☐ Averaged ☑ Differentiated, specify WAAS

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth From	Depth To
Grey	asphalt, Crushed gravel		Typical Monitoring well installation	0	0.8
Brown	Sand, trace silt			0.8	1.2
Grey	Silty Clay trace sand			1.2	6
			6 Monitoring wells as Constructed. (Typical Installations)		

Hole Diameter

Depth From	Depth To	Diameter Centimetres
0	6 m	20 cm

Water Record

Water found at ___ Metres	Kind of Water
___ m	☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☑ Other:
___ m	☐ Fresh ☐ Sulphur ☐ Gas ☑ Salty ☐ Minerals ☐ Other:
___ m	☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other:

After test of well yield, water was: ☐ Clear and sediment free ☐ Other, specify

Chlorinated ☐ Yes ☑ No

Construction Record

Inside diam centimetres	Material	Wall thickness centimetres	Depth From	Depth To
Casing				
50 mm	☐ Steel ☐ Fibreglass ☑ Plastic ☐ Concrete ☐ Galvanized	Schedule # 40	0	3 m
	☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized			
	☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized			
Screen				
Outside diam 61 mm	☐ Steel ☐ Fibreglass ☑ Plastic ☐ Concrete ☐ Galvanized	Slot No. #10	3 m	6 m
No Casing or Screen				
	☐ Open hole			

Test of Well Yield

Pumping test method	Draw Down Time min	Draw Down Water Level Metres	Recovery Time min	Recovery Water Level Metres
Pump intake set at - (metres)	Static Level			
Pumping rate - (litres/min)	1		1	
Duration of pumping ___ hrs + ___ min	2		2	
Final water level end of pumping ___ metres	3		3	
Recommended pump type. ☐ Shallow ☐ Deep	4		4	
Recommended pump depth. ___ metres	5		5	
Recommended pump rate. (litres/min)	10		10	
If flowing give rate - (litres/min)	15		15	
If pumping discontinued, give reason.	20		20	
	25		25	
	30		30	
	40		40	
	50		50	
	60		60	

Plugging and Sealing Record

☑ Annular space ☐ Abandonment

Depth set at - Metres From	Depth set at - Metres To	Material and type (bentonite slurry, neat cement slurry) etc.	Volume Placed (cubic metres)
0	2.5 m	Bentonite Hole Plug	40 KG. 2 Bags

Method of Construction

☐ Cable Tool ☐ Rotary (air) ☐ Diamond ☐ Digging
☐ Rotary (conventional) ☐ Air percussion ☐ Jetting ☑ Other Hydrovac
☐ Rotary (reverse) ☐ Boring ☐ Driving

Water Use

☐ Domestic ☐ Industrial ☐ Public Supply ☑ Other Dewatering
☐ Stock ☐ Commercial ☐ Not used
☐ Irrigation ☐ Municipal ☐ Cooling & air conditioning

Final Status of Well

☐ Water Supply ☐ Recharge well ☐ Unfinished ☐ Abandoned, (Other)
☑ Observation well ☐ Abandoned, insufficient supply ☐ Dewatering
☐ Test Hole ☐ Abandoned, poor quality ☐ Replacement well

Well Contractor/Technician Information

Name of Well Contractor: George Downing Estate Drilling | Well Contractor's Licence No.: 1844

Business Address (street name, number, city etc.): 410 Main St. Grenville-Sur-La-Rouge QC J0V 1B0

Name of Well Technician (last name, first name): Downing Bruce | Well Technician's Licence No.: T2173

Signature of Technician/Contractor: X [signature] | Date Submitted YYYY MM DD: 2005 06 03

Location of Well

In diagram below show distances of well from road, lot line, and building. Indicate north by arrow.

Please see site plan

Audit No. Z 30507 | Date Well Completed YYYY MM DD: 2005 04 27

Was the well owner's information package delivered? ☐ Yes ☑ No | Date Delivered YYYY MM DD:

Ministry Use Only

Data Source | Contractor: 1844

Date Received: JUN 24 2005 | Date of Inspection YYYY MM DD:

Remarks | Well Record Number

0506E (09/03) Contractor's Copy ☐ Ministry's Copy ☑ Well Owner's Copy ☐ *Cette formule est disponible en français*

05/12/2005 THU 9:12 FAX 613 7380721 Jacques Whitford 004/004

© JACQUES WHITFORD 2005

Z 30507

1844

JUN 24 2005

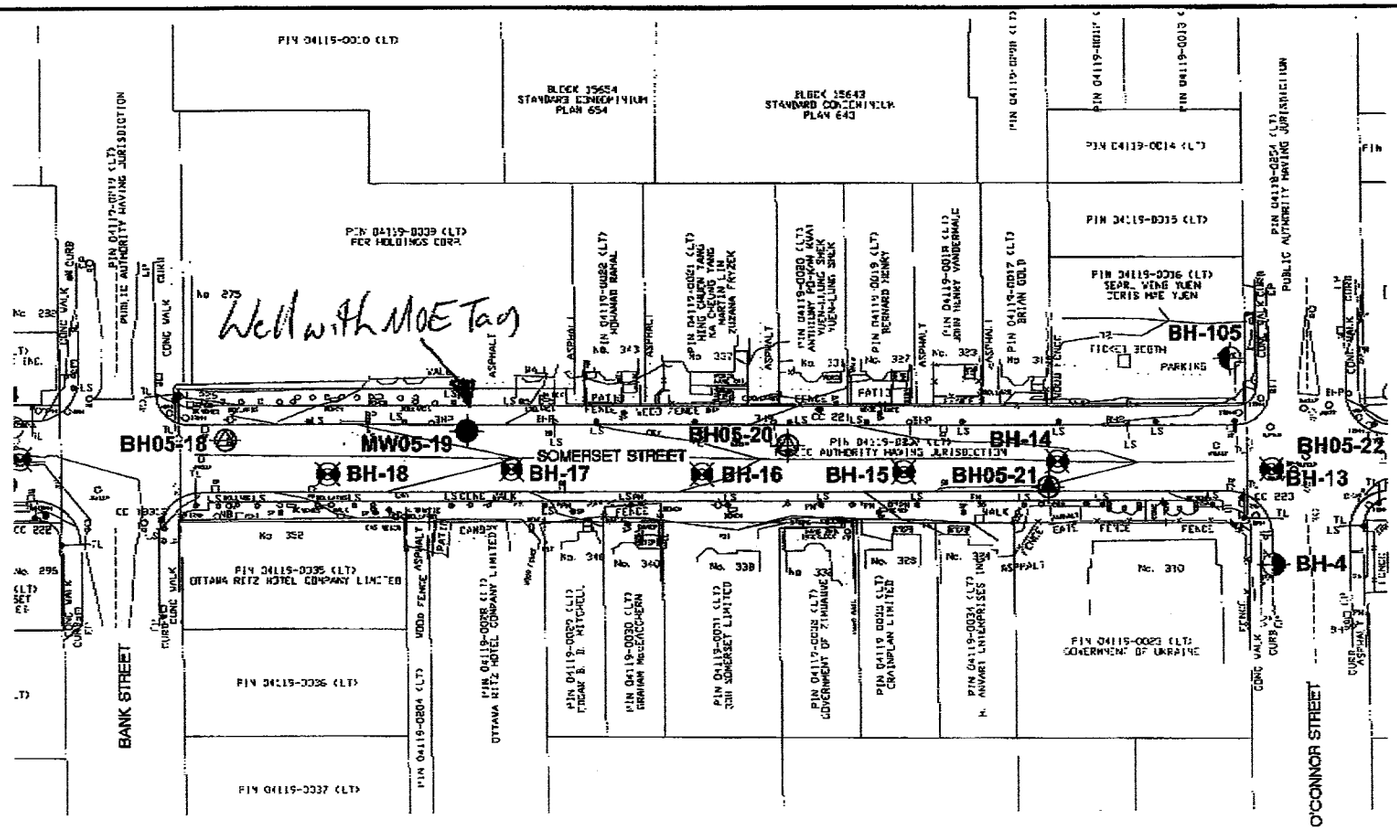

LEGEND:

- BH-106 — APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY GOLDER (REPORT NO. 991-2211)
- BH-25 — APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY TROW (REPORT NO. TA 12105A)
- BH-4 — APPROXIMATE BOREHOLE LOCATION, PREVIOUS INVESTIGATION BY OTHERS (PLAN 1526, EXISTING COMBINED SEWER, O'CONNOR STREET)
- BH05 — APPROXIMATE BOREHOLE LOCATION BY JACQUES WHITFORD, 2005
- BH05 — APPROXIMATE BOREHOLE LOCATION BY JACQUES WHITFORD, 2005 (ASPHALT OVERLAID CONCRETE PAVEMENT)
- MW05 — APPROXIMATE MONITORING WELL LOCATION BY JACQUES WHITFORD, 2005

DELCAN CORPORATION

SOMERSET STREET
FROM BANK STREET TO O'CONNOR STREET
BOREHOLE AND MONITORING WELL LOCATION PLAN

OTTAWA, ONTARIO

Scale:	Proj. No.:	Dwg. No.:
1 : 1000	ONO63588-1	1
Date:	**Dwn. by:**	**Appd.:**
05/05/12	GBB	

Ontario Ministry of the Environment

Well T... mber below)
A 061568
A 061568

Well Record
Regulation 903 Ontario Water Resources Act

page ___ of ___

Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
- All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
- Questions regarding completing this application can be directed to the Water Well Help Desk (Toll Free) at 1-888-396-9355.
- **All metre measurements shall be reported to 1/10th of a metre.**
- Please print clearly in blue or black ink only.

Ministry Use Only
MUN | CON | LOT

Well Owner's Information and Location of Well Information

First Name	Last Name	Mailing Address (Street Number/Name, RR,Lot,Concession)
Canadian	Federation of Students	170 Metcalfe st

County/District/Municipality	Township/City/Town/Village	Province	Postal Code	Telephone Number (include area code)
CARLETON	Ottawa	Ontario	K2P 1P3	

Address of Well Location (County/District/Municipality)	Township	Lot	Concession
338 Somerset st. W., CARLETON			

RR#/Street Number/Name	City/Town/Village	Site/Compartment/Block/Tract etc.
	Ottawa	

GPS Reading	NAD	Zone	Easting	Northing	Unit Make/Model	Mode of Operation
	83	18	445602	5029369	Garmin Etrex	ETREX ☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth From	Depth To (Metres)
Brn	Topsoil		Sandy Gravel, soft	0	.91
Brn	silt	Sand / clay	fine sand, dry, soft	.91	1.5
Brn Grey	silt	clay	soft, moist	1.5	3.66
Grey	clay	silt	soft, moist	3.66	6.1
Grey	clay		wet, sticky, soft	6.1	8.23

Hole Diameter

Depth From	Depth To (Metres)	Diameter (Centimetres)
0	8.23	8.89

Water Record

Water found at ___ Metres / Kind of Water

- ___ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other:
- ___ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other:
- ___ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other:

After test of well yield, water was
☐ Clear and sediment free
☐ Other, specify

Chlorinated ☐ Yes ☐ No

Construction Record

Casing

Inside diam centimetres	Material	Wall thickness centimetres	Depth From	Depth To (Metres)
3.81	☐ Steel ☐ Fibreglass ☑ Plastic ☐ Concrete ☐ Galvanized	~~5.51~~ 0.25	0	4.88
	☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized			
	☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized			

Screen

Outside diam	Material	Slot No.	Depth From	Depth To (Metres)
	☐ Steel ☐ Fibreglass ☑ Plastic ☐ Concrete ☐ Galvanized	10	4.88	8.23

No Casing or Screen

☐ Open hole

Test of Well Yield

Pumping test method	Draw Down Time min	Draw Down Water Level Metres	Recovery Time min	Recovery Water Level Metres
Pump intake set at - (metres)	Static Level			
Pumping rate - (litres/min)	1		1	
Duration of pumping ___hrs +___ min	2		2	
Final water level end of pumping ___metres	3		3	
Recommended pump type. ☐ Shallow ☐ Deep	4		4	
Recommended pump depth. ___metres	5		5	
Recommended pump rate. (litres/min)	10		10	
If flowing give rate - (litres/min)	15		15	
If pumping discontinued, give reason.	20		20	
	25		25	
	30		30	
	40		40	
	50		50	
	60		60	

Plugging and Sealing Record

☑ Annular space ☐ Abandonment

Depth set at - Metres From	Depth set at - Metres To	Material and type (bentonite slurry, neat cement slurry) etc.	Volume Placed (cubic metres)
0	.31	flushmount / concrete	
.31		Benseal	
		Sand	

Method of Construction

☐ Cable Tool ☐ Rotary (air) ☐ Diamond ☐ Digging
☐ Rotary (conventional) ☐ Air percussion ☐ Jetting ☑ Other Geoprobe
☐ Rotary (reverse) ☐ Boring ☐ Driving

Water Use

☐ Domestic ☐ Industrial ☐ Public Supply ☑ Other Monitoring well
☐ Stock ☐ Commercial ☐ Not used
☐ Irrigation ☐ Municipal ☐ Cooling & air conditioning

Final Status of Well

☐ Water Supply ☐ Recharge well ☐ Unfinished ☐ Abandoned, (Other)
☑ Observation well ☐ Abandoned, insufficient supply ☐ Dewatering
☑ Test Hole ☐ Abandoned, poor quality ☐ Replacement well

Well Contractor/Technician Information

Name of Well Contractor	Well Contractor's Licence No.
STRATA SOIL SAMPLING	7241

Business Address (street name, number, city etc.)
147 WEST BEAVER CREEK, RICHMOND HILL

Name of Well Technician (last name, first name)	Well Technician's Licence No.
TENELIUS JOHN T-3069	T-3069

Signature of Technician/Contractor
X Brian Brantham, 1796

Date Submitted: 2007 06 22

Location of Well

In diagram below show distances of well from road, lot line, and building. Indicate north by arrow.

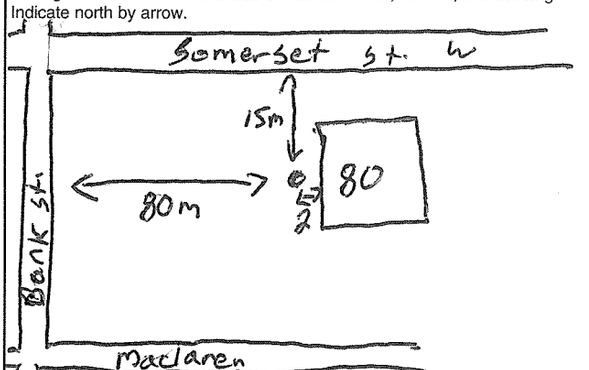

Audit No.	Date Well Completed YYYY MM DD
Z 74024	2007 06 22
Was the well owner's information package delivered? ☐ Yes ☑ No	Date Delivered YYYY MM DD

Ministry Use Only

Data Source	Contractor
	7241
Date Received YYYY MM DD: JUL 17 2007	Date of Inspection YYYY MM DD
Remarks	Well Record Number

0506E (08/2006) Ministry's Copy

Cette formule est disponible en français

Ontario Ministry of the Environment

Well Tag No. for Master Well *(Place Sticker and/or Print Below)*
A 074637 MW-9

Master Well Record for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 2

Master Well Owner's and Land Owner's Information

First Name	Last Name	E-mail Address
Shell Canada Products		

Mailing Address (Street Number/Name, RR)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
90 Sheppard Ave. Ste 600	Toronto	ON	M2N1G4J2	4161227171111

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR)	Township	Lot	Concession
154 O'Connor Street			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation
NAD 83	18	445141815	5012976147	Garmin	Etrex	☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify

Overburden and Bedrock Materials *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From	Depth (Metres) To
	Asphalt surface			0	0.1
Grey	Sand + Gravel Fill		moist	0.1	0.4
Brown	Sand Fill			0.4	0.5
Brown/Black	Sandy clay fill		moist	0.5	1.5
Grey	Silty clay	some sand	fractured	1.5	4.8
Black/Brown	unconsolidated shale			4.8	6.1

Hole Details

Depth (Metres) From	Depth (Metres) To	Diameter (Centimetres)
0	4.8	20
4.8	6.1	10

Water Use

☐ Public ☐ Industrial ☐ Not used ☐ Other, specify
☐ Domestic ☐ Commercial ☐ Dewatering
☐ Livestock ☐ Municipal ☑ Monitoring
☐ Irrigation ☐ Test Hole ☐ Cooling & Air Conditioning

Method of Construction

☐ Cable Tool ☐ Air Percussion ☐ Digging
☐ Rotary (Conventional) ☐ Diamond ☐ Boring
☐ Rotary (Reverse) ☐ Jetting ☐ Other, specify Geoprobe
☐ Rotary (Air) ☐ Driving

Status of Well

☑ Test Hole ☐ Abandoned, Insufficient Supply
☐ Replacement Well ☐ Abandoned, Poor Water Quality
☐ Dewatering Well ☐ Other, specify
☐ Alteration (Construction) ☐ Abandoned, other, specify

Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres) From	Depth (Metres) To
3.2	~~Abandonment~~ PVC	Sched 40	0	3.0

No Casing and Screen Used

Open Hole ☐ Yes ☑ No

Static Water Level Test

> 6.8 Metres

Screen

☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☑ Plastic

Outside Diameter (Centimetres)	Slot No.
3.8	10

Water Details

Water found at Depth	Kind of Water
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Annular Space/Abandonment Sealing Record

Depth Set at (Metres) From	Depth Set at (Metres) To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
0.1	2.4	Bentonite	40 kgs

Disinfected ☐ Yes ☑ No If no, provide reason: Monitoring well

Date Master Well Completed (yyyy/mm/dd): 2009/07/25

Cluster Information *(Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)*

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
7	
Total Wells on this Property	
Unknown	1

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.
☐ Check box to confirm detailed map is provided as per Section 11.1 (3)

[redacted]

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
George Downing Estate Drilling Ltd	11814

Business Address (Street No./Name, number, RR)	Municipality
410 Rue Principale	Grenville Sur la Rouge

Province	Postal Code	Business E-mail Address
QC	J0V1B0	downing@hawk.igs.net

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
8199241744	Downing, Bruce

Well Technician's Licence No.	Signature of Technician	Date Submitted (yyyy/mm/dd)
21713		2009/09/17

Ministry Use Only

Audit No.	Well Contractor No.
M 04512	
Date Received (yyyy/mm/dd) OCT 01 2009	Date of Inspection (yyyy/mm/dd)
Remarks	

© Queen's Printer for Ontario, 2005

Ontario Ministry of the Environment

Well Tag No. for Master Well *(Print Well Tag No.)*
A 074637 A074637

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Property Owner's Information

First Name	Last Name	Mailing Address (Street No./Name, RR)	Municipality
Shell Canada Products		90 Sheppard Ave. Ste 600	Toronto

Province	Postal Code	E-mail Address	Telephone No. (inc. area code)
ONTARIO	M2N6Y2		4162277111

[redacted]
upon request

Cluster Well Information

Address of Well Location (Street Number/Name, RR)	Lot	Concession	Township	County/District/Municipality
154 O'Connor Street				

City/Town/Village	Province	Postal Code	GPS Unit Make	Model	Unit Mode of Operation	Signature of Technician/Contractor	Date *(yyyy/mm/dd)*
Ottawa	Ontario		GARMIN	Etrex	☐ Undifferentiated ☐ Averaged ☐ Differentiated, specify:	Bruce Downing	2009/09/17

Well # on Sketch	UTM Coordinates Zone	Easting	Northing	Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres) From	To	Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion *(yyyy/mm/dd)*
mw 3	18	445511	5029653	6.8	20/10	Geoprobe	PVC	3.8	3.8	6.8	Bentonite				2009/07/25
mw 5	18	445513	5029677	6.1				3.0	3.0	6.1					2009/07/24
mw 10	18	445494	5029651	6.1				3.0	3.0	6.1					2009/07/24
mw 7	18	445492	5029665	6.1				3.0	3.0	6.1					2009/07/24
mw 8	18	445498	5029642	5.9				3.0	3.0	5.9					2009/07/25
mw 10	18	445506	5029676	6.7				3.7	3.7	6.7					2009/07/25

Well Contractor and Well Technician Information

Business Name of Well Contractor	Business Address (Street Number/Name, RR)	Municipality	Province
George Downing Estate Drilling Ltd	410 Rue Principale	Grenville Sur La Rouge	QC

Postal Code	Business Telephone No. *(inc. area code)*	Well Contractor's Licence No.	Business E-mail Address
J0V1B0	8192426469	1814	downing@hawk.igs.net

Name of Well Technician (First Name, Last Name)	Well Technician's Licence No.	Date Submitted *(yyyy/mm/dd)*	Signature of Technician
Bruce Downing	2173	2009/09/17	Bruce Downing

Date 1st Well in Cluster Constructed *(yyyy/mm/dd)*	Date Last Well in Cluster Constructed *(yyyy/mm/dd)*
2009/07/24	2009/07/25

Ministry Use Only

Date Received *(yyyy/mm/dd)*	Date Inspected *(yyyy/mm/dd)*
OCT 01 2009	
Audit No. C05217	Remarks mo45127

1991 (11/2006)

Ministry's Copy

© Queen's Printer for Ontario, 2006

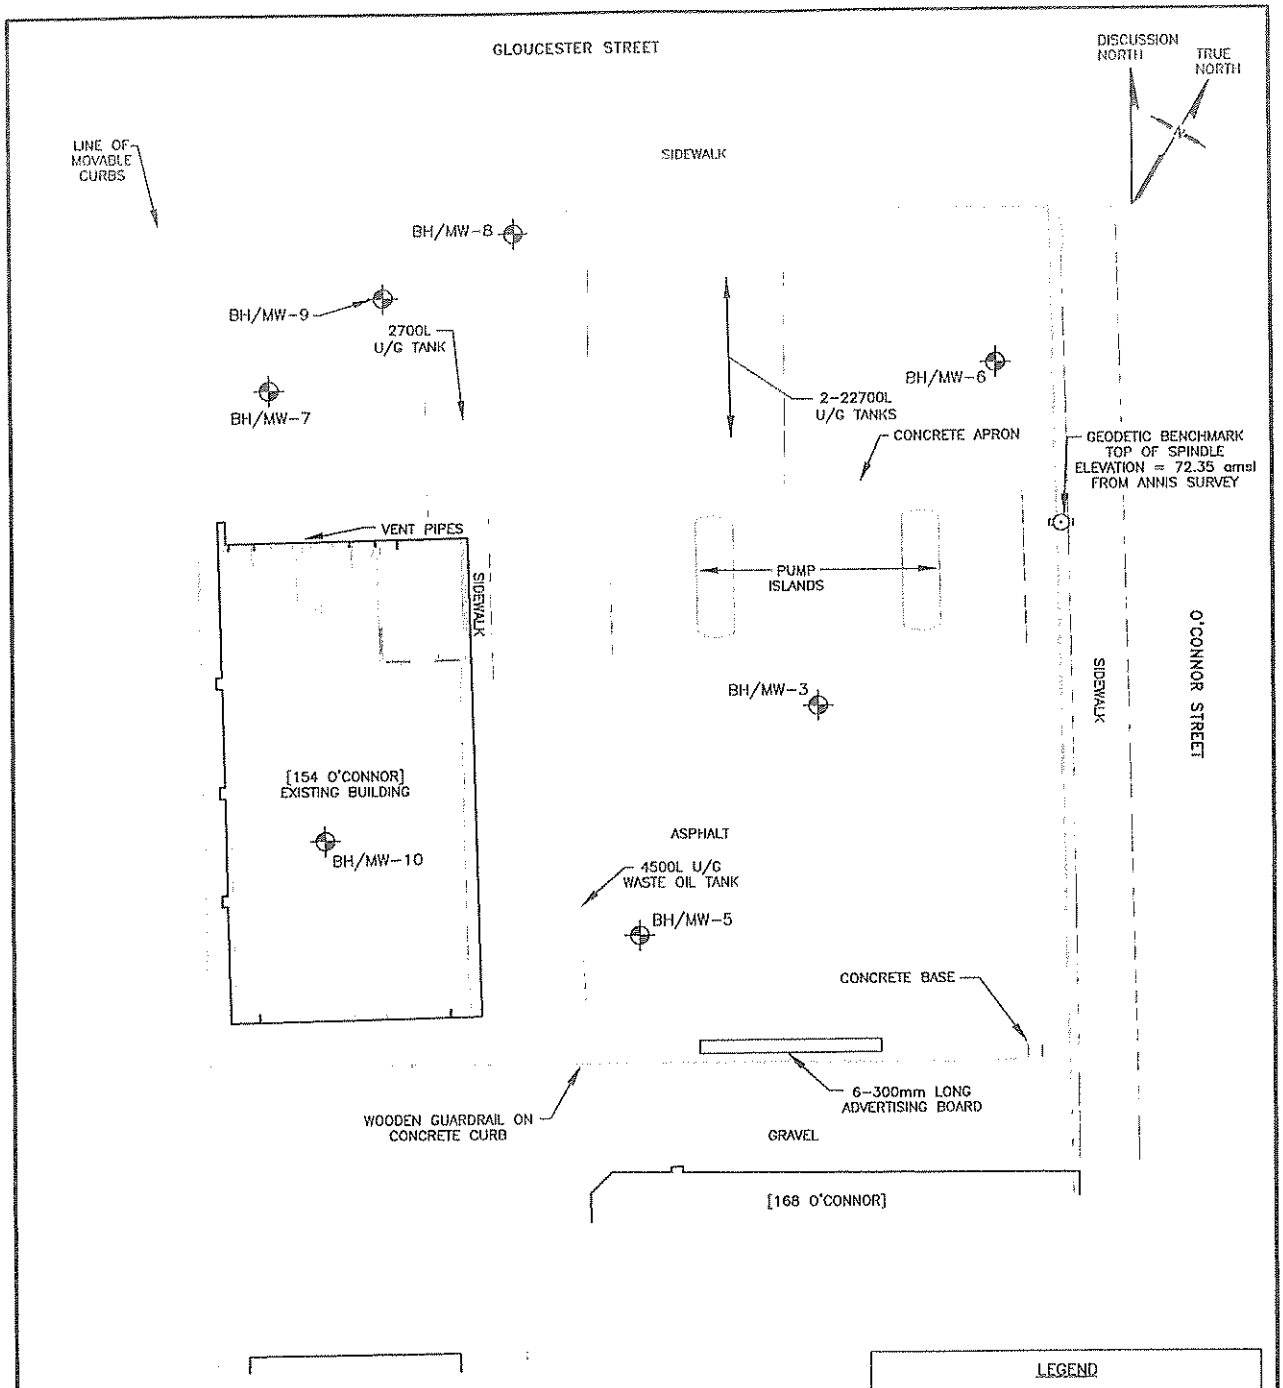

Client/Location: SHELL 154 O'CONNOR STREET OTTAWA, ONTARIO		Title: MONITORING WELL LOCATIONS	
Project No: 09515	Filename: 09515-WWR-1.DWG	Date: SEPTEMBER 2009	Dwg No: FIGURE 1
Drawn: EM	Verified: TT	Project Manager: CB	

C-1844 M04512 C05217.

OCT 0 1 2009

Ontario — Ministry of the Environment

Well Tag No. for Master Well *(Place Sticker and/or Print Below)*: 2 M.W. abandonments under Tag A074637 (5 Remaining wells)

Master Well Record for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 2

Master Well Owner's and Land Owner's Information

First Name	Last Name	E-mail Address
Shell Canada Products		

Mailing Address (Street Number/Name, RR)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
90 Sheppard Ave East Suite 1600	Toronto	ON	M2N6Y2	4166227111

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR)	Township	Lot	Concession
154 O'Connor Street			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation
NAD 83	18	445063	5029676	GARMIN	Etrex	☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify

Overburden and Bedrock Materials *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From	Depth (Metres) To
	MW 5 and MW 10 abandonned under Tag A074637 (MW #10) Remove casing + screen; back fill borehole from 6.7 m below surface to surface with aqua guard cement as per ONT MOE Reg 903				
	Tag remains affixed to MW #9.				

Hole Details

Depth (Metres) From	Depth (Metres) To	Diameter (Centimetres)
0	6.7	20/10

Water Use

☐ Public ☐ Industrial ☐ Not used ☐ Other, specify
☐ Domestic ☐ Commercial ☐ Dewatering
☐ Livestock ☐ Municipal ☐ Monitoring
☐ Irrigation ☐ Test Hole ☐ Cooling & Air Conditioning

Method of Construction

☐ Cable Tool ☐ Air Percussion ☐ Digging
☐ Rotary (Conventional) ☐ Diamond ☐ Boring
☐ Rotary (Reverse) ☐ Jetting ☐ Other, specify
☐ Rotary (Air) ☐ Driving

Status of Well

☐ Test Hole ☐ Abandoned, Insufficient Supply
☐ Replacement Well ☐ Abandoned, Poor Water Quality
☐ Dewatering Well ☐ Other, specify
☐ Alteration (Construction) ☑ Abandoned, other, specify M.W.

Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres) From	Depth (Metres) To

No Casing and Screen Used

Open Hole ☐ Yes ☑ No

Static Water Level Test

Metres

Screen

☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☐ Plastic

Outside Diameter (Centimetres)	Slot No.

Annular Space/Abandonment Sealing Record

Depth Set at (Metres) From	Depth Set at (Metres) To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
		Bentonite	
0	6.7	Aqua guard Cement	36 Kgs

Water Details

Water found at Depth		Kind of Water
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☑ No If no, provide reason:

Date Master Well Completed (yyyy/mm/dd): 2009/12/09

Cluster Information *(Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)*

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
2	
Total Wells on this Property	
unknown	1

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.

☑ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to [redacted]

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
George Downing Estate Drilling Ltd	1814

Business Address (Street No./Name, number, RR)	Municipality
410 Rue Principale	Grenville Sur La Rouge

Province	Postal Code	Business E-mail Address
QC	J0V1B0	downing@hawk.igs.net

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
8192426469	Downing, Bruce

Well Technician's Licence No.	Signature of Technician	Date Submitted (yyyy/mm/dd)
	Bruce Downing	2009/12/01

Ministry Use Only

Audit No.	Well Contractor No.
M 05531	
Date Received (yyyy/mm/dd) JAN 07 2010	Date of Inspection (yyyy/mm/dd)
Remarks	

1992 (11/2006)

Ministry's Copy

© Queen's Printer for Ontario, 2006

Ontario Ministry of the Environment

Well Tag No. for Master Well *(Print Well Tag No.)*
2 M.W. abandonments under Tag A074637 (5 remaining wells)

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Property Owner's Information

First Name	Last Name	Mailing Address (Street No./Name, RR)	Municipality
Shell Canada Products		90 Sheppard Ave. East Suite 600	Toronto

Province	Postal Code	E-mail Address	Telephone No. (inc. area code)
ON	M2N 6Y2		4162771111

[redacted]

Cluster Well Information

Address of Well Location (Street Number/Name, RR)	Lot	Concession	Township	County/District/Municipality
154 O'Connor Street				

City/Town/Village	Province	Postal Code	GPS Unit Make	Model	Unit Mode of Operation	Signature of Technician/Contractor	Date (yyyy/mm/dd)
Ottawa.	Ontario		Garmin	Etrex	☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify:	Bruce Downing	2009/12/01

Well # on Sketch	UTM Coordinates Zone	Easting	Northing	Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres) From	To	Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion (yyyy/mm/dd)
MW #5	18	445513	5029627	6.1	20/10								Aquaguard cement		2009/11/09.

Well Contractor and Well Technician Information

Business Name of Well Contractor	Business Address (Street Number/Name, RR)	Municipality	Province
George Downing Estate Drilling Ltd.	410 Rue Principale	Grenville Sur La Rouge	QC.

Postal Code	Business Telephone No. (inc. area code)	Well Contractor's Licence No.	Business E-mail Address
J0V1B0	8192426469	1844	downing@hawk.igs.net

Name of Well Technician (First Name, Last Name)	Well Technician's Licence No.	Date Submitted (yyyy/mm/dd)	Signature of Technician
Bruce Downing.	2173	2009/12/01	Bruce Downing

Date 1st Well in Cluster Constructed (yyyy/mm/dd)	Date Last Well in Cluster Constructed (yyyy/mm/dd)
2009/11/09.	2009/11/09

Ministry Use Only

Date Received (yyyy/mm/dd)	Date Inspected (yyyy/mm/dd)
JAN 07 2010	
Audit No.	**Remarks**
C06149	M05531

1991 (11/2006)

Ministry's Copy

© Queen's Printer for Ontario, 2006

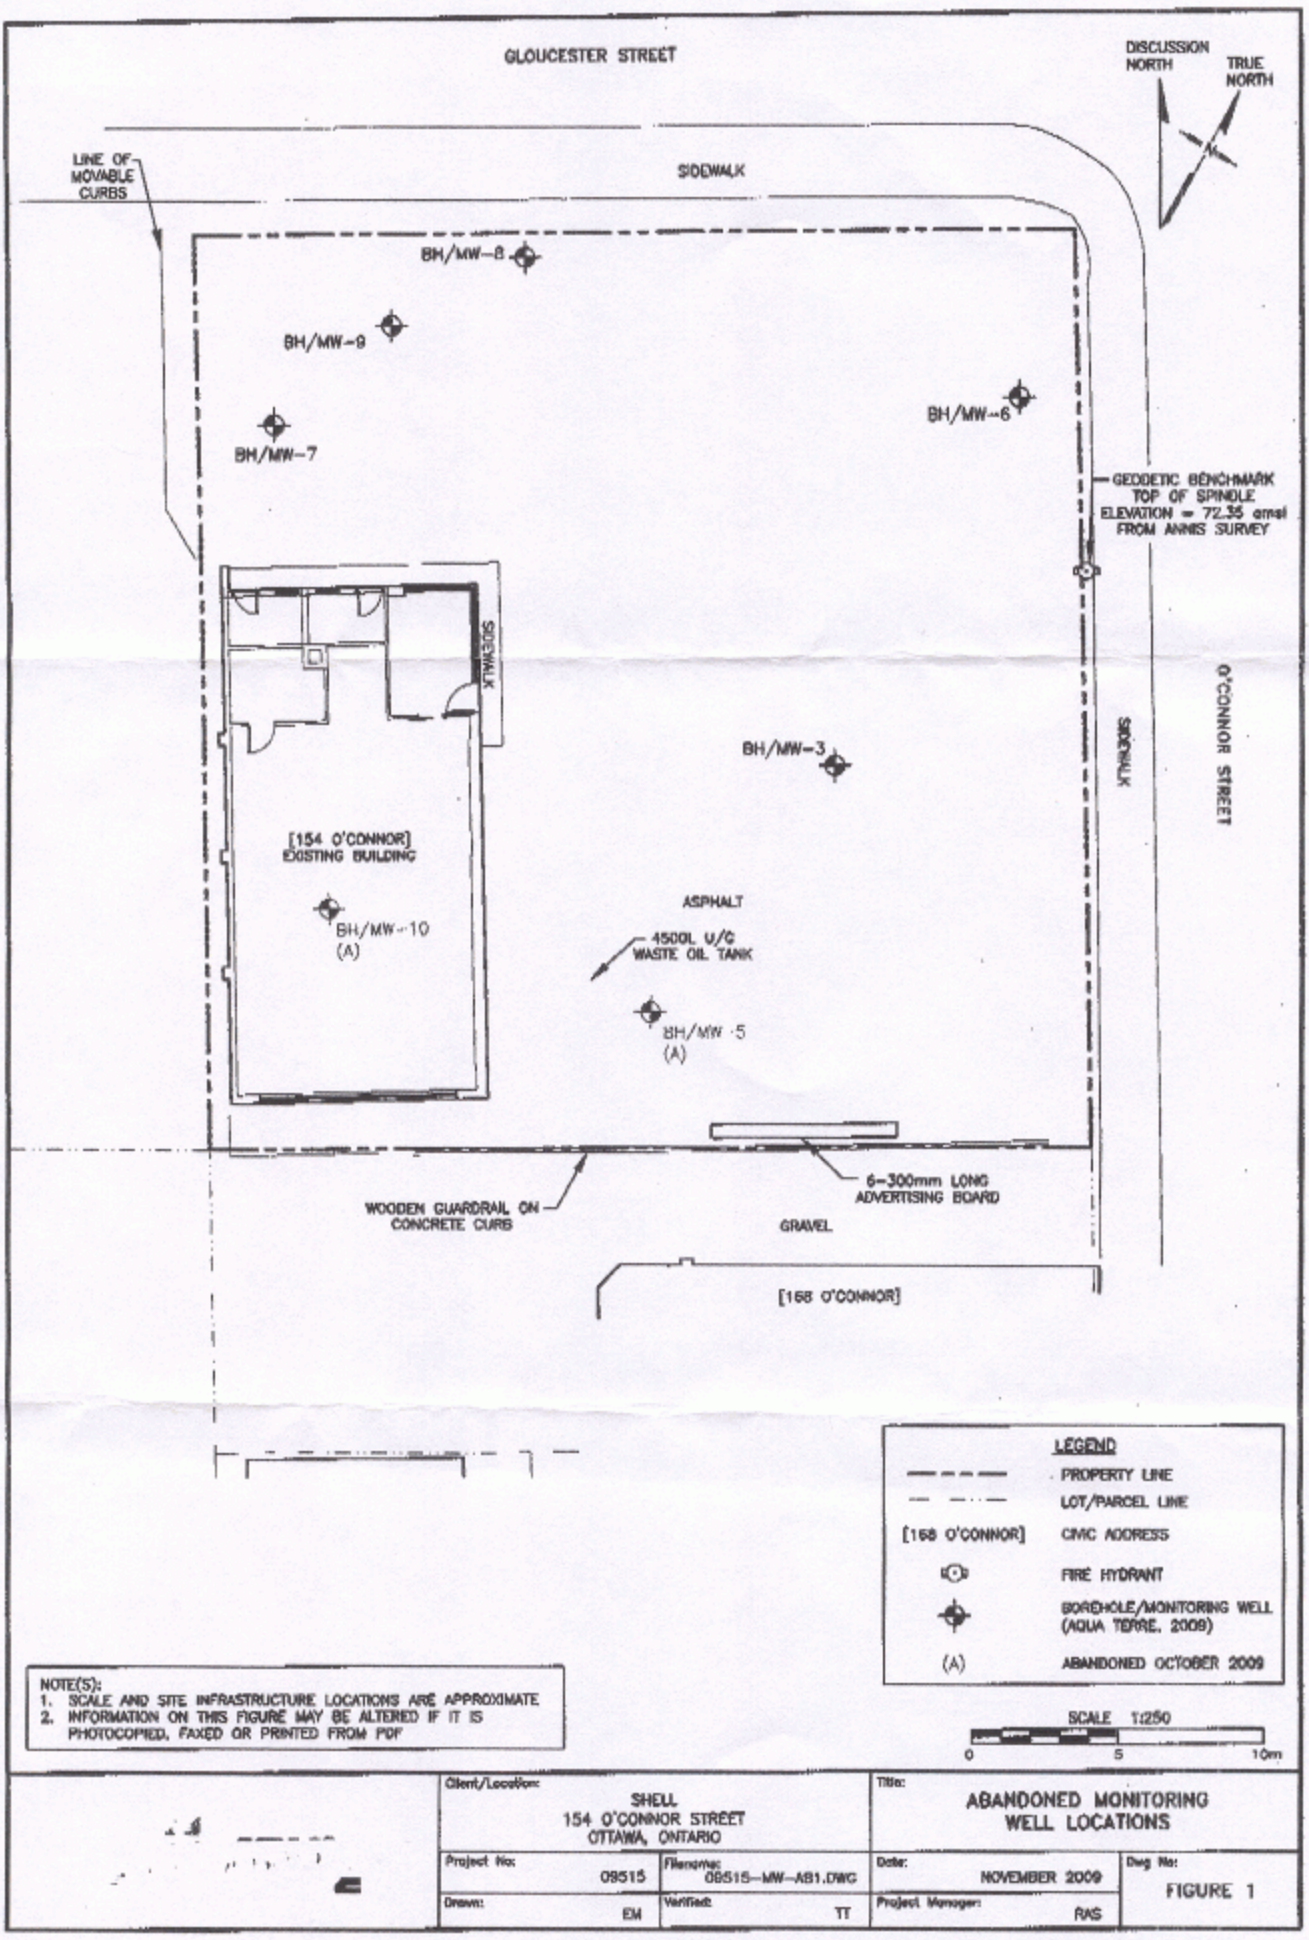

LEGEND

———	PROPERTY LINE
— —·—	LOT/PARCEL LINE
[168 O'CONNOR]	CIVIC ADDRESS
	FIRE HYDRANT
	BOREHOLE/MONITORING WELL (AQUA TERRE, 2009)
(A)	ABANDONED OCTOBER 2009

NOTE(S):
1. SCALE AND SITE INFRASTRUCTURE LOCATIONS ARE APPROXIMATE.
2. INFORMATION ON THIS FIGURE MAY BE ALTERED IF IT IS PHOTOCOPIED, FAXED OR PRINTED FROM PDF

SCALE 1:250
0 5 10m

Client/Location: SHELL 154 O'CONNOR STREET OTTAWA, ONTARIO		Title: ABANDONED MONITORING WELL LOCATIONS	
Project No: 09515	Filename: 09515-MW-AB1.DWG	Date: NOVEMBER 2009	Dwg No: FIGURE 1
Drawn: EM	Verified: TT	Project Manager: RAS	

C-1844
M05531
C6149

JAN 0 7 2010

Ontario — Ministry of the Environment

Well Tag No. (Sticker and/or Print Below): **A 083149** MW 09-23

Master Well Record for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 2

Master Well Owner's and Land Owner's Information

First Name	Last Name	E-mail Address
Shell Canada Products Ltd.		

Mailing Address (Street Number/Name, RR)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
90 Sheppard Ave. Suite 600	Toronto	ON	M2N6Y2	4164383862

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR)	Township	Lot	Concession
154 O'Connor Street		41 & Part of 2	Lot D - Con C

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa.	Ontario	K2P1T5

UTM Coordinates NAD 83	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation: ☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify
	18	445498	5029689	Garmin	Etrex	

Overburden and Bedrock Materials *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From	Depth (Metres) To
Dk Brown	Sand Fill		Moist	0	0.6
" "	Sand + Gravel Fill		"	0.6	1.2
Brown/Grey	Silty Clay		"	1.2	3.0
Grey	Clay		Wet	3.0	4.3
"	Clayey Silt			4.3	5.5
"	Sandy clay			5.5	6.0
Brown/Grey	Shale		Grey	6.0	11.3

Hole Details

Depth (Metres) From	Depth (Metres) To	Diameter (Centimetres)
0	6.0	20
6.0	11.3	10

Water Use

☐ Public ☐ Industrial ☐ Not used ☐ Other, specify
☐ Domestic ☐ Commercial ☐ Dewatering
☐ Livestock ☐ Municipal ☑ Monitoring
☐ Irrigation ☐ Test Hole ☐ Cooling & Air Conditioning

Method of Construction

☐ Cable Tool ☑ Air Percussion ☐ Digging
☐ Rotary (Conventional) ☐ Diamond ☐ Boring
☐ Rotary (Reverse) ☐ Jetting ☑ Other, specify HSA
☐ Rotary (Air) ☐ Driving

Status of Well

☑ Test Hole ☐ Abandoned, Insufficient Supply
☐ Replacement Well ☐ Abandoned, Poor Water Quality
☐ Dewatering Well ☐ Other, specify
☐ Alteration (Construction) ☐ Abandoned, other, specify

Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres) From	Depth (Metres) To
5.1	Aluminum flushmount PVC Riser	Sched 40	0	8.3

No Casing and Screen Used

Open Hole ☐ Yes ☑ No

Static Water Level Test

Metres

Screen

☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☑ Plastic

Outside Diameter (Centimetres)	Slot No.
5.8	10

Annular Space/Abandonment Sealing Record

Depth Set at (Metres) From	Depth Set at (Metres) To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
0.5	7.0	Bentonite	120 kgs

Water Details

Water found at Depth	Kind of Water
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☑ No If no, provide reason: Monitoring well

Date Master Well Completed (yyyy/mm/dd): 2009/12/17

Cluster Information *(Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)*

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
6	1
Total Wells on this Property: unknown	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.

☑ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director upon request

[redacted]

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
George Downing Estate Drilling Ltd	1814

Business Address (Street No./Name, number, RR)	Municipality	Province	Postal Code	Business E-mail Address
410 rue Principale	Grenville Sur La Rouge	QC	J0V1B0	downing@hawk.igs.net

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	Well Technician's Licence No.	Signature of Technician	Date Submitted (yyyy/mm/dd)
8199264649	Downing, Bruce	2173		2010/01/19

Audit No.	Well Contractor No.
M 05547	
Date Received (yyyy/mm/dd): FEB 02 2010	Date of Inspection (yyyy/mm/dd)
Remarks	

1992 (11/2006)

Ministry's Copy

© Queen's Printer for Ontario, 2006

Ontario Ministry of the Environment

Well Tag No. for Master Well (Print Well Tag No.) **A 083149** A083149

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Property Owner's Information

First Name	Last Name	Mailing Address (Street No./Name, RR)	Municipality
Shell Canada Products Ltd.		90 Sheppard Avenue Suite 600	Toronto

Province	Postal Code	E-mail Address	Telephone No. (inc. area code)
ONTARIO			4164383862

[redacted]

upon request

Cluster Well Information

Address of Well Location (Street Number/Name, RR)	Lot	Concession	Township	County/District/Municipality
154 O'Connor Street	41 & Part 2			

City/Town/Village	Province	Postal Code	GPS Unit Make	Model	Unit Mode of Operation	Signature of Technician/Contractor	Date (yyyy/mm/dd)
Ottawa	Ontario	K2P1T5	Garmin	Etrex	☐ Undifferentiated ☑ Averaged ☐ Differentiated, specify:		2010/01/19

Well # on Sketch	UTM Coordinates Zone	Easting	Northing	Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres) From	To	Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion (yyyy/mm/dd)
MW 20	18	445475	5029689	10.7	20/10	HSA/AP	PVC	7.7	7.7	10.7	Bentonite	7.7			2009/12/21
MW 22	18	445494	5029702	10.7											2009/12/16
MW 24	18	445508	5029678	10.7											2009/12/18
MW 26	18	445505	5029625	10.7											2009/12/18
MW 27	18	445484	5029688	10.7											2009/12/21

Well Contractor and Well Technician Information

Business Name of Well Contractor	Business Address (Street Number/Name, RR)	Municipality	Province
George Downing Estate Drilling Ltd.	410 Rue Principale	Granville Sur la Rouge	Qc.

Postal Code	Business Telephone No. (inc. area code)	Well Contractor's Licence No.	Business E-mail Address
J0V1B0	8192426469	1844	downing@hawk.igs.net

Name of Well Technician (First Name, Last Name)	Well Technician's Licence No.	Date Submitted (yyyy/mm/dd)	Signature of Technician
Bruce Downing	2173	2010/12/19	

Date 1st Well in Cluster Constructed (yyyy/mm/dd)	Date Last Well in Cluster Constructed (yyyy/mm/dd)
2009/12/16	2009/12/21

Ministry Use Only

Date Received (yyyy/mm/dd)	Date Inspected (yyyy/mm/dd)
FEB 02 2010	
Audit No. c 06171	**Remarks** M05547

1991 (11/2006)

Ministry's Copy

© Queen's Printer for Ontario, 2006

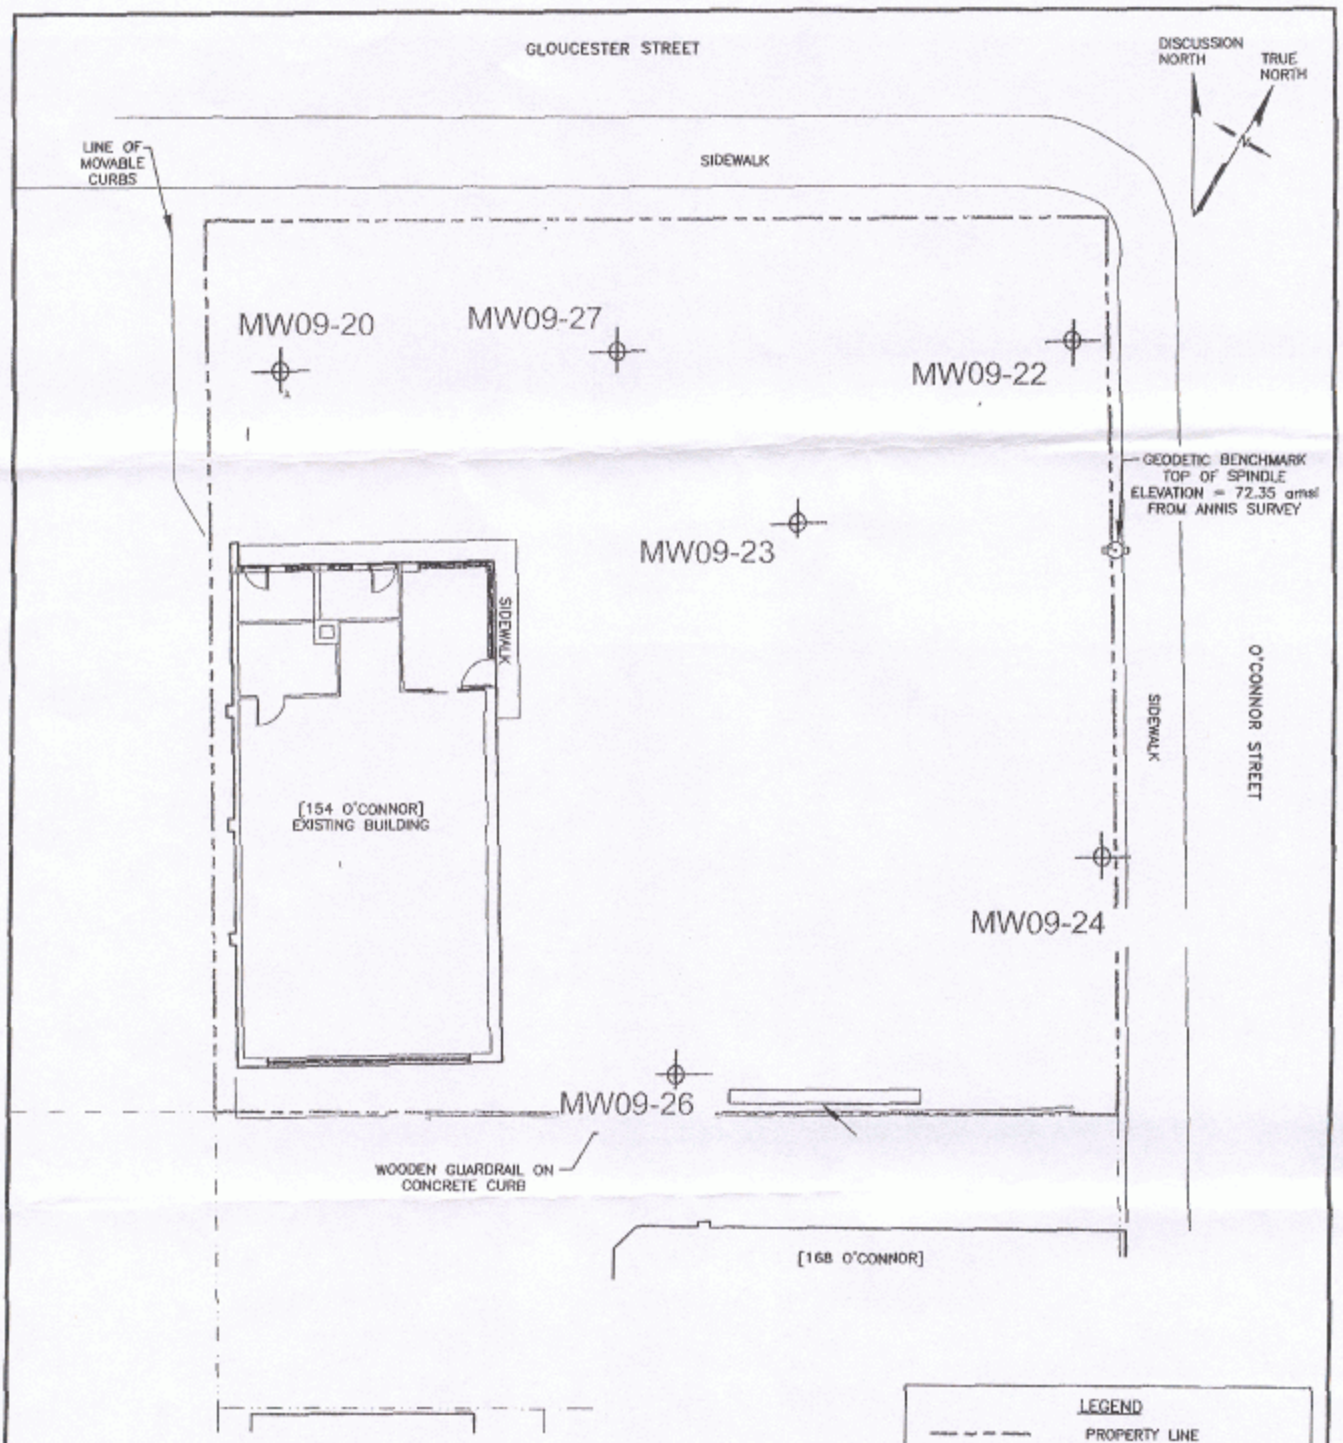

C1844 m0547 c0617

FEB 0 2 2010

Ontario — Ministry of the Environment

Measurements recorded in: ☐ Metric ☐ Imperial

Well Tag No. *(Place Sticker and/or Print Below)* A152335

Well Record

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
110 Laurier Ave. West	Ottawa	ON	K1P 1J1	613 580 2424

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession

County/District/Municipality	City/Town/Village	Province	Postal Code
		Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445315	5029218		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
106	Quick Grout	+ Cement		57	0

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify*

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To

Status of Well

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☒ Abandoned, other, *specify* Removed
☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Kind of Water	
☐ Gas	☐ Fresh ☐ Untested	☐ Other, *specify*
Water found at Depth (m/ft) ☐ Gas	☐ Fresh ☐ Untested	☐ Other, *specify*
Water found at Depth (m/ft) ☐ Gas	☐ Fresh ☐ Untested	☐ Other, *specify*

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify*

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping ____ hrs + ____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
50		50	
60		60	

Map of Well Location

Please provide a map below following instructions on the back.

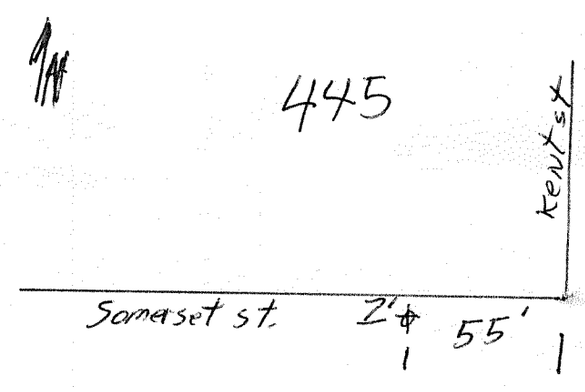

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Marathon Drilling Co Ltd.	6894

Business Address (Street Number/Name)	Municipality
6847 Hiram Dr.	OTT

Province	Postal Code	Business E-mail Address
ON	K4P 1A2	

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
6138220571	Wright Terry

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
0715		2013 09 13

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered Y Y Y Y M M D D

Date Work Completed Y Y Y Y M M D D

Ministry Use Only

Audit No. Z096858

Received NOV 14 2013

0506E (12/2007)

Ministry's Copy

© Queen's Printer for Ontario, 2007

S-14403

Ontario — Ministry of the Environment

Measurements recorded in: ☑ Metric ☐ Imperial

Well Tag No. *(Place Sticker and/or Print Below)*

Tag#: A152603 A152603

Well Record

Regulation 903 Ontario Water Resources Act

Page _____ of _____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	District Realty Corporation		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
50 Bayswater Avenue	Ottawa	ON	K1Y 2E9	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
384 McLaurin Rd.			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445546	5025231		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
DRY	concrete	gravel,	hard	0	.31
BRN	sand	gravel	loose	.31	2.13
GRY	clay	silt	soft	2.13	6.1

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)
0	.31	concrete/flushmount	
.31	2.74	bentonite	
2.74	6.1	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☑ Other, *specify* Direct Push

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
3.45	PVC	.356	0	3.1

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.21	PVC	10	3.1	6.1

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*
☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Gas	Kind of Water: Fresh	Untested	Other, *specify*
	☐	☐	☐	☐
	☐	☐	☐	☐
	☐	☐	☐	☐

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	6.1	5.71

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping _____ hrs + _____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
50		50	
60		60	

Map of Well Location

Please provide a map below following instructions on the back.

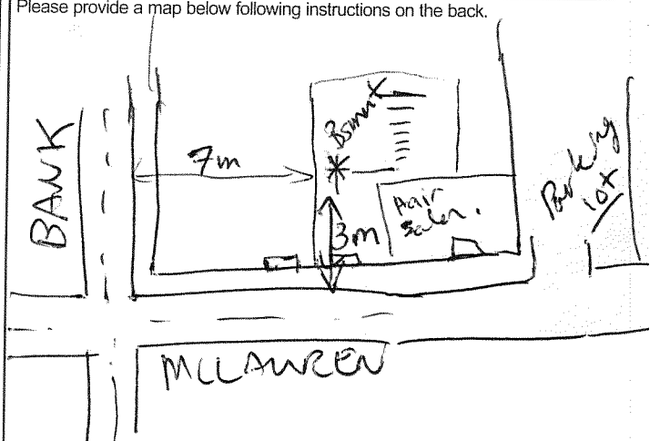

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
147 West Beaver Creek	Richmond Hill

Province	Postal Code	Business E-mail Address
ON	L4B1G6	wrecords@stratasoil.com

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
905 764-9304	McCoy, James

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3656		2013 10 15

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: Y Y Y Y M M D D

Date Work Completed: 2013 10 15

Ministry Use Only

Audit No. Z177968

Received NOV 28 2013

Ontario — Ministry of the Environment

Well Tag No. *(Place Sticker and/or Print Below)* **Tag#: A173760** A173760

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: [X] Metric [ ] Imperial

5-16268 Page _____ of _____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	[ ] Well Constructed by Well Owner
	1618721 Ontario Inc. The Hair Loft Lespa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
429 MacLaren Street	Ottawa	ON	K2P 0M7	(613) 232-0202

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
429 McLearn			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445397	5029225		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Fill	Gravel / Sand	Soft	0	1.22
BRN	Silty Sand	Trace Clay	Soft	1.22	3.1
BRN	Silty Clay		Soft	3.1	4.88
GRY	Clay	Silt	Soft	4.88	6.1

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)
0	.31	Concrete / Flushmount	
.31	2.74	Bentonite	
2.74	6.1	Sand	

Method of Construction

[ ] Cable Tool [ ] Diamond
[X] Rotary (Conventional) [ ] Jetting
[ ] Rotary (Reverse) [ ] Driving
[ ] Boring [ ] Digging
[ ] Air percussion
[ ] Other, *specify* _____

Well Use

[ ] Public [ ] Commercial [ ] Not used
[ ] Domestic [ ] Municipal [ ] Dewatering
[ ] Livestock [X] Test Hole [X] Monitoring
[ ] Irrigation [ ] Cooling & Air Conditioning
[ ] Industrial
[ ] Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	.390	0	3.1

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	3.1	6.1

Status of Well

[ ] Water Supply
[ ] Replacement Well
[X] Test Hole
[ ] Recharge Well
[ ] Dewatering Well
[X] Observation and/or Monitoring Hole
[ ] Alteration (Construction)
[ ] Abandoned, Insufficient Supply
[ ] Abandoned, Poor Water Quality
[ ] Abandoned, other, *specify*
[ ] Other, *specify*

Water Details

Water found at Depth (m/ft)	Kind of Water	Hole Diameter Depth From (m/ft)	Hole Diameter Depth To (m/ft)	Hole Diameter (cm/in)
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, *specify*	0	6.1	15.32
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, *specify*			
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, *specify*			

Results of Well Yield Testing

After test of well yield, water was:
[ ] Clear and sand free
[ ] Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping _____ hrs + _____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? [ ] Yes [ ] No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

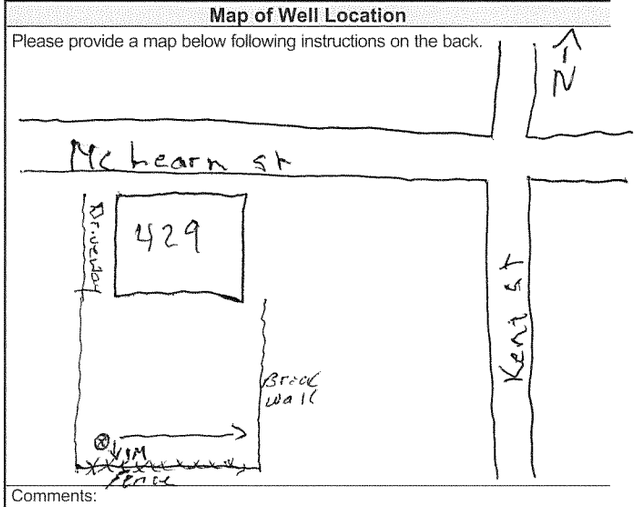

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
165 Shields Court	Markham

Province	Postal Code	Business E-mail Address
ON	L3R 8V2	WLrecords@Stratasoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
905 764 9304	Halladay, Phil

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3832		2014/11/06

Well owner's information package delivered: [ ] Yes [ ] No

Date Package Delivered: _____

Date Work Completed: 2014/10/6

Ministry Use Only

Audit No. Z 198211

Received DEC 15 2014

 © Queen's Printer for Ontario, 2007

Ministry's Copy

Ontario — Ministry of the Environment

Well Record

Regulation 903 Ontario Water Resources Act

Well Tag No. *(Place Sticker and/or Print Below)* **Tag#: A173761** A173761

Measurements recorded in: ☒ Metric ☐ Imperial

S-16268 Page ____ of ____

Well Owner's Information

First Name	Last Name / Organization	Email Address	☐ Well Constructed by Well Owner
	1618721 Ontario Inc. The Hair Loft / Le Spa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
429 MacLaren Street	Ottawa	ON	K2P 0M7	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
429 McLearn			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	449405	5029222		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Fill	Gravel / Sand	Soft	0	1.22
BRN	Silty Sand	Trace Clay	Soft	1.22	3.1
BRN	Silty Clay		Soft	3.1	4.88
GRY	Clay	Silt	Soft	4.88	6.1

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)
0	.31	Concrete / Flushmount	
.31	2.74	Bentonite	
2.74	6.1	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☒ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify*

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	390	0	3.1

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	3.1	6.1

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*
☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Kind of Water	Other, *specify*
	☐ Fresh ☐ Untested ☐ Gas	
	☐ Fresh ☐ Untested ☐ Gas	
	☐ Fresh ☐ Untested ☐ Gas	

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
0	6.1	15.32

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify*

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping ____ hrs + ____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

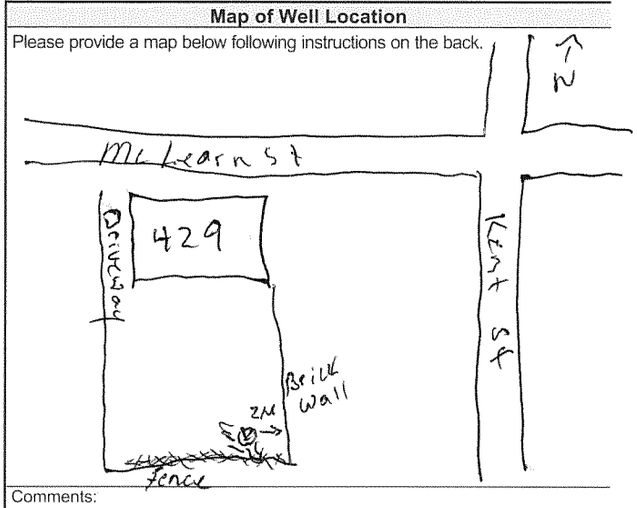

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
165 Shields Court	Markham

Province	Postal Code	Business E-mail Address
ON	L3R8V2	Wtrecords@Stratasoil.ca

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
9057649304	Halladay Phil

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3872		2014/11/06

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☐ No		2014/11/06

Ministry Use Only

Audit No. Z 198210

DEC 15 2014 Received

© Queen's Printer for Ontario, 2007

Ministry's Copy

Ontario — Ministry of the Environment

Well Tag No. (Place Sticker and/or Print Below): A173762 — Tag#: A173762

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: [X] Metric [ ] Imperial

5-16269 Page ____ of ____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	[ ] Well Constructed by Well Owner
	1618721 Ontario Inc. The Hair Loft / Le Spa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
429 MacLaren Street	Ottawa	ON	K2P 0H7	(613) 232-0202

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
429 McLaren			

County/District/Municipality	City/Town/Village	Province	Postal Code
		Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445410	5024217		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Fill	Gravel Sand	Soft	0	1.22
BRN	Slt Sand	Trace Clay	Soft	1.22	3.1
BRN	Slt Clay		Soft	3.1	4.88
GRY	Clay	Slt	Soft	4.88	6.1

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	concrete/flushmount	
.31	2.74	bentonite chips	
2.74	6.1	Filter Sand	

Method of Construction

[ ] Cable Tool [ ] Diamond
[X] Rotary (Conventional) [ ] Jetting
[ ] Rotary (Reverse) [ ] Driving
[ ] Boring [ ] Digging
[ ] Air percussion
[X] Other, specify: direct push

Well Use

[ ] Public [ ] Commercial [ ] Not used
[ ] Domestic [ ] Municipal [ ] Dewatering
[ ] Livestock [X] Test Hole [X] Monitoring
[ ] Irrigation [ ] Cooling & Air Conditioning
[ ] Industrial
[ ] Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	.390	0	3.1

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	3.1	6.1

Status of Well

[ ] Water Supply
[ ] Replacement Well
[X] Test Hole
[ ] Recharge Well
[ ] Dewatering Well
[X] Observation and/or Monitoring Hole
[ ] Alteration (Construction)
[ ] Abandoned, Insufficient Supply
[ ] Abandoned, Poor Water Quality
[ ] Abandoned, other, specify
[ ] Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	Gas	Other, specify
	[ ] Fresh [ ] Untested	[ ]	
	[ ] Fresh [ ] Untested	[ ]	
	[ ] Fresh [ ] Untested	[ ]	

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	6.1	15.32

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
165 Shields Crt	Markham

Province	Postal Code	Business E-mail Address
ON	L3R 5N4	wrecords@stratagoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
905 764 9304	Halladay Phil

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3832		2014/11/06

Results of Well Yield Testing

After test of well yield, water was:
[ ] Clear and sand free
[ ] Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? [ ] Yes [ ] No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

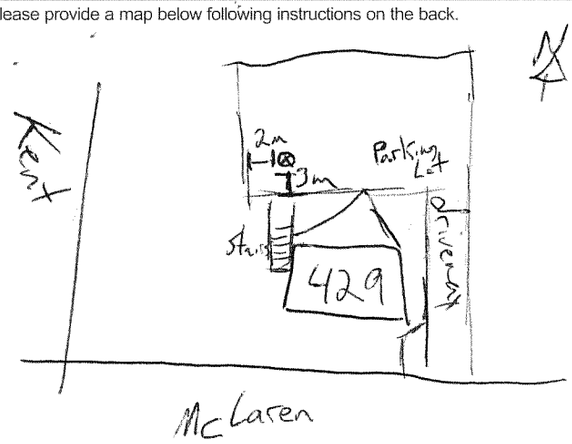

Comments:

Well owner's information package delivered: [ ] Yes [ ] No

Date Package Delivered: Y Y Y Y M M D D

Date Work Completed: 2014/106

Ministry Use Only

Audit No Z 188288

DEC 15 2014 Received

© Queen's Printer for Ontario, 2007

Ministry's Copy

7246842

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☐ Metric ☒ Imperial

Well Tag #: A165621 (below) A165621

Well Record

Regulation 903 Ontario Water Resources Act

S-17328 Page ____ of ____

LOBLAW REAL ESTATE

[redacted]

Address of Well Location (Street Number/Name)	Township	Lot	Concession
296 Bank st ~~Ottawa~~			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	756963	4591509		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	Concrete			0	1
GRY	Clay	silt		1	10
~~MIXED~~	T. 11			10	20

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	concrete flushmount	
1	9	bensenl	
9	20	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☒ Other, *specify* direct push

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
1.38	PVC	.14	0	10

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
1.66	PVC	10	10	20

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*
☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	20	2.375

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify*

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

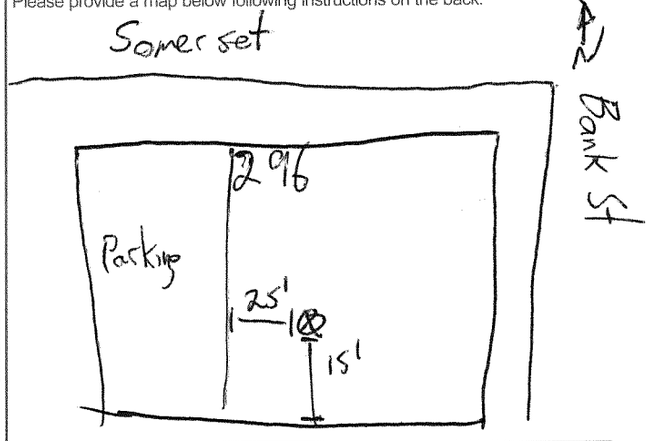

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
4 record@Stratasol.com	Markham

Province	Postal Code	Business E-mail Address
ON	L3R8V2	165 Shields Court Markham

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
905 940 7919	Beatty Brian

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3616		2015 07 17

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☐ No	Y Y Y Y M M D D	2015 07 17

Ministry Use Only

Audit No Z 208884

Received AUG 24 2015

0506E (2014/11) **Ministry's Copy**

© Queen's Printer for Ontario, 2014

7246843

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☐ Metric ☒ Imperial

Well Tag #: A163032 (N) A163032

Well Record

Regulation 903 Ontario Water Resources Act

5-17328 Page ____ of ____

LOBLAW REAL ESTATE

Address of Well Location (Street Number/Name)	Township	Lot	Concession
296 Bank St			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	756963	4541509		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	Concrete		hard	0	1
GRY	Clay	Silt	soft, wet	1	10

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	Concrete / flushmount	
1	2.5	bensead	
2.5	10	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☒ Other, specify direct push

Well Use

☐ Public ☐ Commercial ☐ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☒ Test Hole ☒ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
1.38	PVC	.14	0	3

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
1.66	PVC	10	3	10

Status of Well

☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	
	☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	
	☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	
	☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	10	2.375

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

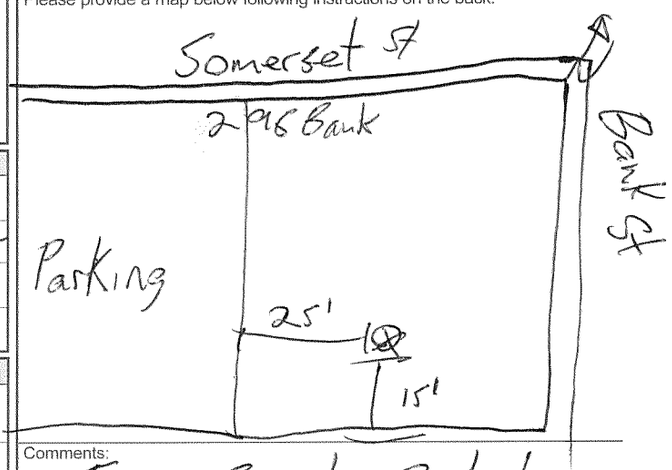

Comments: Exp General Contractors

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7141

Business Address (Street Number/Name)	Municipality
165 Shields Court	Markham

Province	Postal Code	Business E-mail Address
ON	L3R8V2	wrecords@stratasoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
9059407919	Beath, Brian

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3616		2015 07 17

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: Y Y Y Y M M D D

Date Work Completed: 2015 07 17

Ministry Use Only

Audit No Z 208885

Received AUG 24 2015

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

Ontario

Ministry of the Environment and Climate Change

Well Record for Well Cluster - Part 1 of 3

(Only for Multiple Test Holes or Dewatering Wells)

Regulation 903 Ontario Water Resources Act

All measurements recorded in: ☒ Metric ☐ Imperial

Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: *(Print Well Tag No.)* A203689

Well # on Drawing of Deepest Well: BH2

Page 1 of 1

Well Cluster Location Information

Address of Well Location (Street Number(s)/Name(s), RR, if available)	Lot(s)	Concession(s)	Geographic Township	County/District/Upper Tier Municipality
176 NEPEAN STREET, 293-309 LISGAR STREET				

City, Town, Village or Hamlet	Province	GPS Unit Make	Model	Unit Mode of Operation
OTTAWA	Ontario	GARMIN	ETREX	☐ Undifferentiated ☐ Averaged ☐ Differentiated, specify:

Mandatory Attachments/Additional Information

☒ Land Owner Consent Form must be attached.

☒ Detailed Drawing of All Well Locations must be attached.

I, the person constructing the well, will promptly submit to the Director, on request, any additional information in my custody or control related to any well in the well cluster that I have constructed.

Signature of Technician/Contractor — Date (yyyy/mm/dd): 2017/09/18

Well Details

Well # on Drawing	UTM Coordinates Zone	Easting	Northing	Hole Depth (m/ft)	Hole Diameter (cm/in)	Method of Construction	Casing Material; Diameter (cm/in)	Casing (m/ft) From	Casing (m/ft) To	Screen Interval (m/ft) From	Screen Interval (m/ft) To	Annular Space Material (m/ft) From	Annular Space Material (m/ft) To	Annular Space Material:	Overburden/Bedrock or Abandonment Filing Material Intervals (m/ft)	Static Water Level (m/ft)	Date of Completion (yyyy/mm/dd)
BH1	18	445448	5029568	9.1 / 19.2	20.3 / 7.62	HSA DIAMOND NQ/W	3.18	0.1	16.15	16.15	19.2	0.31	15.85	BENTONITE	0-1.5 → 4.6 → 9.1 → 19.2 BACKFILL, CLAY, TILL, SHALE BEDROCK	10.21	2017/08/21
BH1A	18	445440	5029546	7.6 / 12.19	20.3 / 7.62	HSA DIAMOND NQ/W	3.18	0.1	9.5	9.1	12.19	0.31	8.8	BENTONITE	→1.5 →4.6 →7.6 → 12.19 BACKFILL, CLAY, TILL, SHALE BEDROCK	10.29	2017/08/23
BH2	18	445485	5029547	7.6 / 19.25	20.3 / 7.62	HSA DIAMOND NQ/W	3.18	0.1	16.2	16.2	19.25	0.31	15.85	BENTONITE	0-1.2 → 4.3 → 7.6 → 19.25 BACKFILL, CLAY, TILL, SHALE BEDROCK	11.6	2017/08/24
BH3	18	445458	5029576	7.3 / 13.16	20.3 / 7.62	HSA DIAMOND NQ/W	3.18	0.1	10.17	10.17	13.16	0.31	9.75	BENTONITE	0-1.2 → 3.7 → 7.3 → 13.16 BACKFILL, CLAY, TILL, SHALE BEDROCK	13.16	2017/08/22
BH5	18	445493	5029527	9.1 / 12.12	20.3 / 7.62	HSA DIAMOND NQ/W	3.18	0.1	9.15	9.15	12.12	0.31	8.83	BENTONITE	0-1.2 → 4.3 → 7.9 → 12.12 BACKFILL, CLAY, TILL, SHALE BEDROCK	11.31	2017/08/23

Well Contractor and Well Technician Information

Business Name of Well Contractor	Business Address (Street Number/Name, RR)	Municipality	Province
EASTERN ONTARIO DIAMOND DRILLING	3780 COUNTY ROAD 17, P.O. BOX 33	HAWKESBURY	ON

Postal Code	Bus. Telephone No.	Well Contractor's Licence No.	Business E-mail Address
K6A2R2	(613) 632-7769	7328	eedd@forgedowningdrilling.com

Name of Well Technician (First Name, Last Name)	Well Technician's Licence No.	Signature of Well Technician	Date Submitted (yyyy/mm/dd)
STEPHEN DOWNING	3326		2017/09/18

Date First Well in Cluster Constructed or Abandoned (yyyy/mm/dd)	Date Last Well in Cluster Completed (yyyy/mm/dd)
2017/08/21	2017/08/24

Well Abandonment

Person Abandoning the Wells:

Name: n/a

(Print or Type) - See instruction 11 on the back of this form

Ministry Use Only

Date Received (yyyy/mm/dd)	Audit No.
OCT 06 2017	C 30157

Comments:

 © Queen's Printer for Ontario, 2014

Ministry's Copy

Ontario Ministry of the Environment

Well Record for Well Cluster - Part 3 of 3
Detailed Drawing of All Well Locations

Note: This **Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations,** must be attached to Parts 1 and 2. The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the **Well Record for Well Cluster Parts 1 and 2.** The well with the well tag must be clearly identified on the Drawing.
UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing

Well Tag Number: # A203689

"Well Record for Well Cluster" Form Audit Number: # C30157

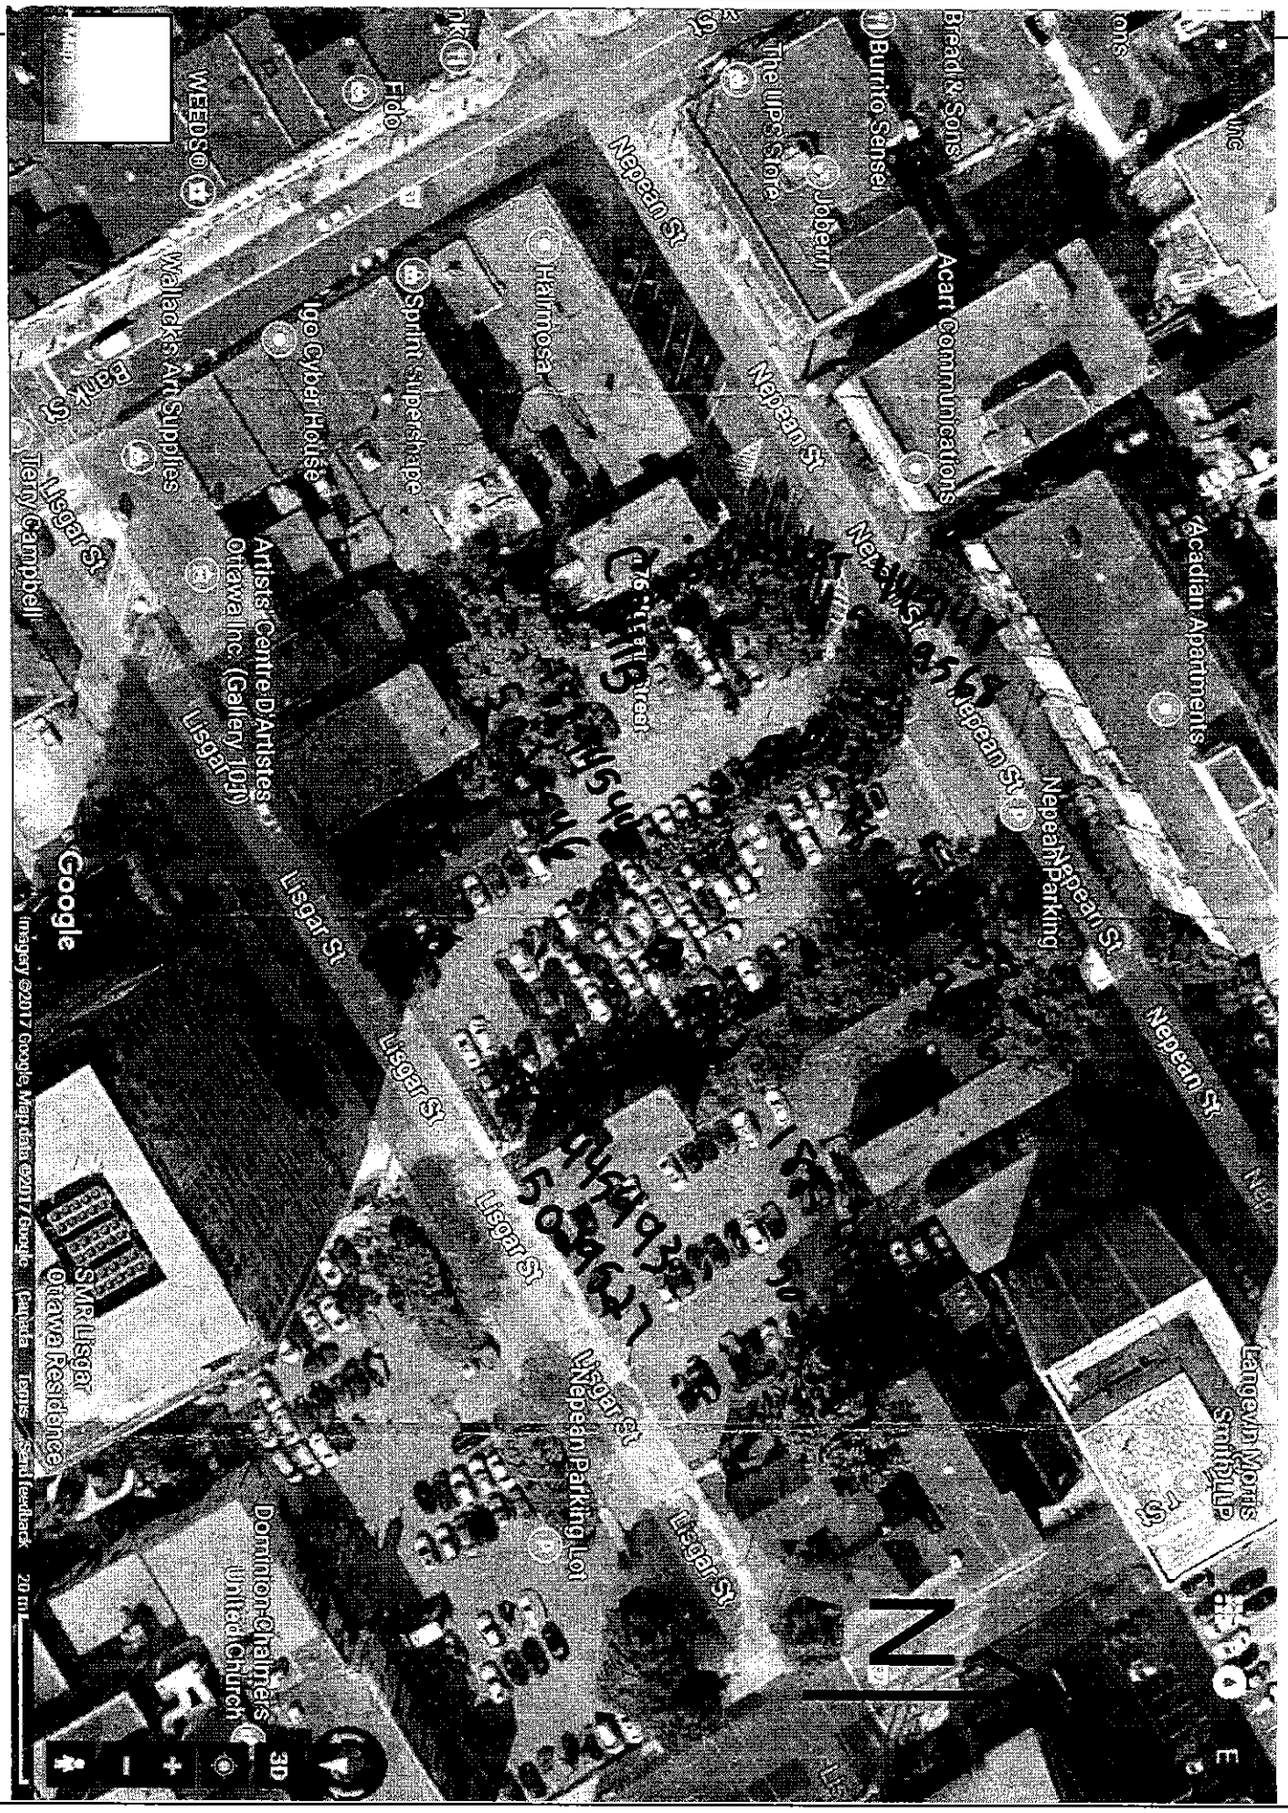

Ministry's Copy

OCT 0 6 2017

2060E (2013/02) © Queen's Printer for Ontario, 2013 Disponible en français

C-7328
C30157

7305579

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☒ Metric ☐ Imperial

W Tag#: A182713 (Below)
A182713

Well Record

Regulation 903 Ontario Water Resources Act

S-21891 Page _____ of _____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
355 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
	Ottawa	Ontario	
UTM Coordinates Zone / Easting / Northing	**Municipal Plan and Sublot Number**	**Other**	
NAD 83 18 445537 5029504			

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Gravel	Sand	Loose	0	.61
BRN	Fill		Packed	.61	3.1
BRN	Clay	Silt	Soft	3.1	4.57
GRY	Clay		Soft	4.57	7.62

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)
0	.31	Concrete / flushmount	
.31	3.96	Bentonite	
3.96	7.62	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☒ Other, specify direct push

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	To
4.03	PVC	3.68	0	4.57

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	To
4.82	PVC	10	4.57	7.62

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	7.62	8.25

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

1

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata drilling Group	7141
Business Address (Street Number/Name)	**Municipality**
165 Shields Court	Markham
Province	**Postal Code**	**Business E-mail Address**
ON	L3R8V2	Wrecords@Stratagp.com
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**
9059407919	Halladay Phil
Well Technician's Licence No.	**Signature of Technician and/or Contractor**	**Date Submitted**
3832		2018/01/09

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered

Date Work Completed 2018/01/09

Ministry Use Only

Audit No Z 212304

FEB 13 2018

Received

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

D-2138

FEB 13 2018

D-2138-2121304

5 m ata ©2018 Goo Report a map error

7305580

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: [X] Metric [ ] Imperial

Well Tag#: A182697 (low)

A182697

2

Well Record

Regulation 903 Ontario Water Resources Act

S-21381 Page ____ of ____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
355 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
	ottawa	Ontario	
UTM Coordinates Zone / Easting / Northing	**Municipal Plan and Sublot Number**	**Other**	
NAD 83 18 445526 5028511			

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Gravel		Loose	0	.61
BRN	Fill		Packed	.61	3.1
BRN	Clay	Silt	Soft	3.1	457
GRY	Clay		Soft	457	762

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete (Flush mount)	
.31	3.96	Bentonite	
3.96	7.62	Sand	

Method of Construction

[ ] Cable Tool [ ] Diamond
[ ] Rotary (Conventional) [ ] Jetting
[ ] Rotary (Reverse) [ ] Driving
[ ] Boring [ ] Digging
[ ] Air percussion
[X] Other, specify: direct push

Well Use

[ ] Public [ ] Commercial [ ] Not used
[ ] Domestic [ ] Municipal [ ] Dewatering
[ ] Livestock [X] Test Hole [X] Monitoring
[ ] Irrigation [ ] Cooling & Air Conditioning
[ ] Industrial
[ ] Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
4.03	PVC	368	0	4.57

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.82	PVC	10	4.57	7.62

Status of Well

[ ] Water Supply
[ ] Replacement Well
[X] Test Hole
[ ] Recharge Well
[ ] Dewatering Well
[X] Observation and/or Monitoring Hole
[ ] Alteration (Construction)
[ ] Abandoned, Insufficient Supply
[ ] Abandoned, Poor Water Quality
[ ] Abandoned, other, specify
[ ] Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	
	[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify
	[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify
	[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
0	7.62	8.25

Results of Well Yield Testing

After test of well yield, water was:
[ ] Clear and sand free
[ ] Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? [ ] Yes [ ] No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

2

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241
Business Address (Street Number/Name)	**Municipality**
165 Shields Court	Markham
Province	**Postal Code**
ON	L3R8V2
Business E-mail Address	
Wrecords@stratagsa.com	
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**
9059407919	Halladay, Phil
Well Technician's Licence No.	**Signature of Technician and/or Contractor**
3532	

Date Submitted: 2018 01 09

Well owner's information package delivered: [ ] Yes [ ] No

Date Package Delivered: ____

Date Work Completed: 2018 01 08

Ministry Use Only

Audit No Z 212307

FEB 13 2018

Received

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

S-2381

FEB 13 2018

C-7241 Z-212307

5 m t——— ata ©2018 Goo Report a map error

7305581

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☑ Metric ☐ Imperial

Tag#: A182694 (nt Below)
A182694 A182694

3

Well Record

Regulation 903 Ontario Water Resources Act

5-21391 Page ____ of ____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
355 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
	Ottawa	Ontario	
UTM Coordinates NAD 83 — Zone	Easting	Northing	**Municipal Plan and Sublot Number** / **Other**
18	445556	5029579	

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Gravel		Loose	0	.61
BRN	Fill		Packed	.61	1.83
BRN	Clay	Silt	Soft	1.83	4.57
GRY	Silt	Clay	Soft	4.57	7.62

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete flushmount	
.31	3.96	Bentonite	
3.96	7.62	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☑ Other, specify direct push

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
4.03	PVC	368	0	4.57

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.82	PVC	10	4.57	7.62

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Water Details

Water found at Depth (m/ft)	Gas	Kind of Water: Fresh / Untested / Other, specify
	☐	☐ ☐ ☐
	☐	☐ ☐ ☐
	☐	☐ ☐ ☐

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	7.62	8.25

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

3

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241
Business Address (Street Number/Name)	**Municipality**
165 Shields Court	Markham
Province	**Postal Code**	**Business E-mail Address**
ON	L3R8V2	Wrecords@Stratasoil.com
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**
9059407919	Halladay Phil
Well Technician's Licence No.	**Signature of Technician and/or Contractor**	**Date Submitted**
3532		2018 01 19

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: ____

Date Work Completed: 2018 01 09

Ministry Use Only

Audit No: Z 212305

FEB 13 2018

Received

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

D-2138

FEB 13 2018

D-2141
2-212305

5 m t ata ©2018 Goo Report a map error

7305582

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: [X] Metric [ ] Imperial

Well Tag#: A182722 (ow)

A182722

Well Record

Regulation 903 Ontario Water Resources Act

S-21391 Page _____ of _____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
355 Cooper St			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445534	5029570		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	Concrete			0	.15
GRY	Gravel		Loose	.15	.31
BRN	Clay	Silt	Soft	.31	1.83
GRY	Clay		Soft	1.83	3.96

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete Flushmount	
.31	.91	Bentonite	
.91	3.96	Sand	

Method of Construction

[ ] Cable Tool [ ] Diamond
[ ] Rotary (Conventional) [ ] Jetting
[ ] Rotary (Reverse) [ ] Driving
[ ] Boring [ ] Digging
[ ] Air percussion
[X] Other, specify direct push

Well Use

[ ] Public [ ] Commercial [ ] Not used
[ ] Domestic [ ] Municipal [ ] Dewatering
[ ] Livestock [X] Test Hole [X] Monitoring
[ ] Irrigation [ ] Cooling & Air Conditioning
[ ] Industrial
[ ] Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
3.45	PVC	.356	0	.91

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.21	PVC	10	.91	3.96

Status of Well

[ ] Water Supply
[ ] Replacement Well
[X] Test Hole
[ ] Recharge Well
[ ] Dewatering Well
[X] Observation and/or Monitoring Hole
[ ] Alteration (Construction)
[ ] Abandoned, Insufficient Supply
[ ] Abandoned, Poor Water Quality
[ ] Abandoned, other, specify
[ ] Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	Hole Diameter Depth From (m/ft)	Depth To (m/ft)	Diameter (cm/in)
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify			
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify	0	3.96	5.08
[ ] Gas	[ ] Fresh [ ] Untested [ ] Other, specify			

Results of Well Yield Testing

After test of well yield, water was:
[ ] Clear and sand free
[ ] Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? [ ] Yes [ ] No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

See MAP

4

Comments: Well in boiler room

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata drilling Group	7241

Business Address (Street Number/Name)	Municipality
165 Shields Court	Markham

Province	Postal Code	Business E-mail Address
ON	L3R8V2	Wrecords@Stratasoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
9054907919	Halladay, Phil

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3832		2018 01 16

Well owner's information package delivered: [ ] Yes [ ] No

Date Package Delivered: _____

Date Work Completed: 2018 01 09

Ministry Use Only

Audit No: Z 212306

Received FEB 13 2018

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

3-2138

FEB 13 2018

C-7241
Z-212306

5 m ata ©2018 Goo Report a map error

7312995

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☑ Metric ☐ Imperial

We Tag#: A199385 Below)

A199385

Well Record

Regulation 903 Ontario Water Resources Act

S-21688 Page _____ of _____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
355 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
	ottawa	Ontario	
UTM Coordinates Zone / Easting / Northing	**Municipal Plan and Sublot Number**	**Other**	
NAD 83 18 445576 5029551			

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Fill	Sand, Gravel	Packed	0	1.22
BRN	Clay	Sand	Soft	1.22	3.1
GRY	Clay		Soft	3.1	6.1

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	Concrete Flushmount	
		Bentonite	
		Sand	

Method of Construction

☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☑ Other, specify Direct Push

Well Use

☐ Public ☐ Commercial ☐ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☑ Test Hole ☑ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
4.07	PVC	368	0	3.1

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.82	PVC	10	3.1	6.1

Status of Well

☐ Water Supply ☐ Replacement Well ☑ Test Hole ☐ Recharge Well ☐ Dewatering Well ☑ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify
	☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
0	6.1	8.25

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

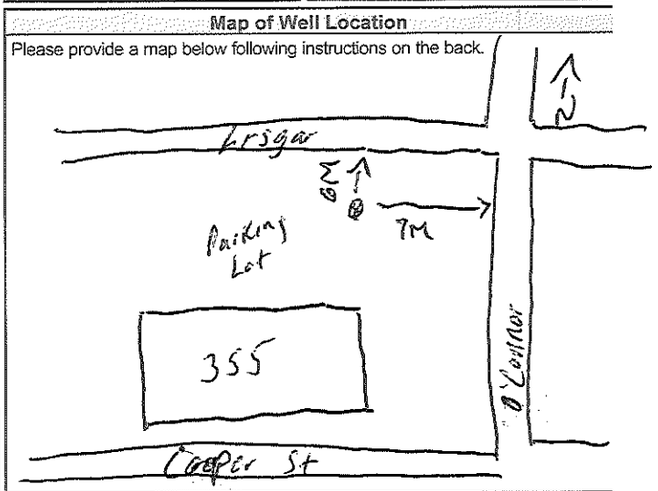

Comments: EXP

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7414
Business Address (Street Number/Name)	**Municipality**
165 Shields Court	Markham
Province	**Postal Code**	**Business E-mail Address**
ON	L3R8N2	Wrecords@stratase.ca
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**	
905 940 7919	Holladay, Phil	
Well Technician's Licence No.	**Signature of Technician and/or Contractor**	**Date Submitted**
3832		2018 03 28

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: Y Y Y Y M M D D

Date Work Completed: 2018 03 02

Ministry Use Only

Audit No: Z 212308

Received JUN 19 2018

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

7312996

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☐ Metric ☒ Imperial

Well Tag#: A215904 A215904

Well Record

Regulation 903 Ontario Water Resources Act

S-21688 Page _____ of _____

CARLETON UNIVERSITY

Address of Well Location (Street Number/Name)	Township	Lot	Concession
315 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
		Ontario	
UTM Coordinates NAD 8 3 — Zone 18 — Easting 445158 — Northing 5029481	**Municipal Plan and Sublot Number**	**Other**	

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BLK	Topsoil			0	1
BRN	fine Sand	Gravel, Silt	Fill	1	10
GRY	Clay	Silt	Soft	10	20

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	Concrete Flush mount	
1	9	bentonite	
9	20	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☒ Other, *specify* direct push

Well Use

☐ Public ☐ Commercial ☐ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☒ Test Hole ☒ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
1.38	PVC	.14	0	10

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
1.66	PVC	10	10	20

Status of Well

☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, *specify* ☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Kind of Water	Hole Diameter Depth From	Depth To	Diameter (cm/in)
☐ Gas	☐ Fresh ☐ Untested ☐ Other, *specify*	0	20	23.5
☐ Gas	☐ Fresh ☐ Untested ☐ Other, *specify*			
☐ Gas	☐ Fresh ☐ Untested ☐ Other, *specify*			

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7121
Business Address (Street Number/Name)	**Municipality**
65 Shields Court	Markham
Province	**Postal Code**
ON	L3R 9W2
Business E-mail Address	
wrecords@stratagroup.com	
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**
905 940 7979	Beatty, Ryan
Well Technician's Licence No.	**Signature of Technician and/or Contractor**
5161	
Date Submitted	
2018 03 09	

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, *specify*

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
50		50	
60		60	

Map of Well Location

Please provide a map below following instructions on the back.

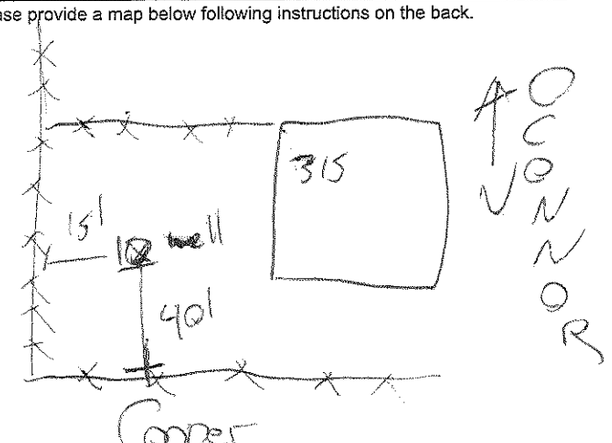

Comments: Exp General Contractor

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: Y Y Y Y M M D D

Date Work Completed: 2018 03 07

Ministry Use Only

Audit No. 277582

Received 2018 03 19

0506E (2014/11) Ministry's Copy

© Queen's Printer for Ontario, 2014

7334763

Ontario — Ministry of the Environment and Climate Change

Measurements recorded in: ☐ Metric ☒ Imperial

Well T... Tag#:A257375 ...Below)

A257375

Well Record

Regulation 903 Ontario Water Resources Act

S-22915 Page ____ of ____

SERCO REALTY LTD.

Address of Well Location (Street Number/Name)	Township	Lot	Concession
331 Cooper St			
County/District/Municipality	**City/Town/Village**	**Province**	**Postal Code**
	Ottawa	Ontario	
UTM Coordinates NAD 8 3	**Zone** 18 **Easting** 445651 **Northing** 5029536	**Municipal Plan and Sublot Number**	**Other**

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	Gravel	Asphalt	hard packed	0	1
BRN	Med Sand		Soft loose	1	6
GRY	Clay	S. H	soft	6	18

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1	Concrete / flushmount	
1	2	Bensea	
2	18	Filter Sand	

Method of Construction

☐ Cable Tool ☐ Diamond ☐ Rotary (Conventional) ☐ Jetting ☐ Rotary (Reverse) ☐ Driving ☐ Boring ☐ Digging ☐ Air percussion ☒ Other, specify direct push

Well Use

☐ Public ☐ Commercial ☐ Not used ☐ Domestic ☐ Municipal ☐ Dewatering ☐ Livestock ☒ Test Hole ☒ Monitoring ☐ Irrigation ☐ Cooling & Air Conditioning ☐ Industrial ☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
1.38	pvc	.14	0	8

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
1.66	pvc	10	8	18

Status of Well

☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	Gas	Other, specify
	☐ Fresh ☐ Untested	☐	
	☐ Fresh ☐ Untested	☐	
	☐ Fresh ☐ Untested	☐	

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
0	18	2.375

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

MW1 on MAP

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7141
Business Address (Street Number/Name)	**Municipality**
165 Shields Court	Markham
Province	**Postal Code**	**Business E-mail Address**
ON	L3R 8V2	wreports@stratasoil.com
Bus. Telephone No. (inc. area code)	**Name of Well Technician (Last Name, First Name)**
9059400719	Beattie Brian
Well Technician's Licence No.	**Signature of Technician and/or Contractor**	**Date Submitted**
3616		2019/08/14

Comments: Pinchin General Contractors

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered ____

Date Work Completed 2018/08/14

Ministry Use Only

Audit No. Z298238

MAR 08 2019

Received

Ministry's Copy

© Queen's Printer for Ontario, 2014

MAR 0 8 2019

G7241 229838

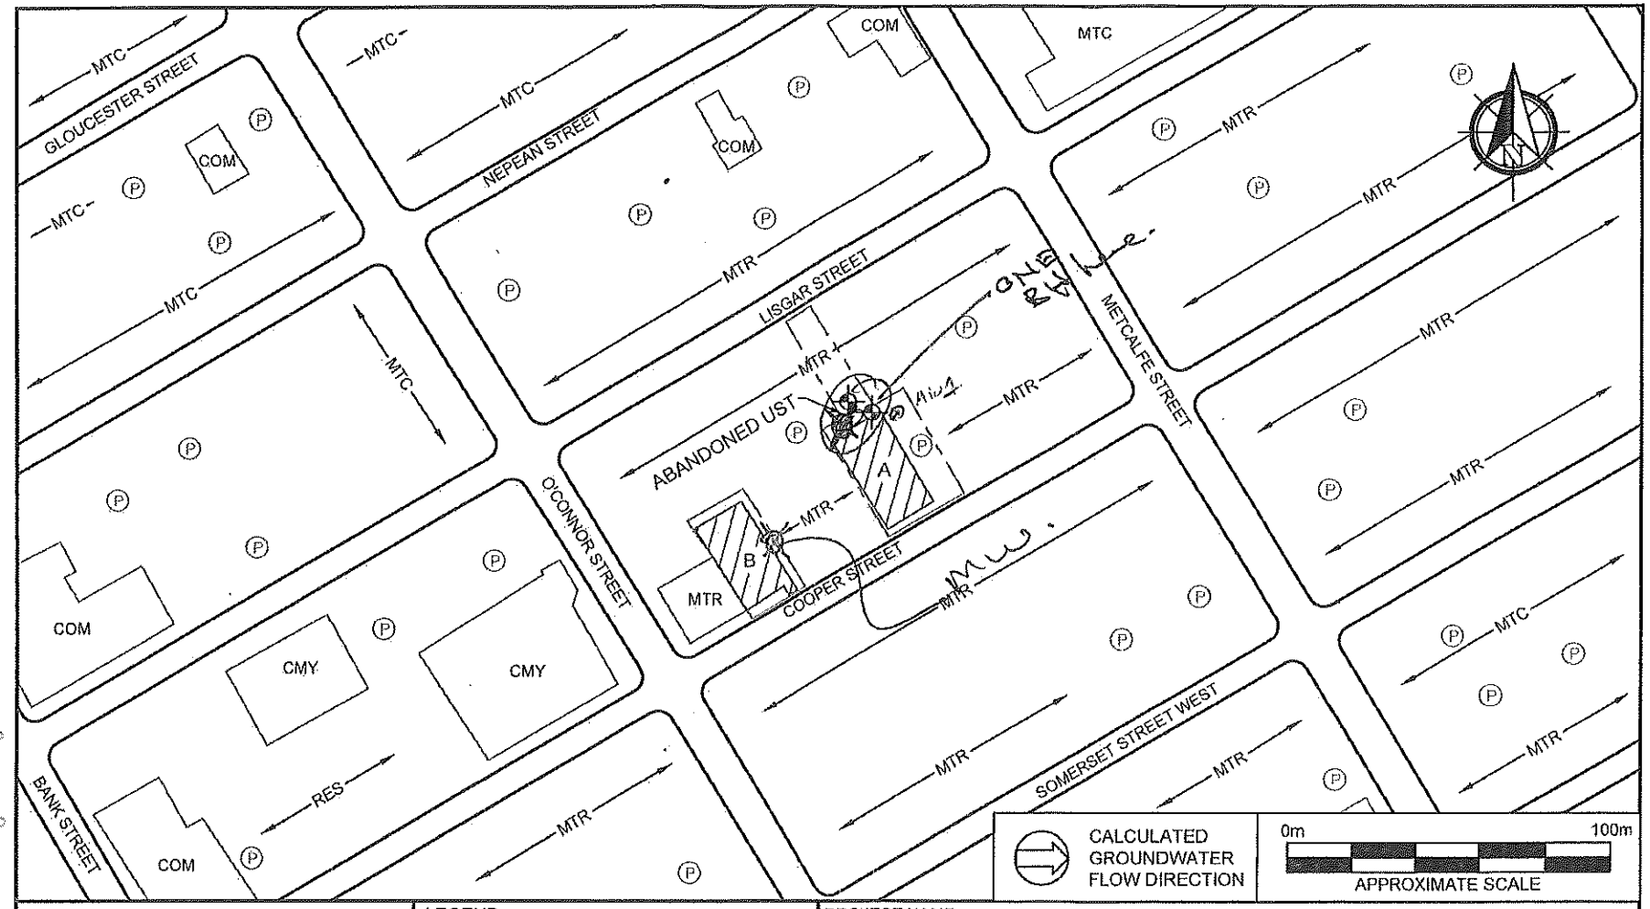

PINCHIN

LEGEND

- SITE BOUNDARY
- SITE BUILDING
- RES RESIDENTIAL
- MTR MULTI-TENANT RESIDENTIAL
- COM COMMERCIAL
- MTC MULTI-TENANT COMMERCIAL
- CMY COMMUNITY
- UST UNDERGROUND STORAGE TANK
- (P) PARKING
- GROUNDWATER MONITORING WELL

PROJECT NAME: PHASE I ENVIRONMENTAL SITE ASSESSMENT			
CLIENT NAME: SERCO COMMERCIAL HOLDINGS INC.			
PROJECT LOCATION: 309 AND 331 COOPER STREET, OTTAWA, ONTARIO			
FIGURE NAME: SITE AND SURROUNDING LAND USE PLAN			FIGURE NO. 2
APPROXIMATE SCALE: AS SHOWN	PROJECT NO.: 230021	DATE: OCTOBER 2018	

Ontario

Ministry of the Environment and Climate Change

Well Tag No. *(Place Sticker and/or Print Below)*

Well Record

Regulation 903 Ontario Water Resources Act

Page _____ of _____

Measurements recorded in: ☐ Metric ☐ Imperial

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
100 CONSTELLATION DR	OTTAWA	ON	K2G6S8	6135802426

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
KENT ST.	OTTAWA		

County/District/Municipality	City/Town/Village	Province	Postal Code
OTTAWA	OTTAWA	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445355	5029224		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
	ABANDON ~~PTW~~ VPW				

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used *(Material and Type)*	Volume Placed (m^3/ft^3)

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☐ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter *(cm/in)*	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness *(cm/in)*	Depth (m/ft) From	Depth (m/ft) To

Construction Record - Screen

Outside Diameter *(cm/in)*	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To

Status of Well

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*
☐ Other, *specify*

Water Details

Water found at Depth (m/ft)	Gas	Kind of Water: Fresh	Untested	Other, *specify*
	☐	☐	☐	☐
	☐	☐	☐	☐
	☐	☐	☐	☐

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter *(cm/in)*

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping _____ hrs + _____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

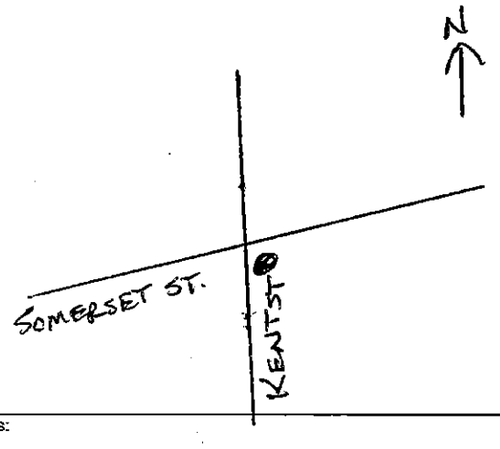

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
CCC GEOTECHNICAL + ENVIRONMENTAL DRILLING	7543

Business Address (Street Number/Name)	Municipality
48-2627 EDINBURGH PL	OTTAWA

Province	Postal Code	Business E-mail Address
ON	K1B5M1	matt.webb@cccgroup.ca

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
6137572277	CORY ALGER

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
3388	Cory Alger	Y Y Y Y M M D D

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☐ No	Y Y Y Y M M D D	Y Y Y Y M M D D

Ministry Use Only

Audit No. Z287916

Received 2 2019

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

Ontario

Ministry of the Environment and Climate Change

Measurements recorded in: ☐ Metric ☑ Imperial

Well Tag No. *(Place Sticker and/or Print Below)* A191626 17-4

Well Record

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
100 Constellation Dr.	Ottawa	ON	K2G6J8	6135802424

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
Kent St.			

County/District/Municipality	City/Town/Village	Province	Postal Code
Ottawa	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445267	5029378		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
			20% bentonite slurry	17.5ft	35ft
			Portland (quick grout)		
			3/8 bentonite chips	6in	17.5ft
			Cold patch asphalt	0ft	6in
		Top 6' of 2in PVC cut			

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☐ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To

Status of Well

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☑ Abandoned, other, *specify* NB Longer required
☐ Other, *specify* _____

Water Details

Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☑ Untested ☐ Other, *specify*
25		
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)
6in	35ft	2in
Well Pipe Size		

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min / GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min / GPM)

Well production (l/min / GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
CCC Drilling	7543

Business Address (Street Number/Name)	Municipality
48-2627 Edinburgh Place	Ottawa

Province	Postal Code	Business E-mail Address
ON	K1B5M6	mackie@cccgroup.ca

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
6137375227	Chad Echlin

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
32199		2019 09 22

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☑ No		2019 09 19

Ministry Use Only

Audit No. Z286433

Received OCT 22 2019

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

Ontario

Ministry of the Environment and Climate Change

A157400

Well Tag No. *(Place Sticker and/or Print Below)* 13-1116 13-1114a

Well Record

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Measurements recorded in: ☐ Metric ☐ Imperial

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
100 Constellation Dr.	Ottawa	ON	K2G6J8	6135802424

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
Kent St.			

County/District/Municipality	City/Town/Village	Province	Postal Code
Ottawa	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 8 3	18	445182	5029510		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
			2990 bentonite slurry (PorHard / Quickgrout)	21	Bottom
			7/8 PorHard chips	6"	21
			Cold patch asphalt	0"	6"
			Both these were 3/4" standpipes installed in the same hole. Could not get a tape down the pipe's for a measurement. Top 5' of pipe out of both.		

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used *(Material and Type)*	Volume Placed (m^3/ft^3)

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☐ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To

Status of Well

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify* NSLonged Capped
☐ Other, *specify* _____

Water Details

Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping _____ hrs + _____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
50		50	
60		60	

Map of Well Location

Please provide a map below following instructions on the back.

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
CCC Drilling	7513

Business Address (Street Number/Name)	Municipality	Province	Postal Code	Business E-mail Address
48-2627 Edinburgh Place	Ottawa	ON	K1B5M1	mark@cccgroup.ca

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)	Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
6137375217	Chad Edlin	52199		2019/10/22

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered: 2019/10/19

Date Work Completed: 2019/09/19

Ministry Use Only

Audit No. Z286432

Received OCT 22 2019

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

Ontario

Ministry of the Environment and Climate Change

Well Tag No. *(Place Sticker and/or Print Below)* No tag found 17-3

Well Record

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Measurements recorded in: ☐ Metric ☑ Imperial

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
	City of Ottawa		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. *(inc. area code)*
100 Constellation Dr.	Ottawa	ON	K2G6J8	(613) 580-2424

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
Kent St			

County/District/Municipality	City/Town/Village	Province	Postal Code
Ottawa	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 8 3	18	445355	5029228		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
			20% bentonite slurry (Portland / Quickgel)	1'8"	46'
			3/8 bentonite chips	6"	1'8"
			Cold patch asphalt	0"	6"
			Top 6' of 2" PVC out		

Annular Space

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used *(Material and Type)*	Volume Placed *(m³/ft³)*

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☐ Test Hole ☐ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter *(cm/in)*	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness *(cm/in)*	Depth (m/ft) From	Depth (m/ft) To

Construction Record - Screen

Outside Diameter *(cm/in)*	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To

Status of Well

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☐ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☑ Abandoned, other, *specify* No Longer Required
☐ Other, *specify* _____

Water Details

Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☑ Untested ☐ Other, *specify*
41		
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*
Water found at Depth (m/ft)	☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, *specify*

Hole Diameter

Depth (m/ft) From	Depth (m/ft) To	Diameter *(cm/in)*
6"	46'	2"
Well Pipe Size		

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
CC Drilling	7514

Business Address (Street Number/Name)	Municipality
48-2627 Edinburgh Rd	Ottawa

Province	Postal Code	Business E-mail Address
ON	K1B5M1	mweb@ccdrill.ca

Bus. Telephone No. *(inc. area code)*	Name of Well Technician (Last Name, First Name)
(613) 737-5227	Chad Echlin

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
32199		2019/09/22

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, *specify* _____

If pumping discontinued, give reason:

Pump intake set at *(m/ft)*

Pumping rate *(l/min / GPM)*

Duration of pumping _____ hrs + _____ min

Final water level end of pumping *(m/ft)*

If flowing give rate *(l/min / GPM)*

Recommended pump depth *(m/ft)*

Recommended pump rate *(l/min / GPM)*

Well production *(l/min / GPM)*

Disinfected? ☐ Yes ☐ No

Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
50		50	
60		60	

Map of Well Location

Please provide a map below following instructions on the back.

Comments:

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☑ No		2019/09/19

Ministry Use Only

Audit No. Z286434

Received OCT 22 2019

0506E (2014/11)

Ministry's Copy

© Queen's Printer for Ontario, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7354243
Well Audit Number: *Z302715*
Well Tag Number: *A282350*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	281 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445329.00 Northing: 5029309.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	GRVL	----	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	7.13 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	3.72 m	BENTONITE		
3.72 m	7.13 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
4.03 cm	PLASTIC	0 m	4.03 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
4.82 cm	PLASTIC	4.03 m	7.13 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter
0 m	7.13 m	8.3 cm

Audit Number: Z302715

Date Well Completed: January 24, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024

Published: March 20, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7354244
Well Audit Number: *Z302714*
Well Tag Number: *A269067*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	81 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445329.00 Northing: 5029277.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	GRVL	----	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	6.1 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	2.79 m	BENTONITE		
2.79 m	6.1 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
4.03 cm	PLASTIC	0 m	3.1 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
4.82 cm	PLASTIC	3.1 m	6.1 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter
0 m	6.1 m	8.3 cm

Audit Number: Z302714

Date Well Completed: January 20, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024

Published: March 20, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7354245
Well Audit Number: *Z302708*
Well Tag Number: *A269066*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	281 kent st
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445323.00 Northing: 5029289.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	----	GRVL	LOOS	0 m	.31 m

BRWN	CLAY	SILT	DNSE	.31 m	4 m
GREY	SILT	SAND	SOFT	4 m	6.1 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	2.79 m	BENTONITE		
2.79 m	6.1 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push	Monitoring	
	Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
4.03 cm	PLASTIC	0 m	3.1 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
4.82 cm	PLASTIC	3.1 m	6.1 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter
0 m	6.1 m	8.3 cm

Audit Number: Z302708

Date Well Completed: January 20, 2020

Date Well Record Received by MOE: February 19, 2020

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024

Published: March 20, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7382782
Well Audit Number: *Z338246*
Well Tag Number: *A302969*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	311 Somerset St W
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445647.00 Northing: 5029419.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
GREY	GRVL		HARD	0 m	2 m

GREY	GRVL	FILL	HARD	2 m	5 m
GREY	SILT	CLAY	SOFT	5 m	9 m
GREY	CLAY		SOFT	9 m	20 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1 m	CONCRETE FLUSHMOUNT		
1 m	9 m	BENSEAL		
9 m	20 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push		
	Monitoring and Test Hole	

Status of Well

Observation Wells

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
2.047 cm	PLASTIC	0 m	10 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
2.375 cm	PLASTIC	10 m	20 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	

If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	

2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter
0 m	20 m	4.5 cm

Audit Number: Z338246

Date Well Completed: February 19, 2021

Date Well Record Received by MOE: March 18, 2021

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024
Published: March 20, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7382859
Well Audit Number: *Z343100*
Well Tag Number: *A302968*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	311 Somerset St W
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445633.00 Northing: 5029462.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
GREY	GRVL		DNSE	0 m	2 m

GREY	FILL		DNSE	2 m	4 m
GREY	SILT	CLAY	SOFT	4 m	10 m
GREY	CLAY		SOFT	10 m	22.5 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1 m	CONCRETE FLUSHMOUNT		
1 m	11.5 m	BENSEAL		
11.5 m	22.5 m	SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Direct Push		
	Monitoring and Test Hole	

Status of Well

Observation Wells

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
2.047 cm	PLASTIC	0 m	12.5 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
2.37 cm	PLASTIC	12.5 m	22.5 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	

If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	

2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter
0 m	22.5 m	4.5 cm

Audit Number: Z343100

Date Well Completed: February 19, 2021

Date Well Record Received by MOE: March 17, 2021

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024
Published: March 20, 2014

Ontario — Ministry of the Environment, Conservation and Parks

Well Record

Regulation 903 Ontario Water Resources Act

Well Tag No. (Place Sticker and/or Print Below): A302973 Tag#:A302973

Measurements recorded in: ☑ Metric ☐ Imperial

Page ____ of ____

Well Owner's Information

First Name	Last Name/Organization	E-mail Address	☐ Well Constructed by Well Owner
	Somerset & O'Conner		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
252 Argyle Ave	Ottawa	ON	K2P1B9	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
311 Somerset			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445630	5029428		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	gravel	sand	loose	0	.31
BRN	sand	gravel	soft	.31	2.44
BRN	clay	sand	soft	2.44	3.66
GRY	clay	silt	soft, wet	3.66	11.28
GRY	silt	gravel, shale	dense	11.28	13.1

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	concrete/cement	
.31	9.75	bentonite	
9.75	13.1	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☑ Air percussion
☐ Other, specify

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	.390	0	10.05

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	10.05	13.1

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	13.1	11.43

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min/GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min/GPM)

Well production (l/min/GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

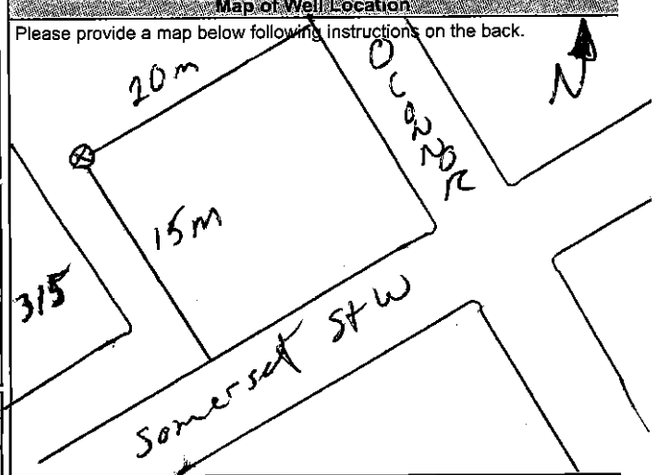

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Stratas Drilling Group	7241

Business Address (Street Number/Name)	Municipality
129 Ringwood Dr.	Stouffville

Province	Postal Code	Business E-mail Address
ON	L4A8C1	wrecord@stratasil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
9059487919	McCoy, James

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted Y Y Y Y M M D D
7108		

Well owner's information package delivered ☐ Yes ☐ No

Date Package Delivered Y Y Y Y M M D D

Date Work Completed 2021/05/26

Ministry Use Only

Audit No. Z364081

Received JUN 29 2021

Ministry's Copy

0506E (2020/06) © Queen's Printer for Ontario, 2020

Ontario — Ministry of the Environment, Conservation and Parks

Well Record

...ation 903 Ontario Water Resources Act

Measurements recorded in: ☑ Metric ☐ Imperial

Well Tag No. (Place Sticker and/or Print Below) A302951 Tag#:A302951

Page _____ of _____

Well Owner's Information

First Name	Last Name/Organization	E-mail Address	☐ Well Constructed by Well Owner
	Somerset & O'Connor		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
252 Argyle Ave	Ottawa	ON	K2P1B9	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
311 Somerset			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445624	5029452		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	top soil		soft	0	.31
BRN	sand	gravel	soft	.31	2.13
BRN	clay	sand	soft	2.13	3.66
GRY	clay	silt	soft, wet	3.66	10.36
GRY	silt	gravel, shale	dense	10.36	14.33

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m^3/ft^3)
0	.31	cement/bentonite	
.31	10.97	bentonite	
10.97	14.33	filter sand	

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify _____

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping _____ hrs + _____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min/GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min/GPM)

Well production (l/min/GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☑ Air percussion
☐ Other, specify, _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, specify _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
2.0	PVC	.390	0	11.28

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	11.28	14.33

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Water Details

Water found at Depth (m/ft)	Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify

Hole Diameter

Depth (m/ft) From	To	Diameter (cm/in)
0	14.33	11.43

Map of Well Location

Please provide a map below following instructions on the back.

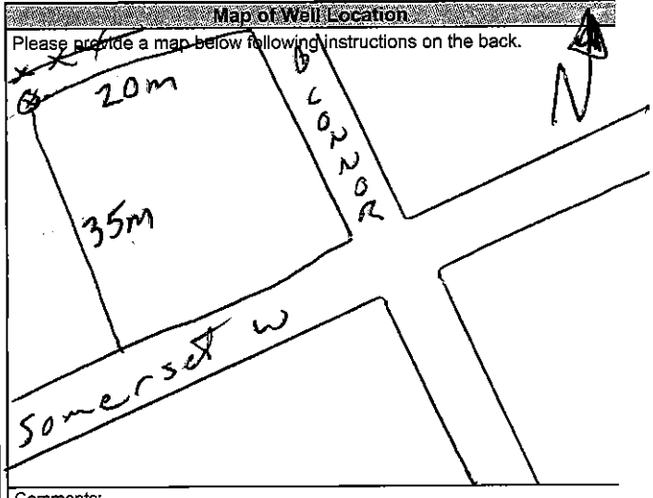

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7214

Business Address (Street Number/Name)	Municipality
129 Ringwood Dr	Stouffville

Province	Postal Code	Business E-mail Address
Ont	L4A8C1	wlrecord@stratasoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
9059407917	McCoy, James

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
7210		Y Y Y Y M M D D

Well owner's information package delivered	Date Package Delivered	Date Work Completed
☐ Yes ☐ No		2021 05 25

Ministry Use Only

Audit No. Z364138

Received JUN 29 2021

0506E (2020/06) © Queen's Printer for Ontario, 2020

Ministry's Copy

Ontario — Ministry of the Environment, Conservation and Parks

Measurements recorded in: ☑ Metric ☐ Imperial

Well Tag No. (Place Sticker and/or Print Below): 1302952 | Tag#:A302952

Well Record

Regulation 903 Ontario Water Resources Act

Page ____ of ____

Well Owner's Information

First Name	Last Name/Organization	E-mail Address	☐ Well Constructed by Well Owner
	Somerset & O'Connor		

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code	Telephone No. (inc. area code)
252 Argyle Ave	Ottawa	ON	K2P 1B9	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
311 Somerset			

County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	445647	5029441		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
GRY	gravel	sand	loose	0	.31
BRN	sand	gravel	soft	.31	2.74
BRN	clay	sand	soft	2.74	3.35
GRY	clay	silt	soft	3.35	11.28
GRY	silt	gravel, shale	dense	11.28	14.94

Annular Space

Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	.31	concrete/Rushmant	
.31	11.58	bentonite	
11.58	14.94	filter sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☑ Air percussion
☐ Other, specify

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☑ Municipal ☐ Dewatering
☐ Livestock ☑ Test Hole ☑ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, specify

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To
5.20	PVC	.390	0	11.89

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
6.03	PVC	10	11.89	14.94

Status of Well

☐ Water Supply
☐ Replacement Well
☑ Test Hole
☐ Recharge Well
☐ Dewatering Well
☑ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Water Details

Water found at Depth (m/ft)	Kind of Water	Hole Diameter Depth From	Depth To	Diameter (cm/in)
☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify	0	14.94	11.43
☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify			
☐ Gas	☐ Fresh ☐ Untested ☐ Other, specify			

Results of Well Yield Testing

After test of well yield, water was:
☐ Clear and sand free
☐ Other, specify

If pumping discontinued, give reason:

Pump intake set at (m/ft)

Pumping rate (l/min / GPM)

Duration of pumping ____ hrs + ____ min

Final water level end of pumping (m/ft)

If flowing give rate (l/min/GPM)

Recommended pump depth (m/ft)

Recommended pump rate (l/min/GPM)

Well production (l/min/GPM)

Disinfected? ☐ Yes ☐ No

	Draw Down Time (min)	Draw Down Water Level (m/ft)	Recovery Time (min)	Recovery Water Level (m/ft)
Static Level				
1			1	
2			2	
3			3	
4			4	
5			5	
10			10	
15			15	
20			20	
25			25	
30			30	
40			40	
50			50	
60			60	

Map of Well Location

Please provide a map below following instructions on the back.

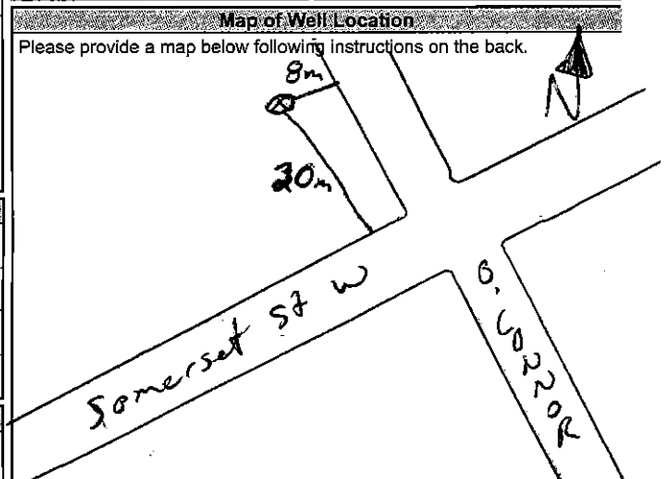

Comments:

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
Strata Drilling Group	7241

Business Address (Street Number/Name)	Municipality
129 Ringwood Dr	Stouffville

Province	Postal Code	Business E-mail Address
Ont	L4A8C1	wrecord@stratasoil.com

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
9059407917	McCoy, James

Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
7107		

Well owner's information package delivered: ☐ Yes ☐ No

Date Package Delivered: ____

Date Work Completed: 2021/05/25

Ministry Use Only

Audit No. Z364139

Received JUN 29 2021

0506E (2020/06) © Queen's Printer for Ontario, 2020

Ministry's Copy

Ontario — Ministry of the Environment, Conservation and Parks

Well Record for Well Cluster – Part 1 of 3

(Only for Multiple Test Holes or Dewatering Wells)

Regulation 903 Ontario Water Resources Act

All measurements recorded in: ☒ Metric ☐ Imperial

Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: *(Print Well Tag No.)* A290213

Well No. on Drawing of Deepest Well:

☐ Dewatering wells ☑ Test holes

No. of wells reported 1-21(B)

Page 1 of 1

Well Cluster Location Information

Address of Well Location (Street Number(s)/Name(s), RR, if available)	Lot(s)	Concession(s)	Geographic Township	County/District/Upper Tier Municipality
108 NEPEAN STREET				

City, Town, Village or Hamlet	Province	GPS Unit Make	Model	Unit Mode of Operation
OTTAWA	Ontario	GARMIN	ETREX	☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify:

Mandatory Attachments/Additional Information

☒ Land Owner Consent Form must be attached.

☒ Detailed Drawing of All Well Locations must be attached.

I, the person constructing the well, will promptly submit to the Director, on request, any additional information in my custody or control related to any well in the well cluster that I have constructed.

Signature of Technician/Contractor — Date (yyyy/mm/dd): 2021/06/25

Well Details

Well # on Drawing	UTM Coordinates Zone	Easting	Northing	Hole Depth (m/ft)	Hole Diameter (cm/in)	Method of Construction	Casing Material; Diameter (cm/in)	Casing (m/ft) From	Casing (m/ft) To	Screen Interval (m/ft) From	Screen Interval (m/ft) To	Annular Space Material (m/ft) From	Annular Space Material (m/ft) To	Annular Space Material: Material:	Overburden/Bedrock or Abandonment Filing Material Intervals (m/ft)	Static Water Level (m/ft)	Date of Completion (yyyy/mm/dd)
1-21(B)	18	445557	5029638	9.6 12.93	20.3 7.62	HSA DIAMOND NW/C	3.18	0.1	9.88	9.88	12.93	0.25	9.14	BENTONITE	0-0.9 FILL, TILL → 9.6 LIMESTONE	(2.24) 1.82	2021/03/09
2-21(A)	18	445585	5029649	9.65 12.8	20.3 7.62	HSA DIAMOND NW/C	3.18	0.1	9.75	9.75	12.8	0.25	9.4	BENTONITE	0-0.9 FILL, TILL → 9.65 LIMESTONE	11.82	2021/03/10
3-21(C)	18	445578	5029623	9.65 12.93	20.3 7.62	HSA DIAMOND NW/C	3.18	0.1	9.88	9.88	12.93	0.25		BENTONITE	0-0.9 FILL, TILL → 9.65 LIMESTONE	11.72	2021/03/10

Well Contractor and Well Technician Information

Business Name of Well Contractor	Business Address (Street Number/Name, RR)	~~Municipality~~	Province
EASTERN ONTARIO DIAMOND DRILLING LTD	3780 COUNTY ROAD 17, P.O. BOX 46	HAWKESBURY	ON

Postal Code	Bus. Telephone No.	Well Contractor's Licence No.	Business E-mail Address
K6A2R4	[redacted](613)632-7769	7328	eodd@spacedowningdrilling.com

Name of Well Technician (First Name, Last Name)	Well Technician's Licence No.	Signature of Well Technician	Date Submitted (yyyy/mm/dd)
STEPHEN DOWNING	3326		2021/06/25

Date First Well in Cluster Constructed or Abandoned (yyyy/mm/dd)	Date Last Well in Cluster Completed (yyyy/mm/dd)
2021/03/09	2021/03/10

Well Abandonment

Person Abandoning the Wells:

Name N/A

(Print or Type) - See instruction 11 on the back of this form

Ministry Use Only

Date Received (yyyy/mm/dd)	Audit No.
JUL 07 2021	C 52802

Comments:

1991E (2020/06) © Queen's Printer for Ontario, 2020

Ministry's Copy

Ontario

Ministry of the Environment, Conservation and Parks

Well Record for Well Cluster - Part 3 of 3
Detailed Drawing of All Well Locations

Note: This **Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations,** must be attached to Parts 1 and 2.
The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the **Well Record for Well Cluster Parts 1 and 2.**
The well with the well tag must be clearly identified on the Drawing.
UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing

Well Tag Number: # A290213

"Well Record for Well Cluster" Form Audit Number: # C52802

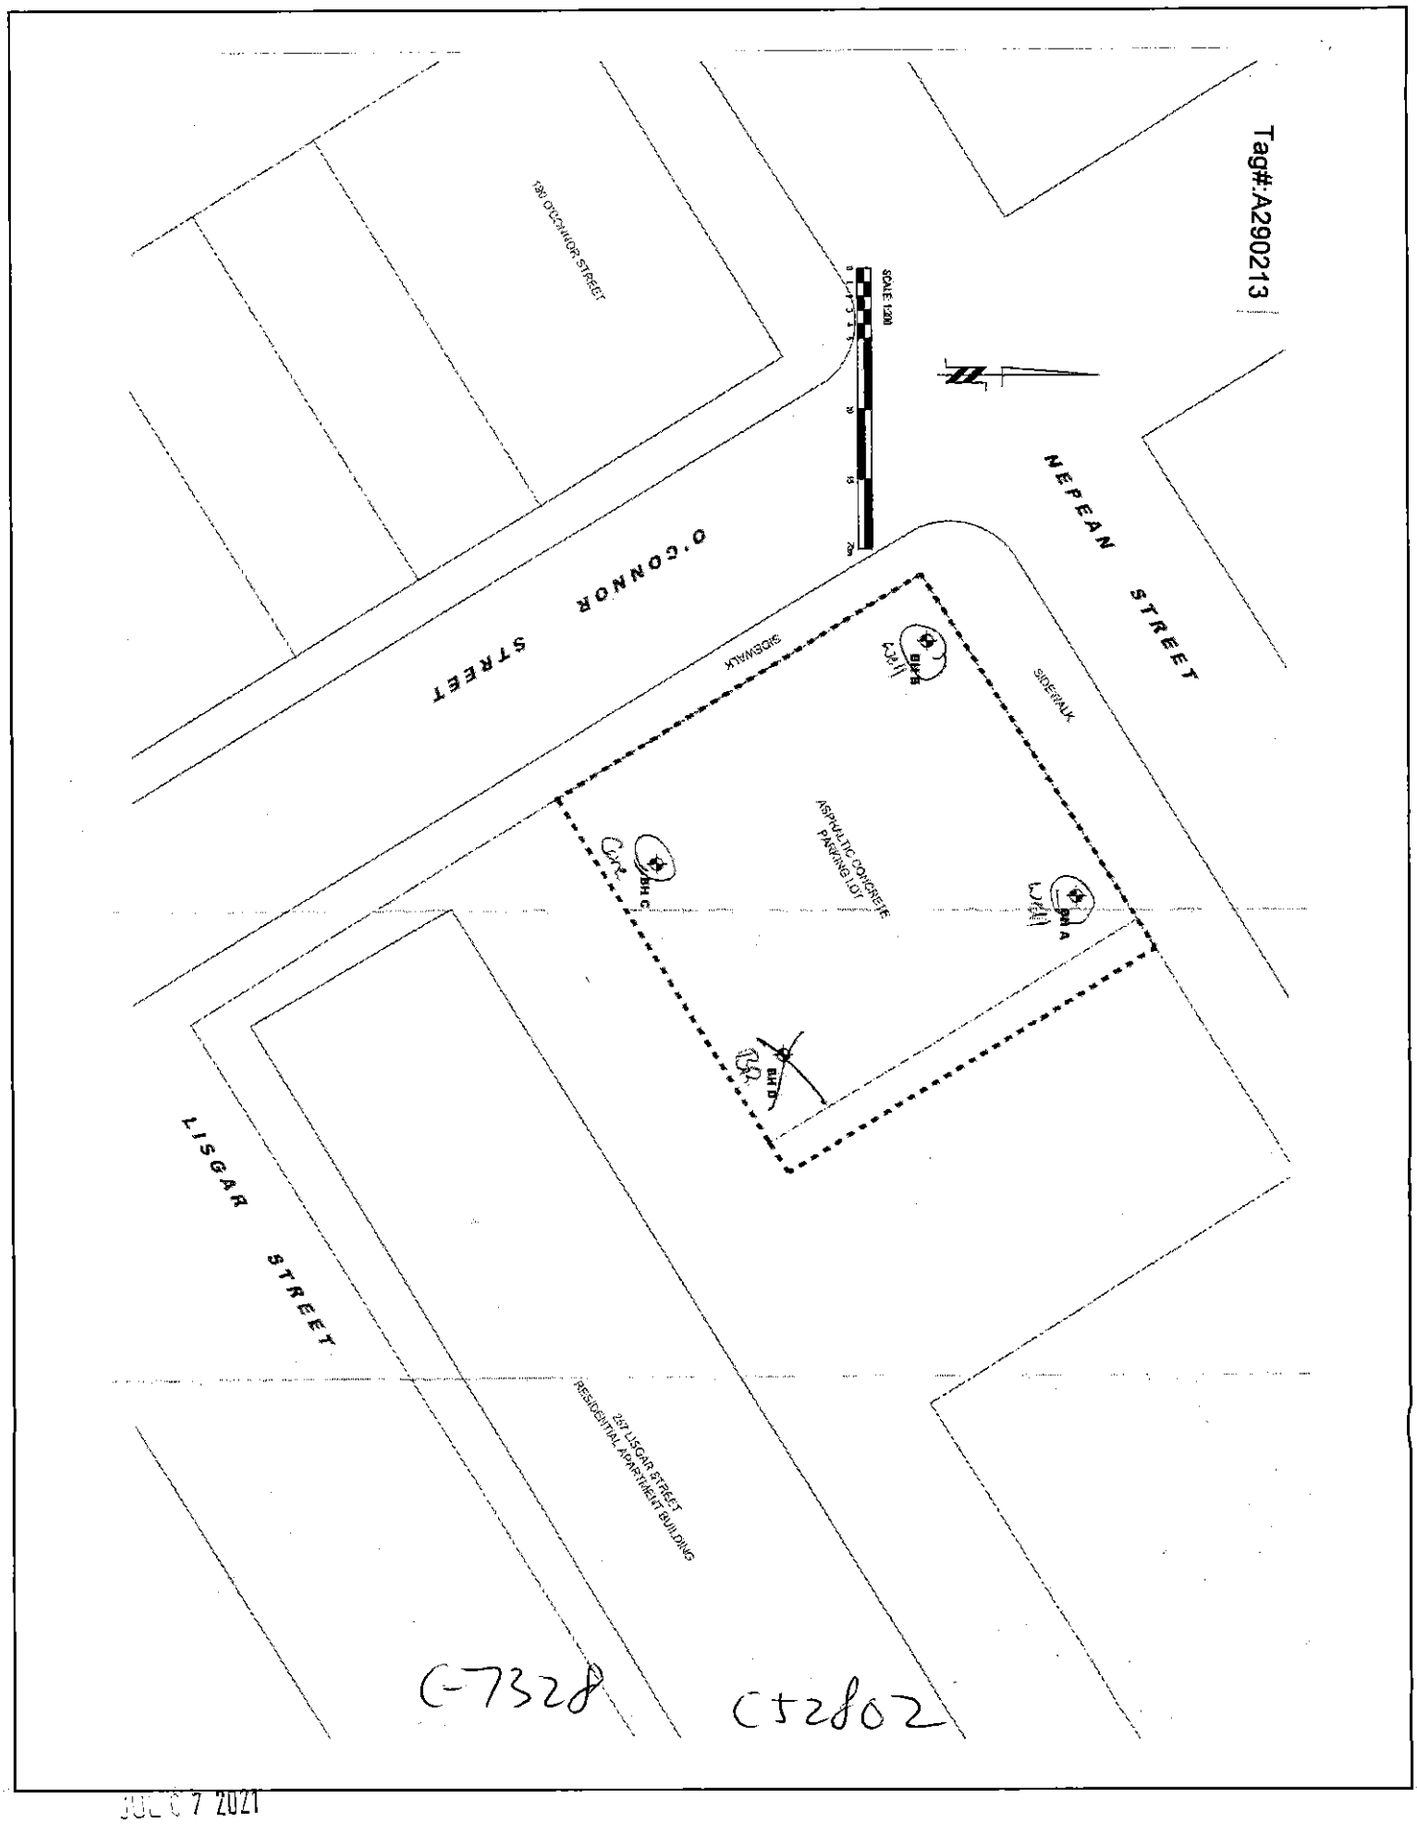

JUL 07 2021

 © Queen's Printer for Ontario, 2020

Ministry's Copy

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7439284
Well Audit Number: *Z394366*
Well Tag Number: *A355544*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location		
Township	NEPEAN TOWNSHIP	

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445428.00 Northing: 5029496.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6964

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter

Audit Number: Z394366

Date Well Completed: December 06, 2022

Date Well Record Received by MOE: December 30, 2022

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024
Published: March 20, 2014

Ontario (https://www.ontario.ca/page/government-ontario)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (https://data.ontario.ca/dataset/well-records) .

Go Back to Map

Well ID

Well ID Number: 7450257
Well Audit Number: *Z400694*
Well Tag Number: *A371031*
This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location		
Township	OTTAWA CITY	

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 445315.00 Northing: 5029555.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind

Hole Diameter

Depth From	Depth To	Diameter

Audit Number: Z400694

Date Well Completed: March 22, 2023

Date Well Record Received by MOE: May 01, 2023

Related

How to use a Ministry of the Environment map (https://www.ontario.ca/page/how-use-ministry-environment-map#wells)

Technical documentation: Metadata record (https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77)

Updated: January 10, 2024
Published: March 20, 2014

Outlook

RE: PE6874-Records Search Request

From Public Information Services <publicinformationservices@tssa.org>
Date Fri 1/17/2025 9:40 AM
To Kuldeep Panchal <KPanchal@patersongroup.ca>

External Email: Do not click on links or open attachments unless you trust the sender.

NO RECORD FOUND IN CURRENT DATABASE

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA's current database.

- We confirm that there are no records in our current database of any fuel storage tanks at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please go to the **TSSA Client Portal** to complete an Application for Release of Public Information.

Please refer to How to Submit a Public Information Request (tssa.org) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationservices@tssa.org.

Kind regards,

Kimberly Gage | Public Information & Records Agent
Public Information
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3581 | Fax: +1 416-734-3568 | E-Mail: kgage@tssa.org
www.tssa.org

Winner of 2024 5-Star Safety Cultures Award

From: Kuldeep Panchal <KPanchal@patersongroup.ca
>
Sent: Friday, January 17, 2025 8:53 AM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: PE6874-Records Search Request

[CAUTION]: This email originated outside the organisation.
Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello,

Could you please complete a search of your records for **underground/aboveground storage tanks, historical spills, or other incidents/infractions** for the following addresses in Ottawa, Ontario:

Bank Street : 212, 223, 240, 242, 243, 248, 250

Lisgar Street: 318, 360

Nepean Street: 222

Best Regards,

PATERSON GROUP
SOLUTION ORIENTED ENGINEERING

KULDEEP PANCHAL

Junior Environmental Scientist

Environmental Division

TEL: (613) 226-7381 ext.103
DIRECT: (613) 701-6276

9 AURIGA DRIVE
OTTAWA ON K2E 7T9

patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!

NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

File Number: D06-03-25-0007

February 12, 2025

Kuldeep Panchal
Paterson Group Inc.

Sent via email kpanchal@patersongroup.ca

Dear Kuldeep Panchal,

Re: Information Request
240 Bank Street Ottawa, Ontario ("Subject Property")

Internal Department Circulation:

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

- **Environmental Remediation Unit:** The City's Environmental Remediation Unit (ERU) does not have any environmental records for this property.
- **Ottawa Public Health - Environmental Health:** all public inspection results are publicly available on the Ottawa Public Health website: https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx
- **Sewer Use Program:** No records found for this property.
- **Solid Waste Services:** No records found for this property.

Documents Provided:

HLUI Summary Report and HLUI Map

The HLUI Summary Report Excel spreadsheet identifies HLUI area, point and line features within 250 metres of the Subject Property, as shown on the provided HLUI Map PDF. Within 500 metres of the Subject Property, landfills and Environmental Risk Management Area (ERMA) are also identified if applicable.

For more information on how to interpret the HLUI data identified in the attached excel sheet ('ADDRESS – HLUI Summary report.xlsx'), please refer to the Overview and User Guide."

Additional information may be obtained by contacting:

Ontario's Environmental Registry

The Environmental Registry found at https://ero.ontario.ca/ contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using keys words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

The Ontario Land Registry Office

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House
161 Elgin Street 4th Floor
Ottawa ON K2P 2K1
Tel: (613) 239-1230
Fax: (613) 239-1422

Ottawa Public Health

Ottawa Public Health inspects many different types of establishments. To view inspection results, please visit the Ottawa Public Health website: Public Health Inspections - Ottawa Public Health

Please note that Ottawa Public Health is not the lead agency on land use contamination in the City of Ottawa – contact the Ministry of Environment Conservation and Parks (MECP) for further information.

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the HLUI database is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact HLUI@ottawa.ca.

Sincerely,

Kaatje Yates

Student Planner
Development Review
Planning, Development and Building Services Department

Enclosures: (2)

1. HLUI Map
2. HLUI Summary Report

cc: File no. D06-03-25-0007

HISTORIC LAND USE INVENTORY (HLUI) - REPORT REFERENCE MAP

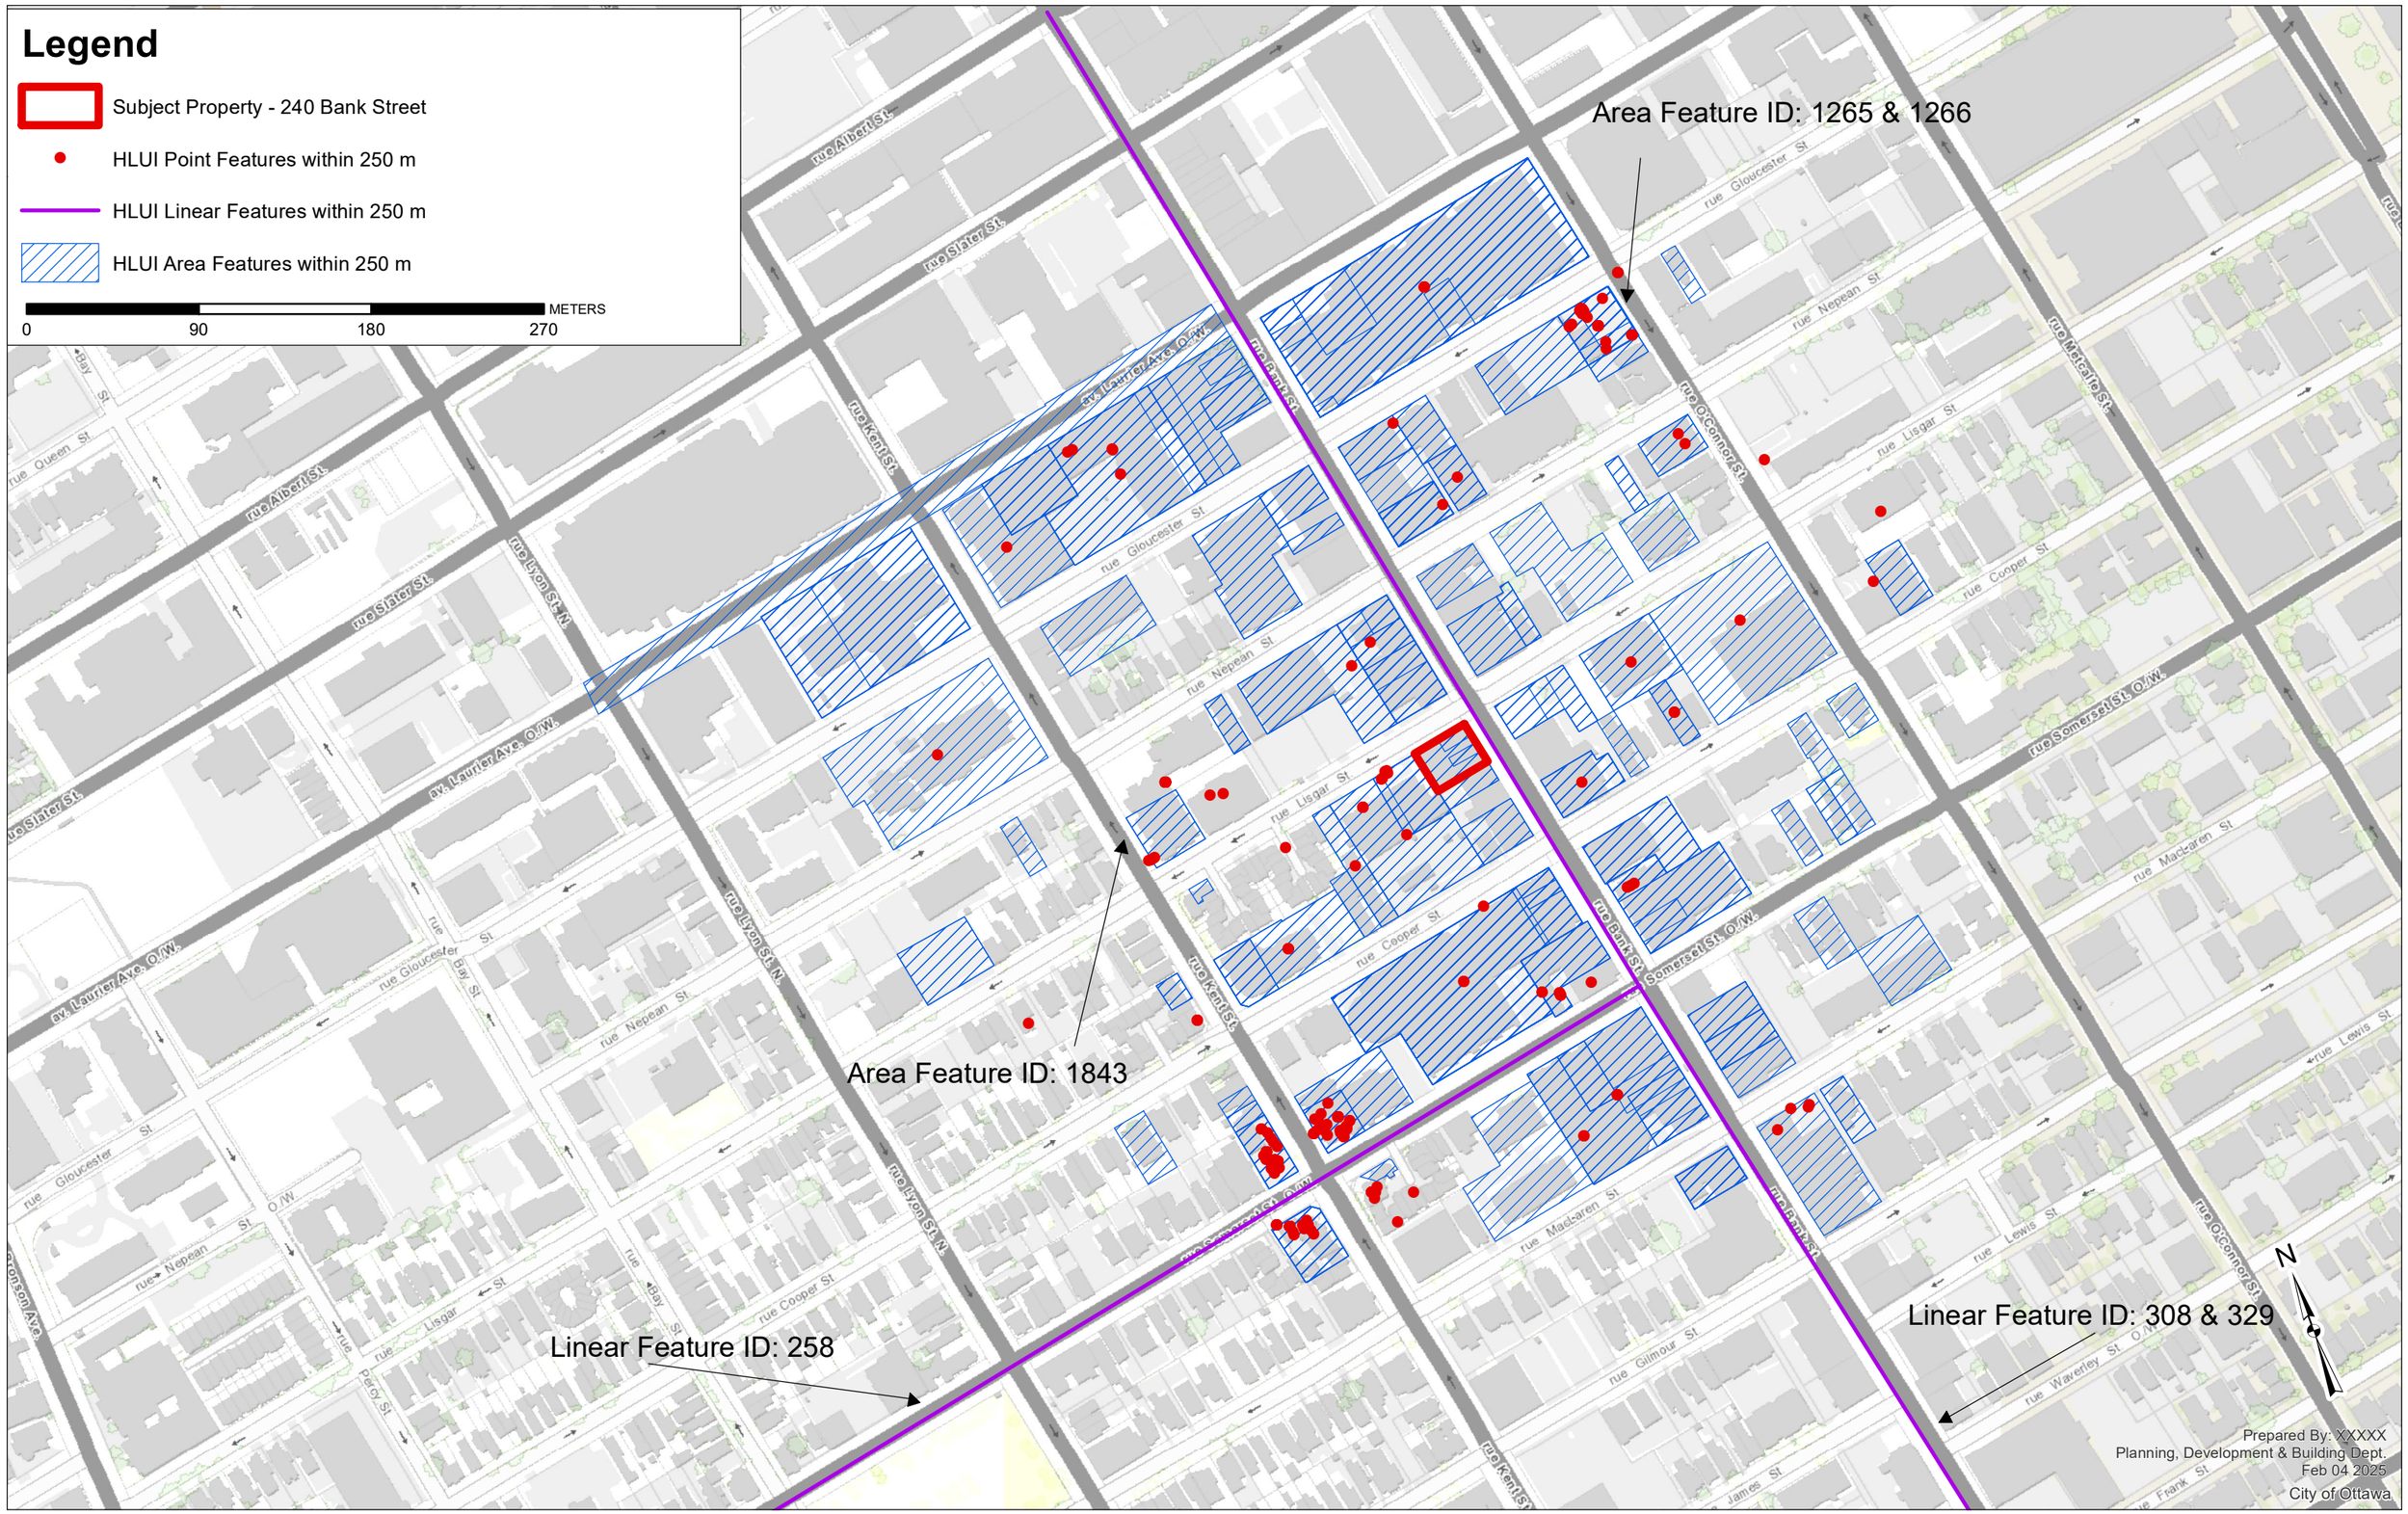

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
21	CARPENTER	Carpenter	1878-FIP	1	1878	1878FIP						168	O'CONNOR	ST		K2P1T5	41150146	OLD OTTAWA			specialty hazardous		564.15249	97.80634246
22	CAPITAL GLASS & PAINT CO LIMITED	Paint and Varnish Industry	1930-M; 1940-M; 1950-M	1	1930-1950	c. 1930-1940; c. 1950	433	COOPER	ST		OTTAWA	433	COOPER	ST		K2P0H1	41140253	OLD OTTAWA	325510; 327214	356; 375	433 - 435; 1930 - 1940 - listed @ # 433 1950 - listed @ # 433 - 435 as Consolidated Plate Glass Ltd.		714.2796001	158.0443062
36	MONSON'S DELUXE DRY CLEANERS	Laundries and Cleaners	1948-FIP-122-234; 1948-M; 1950-M; 1955-M; 1956-FIP-122-234; 1960-M	1	1948-1960	c. 1948-1960	146	NEPEAN	ST		OTTAWA	144	NEPEAN	ST		K2P0B6	41150246	OLD OTTAWA	561740; 812310; 812320; 812330	972			242.873546	76.46296232
39	KENT STREET SHELL	Service Station	1990-CD	1	1990	CD 1990	328	KENT	ST			3	RADSTOCK	PRIV		K1R5J8	41200393	OLD OTTAWA					864.5357898	116.6450664
40	CANADIAN OIL CO LIMITED	Gasoline Service Stations	1940-M; 1950-M; 1956-FIP-126-373; 1960-M; 1970-M	1	1940-1970	c. 1940; c. 1970	430	SOMERSET	ST	WEST	OTTAWA	3	RADSTOCK	PRIV		K1R5J8	41200393	OLD OTTAWA	447110; 447190; 811199	633	Physician in 1950		864.5357898	116.6450664
41	ERNIE'S SERVICE STATION	Motor Vehicle Repair Shops	1940-M; 1948-FIP-126; 1949-M; 1950-M; 1956-FIP-126-373; 1957-M	1	1940-1956	c. 1940-1950; c. 1956-1957; c. 1960; c. 1970; c. 1980	328	KENT	ST		OTTAWA	3	RADSTOCK	PRIV		K1R5J8	41200393	OLD OTTAWA	447110; 447190; 488410; 811112; 811119; 811121; 811199	633; 635; 639		Four USTs on west side of property -FIP1948-1956	864.5357898	116.6450664
163	DIGITAL HENCHMENT	Information and cultural industries	2012-ES	1	2012		210	GLOUCESTER	ST			210	GLOUCESTER	ST		K2P2K4	41149507	OLD OTTAWA	512110				2285.315146	211.516834
166	VRTUCAR-MEMBERS ONLY	Administrative and support, waste management and remediation services	2006-ES	1	2006		356	MACLAREN	ST			356	MACLAREN	ST		K2P0M6	41190064	OLD OTTAWA	561722				454.051655	93.78345516
174	FED-NATIONAL DEFENCE AND THE CANADIAN FORCES	Public administration	2012-ES	1	2012		190	O'CONNOR	ST			190	O'CONNOR	ST		K2P2R3	41150248	OLD OTTAWA	911110				606.8271986	100.5788338
175	OTTAWA TIRE	Other services (except public administration)	2006-ES	1	2006		429	SOMERSET	ST	W		429	SOMERSET	ST	W	K2P2P5	156690000	OLD OTTAWA	811199				1769.592678	171.5397036
298	CAPITAL XTRA-PINK TRIANGLE PRESS	Information and cultural industries	2006-ES	1	2006		251	BANK	ST			251	BANK	ST		K2P1X3	41150209	OLD OTTAWA	511110				810.9345598	120.2264454
324	FED-PARKS CANADA	Public administration	2012-ES	1	2012		360	LAURIER	AVE	W		360	LAURIER	AVE	W	K1P1C8	41140048	OLD OTTAWA	911910				1233.350075	141.8279277
325	HILLARY CLEANERS	Laundries and Cleaners	2006-ES	1	2006		360	LAURIER	AVE	W		360	LAURIER	AVE	W	K1P1C8	41140048	OLD OTTAWA	812320				1233.350075	141.8279277
331	FED-NATIONAL DEFENCE AND THE CANADIAN FORCES	Public administration	2012-ES	1	2012		222	NEPEAN	ST			222	NEPEAN	ST		K2P0B8	41140196	OLD OTTAWA	911110				2442.225463	242.1102399
332	ENERTRAK INC	Retail trade	2006-ES	1	2006		335	MACLAREN	ST			335	MACLAREN	ST		K2P0M5	41190026	OLD OTTAWA	443110				1224.161833	140.0892223
503	FED-NATIONAL DEFENCE AND THE CANADIAN FORCES	Public administration	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	400	COOPER	ST			395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	911110; 911910				6853.099089	396.352024
504	FED-PUBLIC WORKS	Public administration	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	400	COOPER	ST			395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	911110; 911910				6853.099089	396.352024
505	SHINE DRY CLEANERS	Other	2012-ES; 2017-SalesGenie	1	2012-2017	ES 2012	395	SOMERSET	ST			395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	812320				6853.099089	396.352024

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
506	WIN'S JEWELLER	Jewellery Stores and Watch And Jewellery Repair Shops	2001-ES:2005-SelectPhone	1	2005	c. 2001; c. 2005	405	SOMERSET	ST	WEST		395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	448310				6853.099089	396.352024
507	BORDEN DAIRY CO	Dairy Products Industries	1964-S; 1965-S; 1900-M; 1901-FIP-55-298; 1901-M; 1910-M; 1912-FIP-55-298; 1912-M; 1920-M; 1921-M; 1922-FIP-55-298; 1930-M; 1940-M; 1948-FIP-126-298; 1949-M; 1950-M; 1956-FIP-126-298; 1956-M; 1957-M; 1958-M; 1958-S; 1961-M; 1961-S; 1963-M; 1964-M; 1970/71-S; 1971-M	1	1901-1963	c. 1901; c. 1912-1963	0	COOPER	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	311511; 311515; 311520; 415110; 415120; 415190; 811111; 811310	104; 551	420-446; Garage, Paint Shop, Truck Storage, Repair Shop, Tinsmith -Manufacturing of Milk, Butter, Ice Cream and other Dairy Products on Site. In 1940 it was also known as the Ottawa Dairy Division of Borden Co. Company also has an address listed on Somerset st. west. (#395-405)	One UST, 500 gallons	6083.768091	351.4035124
508	COLE BUTTER & CHEESE CO	Dairy Products Industries	1900-M	1	1900	c. 1900	278	BANK	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	311511; 311515; 311520	104	Cooper St		6164.688831	356.1283502
509	GVT OF CAN - RCM.P.	Protective Services	2000-PID	1	2000	c. 2000	400	COOPER	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	911230		OTTAWA A DIVISION, DRUG SECTION		6853.099089	396.352024
510	DRAICCHIO'S TAILORING & CLEANING		1960-M; 1970-M; 1980-M; 1990-M; 1994-PID; 1997-M; 2000-PID; 2016-PID	1	1960-2016	PID2016	272	BANK	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	<Null>		;		6853.099089	396.352024
511	CENTRETOWN COMMUNITY HEALTH CENTRE		2016-PID	1	2016	PID2016	420	COOPER	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	<Null>		;		6853.099089	396.352024
980	UNION BANK OF CANADA	Other Storage and Warehousing Industries	1912-FIP-38-232; 1912-M	1	1912	c. 1912	179	GLOUCESTER	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	412110; 419120; 454310; 493120; 493130; 493190	479; 511		3, underground, contents unknown	71.52512177	35.33209182
981	SUPERTEST OIL CO SERVICE STATION	Gasoline Service Stations	1940-M; 1948-FIP-122-245; 1948-M; 1950-M; 1956-FIP-122-245; 1956-M; 1960-M	1	1900-1980	c. 1940; c. 1940-1960	0	KENT	ST		OTTAWA	235	KENT	ST		K2P1Z9	158090000	OLD OTTAWA	447110; 447190; 811199	633	241 to 243	Four USTs -south section of property	901.3995617	120.1124244
982	GALBRAITH MEAT & PROVISION'S BUTCHERS	Meat and Poultry Products Industries	1920-M; 1922-FIP-42-256; 1930-M; 1940-M; 1948-FIP-121-256; 1949-M; 1950-M; 1956-FIP-121-2-256	1	1920-1956	c. 1920-1930; c. 1940-1956	437	LISGAR	ST		OTTAWA	290	NEPEAN	ST		K1R5G3	41140184	OLD OTTAWA	311611; 311614; 311615	101	Also known as Galbraith Sausage in 1940		1227.541581	141.5092928
983	JOHN LABATT BREWERY (LABATT |-S BREWERY VAULTS)	Brewers/Bottlers	1901-FIP-55-297; 1910-M; 1912-FIP-55-297	1	1900-1963	c. 1901-1912	275	KENT	ST		OTTAWA	453	COOPER	ST		K2P0H1	41140258	OLD OTTAWA		113	Producers Dairy Ltd. listed at this address from M.1900-1910.		652.4621687	102.2129581
984	PRODUCERS DAIRY LIMITED	Dairy Products Industries	1920-M; 1922-FIP-55-297; 1930-M; 1940-M; 1948-FIP-126-297; 1949-M; 1950-M; 1956-FIP-126-297; 1956-M; 1957-M; 1960-M; 1963-M; 1970-M	1	1920-1970	c. 1920-1963; c. 1970-1971	257	KENT	ST		OTTAWA	453	COOPER	ST		K2P0H1	41140258	OLD OTTAWA	311511; 311515; 311520	104	257 to 275; John Labatt (brewers/bottlers) located at this site from 1900-1910.		652.4621687	102.2129581
985	LISGAR ST GARAGE	Motor Vehicle Repair Shops	1920-M; 1922-FIP-55-297; 1930-M; 1940-M; 1948-FIP-126-297; 1949-M; 1950-M; 1956-FIP-126-297; 1956-M; 1957-M; 1960-M; 1963-M	1	1920-1963	c. 1920; c. 1922-1963; c. 1930-1940	346	LISGAR	ST		OTTAWA	360	LISGAR	ST		K2P2E4	41140321	OLD OTTAWA	447110; 447190; 811112; 811119; 811121; 811199	633; 635	#NAME?	FIP1922 -One UST, gasoline, 500 gal. FIP1948, FIP1956 - Three USTs on south west end of property	923.7150458	123.0844207
986	MILLER PRINT SHOPPE	Commercial Printing Industries	1956-FIP-126-297; 1956-M; 1957-M; 1960-M	1	1956-1960	c. 1956-1960	0	LISGAR	ST		OTTAWA	360	LISGAR	ST		K2P2E4	41140321	OLD OTTAWA	323114; 323115; 323116; 323119	281	344 to 346		923.7150458	123.0844207
1014	HARNESS MAKER	Leather and Allied Products Industries	1920-M	1	1920	c. 1920	238	BANK	ST	WEST	OTTAWA	240	BANK	ST		K2P1X4	41140320	OLD OTTAWA	316110; 316210; 316990; 321999; 332999	171	Chinese laundry in 1900 and 1910. Company not there in 1930, 1940, 1950.		85.11989845	43.1116619
1015	FA JARMAN	Other Furniture and Fixture Industries	1900-M	1	1900	c. 1900	272	BANK	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	OLD OTTAWA	336360; 337910; 339940	269	also residence		129.2822175	53.02053145
1016	CAMPBELL SERVICE STATION	Gasoline Service Stations	1940-M; 1948-FIP-126-298; 1949-1950-M; 1956-FIP-126-298; 1957-M; 1960-M; 1963-M; 1970-M; 1980-M	1	1940-1980	c. 1940; c. 1940-1950; c. 1956-1980; c. 1960; c. 1970; c. 1976-1980	429	SOMERSET	ST	WEST	OTTAWA	429	SOMERSET	ST	W	K2P2P5	156690000	OLD OTTAWA	447110; 447190; 811112; 811119; 811121; 811199	633; 635	FIP1912, FIP1922- vacant lot	Four underground tanks; two are parallel with Somerset W. and two are parallel with Kent St.	567.9022568	95.48353888
1219	SMITH CLAIRE SERVICE STATION	Gasoline Service Stations	1940-1950-M	1	1940-1950		292	KENT	ST		OTTAWA	292	KENT	ST			41200038	OTTAWA					157.1531039	53.12933991

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
1258	IMPERIAL OIL COMPANY/MCDONALD'S SERVICE STATION	Gasoline Service Stations	1948-1956-M	1	1948-1956		443	SOMERSET	ST	WEST	OTTAWA	443	SOMERSET	ST	WEST		41200037	OTTAWA					606.0015814	103.9159437
1259	SMITH SERVICE STATION	Gasoline Service Stations	1949-1950-M	1	1949-1950		443	SOMERSET	ST	WEST	OTTAWA	443	SOMERSET	ST	WEST		41200037	OTTAWA					606.0015814	103.9159437
1262	UNITED CLEANERS, TAILORS AND PRESSORS	Laundries and Cleaners	na	1			286	BANK	ST		OTTAWA	286	BANK	ST			41190007	OTTAWA					1044.669116	149.6315068
1265	CITIES SERVICE OIL CO LTD/MCKEE REG'D	Gasoline Service Stations	1930-1956-M	2	1930-1956			GLOUCESTER	ST		OTTAWA	0	GLOUCESTER	ST			41150142	OTTAWA					923.012994	121.5457897
1266	LLOYD'S SERVICE STATION	Gasoline Service Stations	1950-M; 1955-M	2	1950-1955			GLOUCESTER	ST		OTTAWA	0	GLOUCESTER	ST			41150142	OTTAWA					923.012994	121.5457897
1267	HELIOTYPE	Platemaking, Typesetting and Bindery Industry	1920-M	2	1920		317	LISGAR	ST		OTTAWA	317	LISGAR	ST			41150240	OTTAWA					293.2886541	85.50496167
1268	SAMPSON OFFICE SERVICE LTD	Platemaking, Typesetting and Bindery Industry	1920-M	2	1920		317	LISGAR	ST		OTTAWA	317	LISGAR	ST			41150240	OTTAWA					293.2886541	85.50496167
1335	5 WHEELS LTD SERVICE STATION	Motor Vehicle Repair Shops	1960-M	1	1960		328	KENT	ST		OTTAWA	5	RADSTOCK	PRIV		K1R5J8	41200392	Old Ottawa					864.5332573	116.6450663
1336	BURTON'S SERVICE GARAGE	Motor Vehicle Repair Shops	1956-FIP-126-373; 1957-M	1	1956-1957		328	KENT	ST		OTTAWA	5	RADSTOCK	PRIV		K1R5J8	41200392	Old Ottawa					861.6716615	116.3331704
1337	NEIL AND KEN'S SERVICE CENTRE	Motor Vehicle Repair Shops	1970-M	1	1970		328	KENT	ST		OTTAWA	5	RADSTOCK	PRIV		K1R5J8	41200392	Old Ottawa					864.5332573	116.6450663
1375	OTTAWA DAIRY CO LTD	Dairy Products Industries	1910-1930-M; 1912-FIP-55-298	1	1910-1930		395	SOMERSET	ST	WEST	OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	Old Ottawa					6853.099089	396.352024
1376	THE BORDEN COMPANY LTD	Dairy Products Industries	1940-1965-M	1	1940-1965		395	SOMERSET	ST	WEST	OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	Old Ottawa					6853.099089	396.352024
1590	YOUNG'S SUPPLY CO	Motor Vehicle Repair Shops	1948-M	2	1948			LAURIER	ST	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	Old Ottawa					9861.675752	447.0605348
1597	DUNLOP'S BODY REPAIRS SHOP	Motor Vehicle Repair Shops	1963-M	1	1963		388	MACLAREN	ST		OTTAWA												928.1503809	121.8471892
1598	MODERN MOTOR SERVICE	Motor Vehicle Repair Shops	1930-1940-M	1	1930-1940		388	MACLAREN	ST		OTTAWA												928.1503809	121.8471892
1829	DOMINION HOUSE FURNISHING CO	Household Furniture Industries	1922-M	1	1922		182	BANK	ST		OTTAWA	182	BANK	ST			41150120	OTTAWA					9861.675752	447.0605348
1830	W G EDGE LTD	Plumbing, Heating and Air Conditioning, Mechanical Work	1948-1956-M	1	1948-1956		150	GLOUCESTER	ST		OTTAWA	150	GLOUCESTER	ST			41150144	OTTAWA					1522.587561	161.1950805
1843	HENRY'S SERVICE STATION	Gasoline Service Stations	1940-1960-M	1	1940-1960			KENT	ST		OTTAWA	0	KENT	ST			158090000	OTTAWA					901.3995617	120.1124244

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
1844	CARRIERE AND PILON	Motor Vehicle Repair Shops	1920-M	1	1920		346	LISGAR	ST		OTTAWA	346	LISGAR	ST			41140321	OTTAWA					923.7150458	123.0844207
1845	LILLICO GARAGE/CAPITAL CITY GARAGE/CITY RADIATOR	Motor Vehicle Repair Shops	1922-FIP-55-297; 1963-M	1	1922-1963		346	LISGAR	ST		OTTAWA	346	LISGAR	ST			41140321	OTTAWA					923.7150458	123.0844207
1846	BROWN JOHN B	Gasoline Service Stations	1940-1950-M	1	1940-1950		429	SOMERSET	ST	WEST	OTTAWA	429	SOMERSET	ST	WEST		156690000	OTTAWA					567.9022568	95.48353888
1847	SUN OIL CO SERVICE STATION	Gasoline Service Stations	1940-M; 1970-M; 1975-M	1	1940-1975		429	SOMERSET	ST	WEST	OTTAWA	429	SOMERSET	ST	WEST		156690000	OTTAWA					567.9022568	95.48353888
1883	O'CONNOR SERVICE CENTRE	Motor Vehicle Repair Shops	1970-M	1	1970		154	O'CONNOR	ST		OTTAWA	154	O'CONNOR	ST			41150145	OTTAWA					913.1431797	120.8830494
1887	SOUTHEASTER PUBLICATIONS LTD	Commercial Printing Industries	1970-M	1	1970		230	NEPEAN	ST		OTTAWA	230	NEPEAN	ST			41140194	OTTAWA					304.5991042	80.59363866
1888	CAPITAL STAMP AND STATIONARY CO	Commercial Printing Industries	1948-M	1	1948		299	BANK	ST		OTTAWA	299	BANK	ST			41190036	OTTAWA					583.8315186	103.2049445
1889	CENTRAL MOTOR SALES	Motor Vehicle Repair Shops	1930-M	1	1930			BANK	ST		OTTAWA	301	BANK	ST			41190037	OTTAWA					584.3842915	103.2714042
1890	EMMERSON MOTOR SALES	Motor Vehicle Repair Shops	1920-M	1	1920			BANK	ST		OTTAWA	301	BANK	ST			41190037	OTTAWA					584.3842915	103.2714042
1891	DONALD COLDWELL AGENCY	Laundries and Cleaners	1930-M	1	1930		316	BANK	ST		OTTAWA	316	BANK	ST			41190065	OTTAWA					627.1679785	102.9651926
1892	WILLIAMS OIL-O-MATIC	Laundries and Cleaners	1930-M	1	1930		316	BANK	ST		OTTAWA	316	BANK	ST			41190065	OTTAWA					627.1679785	102.9651926
1893	PARKERS CLEANERS	Laundries and Cleaners	1960-M; 1970-M	1	1960-1970		310	BANK	ST		OTTAWA	310	BANK	ST			41190065	OTTAWA					627.1679785	102.9651926
1914	H H BLOOM SOUND ENTERPRISES	Record Player, Radio and Television Receiver Industry	2001-ES; 2005-SelectPhone	2	2001-2005		386	MACLAREN	ST			312	BANK	ST		K2P1Y1	41190065	Old Ottawa					627.1679785	102.9651926
1927	ROBERT L PARKER SERVICE	Motor Vehicle Repair Shops	1960-M	1	1960		154	O'CONNOR	ST		OTTAWA	154	O'CONNOR	ST			41150145	OTTAWA					913.1431797	120.8830494
1928	BYTOWN TOWING & AUTOCARE LTD	Motor Vehicle Repair Shops	1980-1998-M; 2006-ES	1	1980-2006		154	O'CONNOR	ST		OTTAWA	154	O'CONNOR	ST			41150145	OTTAWA					913.1431797	120.8830494
1929	BRUCE AYEARST SERVICE	Motor Vehicle Repair Shops	1940-M	1	1940		154	O'CONNOR	ST		OTTAWA	154	O'CONNOR	ST			41150145	OTTAWA					913.1431797	120.8830494
1971	ORB OIL BURNER CO LTD	Heating Equipment Industry	1930-M	1	1930		244	BANK	ST		OTTAWA	244	BANK	ST			41140255	OTTAWA					343.6935245	83.03150598
1975	ARMCO PRINT	Commercial Printing Industries	1994-PID	1	1994			NEPEAN	ST		OTTAWA	0	NEPEAN	ST			41150162	OTTAWA					517.8664613	94.74597731

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
1976	EAS ILLUSTRATORS AND PRINTERS LTD	Commercial Printing Industries	1994-PID	1	1994			NEPEAN	ST		OTTAWA	0	NEPEAN	ST			41150162	OTTAWA					517.8664613	94.74597731
1977	CAPITAL XTRA / PINK TRIANGLE PRESS	Combined Publishing and Printing Industries	2001-ES; 2005-SelectPhone	1	2001-2005		207	BANK	ST			207	BANK	ST			41150160						674.8431029	107.2828254
1978	OTTAWA MAGAZINE	Commercial Printing Industries	1994-PID	1	1994		192	BANK	ST		OTTAWA	192	BANK	ST			41140085	OTTAWA					610.4161938	100.872087
2084	PROSPERITY CLEANERS LIMITED	Heating Equipment Industry	1930-M; 1940-M; 1950-M	2	1900-1950	c. 1930; c. 1940	244	BANK	ST		OTTAWA	242	BANK	ST		K2P1X4	41140255	OLD OTTAWA	238220; 333310; 333413; 333416; 561740; 812310; 812320; 812330	307; 424; 972	1930 - oil burners		343.6935245	83.03150598
2171	SAINT PATRICK'S BASILICA-CENTRETOWN	Motor Vehicles, Wholesale	2001-ES	1	2001	c. 2001	281	NEPEAN	ST		OTTAWA	281	NEPEAN	ST		K1R5G2	41140078	OLD OTTAWA	811310				5884.406367	322.5638384
2201	THE FOCUS CENTRE	Camera and Photographic Supply Stores	1990-M; 1997-M; 2000-PID	1	1990-2000	c. 1990-1997; c. 2000; c. 2001	254	BANK	ST		OTTAWA	250	BANK	ST		K2P1X4	41140257	OLD OTTAWA	323120; 443130; 812921; 812922	282			687.3867654	105.8758589
2202	FURNITURE REPAIRS	Household Furniture Stores	1912-FIP-55-297; 1912-M; 1921-M; 1922-FIP-55-297; 1948-FIP-126-297; 1948-M; 1949-M; 1956-FIP-126-297	1	1912-1956	c. 1912-1956	411	COOPER	ST		OTTAWA	250	BANK	ST		K2P1X4	41140257	OLD OTTAWA	442110	621	Also at this location in: 1912: cabinet makers/carpentry shop 1921: upholsterers 1948-49: electrical contractor		687.3867654	105.8758589
2203	HECK'S CONFECTIONARY	Confectionary	1990-CD	1	1990	CD 1990	168	O'CONNOR	ST			168	O'CONNOR	ST		K2P1T5	41150146	OLD OTTAWA					304.5737918	80.61905874
2204	LOWE-MARTIN COMPANY LIMITED	Commercial Printing Industries	1920-M; 1921-M; 1930-M; 1940-M; 1948-M; 1950-M; 1955-M; 1958-M; 1958-S; 1960-M; 1961-M; 1961-S; 1964-M; 1964-S; 1965-S; 1970-M	1	1920-1994	c. 1920-1965; c. 1970; c. 1994	0	NEPEAN	ST		OTTAWA	171	NEPEAN	ST		K2P0B4	41150162	OLD OTTAWA	323114; 323115; 323116; 323119; 323120; 812921	281; 282	171 to 175; Manufacturers of loose leaf systems, office supplies, card systems, filing and library supplies. Armco Print Generator #ON1550000 (waste generator) E.A.S. Illustrators and Printers Ltd. Generator #ON1203100 (waste generator)		517.8664613	94.74597731
2205	CANTOR BAKERY	Bakery	1990-CD	1	1990	CD 1990	205	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA					674.8431029	107.2828254
2206	CAPITAL XTRA INC	Publishing (Newspaper)	2004-GWStudy	1	1994	GW Study 2004 Scotts					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	511110	2711	177 Nepean St		674.8431029	107.2828254
2207	BUILDING & MAINTENANCE IND	Residential Building and Development	2005-SelectPhone; 2017-SalesGenie	1	2005	c. 2005	207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	236110		#405		674.8431029	107.2828254
2208	TO BE	Combined Publishing and Printing Industries	2005-SelectPhone	1	2005	c. 2001; c. 2005	207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	511110				674.8431029	107.2828254
2209	AC SCHLENDER	Photographers	1900-M	2	1900	c. 1900	205	BANK	ST		OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	323120; 541920; 812921	282; 993	1900 - also residence		674.8431029	107.2828254
2210	ACTION RESTORATION	Masonry Contractors	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	23814006	1741-01	311		674.8431029	107.2828254
2211	CHEMCO CANADA INC	Pest Control Supplies & Equip-Mfrs	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	32532008	357695	260		674.8431029	107.2828254
2212	IN THE WORKS PRINT OPTIONS	Screen Printing (Mfrs)	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	32311301	313776	322		674.8431029	107.2828254

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
2213	KWIK KLOSET	Closet Accessories-Manufacturers	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	31412004	179975	240		674.8431029	107.2828254
2214	ROPE ACCESS LEADERS INC	General Contractors	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	23611505	1521-03	326		674.8431029	107.2828254
2215	CANADIAN BIBLE SOCIETY INC	Publishing (Book)	2004-GWStudy	2	1805	GW Study 2004 Scotts					OTTAWA	307	LISGAR	ST		K2P0E1	41150242	OLD OTTAWA	511130	2731	315 Lisgar St		2121.272814	220.6929289
2216	CHEMCHAMP	Wire and Wire Products Industries	2001-ES	1	2001	ES 2001	331	COOPER	ST			331	COOPER	ST		K2P0G5	41150226	OLD OTTAWA	333990				690.6301832	108.8946637
2278	ACCUNET ENVELOPE CANADA LIMITED	Other Converted Paper Products Industries	1964-M; 1964-S; 1965-M; 1965-S	1	1964-1965	c. 1964-1965	433	COOPER	ST		OTTAWA	433	COOPER	ST		K2P0H1	41140253	OLD OTTAWA	322230; 325999	279			714.2796001	158.0443062
2292	KENT HAND LAUNDRY	Laundry	1990-CD	1	1990	CD 1990	114	GLOUCESTER	ST			112	GLOUCESTER	ST		K2P0A2	41150149	OLD OTTAWA					257.696776	77.46374691
2324	SHELL CANADA	Retail trade	2006-ES	1	2006	ES 2006	154	O'CONNOR	ST			154	O'CONNOR	ST		K2P1T5	41150145	OLD OTTAWA	447110; 811111				913.1431797	120.8830494
2325	BYTOWN SHELL / TOWING & AUTO CARE LIMITED	Motor Vehicles, Wholesale	1990-CD; 2001-ES; 2005-SelectPhone; 2006-ES	1	1990-2006	c. 2001; c. 2005	154	O'CONNOR	ST			154	O'CONNOR	ST		K2P1T5	41150145	OLD OTTAWA	447110; 447190; 811111				913.1431797	120.8830494
2326	GERALD THERIAULT	Motor Vehicle Repair Shops	1940-M; 1950-M; 1960-M; 1970-M; 1980-M; 1998-SC	1	1940-1998	c. 1940; c. 1950; c. 1960; c. 1970; c. 1980-1998	154	O'CONNOR	ST		OTTAWA	154	O'CONNOR	ST		K2P1T5	41150145	OLD OTTAWA	447110; 447190; 811112; 811119; 811121; 811199	633; 635			913.1431797	120.8830494
2333	N C SHEET METAL INC	Highway and Heavy Construction	2005-SelectPhone	1	2005	c. 2005	331	COOPER	ST			331	COOPER	ST		K2P0G5	41150226	OLD OTTAWA	238210; 238220; 238910		#601		690.6301832	108.8946637
2334	EPRINTIT	Commercial Printing Industries	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2006; ES 2012	200	KENT	ST			200	KENT	ST		K1A0M1	41140049	OLD OTTAWA	323115; 911910				5572.597359	304.2564956
2335	FED-PUBLIC WORKS	Manufacturing	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	200	KENT	ST			200	KENT	ST		K1A0M1	41140049	OLD OTTAWA	323115; 911910				5572.597359	304.2564956
2336	CAPITAL CITY MAINTENANCE LIMITED	Service Industries Incidental to Air Transport	2005-SelectPhone; 2006-ES	1	2005-2006	c. 2005	200	KENT	ST			200	KENT	ST		K1A0M1	41140049	OLD OTTAWA	561722; 561799				5572.597359	304.2564956
2337	GWLRA	Real estate and rental and leasing	2016-PID	1	2016	PID2016	200	KENT	ST		OTTAWA	200	KENT	ST		K1A0M1	41140049	OLD OTTAWA	531310				5572.597359	304.2564956
2338	UNION ENGRAVING COMPANY	Jewellery Stores and Watch And Jewellery Repair Shops	1956-FIP-126-297; 1956-M; 1957-M; 1958-M; 1958-S; 1961-M; 1961-S; 1963-M; 1964/1965-S; 1964-M	1	1901-1964	c. 1958-1965	437	COOPER	ST		OTTAWA	437	COOPER	ST		K2P0H1	41140039	OLD OTTAWA	323120; 331490; 448310; 812921	282; 392; 656			356.8948865	89.40598554
2339	UNNAMED AUTO PAINT SHOP	Motor Vehicle Repair Shops	1901-FIP-38-244	2	1900-1922	c. 1901	194	GLOUCESTER	ST		OTTAWA	188	BANK	ST		K2P1W8	41140085	OLD OTTAWA	811112; 811119; 811121	635			610.4161938	100.872087
2340	DUSTBANE PRODUCTS LTD	Manufacture Chemical Cleaning Products/Supplies	1950-M	1	1900-1950	c. 1950	0	BANK	ST		OTTAWA	188	BANK	ST		K2P1W8	41140085	OLD OTTAWA		376	200?; Also provides cleaning materials and sanitary supplies.		610.4161938	100.872087
2341	BORTS PRINTING SHOP	Commercial Printing Industries	1950-M; 1994-PID	1	1900-1994	c. 1950; c. 1994	192	BANK	ST		OTTAWA	188	BANK	ST		K2P1W8	41140085	OLD OTTAWA	323114; 323115; 323116; 323119	281	Ottawa Magazine GEN# = ON0897800 GEN# = ON0923900		610.4161938	100.872087

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
2581	LMD ONTARIO LP		2016-PID	1	2016	PID2016	407	LAURIER	AVE	WEST	OTTAWA	0					41140265		<Null>		Suite #10/11		7110.308505	808.0937471
2582	DO IT NOW FLOORING	Other Trade Work	2001-ES	1	2001	c. 2001	230	GLOUCESTER	ST		OTTAWA	230	GLOUCESTER	ST		K2P0A9	41140081	OLD OTTAWA	238330				1578.622495	164.8976659
2760	MUSTY'S SERVICE STATION	Gasoline Service Stations	1960-M; 1970-M	2	1960-1970	c. 1960; c. 1970	195	KENT	ST		OTTAWA	199	KENT	ST		K2P2K8	153470000	OLD OTTAWA	447110; 447190; 811199	633			2042.14408	207.7496999
2788	CITY OF OTTAWA	General Administrative Services	2016-PID	1	2016	PID2016	210	GLOUCESTER	ST		OTTAWA	210	GLOUCESTER	ST		K2P2K4	41149507	OLD OTTAWA	913910				2285.315146	211.516834
2793	SERVICE STATION, SUN OIL CO	Gasoline Service Station	1934-CityofOttawa	2	1934	c. 1934	430	SOMMERSET	ST			426	SOMERSET	ST	W	K2P0K2	41190280	OLD OTTAWA			;		108.4429712	50.44284722
2799	IMPERIAL OIL STATION	Gasoline Service Stations	1930-M; 1940-M; 1950-M	1	1930-1950	c. 1930; c. 1940-1950	292	KENT	ST		OTTAWA	292	KENT	ST		K2P2A4	41200038	OLD OTTAWA	447110; 447190; 811199	633			157.1531039	53.12933991
2916	GOLDART JEWELLERY STUDIO INC	Jewellery Manufaturing	1990-CD	1	1990	CD 1990	323	SOMERSET	ST			323	SOMERSET	ST	W	K2P0J8	41190018	OLD OTTAWA					362.13407	89.591286
2917	JONATHAN'S INTERIORS AND ANTIQUES INC	Household Furniture Stores	2001-ES; 2006-ES	1	2001-2006	c. 2001	323	SOMERSET	ST		OTTAWA	323	SOMERSET	ST	W	K2P0J8	41190018	OLD OTTAWA	442110				362.13407	89.591286
2918	AUBUT & NADEAU SERVICES INC	Camera and Photographic Supply Stores	2000-PID	1	2000	c. 2000	356	MACLAREN	ST		OTTAWA	356	MACLAREN	ST		K2P0M6	41190064	OLD OTTAWA	443130; 812922				454.051655	93.78345516
2922	BUDGET RENT A CAR	Car Rental	1990-CD; 2016-PID	1	1990-2016	CD 1990	443	SOMERSET	ST			443	SOMERSET	ST	W	K1R5J7	41200037	OLD OTTAWA					606.0015814	103.9159437
2923	AVSOL HOLDINGS INC	Gasoline Service Stations	1948-FIP-120-301; 1949-M; 1950-M; 1956-FIP-126-301; 1957-M; 1960-M; 1970-M; 1980-M; 2005-PropertyAssessment	1	1900-1980	c. 1948-1956; c. 1949-1950; c. 2005	443	SOMERSET	ST	WEST	OTTAWA	443	SOMERSET	ST	W	K1R5J7	41200037	OLD OTTAWA	447110; 447190; 811199	633		Four USTs -FIP1948, FIP1956	606.0015814	103.9159437
2924	SERVICE STATION, SUPERTEST PETROLEUM CORP,	Gasoline Service Station	1934-CityofOttawa	1	1934	c. 1934	443	SOMMERSET	ST			443	SOMERSET	ST	W	K1R5J7	41200037	OLD OTTAWA					606.0015814	103.9159437
3001	CHRISTIANCURRENT OTTAWA	Combined Publishing and Printing Industries	2005-SelectPhone	1	2005	c. 2005	355	COOPER	ST			355	COOPER	ST		K2P0G8	41150289	OLD OTTAWA	511110				4964.534473	281.9843078
3086	BROWN'S CLEANERS & TAILORS	Laundries and Cleaners	1940-M; 1950-M	1	1900-1980	c. 1940-1950	286	BANK	ST		OTTAWA	282	BANK	ST		K2P1X6	41190007	OLD OTTAWA	561740; 812310; 812320; 812330	972	Charles Binks (photographer) listed at this address from 1910-1930 (MIGHTS). The Ottawa Stair Works was listed at 286-288 Bank St. in M.1900.		1044.669116	149.6315068
3087	CHARLES BINKS	Photographers	1900-M; 1910-M; 1920-M; 1930-M	2	1900-1950	c. 1910-1930	286	BANK	ST		OTTAWA	282	BANK	ST		K2P1X6	41190007	OLD OTTAWA	323120; 541920; 812921	282; 993	Ottawa Stair Works listed at this address in M.1900 at 286-288 Bank St. Cleaners listed in M.1940-1950.		1044.669116	149.6315068
3088	OTTAWA STAIR WORKS	Sash, Door and Other Millwork Industries	1900-M; 1901-FIP-55-298-(1888)	1	1900	c. 1900	0	BANK	ST		OTTAWA	282	BANK	ST		K2P1X6	41190007	OLD OTTAWA	321215; 321911; 321992; 337110	254	286 to 288; Charles Binks (photographer) listed at 286 Bank from M.1910-1930. United Cleaners, Tailors and Pressers listed from M.1940-1950.		1044.669116	149.6315068
3089	TYNELL REPRODUCTION SERVICES	Commercial Printing Industries	1960-M; 1961-S	1	1960-1961	c. 1960-1961	306	BANK	ST		OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	323114; 323115; 323116; 323119	281			353.3966123	84.54788665
3090	MULTI ARMS SECURITY INC	Motor Vehicles, Wholesale	2005-SelectPhone	1	2005	c. 2005	309	BANK	ST			305	BANK	ST		K2P1X7	41190038	OLD OTTAWA	561791; 811310; 811411				584.9490044	103.3382

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
3091	UNNAMED CONTRACTORS YARD & LUMBER YARD	Lumber and Building Materials, Wholesale	1901-FIP-55-301; 1901-M	2	1900-1922	c. 1901	482	COOPER	ST		OTTAWA	480	COOPER	ST		K1R5H9	41200045	OLD OTTAWA	416310; 416320; 416340; 444110; 444120; 444190	563			605.2932885	103.8596425
3270	KOFFMAN SIGNS	Sign and Display Industry	2001-ES; 2004-GWStudy; 2005-SelectPhone; 2006-ES	1	2001-2006	c. 2001; c. 2005	146	NEPEAN	ST			144	NEPEAN	ST		K2P0B6	41150246	OLD OTTAWA	339950				242.873546	76.46296232
3271	THOMPSON BOB JEWELLERS AND WATCH REPAIR LTD	Watch Repair & Jewellery	1990-CD; 2001-ES; 2012-ES	1	1990-2001	CD 1990	193	BANK	ST			187	BANK	ST		K2P1W7	41150140	OLD OTTAWA					662.2287984	106.0148307
3272	TYPIN'S COOL	Electrical and Electronic Machinery, Equipment And Supplies, Wholesale	2001-ES	1	2001	c. 2001	176	GLOUCESTER	ST		OTTAWA	187	BANK	ST		K2P1W7	41150140	OLD OTTAWA	443120				662.2287984	106.0148307
3273	O'BRIEN PUBLISHING	Combined Publishing and Printing Industries	2001-ES; 2005-SelectPhone	1	2005	c. 2001; c. 2005	176	GLOUCESTER	ST			187	BANK	ST		K2P1W7	41150140	OLD OTTAWA	511120; 511130		401		662.2287984	106.0148307
3281	ALBERT OLDHAM AUTO SERVICE	Gasoline Service Stations	1930-M; 1940-M; 1948-FIP-123-224; 1949-M; 1950-M; 1956-FIP-122-233	2	1900-1957	c. 1930-1956; c. 1948-1956; c. 1950	0	GLOUCESTER	ST		OTTAWA	158	GLOUCESTER	ST		K2P0A6	41150142	OLD OTTAWA	447110; 447190; 811199	633	Albert Oldham Auto Service listed at # 154 Gloucester St. in 1955.	FIP1948, FIP1956 -Three USTs	612.3764544	100.9949047
3282	FRED H BOUGHTON	Platemaking, Typesetting and Bindery Industry	1920-M; 1921-M; 1922-FIP-38-234	2	1920-1922	c. 1920; c. 1922	317	LISGAR	ST		OTTAWA	315	LISGAR	ST		K2P0E1	41150240	OLD OTTAWA	323114; 323115; 323116; 323119; 323120; 812921	281; 282			293.2886541	85.50496167
3283	DEPT OF NATIONAL DEFENCE	Defence Services	2000-PID; 2001-ES; 2006-ES; 2012-ES	1	2000-2012	c. 2000; c. 2001	190	O'CONNOR	ST		OTTAWA	190	O'CONNOR	ST		K2P2R3	41150248	OLD OTTAWA	911110		DEFENCE RESEARCH DEVELOPMENT BRANCH		606.8271986	100.5788338
3285	DISCOUNT CAR AND TRUCK RENTAL	Car and Truck Rental	1990-CD	1	1990	CD 1990	429	SOMERSET	ST			429	SOMERSET	ST	W	K2P2P5	156690000	OLD OTTAWA					1769.592678	171.5397036
3333	GINN PHOTOGRAPHIC COMPANY	Photography	1990-CD	1	1990	CD 1990	181	BANK	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA					9861.675752	447.0605348
3334	FED-PUBLIC WORKS	Public administration	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	140	O'CONNOR	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	911910				9861.675752	447.0605348
3335	GALINA'S TAILOR & DRY CLEANING SHOP	Construction	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	171	BANK	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	231110; 531310; 812320; 812990				9861.675752	447.0605348
3336	ROSDEV CONSTRUCTION LC	Construction	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2001; ES 2006; ES 2012	171	BANK	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	231110; 531310; 812320; 812990				9861.675752	447.0605348
3337	OLYMPIA & YORK DEVELOPMENTS LTD		2004-GWStudy	1	2004	GW Study 2004 Renfrew Watershed					OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA					9861.675752	447.0605348
3338	ROSTRUST INVESTMENTS INC	General Administrative Services	2003-PID; 2004-GWStudy	1	2003-2004	c. 2003	171	BANK	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	911910		(L'ESPLANADE LAURIER)		9861.675752	447.0605348
3372	DEPT OF FINANCE/TREASURY BOARD OF CANADA	Protective Services	2003-PID	1	2003	c. 2001; c. 2003	140	O'CONNOR	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	911230; 911910		L'ESPLANDE LAURIER; FACILITIES MANAGEMENT		9861.675752	447.0605348
3373	EPRINT IT	Commercial Printing Industries	2005-SelectPhone	1	2005	c. 2005	140	O'CONNOR	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	323114		#11347		9861.675752	447.0605348
3374	DON THOMPSON JEWELLERS LIMITED	Jewellery Stores and Watch And Jewellery Repair Shops	2005-SelectPhone	1	2005	c. 2001; c. 2005	181	BANK	ST			171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	448310				9861.675752	447.0605348

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
3375	FX LADEROUTE STORAGE	Motor Vehicle Repair Shops	1922-FIP-38-232; 1930-M; 1940-M; 1950-M	2	1922-1940	c. 1922; c. 1940	0	LAURIER	AVE	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	335910; 811112; 811119; 811121	339; 635	298 to 300; M.1921 lists as 296-298 Laurier Ave. W.		9861.675752	447.0605348
3376	GOVERNMENT OF CANADA	Combined Publishing and Printing Industries	1994-PID	1	1994	c. 1994	300	LAURIER	AVE	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	511110; 511120; 511130; 512230; 911910	284; 815	GEN# = ON0249609, out of business in 1994		9861.675752	447.0605348
3377	J LOW & CO	Household Furniture Industries	1901-FIP-38-232; 1912-FIP-38-232; 1921-M; 1922-FIP-38-232	2	1900-1922	c. 1901-1912; c. 1922	182	BANK	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	337121; 337123; 337126	261	M.1921 shows the business at 181-185 Bank St.		9861.675752	447.0605348
3378	LEA AND HAWLEY LIMITED	Motor Vehicle Repair Shops	1930-M; 1940-M; 1948-FIP-122-232; 1948-M	2	1930-1948	c. 1930; c. 1948	0	LAURIER	AVE	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	811112; 811119; 811121	635	294 to 304; Laurier St West previously known as Maria		9861.675752	447.0605348
3379	MED LAKE MANUFACTURING COMPANY	Motor Vehicle Parts and Accessories Industries	1920-M	2	1920	c. 1920	167	GLOUCESTER	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	326193; 336330; 336340; 336370	325			9861.675752	447.0605348
3417	SHAMROCK PARKING LTD	Parking Lot	1990-CD	1	1990	CD 1990	168	GLOUCESTER	ST			170	GLOUCESTER	ST		K2P0A6	41150141	OLD OTTAWA			170 Gloucester St		609.9521723	100.8316597
3418	PLUS CLEANERS	Laundries and Cleaners	1998-SC	1	1998	c. 1998	174	GLOUCESTER	ST		OTTAWA	170	GLOUCESTER	ST		K2P0A6	41150141	OLD OTTAWA	561740; 812310; 812320; 812330	972			609.9521723	100.8316597
3419	POOK SHEET METAL WORKS	Plumbing, Heating and Air Conditioning, Mechanical Work	1940-M; 1948-FIP-122-233; 1948-M; 1950-M; 1955-M; 1956-FIP-122-233	1	1900-1956	c. 1940; c. 1948-1956	150	GLOUCESTER	ST		OTTAWA	138	GLOUCESTER	ST		K2P0A6	41150144	OLD OTTAWA	238220	424	Edge Limited -Heating Contractors and Capital Insulating Co. ltd in 1930 and 1950 (use of asbestos products)		1522.587561	161.1950805
3505	ALLSTAR RECO CLEANING SERVICES INC	Services to Buildings and Dwellings	2001-ES; 2005-SelectPhone; 2006-ES	1	2001-2006	c. 2001; c. 2005	251	BANK	ST			251	BANK	ST		K2P1X3	41150209	OLD OTTAWA	561722; 561799		#709		810.9345598	120.2264454
3506	AM-PRO CAMERA REPAIR	Motor Vehicles, Wholesale	2005-SelectPhone	1	2005	c. 2005	251	BANK	ST			251	BANK	ST		K2P1X3	41150209	OLD OTTAWA	561791; 811310; 811411		#608		810.9345598	120.2264454
3628	BROWN'S CLEANERS	Laundries and Cleaners	1990-CD; 1998-SC; 2001-ES	1	1990-2001	c. 1998; c. 2001	211	BANK	ST		OTTAWA	178	NEPEAN	ST		K2P0B6	41150236	OLD OTTAWA	561740; 812310; 812320; 812330	972			685.1589602	108.3003917
3629	BRISEBOIS DENTAL LABORATORY	Other Manufactured Products Industries	1950-M	2	1900-1950	c. 1950	319	LISGAR	ST		OTTAWA	223	BANK	ST		K2P1W9	41150238	OLD OTTAWA	334610	399			912.2793621	120.8166698
3630	WALLACK'S ART & DRAFTING SUPLS	Drafting Equipment Manufacturers	2017-SalesGenie	1	2017	SalesGenie 2017					OTTAWA	223	BANK	ST		K2P1W9	41150238	OLD OTTAWA	33451907	704645			912.2793621	120.8166698
3631	NATHAN SHERWOOD - TAILOR	Laundries and Cleaners	1948-FIP-122-234; 1948-M; 1955-M; 1956-FIP-122-234	2	1948-1956	c. 1948-1956	291	LISGAR	ST		OTTAWA	287	LISGAR	ST		K2P0E1	41150250	OLD OTTAWA	561740; 812310; 812320; 812330	972			913.9476505	120.9366905
3848	SHERIN WILLIAMS PAINT CO OF CANADA LIMITED	Paint and Varnish Industry	1970-M	1	1960-1980	c. 1970	197	BANK	ST		OTTAWA	195	BANK	ST		K2P1W7	41150159	OLD OTTAWA	325510	375			669.1872963	106.6882076
3855	CENTRE GO	Coin Operated Laundry	1990-CD	1	1990	CD 1990	318	LISGAR	ST			318	LISGAR	ST		K2P0E2	41150200	OLD OTTAWA					999.04567	151.8154386
3856	CLEANAWAY LAUNDRY AND DRY CLEANERS	Laundries and Cleaners	1998-SC	1	1998	c. 1998	320	LISGAR	ST		OTTAWA	318	LISGAR	ST		K2P0E2	41150200	OLD OTTAWA	561740; 812310; 812320; 812330	972			999.04567	151.8154386
3857	JARMAN FRANK	Other Furniture and Fixture Industries	1920-M	2	1920	c. 1920	235	BANK	ST		OTTAWA	318	LISGAR	ST		K2P0E2	41150200	OLD OTTAWA	336360; 337910; 339940	269			999.04567	151.8154386

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
3858	THE OTTAWA RECORD PRINTING COMPANY	Commercial Printing Industries	1920-M; 1921-M; 1922-FIP-53-294	2	1900-1950	c. 1920-1922	389	COOPER	ST		OTTAWA	389	COOPER	ST		K2P0G8	41150208	OLD OTTAWA	323114; 323115; 323116; 323119	281	Unsure about address		360.1703744	89.72440213
3859	ARGUE & MCCOLL	Railway Transport and Related Service Industries	1910-M	2	1900-1950	c. 1910	251	BANK	ST		OTTAWA	251	BANK	ST		K2P1X3	41150209	OLD OTTAWA	416310; 416320; 416340; 444110; 444120; 444190; 482112; 482113; 482114; 483116; 488210	453; 563			810.9345598	120.2264454
3860	7TH HEAVEN FUTONS	Household Furniture Stores	2001-ES	1	2001	c. 2001	259	BANK	ST		OTTAWA	251	BANK	ST		K2P1X3	41150209	OLD OTTAWA	442110				810.9345598	120.2264454
3975	BILL'S AUTO SERVICE	Gasoline Service Stations	1940-M	1	1900-1950	c. 1940	375	COOPER	ST		OTTAWA	375	COOPER	ST		K2P0G8	41150340	OLD OTTAWA	447110; 447190; 811199	633			350.6329847	89.16544129
3976	CAPITAL AUDIO TECHNICAL SERVICES	Record Player, Radio and Television Receiver Industry	2001-ES; 2005-SelectPhone; 2006-ES	1	2001-2006	c. 2001; c. 2005	375	COOPER	ST			375	COOPER	ST		K2P0G8	41150340	OLD OTTAWA	334310; 811210				350.6329847	89.16544129
3977	CANUS PLASTICS INC	Plastic Product Manufacturers	1990-CD; 1998-SC; 2001-ES; 2004-GWStudy; 2005-SelectPhone; 2006-ES	1	1990-2006	CD 1990	300	LISGAR	ST			300	LISGAR	ST		K2P0E2	41159502	OLD OTTAWA					1453.219161	153.601556
3978	HOBBS GLASS LIMITED	Glass and Glass Products Industries	1930-M; 1940-M; 1950-M	2	1930-1950	c. 1930-1950	300	LISGAR	ST		OTTAWA	300	LISGAR	ST		K2P0E2	41159502	OLD OTTAWA	327214	356			1453.219161	153.601556
4106	S J T SOFTWARE	Motion Picture Laboratories and Video Production Facilities	2001-ES	1	2001	c. 2001	340	LAURIER	AVE			340	LAURIER	AVE	W	K1A0P9	41140047	OLD OTTAWA	512110				4307.684595	283.4026347
4107	HOBART MANUFACTURING CO	Motor Vehicle Parts and Accessories Industries	1940-M	2	1940	c. 1940	332	LAURIER	AVE	WEST	OTTAWA	340	LAURIER	AVE	W	K1A0P9	41140047	OLD OTTAWA	326193; 336330; 336340; 336370	325			4307.684595	283.4026347
4108	STARLIGHT INVESTMENTS	Construction	2016-PID	1	2016	PID2016	340	LAURIER	AVE	WEST	OTTAWA	340	LAURIER	AVE	W	K1A0P9	41140047	OLD OTTAWA	238220		<Null>		4307.684595	283.4026347
4109	TNC 340 LAURIER LTD	Real estate and rental and leasing	2016-PID	1	2016	PID2016	340	LAURIER	AVE	WEST	OTTAWA	340	LAURIER	AVE	W	K1A0P9	41140047	OLD OTTAWA	531310				4307.684595	283.4026347
4140	FED-PUBLIC WORKS	Other services (except public administration)	2001-ES; 2006-ES; 2012-ES	1	2001-2012	ES 2006; ES 2012	360	LAURIER	AVE			360	LAURIER	AVE	W	K1P1C8	41140048	OLD OTTAWA	812320; 911910				1233.350075	141.8279277
4141	SOOTER'S	Platemaking, Typesetting and Bindery Industry	1998-SC	1	1998	c. 1998	360	LAURIER	AVE	WEST	OTTAWA	360	LAURIER	AVE	W	K1P1C8	41140048	OLD OTTAWA	323120; 812921	282			1233.350075	141.8279277
4142	HILLARY'S DRY CLEANERS	Laundries and Cleaners	1980-M; 1998-SC; 2001-ES; 2006-ES; 2012-ES	1	1980-2012	c. 1980; c. 1998; c. 2001	360	LAURIER	AVE		OTTAWA	360	LAURIER	AVE	W	K1P1C8	41140048	OLD OTTAWA	561740; 812310; 812320; 812330	972			1233.350075	141.8279277
4239	REID DENTAL LABORATORY	Other Manufactured Products Industries	1970-M; 1980-M	1	1960-1980	c. 1970-1980	356	COOPER	ST		OTTAWA	356	COOPER	ST		K2P0G9	41190298	OLD OTTAWA	334610	399			389.7087845	92.44191769
4243	PHOTOS WHILE-U-WAIT	Platemaking, Typesetting and Bindery Industry	1950-M	2	1900-1950	c. 1950	380	SOMERSET	ST	WEST	OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	323120; 812921	282			4655.534542	272.9563153
4244	ROCKWELL'S BODY SHOP	Motor Vehicle Repair Shops	1930-1980-M; 1901-FIP-5-299(1888); 1912-FIP-55-299; 1922-FIP-55-299; 1948-FIP-126-299; 1956-FIP-126-299	1	1901-1963	c. 1930-1940; c. 1948-1957; c. 1963	388	MACLAREN	ST		OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	811112; 811119; 811121	635			4655.534542	272.9563153
4277	MAURICE SIDNEY	Other Textile Products Industries	1920-M	1	1920	c. 1920	386	SOMERSET	ST	WEST	OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	313220; 313320; 315990; 322291; 325620	199			4655.534542	272.9563153

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
4278	SERVICE STATION, SUPERTEST PETROLEUM CORP,	Gasoline Service Station	1934-CityofOttawa	2	1934	c. 1934		KENT	ST			386	LISGAR	ST		K2P2J3	41140171	OLD OTTAWA			Lisgar & Kent		82.11250381	39.89787729
4283	FINTER'S TAILORING	Recreational Vehicle Dealers (Where Servicing Is Present)	1998-SC; 2001-ES	1	1998-2001	c. 1998; c. 2001	290	KENT	ST		OTTAWA	288	KENT	ST		K2P2A4	41200039	OLD OTTAWA	561740; 811490; 812310; 812320; 812330	972			153.2371968	52.68347673
4284	W H WHELAN AND SON	Other Repair Services	1950-M	1	1900-1950	c. 1950	274	NEPEAN	ST		OTTAWA	274	NEPEAN	ST		K1R5G3	41140186	OLD OTTAWA	811411	994			304.1963516	80.52267163
4285	MAIL-MATIC	Commercial Printing Industries	1970-M	1	1970	c. 1970	230	NEPEAN	ST		OTTAWA	230	NEPEAN	ST		K2P0B8	41140194	OLD OTTAWA	323114; 323115; 323116; 323119; 511110; 511120; 511130; 512230	281; 284			304.5991042	80.59363866
4286	DEPT OF NATIONAL DEFENCE	Defence Services	2000-PID; 2001-ES; 2006-ES; 2012-ES	1	2000-2012	c. 2000; c. 2001	222	NEPEAN	ST		OTTAWA	222	NEPEAN	ST		K2P0B8	41140196	OLD OTTAWA	911110		VANIER BUILDING		2442.225463	242.1102399
4287	GORDON LOVE PRINTING SERVICE	Commercial Printing Industries	1964-M; 1964-S; 1965-S	2	1964-1965	c. 1964-1965	345	LISGAR	ST		OTTAWA	222	NEPEAN	ST		K2P0B8	41140196	OLD OTTAWA	323114; 323115; 323116; 323119	281			2442.225463	242.1102399
4288	THE COOKWARE CENTRE	Utensils (Cooking)	2004-GWStudy	1	1959	GW Study 2004 Scotts					OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	417920	5046	220 Bank St		1832.451888	181.5706317
4318	PHONE CLINIC	Electrical and Electronic Machinery, Equipment And Supplies, Wholesale	2001-ES	1	2001	c. 2001	214	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	811210				1832.451888	181.5706317
4319	S J TOWNSHEND	Other Furniture and Fixture Industries	1900-M	2	1900-1950	c. 1900	214	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	336360; 337910; 339940	269	Unsure about address - 'Also residential at this address.		1832.451888	181.5706317
4320	ASHLEY REPRODUCTIONS INC	Commercial Printing Industries	1998-SC	1	1998	c. 1998	232	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	323114; 323115; 323116; 323119	281			1832.451888	181.5706317
4321	BICYCLE REVIVAL LIMITED	Other Repair Services	2000-PID	1	2000	c. 2000	224	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	811411				1832.451888	181.5706317
4322	FESS OIL BURNERS OF CANADA LIMITED	Heating Equipment Industry	1930-M	2	1930	c. 1930	222	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	333310; 333413; 333416	307			1832.451888	181.5706317
4323	TREATS	Bakery/Caf ├⌐	1990-CD	1	1990	CD 1990	271	BANK	ST			271	BANK	ST		K2P1X5	41190009	OLD OTTAWA					2282.006986	208.8245954
4324	GPC LABWORKS LTD	Other	2006-ES; 2012-ES	1	2006-2012	ES 2006; ES 2012	273	BANK	ST			271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	323113; 812921				2282.006986	208.8245954
4325	BIZPOINT PRINTING	Manufacturing	2006-ES; 2012-ES	1	2006-2012	ES 2006; ES 2012	273	BANK	ST			271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	323113; 812921				2282.006986	208.8245954
4326	HERBERT ARTHUR V J	Plumbing, Heating and Air Conditioning, Mechanical Work	1930-M	2	1930	c. 1930	361	SOMERSET	ST		OTTAWA	271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	238220	424			2282.006986	208.8245954
4329	OTTAWA XPRESS	Combined Publishing and Printing Industries	2005-SelectPhone	1	2005	c. 2005	396	COOPER	ST			263	BANK	ST		K2P1X5	41190010	OLD OTTAWA	511110		#204		1417.368525	171.4502171
4330	ANDRE'S PRINTING SVC INC	Commercial Printing Industries	2005-SelectPhone	1	2005	c. 2005	396	COOPER	ST			263	BANK	ST		K2P1X5	41190010	OLD OTTAWA	323114				1417.368525	171.4502171

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
4331	CANADIAN SELECT FARM FOODS	Meat and Poultry Products Industries	2001-ES	1	2001	c. 2001	396	COOPER	ST		OTTAWA	263	BANK	ST		K2P1X5	41190010	OLD OTTAWA	311611				1417.368525	171.4502171
4362	HENRY'S	Camera and Photographic Supply Stores	2005-SelectPhone	1	2005	c. 2005	267	BANK	ST			263	BANK	ST		K2P1X5	41190010	OLD OTTAWA	443130				1417.368525	171.4502171
4363	IMAGNAN CORP	Pulp and Paper Industries	2005-SelectPhone	1	2005	c. 2005	396	COOPER	ST			263	BANK	ST		K2P1X5	41190010	OLD OTTAWA	322122		#203		1417.368525	171.4502171
4364	LITTLE TV PHOTOGRAPHY	Platemaking, Typesetting and Bindery Industry	1970-M	1	1970	c. 1970	226	O'CONNOR	ST		OTTAWA	226	O'CONNOR	ST		K2P1T9	41190013	OLD OTTAWA	323120; 541920; 812921	282; 993	Unit A		407.7842947	81.37460133
4365	MALAK PHOTOGRAPHS	Platemaking, Typesetting and Bindery Industry	1948-FIP-127-295; 1948-M; 1955-M; 1956-FIP-127-295; 1960-M; 1970-M	1	1948-1970	c. 1948-1970	315	SOMERSET	ST	WEST	OTTAWA	315	SOMERSET	ST	W	K2P0J8	41190017	OLD OTTAWA	323120; 541920; 812921	282; 993			362.2273052	89.58603044
4366	IVA DIANNE	Women'S Clothing Industries	2001-ES; 2006-ES	1	2001-2006	c. 2001	331	SOMERSET	ST		OTTAWA	331	SOMERSET	ST	W	K2P0J8	41190020	OLD OTTAWA	315233				362.2497356	89.60770687
4367	HOWARD DIE WORKS	Hardware, Tool and Cutlery Industries	1958-M; 1958-S; 1960-M; 1961-M; 1961-S; 1964/1965-S; 1964-M	1	1958-1960	c. 1958; c. 1960	338	SOMERSET	ST	WEST	OTTAWA	338	SOMERSET	ST	W	K2P0J9	41190031	OLD OTTAWA	323120; 332510; 333511; 333519; 812921	282; 306			611.3869872	103.5353685
4368	PARKER CLEANERS AND DYERS LIMITED	Laundries and Cleaners	1960-M; 1970-M	1	1960-1970	c. 1960-1970	287	BANK	ST		OTTAWA	271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	561740; 812310; 812320; 812330	972			296.0578185	75.56743491
4369	DIXOL PRODUCTS CO	Chemical Products; Germicides/Disinfectants/Polish	1930-M	1	1930-1950	c. 1930	299	BANK	ST		OTTAWA	297	BANK	ST		K2P1X7	41190036	OLD OTTAWA		376	- white pages listed @ 297 1/2 Bank		583.8315186	103.2049445
4370	NICHOLAS PRESS LIMITED	Commercial Printing Industries	1948-FIP-127-296; 1948-M; 1955-M; 1956-FIP-127-296	1	1948-1956	c. 1948; c. 1956	299	BANK	ST		OTTAWA	297	BANK	ST		K2P1X7	41190036	OLD OTTAWA	323114; 323115; 323116; 323119	281			583.8315186	103.2049445
4371	CUCKOO CLOCK SHOP	Watch and Clock Repair	1990-CD	1	1990	CD 1990	301	BANK	ST			301	BANK	ST		K2P1X7	41190037	OLD OTTAWA					584.3842915	103.2714042
4372	SPIC AND SPAN CLEANERS AND DYERS	Laundries and Cleaners	1960-M	1	1960	c. 1960	301	BANK	ST		OTTAWA	301	BANK	ST		K2P1X7	41190037	OLD OTTAWA	561740; 812310; 812320; 812330	972			584.3842915	103.2714042
4373	MOTOR SALES	Motor Vehicle Repair Shops	1920-M; 1921-M; 1922-FIP-53-296; 1930-M	1	1920-1930	c. 1920; c. 1930	0	BANK	ST		OTTAWA	301	BANK	ST		K2P1X7	41190037	OLD OTTAWA	811112; 811119; 811121	635	301 to 303; Residential in 1900, 1910. Company not there in 1940, 1950.		584.3842915	103.2714042
4374	DOMINION REINFORCING STEEL CO LIMITED	Fabricated Structural Metal Products Industries	1930-M; 1940-M; 1950-M	2	1930-1950	c. 1930-1950	396	SOMERSET	ST	WEST	OTTAWA	415	MACLAREN	ST		K2P2C8	41190043	OLD OTTAWA	332311; 332319; 332420	302			3018.466135	243.1356417
4410	SEALTEST		2004-GWStudy	2	2004	GW Study 2004 Renfrew Watershed					OTTAWA	453	COOPER	ST		K2P0H1	41140258	OLD OTTAWA					2186.88715	205.7372653
4411	MAID PLUS	Service Industries Incidental to Air Transport	2005-SelectPhone	1	2005	c. 2005	453	COOPER	ST			453	COOPER	ST		K2P0H1	41140258	OLD OTTAWA	561722; 561799				2186.88715	205.7372653
4412	CENTRETOWN PAINT	Retail trade	2006-ES	1	2006	ES 2006	240	BANK	ST			240	BANK	ST		K2P1X4	41140320	OLD OTTAWA	444120				687.3772449	105.8755337
4413	MRS E DE FONTERY	Other Textile Products Industries	1910-M	2	1910	c. 1910	234	BANK	ST		OTTAWA	240	BANK	ST		K2P1X4	41140320	OLD OTTAWA	313220; 313320; 315990; 322291; 325620	199			687.3772449	105.8755337

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
4414	URBANDALE CORPORATION	Residential Building and Development	2003-PID	1	2003	c. 2003	360	LISGAR	ST		OTTAWA	360	LISGAR	ST		K2P2E4	41140321	OLD OTTAWA	236110				3567.360202	241.1914028
4415	BELL CANADA	Information and cultural industries	2016-PID	1	2016	PID2016	360	LISGAR	ST		OTTAWA	360	LISGAR	ST		K2P2E4	41140321	OLD OTTAWA	517110; 517210; 517510				3567.360202	241.1914028
4416	UNNAMED LUMBER YARD	Lumber and Building Materials, Wholesale	1900-M	2	1900-1950	c. 1900	0	BANK	ST		OTTAWA	317	BANK	ST		K2P1X9	41190049	OLD OTTAWA	416310; 416320; 416340; 444110; 444120; 444190	563			2320.336892	202.7401577
4417	SOUNDMASTER LTD	Audio Equipment, Sound Systems	2004-GWStudy	1	1947	GW Study 2004 Scotts					OTTAWA	312	BANK	ST		K2P1Y1	41190065	OLD OTTAWA	334310	3663	386 MacLaren St		627.1679785	102.9651926
4418	BROOKSHIRE CLEANERS AND DYERS	Laundries and Cleaners	1950-M; 1960-M; 1970-M	1	1950-1970	c. 1950; c. 1970	310	BANK	ST		OTTAWA	312	BANK	ST		K2P1Y1	41190065	OLD OTTAWA	561740; 812310; 812320; 812330	972	Parkers Cleaners was listed at 287 Bank St. in M.1960.		627.1679785	102.9651926
4459	ESQUIRE JEWELLERS LTD	Jewellery	1990-CD	1	1990	CD 1990	166	BANK	ST			324	LAURIER	AVE	W	K1P0A4	41149505	OLD OTTAWA			324 laurier ave w		2452.104864	222.4844354
4460	AJW DUVAL	Household Furniture Industries	1900-M; 1901-FIP-38-243	2	1900-1922	c. 1900-1901	0	BANK	ST		OTTAWA	324	LAURIER	AVE	W	K1P0A4	41149505	OLD OTTAWA	321215; 321911; 321992; 337110; 337121; 337123; 337126	254; 261	172 to 174; 1900 - residence @ 172 Bank		2452.104864	222.4844354
4628	TALLY-HO PURE WATER COMPANY LIMITED	Soft Drink Industry	1920-M	1	1900-1950	c. 1920	224	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	312120	111			378.2950262	85.56265267
4631	ALEXANDRA CLEANERS AND TAILORS	Laundries and Cleaners	1930-M; 1940-M; 1950-M	1	1900-1950	c. 1930; c. 1940-1950	316	BANK	ST		OTTAWA	312	BANK	ST		K2P1Y1	41190065	OLD OTTAWA	238220; 333310; 333413; 333416; 561740; 812310; 812320; 812330	307; 424; 972	1930 - heating apparatus & oil burners		627.1679785	102.9651926
4632	SUNSHINE UNIFORM SUPPLY LIMITED	Laundries and Cleaners	1940-M	1	1900-1950	c. 1940	388	MACLAREN	ST		OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	561740; 812310; 812320; 812330	972			627.1679785	102.9651926
4711	OTTAWA SPECIALTY MANUFACTURING CO LIMITED	Sash, Door and Other Millwork Industries	1900-M; 1901-FIP-55-299(1888)	1	1900-1901	c. 1900-1901	304	BANK	ST		OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	238220; 321215; 321911; 321992; 337110; 337127; 337213; 337214	254; 264; 424			520.4439009	99.93640102
4721	ARGUE F W LIMITED	Lumber and Building Materials, Wholesale	1920-M; 1930-M; 1940-M; 1950-M	1	1900-1950	c. 1920-1950	234	BANK	ST		OTTAWA	240	BANK	ST		K2P1X4	41140320	OLD OTTAWA	412110; 416310; 416320; 416340; 419120; 444110; 444120; 444190; 454310	511; 563			112.987529	46.36922038
4766	CARDINAL CHEMICAL CO	Industrial and Household Chemicals, Wholesale	1940-M	2	1900-1950	c. 1940	332	LAURIER	AVE	WEST	OTTAWA	340	LAURIER	AVE	W	K1A0P9	41140047	OLD OTTAWA	418410	597			1115.880972	158.3927099
4777	RADIO LABORATORIES	Telecommunication Broadcasting Industries	1940-M; 1950-M	2	1900-1950	c. 1940-1950	308	LAURIER	AVE	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	515110; 515120	481			201.1803695	59.57041848
4783	ROYAL CABS	Other Transportation Industries	1940-M; 1950-M	2	1900-1950	c. 1940; c. 1940-1950	378	SOMERSET	ST	WEST	OTTAWA	294	BANK	ST			41199501	OLD OTTAWA	485310; 485320	458			552.7759509	100.1468875
4784	ABC CABS	Other Transportation Industries	1940-1950-M	1	1940-1950		378	SOMERSET	ST	WEST	OTTAWA	294	BANK	ST			41199501	OLD OTTAWA					552.7759509	100.1468875
4785	WOODS TAXI	Other Transportation Industries	1940-M	1	1940		378	SOMERSET	ST	WEST	OTTAWA	294	BANK	ST			41199501	OLD OTTAWA					552.7759509	100.1468875
4864	CENTRAL VULCANIZING CO	Other Rubber Products Industries	1930-M; 1940-M	1	1900-1950	c. 1930-1940	344	LISGAR	ST		OTTAWA	360	LISGAR	ST		K2P2E4	41140321	OLD OTTAWA	322220; 326290; 339110; 339990; 415210; 415290	159; 552			763.1688976	114.0911927

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
4908	HURD'S GARAGE	Motor Vehicle Repair Shops	1940-M; 1950-M	2	1940-1950	c. 1940; c. 1950	264	KENT	ST		OTTAWA	1	WALSINGHAM	PRIV		K1R1B8	41140345	OLD OTTAWA	811112; 811119; 811121	635			193.0388898	55.79912524
4927	PARKER'S CLEANERS AND DYERS LIMITED	Laundries and Cleaners	1940-M; 1950-M	2	1900-1950	c. 1940-1950	214	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	561740; 812310; 812320; 812330	972	Milliner in 1910, 1920, 1930		228.4969327	60.64189816
4930	PESTROY CO	Services to Buildings and Dwellings	1940-M; 2004-GWStudy	1	1900-1950	c. 1940	318	LISGAR	ST		OTTAWA	318	LISGAR	ST		K2P0E2	41150200	OLD OTTAWA	561710; 561721; 561791; 561799	995			208.2839195	60.94438306
4947	DRUMMOND, PETER W	Motor Vehicle Repair Shops		1			264	KENT	ST		OTTAWA	1	WALSINGHAM	PRIV		K1R1B8	41140345	Old Ottawa					193.0388898	55.79912524
4948	THE TIGHE PRESS	Commercial Printing Industries	1930-M	2	1930	c. 1930	264	KENT	ST		OTTAWA	1	WALSINGHAM	PRIV		K1R1B8	41140345	OLD OTTAWA	323114; 323115; 323116; 323119	281			193.0388898	55.79912524
4963	CAXTON PRESS	Commercial Printing Industries	1930-M	1	1900-1950	c. 1930	273	BANK	ST		OTTAWA	271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	323114; 323115; 323116; 323119	281	Unit 4		337.762784	81.73883204
5005	OTTAWA DAIRY LIMTED	Dairy Products Industries	1901-M	1	1901			COOPER	ST		OTTAWA	282	BANK	ST		K2P1X6	41190007	Old Ottawa					6083.768091	351.4035124
5007	BROOKSHIRE CLEANERS LTD	Laundries and Cleaners	1948-1970-M	1	1948-1970		178	BANK	ST	WEST	OTTAWA	324	LAURIER	AVE	W	K1P0A4	41149505	Old Ottawa					526.4821628	96.27640937
5008	DE FONTENY DRY CLEANING WORKS	Laundries and Cleaners	1920-1930-M	1	1920-1930		178	BANK	ST	WEST	OTTAWA	324	LAURIER	AVE	W	K1P0A4	41149505	Old Ottawa					526.4821628	96.27640937
5009	DRY CLEANERS	Laundries and Cleaners	1920-M; 1922-FIP-38-243; 1930-M; 1940-M; 1948-FIP-122-243; 1948-M; 1950-M; 1955-M; 1956-FIP-122-243; 1960-M; 1970-M	1	1900-1980	c. 1920-1930; c. 1948-1970	178	BANK	ST	WEST	OTTAWA	324	LAURIER	AVE	W	K1P0A4	41149505	OLD OTTAWA	561740; 812310; 812320; 812330	972	Residential in 1900 and other companies in 1910. In 1930 only did dying. Company not there in 1940 and 1950.		526.4821628	96.27640937
5021	PARKER CLEAN GALINA'S ALTERATIONS	Laundries and Cleaners	1956-FIP-122-232; 1960-M; 1970-M; 1980-M; 1990-M; 1997-M; 2001-ES; 2006-ES; 2012-ES	1	1901-2012	c. 1956; c. 1960; c. 1990-1997; c. 2001	171	BANK	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	561740; 812310; 812320; 812330	972			200.5520339	59.34201439
5063	OTTAWA PHOTO ENGRAVING CO	Platemaking, Typesetting and Bindery Industry	1920-M; 1922-FIP-38-232; 1930-M; 1940-M; 1948-FIP-122-232; 1948-M; 1950-M	2	1900-1950	c. 1920-1950	294	LAURIER	AVE	WEST	OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA	323120; 812921	282	294 to 304; Previously Maria St.		1064.563075	130.322395
5088	R MCGREGOR LTD	Meat and Poultry Products Industries	1920-1930-M	1	1920-1930		437	LISGAR	ST		OTTAWA	290	NEPEAN	ST		K1R5G3	41140184	Old Ottawa					1227.541964	141.5093038
5100	WACKID RADIO TELEVISION LABORATORIES	Electronics - Service	1960-M	1	1960-1980	c. 1960	149	GLOUCESTER	ST		OTTAWA	171	BANK	ST		K2P1W5	41150120	OLD OTTAWA		775			412.6096589	85.20436042
5107	JASON R WATTERS	Corset Manufacturer	1900-M	1	1900-1950	c. 1900	168	BANK	ST		OTTAWA	324	LAURIER	AVE	W	K1P0A4	41149505	OLD OTTAWA		249	1910 - vacant		261.0658506	68.16931921
5188	DRAICCHIO TAILORING & CLEANING	Laundries and Cleaners	1990-1997-M	1	1990-1997		272	BANK	ST		OTTAWA	395	SOMERSET	ST	W	K2P2G6	151000000	Old Ottawa					129.2820838	53.02048915
5199	LARS PETERSON	Small Electrical Appliance Industry	1900-M	1	1900		220	BANK	ST		OTTAWA	220	BANK	ST			41140197	OTTAWA					420.6094145	88.35343226
5200	WILLIAMS MANUFACTURING CO	Small Electrical Appliance Industry	1900-M; 1910-M	1	1900-1950	c. 1900; c. 1910	220	BANK	ST		OTTAWA	212	BANK	ST		K2P1X1	41140197	OLD OTTAWA	335210; 335223; 335229	331; 332			420.6094145	88.35343226

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
5245	UNNAMED TINSMITH	Stamped, Pressed and Coated Metal Products Industries	1901-FIP-53-295	1	1900-1922	c. 1901	273	BANK	ST		OTTAWA	271	BANK	ST		K2P1X5	41190009	OLD OTTAWA	238220; 332118; 332210; 332431; 332439; 332720; 339910	304; 424			337.762784	81.73883204
5277	DOMINION DAIRIES LTD	Dairy Products Industries	1970-1971-M	1	1970		257	KENT	ST		OTTAWA	453	COOPER	ST		K2P0H1	41140258	Old Ottawa					652.4620994	102.2129106
5328	MICHAEL O'MEARA	Laundries and Cleaners	1930-M	1	1930		200	BANK	ST		OTTAWA	196	BANK	ST		K2P1W8	41140326	OLD OTTAWA					223.7228185	75.4792339
5329	DE FONTENY FRENCH CLEANERS	Laundries and Cleaners	1930-M; 1940-M; 1950-M	1	1900-1950	c. 1930; c. 1940	200	BANK	ST		OTTAWA	196	BANK	ST		K2P1W8	41140326	OLD OTTAWA	561740; 812310; 812320; 812330	972			223.7228185	75.4792339
17702	ST PATRICK'S ASYLUM (FOR AGED AND ORPHANS)	Asylum	1901-FIP-42-254; 1912-FIP-42-254	1								200	KENT	ST		K1A0M1	41140049	OLD OTTAWA					3713.007942	243.7458958
17719	BUILDING & MAINTENANCE INDUSTRIES	Administrative and support, waste management and remediation services	2006-ES; 2012-ES	2			207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	561722				674.8431029	107.2828254
17720	DAOUST REFRIGERATION	Other services (except public administration)	2006-ES	2			207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	811412				674.8431029	107.2828254
17721	OTTAWA INSIDER	Information and cultural industries	2006-ES	2			207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	511110				674.8431029	107.2828254
17722	TO BE MAGAZINE	Information and cultural industries	2006-ES	2			207	BANK	ST			203	BANK	ST		K2P1W7	41150160	OLD OTTAWA	511120				674.8431029	107.2828254

DATABASE REPORT

Project Property:	*PE6874 - Phase I ESA* *240 Bank Street* *Ottawa ON K2P 1X4*
Project No:	*62156*
Report Type:	*Standard Report*
Order No:	*25011400345*
Requested by:	*Paterson Group Inc.*
Date Completed:	*January 14, 2025*

Environmental Risk Information Services
A division of Glacier Media Inc.
1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....2
Executive Summary.....3
Executive Summary: Report Summary.....4
Executive Summary: Site Report Summary - Project Property.....7
Executive Summary: Site Report Summary - Surrounding Properties.....8
Executive Summary: Summary By Data Source.....42
Map.....83
Aerial.....84
Topographic Map.....85
Detail Report.....86
Unplottable Summary.....420
Unplottable Report.....425
Appendix: Database Descriptions.....461
Definitions.....471

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *PE6874 - Phase I ESA*
240 Bank Street Ottawa ON K2P 1X4

Project No: *62156*

Coordinates:

Latitude:	*45.4164661*
Longitude:	*-75.6976567*
UTM Northing:	*5,029,452.90*
UTM Easting:	*445,413.79*
UTM Zone:	*18T*

Elevation: *255 FT*
77.81 M

Order Information:

Order No: *25011400345*
Date Requested: *January 14, 2025*
Requested by: *Paterson Group Inc.*
Report Type: *Standard Report*

Historical/Products:

Executive Summary: Report Summary

Database	Name	Searched	Project Property	Within 0.25 km	Total
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	5	5
CA	Certificates of Approval	Y	0	12	12
CDRY	Dry Cleaning Facilities	Y	0	2	2
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	7	7
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	1	1
ECA	Environmental Compliance Approval	Y	0	8	8
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	4	69	73
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	6	6
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	1	1
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	3	3
GEN	Ontario Regulation 347 Waste Generators Summary	Y	1	186	187
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	2	2
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

Database	Name	Searched	Project Property	Within 0.25 km	Total
INC	Fuel Oil Spills and Leaks	Y	0	2	2
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	5	5
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	1	1
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	1	1
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	12	12
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	3	3
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	4	4
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	7	7
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	26	26
SPL	Ontario Spills	Y	0	27	27
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	34	34

Database	Name	Searched	Project Property	Within 0.25 km	Total
Total:		5		427	432

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
1	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	86
1	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	86
1	GEN	Al's Care Pharmacy	240 Bank Street Ottawa ON K2P1X4	-/0.0	0.00	86
1	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	87
1	EHS		240 Bank Street Ottawa ON K2P 1X4	-/0.0	0.00	87

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
2	SPL	PRIVATE BUSINESS	232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	N/30.5	-0.24	87
2	GEN	J Levinston Holding	212 - 232 Bank st. Ottawa ON K2P 1X1	N/30.5	-0.24	88
3	GEN	REVENUE CANADA TAXATION	CUSTOMS & EXCISE 360 LISGAR STREET OTTAWA ON K2P 2E4	WSW/47.6	0.07	88
3	GEN	REVENUE CANADA TAXATION	360 LISGAR STREET OTTAWA ON K1A 0L9	WSW/47.6	0.07	89
3	GEN	URBANDALE CORPORATION	360 Lisgar Street Ottawa ON	WSW/47.6	0.07	89
3	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	90
3	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	90
3	GEN	BELLCANADA	360 LISGAR STREET OTTAWA ON K2P 2E4	WSW/47.6	0.07	91
3	GEN	Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW/47.6	0.07	91
4	EHS		251 Bank Street Ottawa ON K2P 1X3	ESE/49.4	-0.93	93
5	SCT	WALLACK'S ART & DRAFTING	231 BANK ST OTTAWA ON K2P 1W9	N/56.0	-0.23	93
6	GEN	BICYCLE REVIVAL LTD.	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	93

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
6	GEN	BICYCLE REVIVAL LTD. 04-341	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	94
6	GEN	BICYCLE REVIVAL LIMITED	224 BANK STREET OTTAWA ON K2P 1X1	NNW/57.9	0.07	94
7	GEN	FOCUS CENTRE, THE	254 BANK STREET OTTAWA ON K2P 1X4	SE/59.2	-0.93	94
7	GEN	Easy Drain Plumbing	254 Bank Str Ottawa ON	SE/59.2	-0.93	95
8	SCT	COOKWARE CENTRE (THE)	220 BANK ST OTTAWA ON K2P 1X1	NNW/59.8	0.07	95
9	EHS		251-259 Bank Street (395-397 Cooper St) Ottawa ON	ESE/67.9	-0.93	95
9	SCT	Capital Xtra - Div. of Pink	251 Bank St Unit 503 Ottawa ON K2P 1X3	ESE/67.9	-0.93	96
9	SCT	McKenzie Publishing Inc.	251A Bank St Suite 500 Ottawa ON K2P 1X3	ESE/67.9	-0.93	96
9	SCT	Akiva Publishing Inc.	251 Bank St Suite 206 Ottawa ON K2P 1X3	ESE/67.9	-0.93	96
9	EHS		251 Bank Street Ottawa ON	ESE/67.9	-0.93	96
9	EHS		251 Bank St Ottawa ON K2P1X3	ESE/67.9	-0.93	97
10	INC		212 Bank Street , Ottawa ON	NNW/71.1	0.07	97
11	GEN	DEPARTMENT OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	98

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
11	GEN	DEPT OF NATIONAL DEFENCE, CDN. FORCES	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	98
11	GEN	DEPT. OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW/73.6	0.07	98
11	EHS		222 Nepean Street Ottawa ON K2P 0B8	WNW/73.6	0.07	99
11	SPL		222 Nepean Street, Ottawa Ottawa ON	WNW/73.6	0.07	99
11	GEN	Bona Building Management	222 Nepean St Ottawa ON K1R5G2	WNW/73.6	0.07	100
12	CA	OTTAWA CITY	COOPER ST./BANK ST. OTTAWA CITY ON	ESE/75.1	-0.93	101
12	CA	R.M. OF OTTAWA-CARLETON	COOPER ST./BANK ST. OTTAWA CITY ON	ESE/75.1	-0.93	101
13	RSC	Youth Services Bureau of Ottawa	433 COOPER ST/366 LISGAR STREET, OTTAWA OTTAWA ON	SW/77.0	0.07	101
14	SCT	Canadian Bible Society	315 Lisgar St Ottawa ON K2P 0E1	NE/79.7	-0.93	102
15	EHS		178 Nepean, 219 & 223 Bank Ottawa ON K2P 1W9	N/85.7	-1.10	102
16	SCT	Canus Plastics Inc.	300 Lisgar St Ottawa ON K2P 0E2	ENE/85.8	-0.93	102
16	SCT	Canus Signs Plastics Ltd.	300 Lisgar St Ottawa ON K2P 0E2	ENE/85.8	-0.93	103
16	EHS		300 Lisgar Street Ottawa ON K2P 0E2	ENE/85.8	-0.93	103

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
16	RSC	Soho Lisgar Inc.	300 Lisgar Street, Ottawa, Ontario, K2P 1T6 OTTAWA ON	ENE/85.8	-0.93	103
17	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	104
17	GEN	DRAICCHIO'S TAILORING & CLEANING 12-549	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	104
17	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	105
17	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	105
17	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	105
17	GEN	DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE/92.7	-0.93	106
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON	SE/92.7	-0.93	106
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON	SE/92.7	-0.93	106
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	107
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	107
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	107
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	108

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
17	CDRY	Draicchio's Tailoring&Cleaning	272 Bank St Ottawa ON K2P1X6	SE/92.7	-0.93	108
17	CDRY	Downtown Cobler	272 Bank St Ottawa ON K2P1X6	SE/92.7	-0.93	108
17	GEN	7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE/92.7	-0.93	109
17	GEN	DOWNTOWN COBBLER DOWNTOWN COBBLER	272 BANK ST OTTAWA ON k2p1x6	SE/92.7	-0.93	109
17	GEN	Downtown Tailoring	272 BANK ST OTTAWA ON K2P 1X6	SE/92.7	-0.93	109
18	EHS		437 Cooper Street Ottawa ON K2P 0H1	SW/92.7	0.07	112
19	BORE		ON	E/97.5	-0.93	113
20	SPL	Enbridge Gas Distribution Inc.	Bank St and Nepean St Ottawa ON	NNW/100.1	0.07	115
21	GEN	Canus Plastics Inc.	300 Lisgar St. Ottawa ON	ENE/105.0	-0.93	115
21	GEN	Bassi Construction	300 lisgar st ottawa ON K2P 0E2	ENE/105.0	-0.93	116
22	GEN	GLASER PHARMACY LTD.	267 BANK STREET OTTAWA ON K2P 1X3	ESE/105.4	-0.93	116
23	GEN	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	117
23	GEN	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	117

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
23	GEN	COOPER PHARMACY INC	276 BANK ST OTTAWA ON K2P 1X6	SE/107.6	-0.93	117
24	EHS		379 Cooper Street Ottawa ON K2P 0G8	E/110.1	-0.93	119
24	EHS		379 Cooper Street Ottawa ON K2P 0G8	E/110.1	-0.93	119
25	EHS		309 Lisgar Avenue Ottawa ON	NE/110.3	-0.93	119
26	GEN	BAYVIEW PROPERTY MANAGEMENT	210 BANK STREET OTTAWA ON K2P 1W8	NW/114.9	0.07	119
27	EHS		226 Nepean St Ottawa ON K2P0B8	W/116.2	0.07	120
28	EHS		300 Lisgar St and 375 Cooper St Ottawa ON	ENE/118.6	-0.93	120
29	WWIS		ON ***Well ID:*** 7296899	NNE/120.1	-0.95	120
30	EHS		177 Nepean St Ottawa ON K2P 1W7	N/120.8	-0.47	121
31	EHS		PE3651 - 293 Lisgar Street & 176 Nepean Street Ottawa ON K2P 0B6	NE/121.1	-0.93	121
32	EHS		205 Bank Street Ottawa ON K2P 1W7	NNW/121.2	0.07	121
33	SCT	The Ottawa Xpress	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122
33	SCT	The Ottawa X Press - Div. of Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
33	SCT	Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122
33	SCT	Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	122
33	SCT	Ottawa X Press	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE/122.7	-0.93	123
33	SCT	Imagnan Corp.	396 Cooper St Suite 203 Ottawa ON K2P 2H7	ESE/122.7	-0.93	123
34	EHS		203 Bank St Ottawa ON K2P1W7	N/124.5	0.07	123
35	EHS		215 Nepean St Ottawa ON K2P2K5	WNW/125.7	0.07	123
36	SCT	CAPITAL XTRA INC.	177 NEPEAN ST SUITE 500 OTTAWA ON K2P 0B4	N/125.9	0.07	123
36	SPL	PRIVATE RESIDENCE	177 NIPEON STREET FURNACE OIL TANK OTTAWA CITY ON	N/125.9	0.07	124
36	GEN	District Realty Corporation	177 Nepean Street Ottawa ON K2P 0B4	N/125.9	0.07	125
36	CA	Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON	N/125.9	0.07	125
36	ECA	Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON K1Y 2E9	N/125.9	0.07	125
37	WWIS		355 COOPER ST OTTAWA ON ***Well ID:*** 7305580	ENE/126.4	-0.93	126
38	EHS		275 Bank St Ottawa ON K2P2L6	ESE/127.2	-0.93	129

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	129
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	129
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	130
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON	S/127.5	0.07	130
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	131
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	131
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	132
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	132
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	132
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	133
39	GEN	Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S/127.5	0.07	133
40	GEN	GVT. OF CAN. - R.C.M.P.	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S/131.1	0.07	137
40	GEN	GVT. OF CAN. - R.C.M.P. 18-132	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S/131.1	0.07	138

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
40	EHS		400 Cooper Street Ottawa ON K2P 2H8	S/131.1	0.07	138
40	EHS		400 Cooper Street, Ottawa ON K2P 2H8	S/131.1	0.07	138
40	EHS		400 Cooper Street Ottawa ON K2P 2N1	S/131.1	0.07	139
40	GEN	400 Cooper Building Inc.	400 Cooper Street Ottawa ON K2P 2H8	S/131.1	0.07	139
40	EHS		400 Cooper Street Ottawa ON K2P 2N1	S/131.1	0.07	139
41	GEN	E.A.S. ILLUSTRATORS & PRINTERS LTD	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	139
41	GEN	E.A.S. ILLUSTRATORS & PRINTERS LTD14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	140
41	GEN	E.A.S. (OUT OF BUS) 14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N/131.9	-0.95	140
41	GEN	ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N/131.9	-0.95	141
41	GEN	ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N/131.9	-0.95	141
42	WWIS		355 COOPER ST OTTAWA ON ***Well ID:*** 7305582	ENE/133.1	-0.93	141
43	EHS		275 Bank Street Ottawa ON K2P 2L6	SE/133.2	-0.93	144
44	WWIS		355 COOPER ST OTTAWA ON	ENE/133.4	-0.90	145

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7305579			
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	148
45	GEN	Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE/134.3	0.16	148
45	GEN	Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE/134.3	0.16	148
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	149
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE/134.3	0.16	149
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON	SSE/134.3	0.16	149
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	150
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	150
45	GEN	Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	151
45	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	151
45	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	151
45	GEN	Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE/134.3	0.16	152
46	SPL	OTTAWA HYDRO	375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	E/134.3	-0.90	154

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
46	EHS		375 Cooper Street Ottawa ON K2P 0G8	E/134.3	-0.90	154
47	SCT	JacintaIlnk	207 Bank St Suite 242 Ottawa ON K2P 2N2	N/137.5	-0.47	155
47	SCT	To Be Publications Inc.	207 Bank St Ottawa ON K2P 2N2	N/137.5	-0.47	155
48	BORE		ON	WSW/139.1	0.07	155
49	NPCB	SEALTEST	DIVISION OF AULT FOODS; 453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	157
49	SPL	AULT FOODS	453 COOPER STREET OTTAWA WINCHESTER 490 GORDON STREET OTTAWA CITY ON K2P 0H1	SW/142.5	0.07	157
49	SPL	AULT FOODS	453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SW/142.5	0.07	158
49	GEN	AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	159
49	GEN	AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	159
49	GEN	AULT FOODS LIMITE(OUT OF BUSINESS)03-320	453 COOPER STREET OTTAWA ON K2P 0H1	SW/142.5	0.07	160
49	EHS		453 Cooper Street Ottawa ON K2P 0H1	SW/142.5	0.07	160
50	WWIS		195 BANK ST. OTTAWA ON ***Well ID:*** 7246053	NNW/145.1	0.07	161
51	WWIS		ON	NW/145.2	0.07	163

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 1503876			
52	BORE		ON	NW/145.4	0.07	166
53	SCT	Biz Point Inc.	273 Bank St Ottawa ON K2P 1X5	ESE/146.0	-0.93	167
54	GEN	OTTAWA COMMUNITY HOUSING CORPORATION	395 SOMERSET STREET OTTAWA ON	S/146.3	0.07	167
54	GEN	Black & McDonald Ltd.	395 Somerset Ottawa ON K2L 4X8	S/146.3	0.07	167
55	WWIS		315 COOPER ST Ottawa ON ***Well ID:*** 7312996	E/146.9	-1.62	169
56	BORE		ON	SW/154.9	0.07	172
57	GEN	OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	173
57	GEN	OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	173
57	GEN	OTTAWA MAGAZINE INC. 29-278	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA MAGAZINE INCORPORATED	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA(SEE&USE ON0897800 OTTAWA)	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	174
57	GEN	OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290	192 BANK STREET OTTAWA ON K2P 1W8	NW/154.9	0.07	175
57	SCT	Cdn Council Tobacco Control	192 Bank St Ottawa ON K2P 1W8	NW/154.9	0.07	175

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
58	EHS		153 Nepean Street Ottawa ON K2P 0B5	NNE/156.4	-0.93	175
59	WWIS		355 COOPER ST OTTAWA ON ***Well ID:*** 7305581	ENE/156.8	-0.90	175
60	OOGW	Ottawa Dairy Well	Nepean ON ***Licence No:*** F019784	SE/157.1	-0.93	178
61	GEN	MCEVOY-SHIELDS FUNERAL HOMES LTD.	235 KENT STREET OTTAWA ON K2P 1Z9	W/157.4	0.07	180
61	GEN	MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472	235 KENT STREET OTTAWA ON K2P 1Z9	W/157.4	0.07	181
61	GEN	Service Corporation International Canada	235 Kent Street Ottawa ON K2P 1Z9	W/157.4	0.07	181
61	GEN	Charlesfort Development Corporation	235 Kent Street Ottawa ON K2P 1Z9	W/157.4	0.07	181
62	EHS		287 Lisgar Street Ottawa ON	NE/157.6	-0.93	182
63	GEN	Claridge Homes Corporation	287 Lisgar Ottawa ON	NE/157.6	-0.93	182
63	GEN	CLARIDGE HOMES (CENTRETOWN) INC.	287 LISGAR STREET OTTAWA ON	NE/157.6	-0.93	182
63	PTTW	Claridge Homes (287 Lisgar) Inc.	287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA ON	NE/157.6	-0.93	183
63	GEN	Claridge Homes Limited Partnership	287 Lisgar Street Ottawa ON K2P 0E1	NE/157.6	-0.93	183
63	GEN	Claridge Homes	287 Lisgar Street Ottawa ON K2P 0E1	NE/157.6	-0.93	183

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
63	RSC	CLARIDGE HOMES (287 LISGAR) INC.	287 LISGAR STREET ON Ottawa ON	NE/157.6	-0.93	184
63	SPL	Claridge Homes (Carson) Inc.	287 Lisgar Avenue Ottawa ON K2P 1K8	NE/157.6	-0.93	185
64	ECA	City of Ottawa	Ottawa ON K2G 6J8	ENE/160.0	-0.89	186
64	ECA	City of Ottawa	Laurier Avenue at the Rideau Canal Ottawa ON K1P 1J1	ENE/160.0	-0.89	186
65	SPL		239 Nepean St OTTAWA ON	W/163.6	0.16	186
66	EHS		Nepean Street Ottawa ON K2P 0B6	NE/164.4	-0.93	187
67	WWIS		KENT ST Ottawa ON ***Well ID:*** 7344656	WSW/164.8	-0.01	187
68	WWIS		281 kent st Ottawa ON ***Well ID:*** 7354243	SW/167.0	1.07	189
69	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	193
69	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	193
69	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	193
69	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	194
69	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	194

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
69	GEN	City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	195
69	GEN	City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW/167.0	-0.24	195
70	SCT	KOFFMAN SIGNS	146 NEPEAN ST OTTAWA ON K2P 0B6	NE/168.1	-0.93	197
70	SCT	Koffman Signs Ltd.	146 Nepean St Ottawa ON K2P 0B6	NE/168.1	-0.93	198
70	GEN	Marilena Guerra	146 Nepean Street Ottawa ON	NE/168.1	-0.93	198
71	EHS		343 Somerset Street West Ottawa ON	ESE/168.2	-1.38	198
72	EHS		170 Gloucester Street Ottawa ON K2P 0A6	N/168.3	0.07	198
73	EHS		355 Cooper St Ottawa ON K2P0G8	ENE/168.3	-1.62	199
74	WWIS		SOMERSET ROADWAY OTTAWA ON ***Well ID:*** 1535586	ESE/168.6	-0.82	199
75	SCT	O'Brien Publishing Inc.	176 Gloucester St Suite 400 Ottawa ON K2P 0A6	NNW/172.4	0.07	201
75	EHS		176 Gloucester St Ottawa ON K2P0A6	NNW/172.4	0.07	202
76	EHS		PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9	SE/175.0	-0.93	202
77	GEN	HUDSON PARK CONDOS	245 KENT STREET OTTAWA ON K2P 0A5	W/176.6	0.07	202

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
77	RSC	Charlesfort Development Corporation	235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON	W/176.6	0.07	202
78	EHS		281 Kent Street Ottawa ON K2P 2H8	SW/177.2	1.07	203
79	GEN	Regional Group	152 Gloucester St Ottawa ON K2P 0A6	NNE/179.8	-0.96	203
80	PINC	ENBRIDGE GAS INC	142 NEPEAN ST,,OTTAWA,ON,K2P 2N2, CA ON	NE/180.4	-0.93	204
81	EHS		352/348/346 Somerset & 349 MacLaren Ottawa ON	ESE/182.1	-0.93	205
82	CA	ALLAN KWAI	331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	E/186.3	-1.93	205
83	WWIS		296 BANK ST. OTTAWA ON ***Well ID:*** 7246842	SE/186.4	-0.93	205
83	WWIS		296 BANK ST. OTTAWA ON ***Well ID:*** 7246843	SE/186.4	-0.93	208
84	WWIS		281 kent st Ottawa ON ***Well ID:*** 7354245	SW/187.4	1.07	211
85	SPL	TRANSPORT TRUCK	KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SW/188.0	1.07	214
86	PRT	SOMERSET SUNOCO	429 SOMERSET ST OTTAWA ON K2P0K1	SSW/189.0	0.01	215
86	GEN	CLARRIDGE HOMES	419-429 SOMERSET STREET OTTAWA ON K2P 2P5	SSW/189.0	0.01	215
86	GEN	Clarridge Homes	419-429 SOMERSET ST. OTTAWA ON K1N 6W8	SSW/189.0	0.01	216

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
86	DTNK	SAVEWAY GAS & FUELS LTD	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW/189.0	0.01	216
86	DTNK	MARK TAZA	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW/189.0	0.01	217
86	DTNK	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	217
86	EXP	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	218
86	EXP	MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW/189.0	0.01	218
87	WWIS		355 COOPER ST Ottawa ON ***Well ID:*** 7312995	ENE/189.6	-1.61	218
88	EHS		186 Bank St Ottawa ON K2P1W6	NW/193.5	-0.23	221
89	EHS		230 Gloucester St Ottawa ON K2P0A9	WNW/194.6	-0.93	222
90	EHS		327 Somerset St W Ottawa ON K2P0J8	E/195.0	-1.93	222
91	WWIS		81 kent st Ottawa ON ***Well ID:*** 7354244	SW/195.3	1.07	222
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE/197.4	-0.93	225
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE/197.4	-0.93	226
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	226

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	226
92	SPL	Parson Refrigeration (1985) Ltd.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	227
92	CA	Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE/197.4	-0.93	228
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE/197.4	-0.93	228
92	SPL	Parson Refrigeration (1985) Ltd.	296 Bank St Ottawa ON	SE/197.4	-0.93	228
92	EHS		296 Bank St Ottawa ON K2P1X8	SE/197.4	-0.93	229
92	PES	MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	229
92	PES	LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	230
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	230
92	ECA	Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE/197.4	-0.93	230
92	GEN	Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	231
92	GEN	Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	231
92	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	231

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	232
92	PES	HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE/197.4	-0.93	232
92	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	233
92	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	233
92	GEN	LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE/197.4	-0.93	234
92	SPL	296 Bank Street	296 Bank Street OTTAWA ON	SE/197.4	-0.93	237
92	SPL		296 Bank Street, Ottawa ON	SE/197.4	-0.93	238
93	EHS		380 &386 Somerset St W/296 Bank St Ottawa ON	SE/198.0	-0.93	239
93	GEN	DUFRESNE PILING COMPANY (1967) LTD.	380 SOMERSET STREET WEST OTTAWA ON K2P 2R2	SE/198.0	-0.93	239
93	EHS		380 Somerset St W Ottawa ON K2P2R2	SE/198.0	-0.93	240
94	GEN	GVT. OF CAN. - NATIONAL DEFENCE	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE/199.7	-0.93	240
94	GEN	GVT. OF CAN. - NATIONAL DEFENCE	190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	NE/199.7	-0.93	240
94	GEN	GVT. OF CAN. - NATIONAL DEFENCE 18-192	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE/199.7	-0.93	240

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
94	GEN	DEPT. OF NATIONAL DEFENCE	DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	NE/199.7	-0.93	241
94	SCT	Canadian Council on Social	190 O'Connor St Suite 100 Ottawa ON K2P 2R3	NE/199.7	-0.93	241
94	EHS		190 O'connor St Ottawa ON K2P2R3	NE/199.7	-0.93	242
95	WWIS		338 SOMERSET STREET WEST OTTAWA ON ***Well ID:*** 7046637	ESE/206.1	-1.93	242
96	WWIS		154 O'CONNOR STREET Ottawa ON ***Well ID:*** 7130914	NNE/207.0	-0.93	245
97	WWIS		311 SOMERSET Ottawa ON ***Well ID:*** 7391114	E/210.2	-1.93	260
98	WWIS		311 SOMERSET Ottawa ON ***Well ID:*** 7391113	E/217.6	-1.93	264
99	WWIS		429 MC LEARN Ottawa ON ***Well ID:*** 7233874	S/218.4	0.07	267
100	SPL		290-292 Kent Street UTM Zone:18 Easting: 445333.64 Northing:5029231.41 Ottawa ON	SW/219.0	1.07	271
101	WWIS		311 Somerset St W Ottawa ON ***Well ID:*** 7382859	E/219.4	-1.93	272
102	EHS		172 O'Connor Ottawa ON K2P 1T5	NE/220.8	-0.93	275
103	GEN	FOSTER SPORT CENTER	305 BANK STREET OTTAWA ON K2P 1X7	SE/221.6	-0.87	275
103	GEN	FOSTER SPORT CENTER 15-418	305 BANK STREET OTTAWA ON K2P 1X7	SE/221.6	-0.87	276

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
104	GEN	BLACK PHOTO(OUT OF BUS.)	181 BANK STREET, UNITS 121-122 L'ESPLANADE OTTAWA ON K2P 1W5	N/222.5	0.07	276
104	GEN	BLACK PHOTO CORPORATION	171-181 BANK STREET, UNITS 121-122 OTTAWA ON K2P 1W5	N/222.5	0.07	276
105	GEN	PSL Mechanical	415 McLaren St Ottawa ON K2P 2C8	SSE/222.5	0.07	277
106	SCT	CDIA Report Newsletter	338 Somerset St W Unit 4 Ottawa ON K2P 0J9	ESE/224.5	-1.93	278
106	SPL	Enbridge Gas Distribution Inc.	338 Sommerset West Ottawa ON	ESE/224.5	-1.93	278
106	SCT	whatif? Technologies Inc.	338 Somerset St W Unit 3 Ottawa ON K2P 0J9	ESE/224.5	-1.93	279
106	HINC		338 SOMERSET STREET WEST OTTAWA ON	ESE/224.5	-1.93	279
106	EHS		338 Somerset Street West Ottawa Ontario Ottawa ON K2P 0J9	ESE/224.5	-1.93	279
107	CA	QUADRELLE MANAGEMENT LTD.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	280
107	SPL	PRIVATE BUSINESS	340 LAURIER AVE (N.O.S.) OTTAWA CITY ON	WNW/224.8	-0.93	280
107	GEN	JER OTTAWA ULC	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	281
107	GEN	JER OTTAWA ULC	340 LAURIER AVENUE WEST SIR WILFRID LAURIER BUILDING OTTAWA ON K1A 0P9	WNW/224.8	-0.93	282
107	GEN	OTTAWA 340 LAURIER AVENUE WEST INC.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW/224.8	-0.93	283

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
107	GEN	Public Works and Government Services Canada	340 Laurier Street Ottawa ON K1P 5K3	WNW/224.8	-0.93	284
107	EHS		340 Laurier Avenue West Ottawa ON K1A 0P9	WNW/224.8	-0.93	285
107	EHS		340 Laurier Avenue Ottawa ON	WNW/224.8	-0.93	285
107	GEN	Public Works and Government Services Canada	340 Laurier Street Ottawa ON	WNW/224.8	-0.93	285
107	EASR	OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW/224.8	-0.93	286
107	NPRI	O&Y ENTERPRISE	340 LAURIER Avenue West OTTAWA ON K1A0P8	WNW/224.8	-0.93	286
107	EASR	OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW/224.8	-0.93	287
107	GEN	Starlight Investments	340 Laurier Ave West Ottawa ON K1A 0P9	WNW/224.8	-0.93	288
107	GEN	TNC 340 Laurier Ltd.	340 Laurier Ave West ottawa ON K1A 0P8	WNW/224.8	-0.93	288
107	GEN	TNC 340 Laurier Ltd	340 Laurier Ottawa ON K1A 0P9	WNW/224.8	-0.93	289
107	GEN	Epic Realty Partners	340 Laurier Ave. Ottawa ON K1P 5K3	WNW/224.8	-0.93	290
107	GEN	Demo Core	340 Laurier Ave. Ottawa ON K1A 0P9	WNW/224.8	-0.93	290
107	GEN	340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW/224.8	-0.93	292

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
107	GEN	340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW/224.8	-0.93	292
108	SPL	DARLING INTERNATIONAL CANADA INC.	OTTAWA ON	NNE/225.7	-0.93	293
109	CA	OTTAWA CITY - SOMERSET ST.	O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON	NE/225.9	-1.21	294
110	EHS		311 Somerset Street West Ottawa ON K2P 0J8	E/226.5	-1.93	294
111	NPCB	OLYMPIA & YORK DEVELOPMENTS LTD.	L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW/227.7	0.07	294
111	NPCB	ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL II BANK STREET LEVEL II OTTAWA ON	NNW/227.7	0.07	295
111	EHS		171 Bank St Ottawa ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	CAMPBELL AND KENNEDY ELECTRIC LTD.	M2-171 BANK ST. OTTAWA ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	O & Y PROPERTIES INC.	171 BANK STREET L'ESPLANADE LAURIER OTTAWA ON K2P 1W5	NNW/227.7	0.07	295
111	GEN	O & Y PROPERTIES INC.	L'ESPLANADE LAURIER 171 BANK STREET OTTAWA ON K2P 1W5	NNW/227.7	0.07	296
111	GEN	ROSTRUST INVESTMENTS INC.	171 BANK STREET (L'ESPLANADE LAURIER) OTTAWA ON K2P 1W5	NNW/227.7	0.07	296
111	NPCB	ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL 2 L'Esplanade Laurier Ottawa ON K2P 1W5	NNW/227.7	0.07	297

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
111	NPCB	ROSTRUST INVESTMENTS INC.	L'ESPLANADE LAURIER 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW/227.7	0.07	298
112	PES	SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW/228.1	-0.96	299
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	300
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	300
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	301
112	PES	SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW/228.1	-0.96	301
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	301
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	302
112	GEN	B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW/228.1	-0.96	302
113	EHS		326 Somerset St W Ottawa ON K2P0J9	ESE/228.4	-1.93	306
113	GEN	EnviroCentre	326 Somerset St. West Ottawa ON K2P 0J9	ESE/228.4	-1.93	306
114	EHS		234 O'connor St Ottawa ON K2P1T9	E/228.5	-1.93	307
115	PRT	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW/230.4	1.07	308

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
115	EHS		443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	308
115	FSTH	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW/230.4	1.07	308
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	308
115	RSC	Avraham Holdings Inc.	443 SOMERSET ST W ON OTTAWA ON	SSW/230.4	1.07	309
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	309
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	310
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	310
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON	SSW/230.4	1.07	310
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	311
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	311
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	311
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	312
115	GEN	Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW/230.4	1.07	312

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
115	EXP	BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON	SSW/230.4	1.07	314
116	WWIS		154 O'CONNOR ST Ottawa ON ***Well ID:*** 7139448	NNE/230.9	-0.93	314
117	WWIS		429 MC LEARN OTTAWA ON ***Well ID:*** 7233875	S/231.1	0.07	327
118	WWIS		KENT ST Ottawa ON ***Well ID:*** 7344660	SSW/232.5	1.07	330
119	SPL	UNKNOWN	SOMERSET AND KENT STREET OTTAWA CITY ON	SSW/233.0	1.07	332
119	CA	CLARIDGE HOMES (SOMERSET) INC.	SOMERSET ST.W./KENT ST. OTTAWA CITY ON	SSW/233.0	1.07	333
120	SPL	PRIVATE OWNER	220 KENT ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W/233.3	-0.93	333
121	WWIS		311 SONERSET Ottawa ON ***Well ID:*** 7391115	E/233.5	-1.93	334
122	WWIS		ON ***Well ID:*** 7391814	NE/234.0	-1.21	338
123	GEN	HEALTH AND WELFARE CANADA	HEALTH UNIT#28, 10TH FL., WEST TOWER 300 LAURIER AVE. WEST (TBC) OTTAWA ON K1A 0R5	N/234.2	0.07	339
123	GEN	GVT OF CAN-HEALTH&WELFARE CAN.MED. 16-304	SER.BR,UNIT#28,10TH FL. W. TOWER 300 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1A 0L3	N/234.2	0.07	339
123	GEN	HEALTH AND WELFARE CANADA	300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT #28, 10TH FLOOR WEST TOWER OTTAWA ON K1A 0R5	N/234.2	0.07	339
123	GEN	GVT. OF CAN.-SUPPLY AND SERVICES	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W	N/234.2	0.07	340

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			OTTAWA ON K1A 0M7			
123	GEN	GVT. OF CAN.(OUT OF BUS) 18-208	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N/234.2	0.07	340
123	GEN	GVT. OF CAN.(OUT OF BUSINESS)	OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N/234.2	0.07	341
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	341
123	SPL		in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON	N/234.2	0.07	342
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	343
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	344
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	345
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	347
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N/234.2	0.07	348
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	349
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	351
123	GEN	Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N/234.2	0.07	352

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
123	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	353
123	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	355
123	GEN	Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	356
123	GEN	Public Services & Procurement Canada	300 Laurier Ave Ottawa ON K0A 0S5	N/234.2	0.07	358
123	FRST		300 Laurier Avenue Ottawa ON	N/234.2	0.07	364
124	SPL	SHELL CANADA PRODUCTS LTD.	154 O'CONNER STREET SERVICE STATION OTTAWA CITY ON	NNE/234.3	-0.93	371
124	SPL	SHELL CANADA PRODUCTS LTD.	154 O'CONNOR ST. SHELL CANADA GAS STATION SERVICE STATION OTTAWA CITY ON K2P 1T5	NNE/234.3	-0.93	371
124	PRT	BYTOWN TOWING & AUTOCARE LTD	154 O CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	372
124	FSTH	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	373
124	FSTH	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	373
124	EHS		154 O'Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	374
124	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	374
124	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	374

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
124	GEN	Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	375
124	GEN	Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE/234.3	-0.93	375
124	DTNK	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE/234.3	-0.93	376
124	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	377
124	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	377
124	EXP	BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE/234.3	-0.93	377
125	EHS		324 Somerset Street West Ottawa ON K2P 0J9	ESE/235.6	-1.93	377
126	WWIS		311 Somerset St W Ottawa ON ***Well ID:*** 7382782	E/235.7	-1.93	378
127	HINC		322 SOMERSET STREET WEST OTTAWA ON	ESE/235.7	-1.93	381
128	WWIS		19 MCLAREN ON ***Well ID:*** 7233876	S/235.9	0.07	381
129	WWIS		KENT ST Ottawa ON ***Well ID:*** 7344655	SSW/236.3	1.07	385
130	WWIS		ON ***Well ID:*** 7211110	E/237.3	-1.93	386
131	EHS		335 Cooper Street Ottawa ON K2P 0G5	ENE/238.3	-1.93	388

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
132	WWIS		KENT ST Ottawa ON ***Well ID:*** 7344659	W/238.7	-1.23	388
133	WWIS		311 SOMERSET Ottawa ON ***Well ID:*** 7391112	E/240.2	-1.93	390
134	EHS		340 Cooper street Ottawa ON Ottawa ON K2P 0G7	E/241.2	-1.93	394
135	EHS		171 Bank Street Ottawa ON K2P 1W5	N/242.8	0.07	394
136	EHS		340 Laurier Ave W Ottawa ON K1P 5K3	NW/243.2	-0.93	394
137	RSC	Ambassador-Mondrian Inc.	324 LAURIER AVE W ON OTTAWA ON	NW/244.0	-0.96	395
138	BORE		ON	SSW/245.2	1.07	395
139	WWIS		ON ***Well ID:*** 7211109	SSW/245.6	1.07	396
140	EHS		257 Lisgar Street Ottawa ON K2P 0C7	ENE/246.0	-1.93	398
140	GEN	Taggart Corporation Ltd.	257 Lisgar Street Otawa ON K2P 0C7	ENE/246.0	-1.93	399
140	GEN	Taggart Group Ltd	257 Lisgar St Ottawa ON K2P1P0	ENE/246.0	-1.93	399
141	EHS		341 Maclaren St Ottawa ON K2P2E2	ESE/246.3	-1.95	400
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401
142	CA	Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE/246.4	-1.93	401
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ENE/246.4	-1.93	401
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE/246.4	-1.93	402
142	ECA	South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE/246.4	-1.93	402
142	SPL	Enbridge Gas Distribution Inc.	331 Cooper St. Ottawa ON	ENE/246.4	-1.93	402
142	PINC	PIPELINE HIT 1"	331 COOPER ST,,OTTAWA,ON,K2P 0G5, CA ON	ENE/246.4	-1.93	403
143	EHS		441 MACLAREN STREET OTTAWA ON K2P 2H3	S/246.7	0.07	404
143	EHS		441 MacLaren Ottawa ON	S/246.7	0.07	404
143	GEN	Dental Anaesthesia Group	441 MacLaren Street Suite 370 Ottawa ON	S/246.7	0.07	404
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	404
143	GEN	Elevation Elevator Inc.	441 MacLaren Ottawa ON K2P 2R2	S/246.7	0.07	405
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
143	GEN	Dental Anaesthesia Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	406
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	407
143	GEN	Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S/246.7	0.07	408
144	EHS		447 Somerset Street West Ottawa ON K1R 5J7	SW/246.7	1.07	409
145	PRT	I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON K2P2K8	WNW/248.0	-2.08	409
145	DTNK	I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON	WNW/248.0	-2.08	409
145	SPL	Kent Towers<UNOFFICIAL>	199 Kent st Ottawa ON	WNW/248.0	-2.08	410
146	EHS		360 Laurier Ave West Ottawa ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	HEALTH AND WELFARE CANADA	HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	GVT OF CAN-HEALTH&WELFARE CAN.MED. 16-305	SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8	WNW/248.1	-0.87	411
146	GEN	HEALTH AND WELFARE CANADA	360 LAURIER AVE. WEST (HWC) HEALTH UNIT #31, 2ND FLOOR, NORONO BLDG. OTTAWA ON K1P 5K3	WNW/248.1	-0.87	412

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
146	EHS		360 Laurier Avenue West Ottawa ON K1P 1C8	WNW/248.1	-0.87	412
146	EBR	360 Laurier Avenue West Limited	360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA ON	WNW/248.1	-0.87	412
146	CA	360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON	WNW/248.1	-0.87	413
146	ECA	360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON K1P 6E2	WNW/248.1	-0.87	413
146	EHS		360 Laurier Avenue West Ottawa ON K1P 1C8	WNW/248.1	-0.87	413
146	EHS		360 Laurier Ave W Ottawa ON K1P1C8	WNW/248.1	-0.87	414
146	RSC	OTT A360 LAURIER INC.	360 Laurier AVE W Ottawa ON	WNW/248.1	-0.87	414
147	SPL	PRIVATE OWNER	280 GLOUCESTER ST(ST. PATRICK CHURCH) STORAGE TANK/BARREL OTTAWA CITY ON K1R 5E4	W/248.2	-0.93	414
148	GEN	2732685 Ontario Inc.	429 MacLaren Street Ottawa ON K2P 0M7	S/248.2	0.07	415
149	PINC	KEN RALPH	231 O'CONNOR ST,,OTTAWA,ON,K2P 1T8,CA ON	E/248.4	-1.93	416
150	EHS		447 Somerset Street West Ottawa ON K1R 5J7	SW/248.5	1.07	416
150	EHS		447 Somerset Street West Ottawa ON Ottawa ON K1R 5J7	SW/248.5	1.07	416
151	INC		384 MacLaren Street, Ottawa ON	SE/248.9	-0.93	417

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
151	SPL	Enbridge Gas Distribution Inc.	384 MacLaren St Ottawa ON K2P 0M8	SE/248.9	-0.93	417
152	SCT	Soundmaster Ltd.	386 MacLaren St Ottawa ON K2P 0M8	SE/249.4	-0.93	418

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 5 BORE site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	ON	WSW	139.15	48
	ON	NW	145.36	52
	ON	SW	154.89	56
	ON	SSW	245.23	138

Lower Elevation	Address	Direction	Distance (m)	Map Key
	ON	E	97.49	19

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 12 CA site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON	N	125.87	36
CLARIDGE HOMES (SOMERSET) INC.	SOMERSET ST.W./KENT ST. OTTAWA CITY ON	SSW	232.98	119

Lower Elevation	Address	Direction	Distance (m)	Map Key
R.M. OF OTTAWA-CARLETON	COOPER ST./BANK ST. OTTAWA CITY ON	ESE	75.12	12
OTTAWA CITY	COOPER ST./BANK ST. OTTAWA CITY ON	ESE	75.12	12
ALLAN KWAI	331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	E	186.26	82
Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE	197.37	92
QUADRELLE MANAGEMENT LTD.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
OTTAWA CITY - SOMERSET ST.	O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON	NE	225.88	109
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
Tartan Land Corporation	331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	ENE	246.38	142
360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON	WNW	248.07	146

CDRY - Dry Cleaning Facilities

A search of the CDRY database, dated Jan 2004-Dec 2022 has found that there are 2 CDRY site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key

Downtown Cobler	272 Bank St Ottawa ON K2P1X6	SE	92.70	17
Draicchio's Tailoring&Cleaning	272 Bank St Ottawa ON K2P1X6	SE	92.70	17

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 7 DTNK site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
SAVEWAY GAS & FUELS LTD	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW	188.98	86
MARK TAZA	429 SOMERSET ST W OTTAWA ON K2P 0K1	SSW	188.98	86

Lower Elevation	Address	Direction	Distance (m)	Map Key
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124
I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON	WNW	247.96	145

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011-Oct 31, 2024 has found that there are 2 EASR site(s) within approximately 0.25

kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW	224.75	107
OTTAWA - 340 LAURIER WEST INC	340 LAURIER AVENUE WEST OTTAWA ON K1N 0P9	WNW	224.75	107

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Nov 30, 2024 has found that there are 1 EBR site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
360 Laurier Avenue West Limited	360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA ON	WNW	248.07	146

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Oct 31, 2024 has found that there are 8 ECA site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Mel Cohen Realty Ltd.	177 Nepean Street Ottawa ON K1Y 2E9	N	125.87	36

Lower Elevation	Address	Direction	Distance (m)	Map Key
City of Ottawa	Laurier Avenue at the Rideau Canal Ottawa ON K1P 1J1	ENE	160.00	64
City of Ottawa	Ottawa ON K2G 6J8	ENE	160.00	64
Bank and Somerset Holdings Limited	296 Bank Street Ottawa ON K2P 1X8	SE	197.37	92
South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE	246.38	142

South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON	ENE	246.38	142
South Nepean Development Corporation	331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ENE	246.38	142
360 Laurier Avenue West Limited	360 Laurier Ave W Ottawa ON K1P 6E2	WNW	248.07	146

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 73 EHS site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	240 Bank Street Ottawa ON K2P 1X4	-	0.00	1
	222 Nepean Street Ottawa ON K2P 0B8	WNW	73.58	11
	437 Cooper Street Ottawa ON K2P 0H1	SW	92.71	18
	226 Nepean St Ottawa ON K2P0B8	W	116.20	27

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	205 Bank Street Ottawa ON K2P 1W7	NNW	121.21	32
	203 Bank St Ottawa ON K2P1W7	N	124.52	34
	215 Nepean St Ottawa ON K2P2K5	WNW	125.74	35
	400 Cooper Street Ottawa ON K2P 2H8	S	131.07	40
	400 Cooper Street, Ottawa ON K2P 2H8	S	131.07	40
	400 Cooper Street Ottawa ON K2P 2N1	S	131.07	40
	400 Cooper Street Ottawa ON K2P 2N1	S	131.07	40
	453 Cooper Street Ottawa ON K2P 0H1	SW	142.54	49
	170 Gloucester Street Ottawa ON K2P 0A6	N	168.26	72
	176 Gloucester St Ottawa ON K2P0A6	NNW	172.42	75
	281 Kent Street Ottawa ON K2P 2H8	SW	177.21	78
	171 Bank St Ottawa ON K2P 1W5	NNW	227.71	111

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
	171 Bank Street Ottawa ON K2P 1W5	N	242.79	135
	441 MACLAREN STREET OTTAWA ON K2P 2H3	S	246.68	143
	441 MacLaren Ottawa ON	S	246.68	143
	447 Somerset Street West Ottawa ON K1R 5J7	SW	246.72	144
	447 Somerset Street West Ottawa ON K1R 5J7	SW	248.49	150
	447 Somerset Street West Ottawa ON Ottawa ON K1R 5J7	SW	248.49	150

Lower Elevation	Address	Direction	Distance (m)	Map Key
	251 Bank Street Ottawa ON K2P 1X3	ESE	49.42	4
	251-259 Bank Street (395-397 Cooper St) Ottawa ON	ESE	67.86	9
	251 Bank Street Ottawa ON	ESE	67.86	9
	251 Bank St Ottawa ON K2P1X3	ESE	67.86	9

178 Nepean, 219 & 223 Bank Ottawa ON K2P 1W9	N	85.69	15
300 Lisgar Street Ottawa ON K2P 0E2	ENE	85.78	16
379 Cooper Street Ottawa ON K2P 0G8	E	110.11	24
379 Cooper Street Ottawa ON K2P 0G8	E	110.11	24
309 Lisgar Avenue Ottawa ON	NE	110.33	25
300 Lisgar St and 375 Cooper St Ottawa ON	ENE	118.60	28
177 Nepean St Ottawa ON K2P 1W7	N	120.82	30
PE3651 - 293 Lisgar Street & 176 Nepean Street Ottawa ON K2P 0B6	NE	121.06	31
275 Bank St Ottawa ON K2P2L6	ESE	127.25	38
275 Bank Street Ottawa ON K2P 2L6	SE	133.18	43
375 Cooper Street Ottawa ON K2P 0G8	E	134.34	46
153 Nepean Street Ottawa ON K2P 0B5	NNE	156.35	58

287 Lisgar Street Ottawa ON	NE	157.60	62
Nepean Street Ottawa ON K2P 0B6	NE	164.45	66
343 Somerset Street West Ottawa ON	ESE	168.15	71
355 Cooper St Ottawa ON K2P0G8	ENE	168.30	73
PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9	SE	174.97	76
352/348/346 Somerset & 349 MacLaren Ottawa ON	ESE	182.08	81
186 Bank St Ottawa ON K2P1W6	NW	193.51	88
230 Gloucester St Ottawa ON K2P0A9	WNW	194.61	89
327 Somerset St W Ottawa ON K2P0J8	E	195.00	90
296 Bank St Ottawa ON K2P1X8	SE	197.37	92
380 &386 Somerset St W/296 Bank St Ottawa ON	SE	197.97	93
380 Somerset St W Ottawa ON K2P2R2	SE	197.97	93
190 O'connor St Ottawa ON K2P2R3	NE	199.67	94

172 O'Connor Ottawa ON K2P 1T5	NE	220.76	102
338 Somerset Street West Ottawa Ontario Ottawa ON K2P 0J9	ESE	224.49	106
340 Laurier Avenue West Ottawa ON K1A 0P9	WNW	224.75	107
340 Laurier Avenue Ottawa ON	WNW	224.75	107
311 Somerset Street West Ottawa ON K2P 0J8	E	226.54	110
326 Somerset St W Ottawa ON K2P0J9	ESE	228.37	113
234 O'connor St Ottawa ON K2P1T9	E	228.52	114
154 O'Connor Street Ottawa ON K2P 1T5	NNE	234.32	124
324 Somerset Street West Ottawa ON K2P 0J9	ESE	235.60	125
335 Cooper Street Ottawa ON K2P 0G5	ENE	238.27	131
340 Cooper street Ottawa ON Ottawa ON K2P 0G7	E	241.18	134
340 Laurier Ave W Ottawa ON K1P 5K3	NW	243.22	136

257 Lisgar Street Ottawa ON K2P 0C7	ENE	245.96	140
341 Maclaren St Ottawa ON K2P2E2	ESE	246.33	141
360 Laurier Ave West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Avenue West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Avenue West Ottawa ON K1P 1C8	WNW	248.07	146
360 Laurier Ave W Ottawa ON K1P1C8	WNW	248.07	146

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 6 EXP site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
MARK TAZA	429 SOMERSET ST W OTTAWA ON	SSW	188.98	86
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON	SSW	230.45	115

Lower Elevation	Address	Direction	Distance (m)	Map Key
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124

BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124

FRST - Federal Identification Registry for Storage Tank Systems (FIRSTS)

A search of the FRST database, dated Oct 31, 2021 has found that there are 1 FRST site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	300 Laurier Avenue Ottawa ON	N	234.18	123

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 3 FSTH site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW	230.45	115

Lower Elevation	Address	Direction	Distance (m)	Map Key
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124
BYTOWN TOWING & AUTOCARE LTD	154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	NNE	234.32	124

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Nov 30, 2022 has found that there are 187 GEN site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Al's Care Pharmacy	240 Bank Street Ottawa ON K2P1X4	-	0.00	1
REVENUE CANADA TAXATION	CUSTOMS & EXCISE 360 LISGAR STREET OTTAWA ON K2P 2E4	WSW	47.64	3
REVENUE CANADA TAXATION	360 LISGAR STREET OTTAWA ON K1A 0L9	WSW	47.64	3
URBANDALE CORPORATION	360 Lisgar Street Ottawa ON	WSW	47.64	3
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	3
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	3
BELLCANADA	360 LISGAR STREET OTTAWA ON K2P 2E4	WSW	47.64	3
Bell Canada	360 Lisgar st Ottawa ON K2P 2E4	WSW	47.64	3
BICYCLE REVIVAL LTD.	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	6
BICYCLE REVIVAL LTD. 04-341	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	6
BICYCLE REVIVAL LIMITED	224 BANK STREET OTTAWA ON K2P 1X1	NNW	57.88	6
DEPARTMENT OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	11

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
DEPT OF NATIONAL DEFENCE, CDN. FORCES	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	11
DEPT. OF NATIONAL DEFENCE	VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	WNW	73.58	11
Bona Building Management	222 Nepean St Ottawa ON K1R5G2	WNW	73.58	11
BAYVIEW PROPERTY MANAGEMENT	210 BANK STREET OTTAWA ON K2P 1W8	NW	114.93	26
District Realty Corporation	177 Nepean Street Ottawa ON K2P 0B4	N	125.87	36
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
Centretown Community Health Centre Inc.	420 Cooper Street Ottawa ON K2P 2N6	S	127.54	39
GVT. OF CAN. - R.C.M.P.	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S	131.07	40
GVT. OF CAN. - R.C.M.P. 18-132	OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	S	131.07	40
400 Cooper Building Inc.	400 Cooper Street Ottawa ON K2P 2H8	S	131.07	40
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	45
Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE	134.29	45
Dedicated National Pharmacy (In Receivership)	401 Somerset St West Ottawa ON K2P 0K1	SSE	134.29	45
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	45

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P 0K1	SSE	134.29	45
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON	SSE	134.29	45
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
Ontario Addiction Treatment Centres	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
Canadian Addiction Treatment Clinics LP	401 Somerset Street, West Ottawa ON K2P0K1	SSE	134.29	45
AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	49
AULT FOODS LIMITED	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	49
AULT FOODS LIMITE(OUT OF BUSINESS)03-320	453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	49

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
OTTAWA COMMUNITY HOUSING CORPORATION	395 SOMERSET STREET OTTAWA ON	S	146.26	54
Black & McDonald Ltd.	395 Somerset Ottawa ON K2L 4X8	S	146.26	54
OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
OTTAWA MAGAZINE INC.	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
OTTAWA MAGAZINE INC. 29-278	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
OTTAWA MAGAZINE INCORPORATED	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
OTTAWA(SEE&USE ON0897800 OTTAWA)	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290	192 BANK STREET OTTAWA ON K2P 1W8	NW	154.93	57
MCEVOY-SHIELDS FUNERAL HOMES LTD.	235 KENT STREET OTTAWA ON K2P 1Z9	W	157.45	61
MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472	235 KENT STREET OTTAWA ON K2P 1Z9	W	157.45	61
Service Corporation International Canada	235 Kent Street Ottawa ON K2P 1Z9	W	157.45	61
Charlesfort Development Corporation	235 Kent Street Ottawa ON K2P 1Z9	W	157.45	61

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
HUDSON PARK CONDOS	245 KENT STREET OTTAWA ON K2P 0A5	W	176.64	77
CLARRIDGE HOMES	419-429 SOMERSET STREET OTTAWA ON K2P 2P5	SSW	188.98	86
Clarridge Homes	419-429 SOMERSET ST. OTTAWA ON K1N 6W8	SSW	188.98	86
BLACK PHOTO(OUT OF BUS.)	181 BANK STREET, UNITS 121-122 L'ESPLANADE OTTAWA ON K2P 1W5	N	222.50	104
BLACK PHOTO CORPORATION	171-181 BANK STREET, UNITS 121-122 OTTAWA ON K2P 1W5	N	222.50	104
PSL Mechanical	415 McLaren St Ottawa ON K2P 2C8	SSE	222.55	105
CAMPBELL AND KENNEDY ELECTRIC LTD.	M2-171 BANK ST. OTTAWA ON K2P 1W5	NNW	227.71	111
O & Y PROPERTIES INC.	171 BANK STREET L'ESPLANADE LAURIER OTTAWA ON K2P 1W5	NNW	227.71	111
O & Y PROPERTIES INC.	L'ESPLANADE LAURIER 171 BANK STREET OTTAWA ON K2P 1W5	NNW	227.71	111
ROSTRUST INVESTMENTS INC.	171 BANK STREET (L'ESPLANADE LAURIER) OTTAWA ON K2P 1W5	NNW	227.71	111
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
Budget Car Inc	443 Somerset St. West Ottawa ON K1R 5J7	SSW	230.45	115
HEALTH AND WELFARE CANADA	HEALTH UNIT#28, 10TH FL., WEST TOWER 300 LAURIER AVE. WEST (TBC) OTTAWA ON K1A 0R5	N	234.18	123
GVT OF CAN-HEALTH&WELFARE CAN.MED. 16-304	SER.BR,UNIT#28,10TH FL. W. TOWER 300 LAURIER AVE. WEST, C/O 301 ELGIN ST OTTAWA ON K1A 0L3	N	234.18	123
HEALTH AND WELFARE CANADA	300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT #28, 10TH FLOOR WEST TOWER	N	234.18	123

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	OTTAWA ON K1A 0R5			
GVT. OF CAN.-SUPPLY AND SERVICES	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	123
GVT. OF CAN.(OUT OF BUS) 18-208	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	123
GVT. OF CAN.(OUT OF BUSINESS)	OLYMPIA PRINTING PLANT,LEVEL P1,W.TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W OTTAWA ON K1A 0M7	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	123

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	123
Public Works and Government Services Canada	300 Laurier Ave Ottawa ON K0A0S5	N	234.18	123
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Public Services & Procurement Canada RPB	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Public Services & Procurement Canada	300 Laurier Ave Ottawa ON K0A 0S5	N	234.18	123
Dental Anaesthesia Group	441 MacLaren Street Suite 370 Ottawa ON	S	246.68	143
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143
Elevation Elevator Inc.	441 MacLaren Ottawa ON K2P 2R2	S	246.68	143
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Sedation Dental Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143
Dental Anaesthesia Group	Suite 370 441 MacLaren St Ottawa ON K2P 2H3	S	246.68	143
2732685 Ontario Inc.	429 MacLaren Street Ottawa ON K2P 0M7	S	248.25	148

Lower Elevation	Address	Direction	Distance (m)	Map Key
J Levinston Holding	212 - 232 Bank st. Ottawa ON K2P 1X1	N	30.51	2
FOCUS CENTRE, THE	254 BANK STREET OTTAWA ON K2P 1X4	SE	59.17	7
Easy Drain Plumbing	254 Bank Str Ottawa ON	SE	59.17	7
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17
DRAICCHIO'S TAILORING & CLEANING 12-549	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17
DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17

DRAICCHIO'S TAILORING & CLEANING	272 BANK STREET OTTAWA ON K2P 1X6	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	17
7695713 canada inc.	272 BANK ST OTTAWA ON K2P1X6	SE	92.70	17
DOWNTOWN COBBLER DOWNTOWN COBBLER	272 BANK ST OTTAWA ON k2p1x6	SE	92.70	17
Downtown Tailoring	272 BANK ST OTTAWA ON K2P 1X6	SE	92.70	17
Canus Plastics Inc.	300 Lisgar St. Ottawa ON	ENE	104.97	21
Bassi Construction	300 lisgar st ottawa ON K2P 0E2	ENE	104.97	21

GLASER PHARMACY LTD.	267 BANK STREET OTTAWA ON K2P 1X3	ESE	105.36	22
COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
COOPER PHARMACY INC	276 BANK ST OTTAWA ON K2P 1X6	SE	107.56	23
E.A.S. ILLUSTRATORS & PRINTERS LTD	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
E.A.S. ILLUSTRATORS & PRINTERS LTD14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
E.A.S. (OUT OF BUS) 14-740	171 NEPEAN ST. OTTAWA ON K2P 0B4	N	131.90	41
ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N	131.90	41
ARMCO PRINT 02-638	171 NEPEAN STREET OTTAWA ON K2P 0B4	N	131.90	41
Claridge Homes Corporation	287 Lisgar Ottawa ON	NE	157.60	63
CLARIDGE HOMES (CENTRETOWN) INC.	287 LISGAR STREET OTTAWA ON	NE	157.60	63
Claridge Homes Limited Partnership	287 Lisgar Street Ottawa ON K2P 0E1	NE	157.60	63
Claridge Homes	287 Lisgar Street Ottawa ON K2P 0E1	NE	157.60	63

City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa Parks, Bldg & Grounds Services Branch	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
City of Ottawa	210 Gloucester Ottawa ON K2P 2K4	NW	167.04	69
Marilena Guerra	146 Nepean Street Ottawa ON	NE	168.08	70
Regional Group	152 Gloucester St Ottawa ON K2P 0A6	NNE	179.80	79
Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
Loblaw Companies Limited	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92

LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
LOBLAWS INC.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
DUFRESNE PILING COMPANY (1967) LTD.	380 SOMERSET STREET WEST OTTAWA ON K2P 2R2	SE	197.97	93
GVT. OF CAN. - NATIONAL DEFENCE	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE	199.67	94
GVT. OF CAN. - NATIONAL DEFENCE	190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	NE	199.67	94
GVT. OF CAN. - NATIONAL DEFENCE 18-192	CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	NE	199.67	94
DEPT. OF NATIONAL DEFENCE	DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	NE	199.67	94
FOSTER SPORT CENTER	305 BANK STREET OTTAWA ON K2P 1X7	SE	221.56	103
FOSTER SPORT CENTER 15-418	305 BANK STREET OTTAWA ON K2P 1X7	SE	221.56	103
Starlight Investments	340 Laurier Ave West Ottawa ON K1A 0P9	WNW	224.75	107
TNC 340 Laurier Ltd.	340 Laurier Ave West ottawa ON K1A 0P8	WNW	224.75	107

TNC 340 Laurier Ltd	340 Laurier Ottawa ON K1A 0P9	WNW	224.75	107
Epic Realty Partners	340 Laurier Ave. Ottawa ON K1P 5K3	WNW	224.75	107
Demo Core	340 Laurier Ave. Ottawa ON K1A 0P9	WNW	224.75	107
340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW	224.75	107
340 TNC Laurier Ltd.	340 Laurier Avenue Ottawa ON K1A 0P9	WNW	224.75	107
JER OTTAWA ULC	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
JER OTTAWA ULC	340 LAURIER AVENUE WEST SIR WILFRID LAURIER BUILDING OTTAWA ON K1A 0P9	WNW	224.75	107
OTTAWA 340 LAURIER AVENUE WEST INC.	340 LAURIER AVENUE WEST OTTAWA ON K1A 0P9	WNW	224.75	107
Public Works and Government Services Canada	340 Laurier Street Ottawa ON K1P 5K3	WNW	224.75	107
Public Works and Government Services Canada	340 Laurier Street Ottawa ON	WNW	224.75	107
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112

B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
B. Surani Drugs Ltd. (910)	174 BANK ST OTTAWA ON K1P 5N7	NW	228.14	112
EnviroCentre	326 Somerset St. West Ottawa ON K2P 0J9	ESE	228.37	113
Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE	234.32	124
Shell Canada Products	154 O+Connor Street Ottawa ON K2P 1T5	NNE	234.32	124
Taggart Corporation Ltd.	257 Lisgar Street Otawa ON K2P 0C7	ENE	245.96	140
Taggart Group Ltd	257 Lisgar St Ottawa ON K2P1P0	ENE	245.96	140
HEALTH AND WELFARE CANADA	HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8	WNW	248.07	146
GVT OF CAN-HEALTH&WELFARE CAN.MED. 16-305	SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8	WNW	248.07	146
HEALTH AND WELFARE CANADA	360 LAURIER AVE. WEST (HWC) HEALTH UNIT #31, 2ND FLOOR, NORONO BLDG. OTTAWA ON K1P 5K3	WNW	248.07	146

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 2 HINC site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
	338 SOMERSET STREET WEST OTTAWA ON	ESE	224.49	106
	322 SOMERSET STREET WEST OTTAWA ON	ESE	235.67	127

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 2 INC site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	212 Bank Street , Ottawa ON	NNW	71.10	10

Lower Elevation	Address	Direction	Distance (m)	Map Key
	384 MacLaren Street, Ottawa ON	SE	248.87	151

NPCB - National PCB Inventory

A search of the NPCB database, dated 1988-2008* has found that there are 5 NPCB site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
SEALTEST	DIVISION OF AULT FOODS; 453 COOPER STREET OTTAWA ON K2P 0H1	SW	142.54	49
OLYMPIA & YORK DEVELOPMENTS LTD.	L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW	227.71	111
ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL II BANK STREET LEVEL II OTTAWA ON	NNW	227.71	111

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
ROSTRUST INVESTMENTS INC.	171 BANK STREET LEVEL 2 L'Esplanade Laurier Ottawa ON K2P 1W5	NNW	227.71	111
ROSTRUST INVESTMENTS INC.	L'ESPLANADE LAURIER 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5	NNW	227.71	111

NPRI - National Pollutant Release Inventory - Historic

A search of the NPRI database, dated 1993-May 2017 has found that there are 1 NPRI site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
O&Y ENTERPRISE	340 LAURIER Avenue West OTTAWA ON K1A0P8	WNW	224.75	107

OOGW - Ontario Oil and Gas Wells

A search of the OOGW database, dated 1800-Aug 2024 has found that there are 1 OOGW site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
Ottawa Dairy Well	Nepean ON ***Licence No:*** F019784	SE	157.14	60

PES - Pesticide Register

A search of the PES database, dated Oct 2011-Oct 31, 2024 has found that there are 12 PES site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92

LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK ST OTTAWA ON K2P 1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE	197.37	92
HARTMAN'S YOUR INDEPENDENT GROCER	296 BANK STREET OTTAWA ON K2P 1X8	SE	197.37	92
SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW	228.14	112
SHOPPERS DRUG MART #988	174 BANK ST OTTAWA ON K2P1W6	NW	228.14	112

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 3 PINC site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
ENBRIDGE GAS INC	142 NEPEAN ST,,OTTAWA,ON,K2P 2N2,CA ON	NE	180.40	80

PIPELINE HIT 1"	331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA ON	ENE	246.38	142
KEN RALPH	231 O'CONNOR ST,,OTTAWA,ON, K2P 1T8,CA ON	E	248.42	149

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 4 PRT site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
SOMERSET SUNOCO	429 SOMERSET ST OTTAWA ON K2P0K1	SSW	188.98	86
BUDGET CAR & TRUCK RENTALS OF OTTAWA	443 SOMERSET ST W OTTAWA ON K1R 5J7	SSW	230.45	115

Lower Elevation	Address	Direction	Distance (m)	Map Key
BYTOWN TOWING & AUTOCARE LTD	154 O CONNOR ST AT GLOUCESTER OTTAWA ON	NNE	234.32	124
I C ASSALY CONSTRUCTION	199 KENT ST OTTAWA ON K2P2K8	WNW	247.96	145

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Nov 30, 2024 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

Lower Elevation	Address	Direction	Distance (m)	Map Key
Claridge Homes (287 Lisgar) Inc.	287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA ON	NE	157.60	63

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Nov 2024 has found that there are 7 RSC site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
Youth Services Bureau of Ottawa	433 COOPER ST/366 LISGAR STREET, OTTAWA OTTAWA ON	SW	77.03	13
Charlesfort Development Corporation	235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON	W	176.64	77
Avraham Holdings Inc.	443 SOMERSET ST W ON OTTAWA ON	SSW	230.45	115

Lower Elevation	Address	Direction	Distance (m)	Map Key
Soho Lisgar Inc.	300 Lisgar Street, Ottawa, Ontario, K2P 1T6 OTTAWA ON	ENE	85.78	16
CLARIDGE HOMES (287 LISGAR) INC.	287 LISGAR STREET ON Ottawa ON	NE	157.60	63
Ambassador-Mondrian Inc.	324 LAURIER AVE W ON OTTAWA ON	NW	244.03	137
OTT A360 LAURIER INC.	360 Laurier AVE W Ottawa ON	WNW	248.07	146

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 26 SCT site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
COOKWARE CENTRE (THE)	220 BANK ST OTTAWA ON K2P 1X1	NNW	59.81	8
CAPITAL XTRA INC.	177 NEPEAN ST SUITE 500 OTTAWA ON K2P 0B4	N	125.87	36
Cdn Council Tobacco Control	192 Bank St Ottawa ON K2P 1W8	NW	154.93	57

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
O'Brien Publishing Inc.	176 Gloucester St Suite 400 Ottawa ON K2P 0A6	NNW	172.42	75

Lower Elevation	Address	Direction	Distance (m)	Map Key
WALLACK'S ART & DRAFTING	231 BANK ST OTTAWA ON K2P 1W9	N	56.04	5
Akiva Publishing Inc.	251 Bank St Suite 206 Ottawa ON K2P 1X3	ESE	67.86	9
McKenzie Publishing Inc.	251A Bank St Suite 500 Ottawa ON K2P 1X3	ESE	67.86	9
Capital Xtra - Div. of Pink	251 Bank St Unit 503 Ottawa ON K2P 1X3	ESE	67.86	9
Canadian Bible Society	315 Lisgar St Ottawa ON K2P 0E1	NE	79.69	14
Canus Signs Plastics Ltd.	300 Lisgar St Ottawa ON K2P 0E2	ENE	85.78	16
Canus Plastics Inc.	300 Lisgar St Ottawa ON K2P 0E2	ENE	85.78	16
Ottawa X Press	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	33
Imagnan Corp.	396 Cooper St Suite 203 Ottawa ON K2P 2H7	ESE	122.71	33
Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	33

Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	33
The Ottawa X Press - Div. of Communications Voir Inc.	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	33
The Ottawa Xpress	396 Cooper St Suite 204 Ottawa ON K2P 2H7	ESE	122.71	33
To Be Publications Inc.	207 Bank St Ottawa ON K2P 2N2	N	137.46	47
JacintalInk	207 Bank St Suite 242 Ottawa ON K2P 2N2	N	137.46	47
Biz Point Inc.	273 Bank St Ottawa ON K2P 1X5	ESE	145.98	53
Koffman Signs Ltd.	146 Nepean St Ottawa ON K2P 0B6	NE	168.08	70
KOFFMAN SIGNS	146 NEPEAN ST OTTAWA ON K2P 0B6	NE	168.08	70
Canadian Council on Social	190 O'Connor St Suite 100 Ottawa ON K2P 2R3	NE	199.67	94
whatif? Technologies Inc.	338 Somerset St W Unit 3 Ottawa ON K2P 0J9	ESE	224.49	106
CDIA Report Newsletter	338 Somerset St W Unit 4 Ottawa ON K2P 0J9	ESE	224.49	106
Soundmaster Ltd.	386 MacLaren St Ottawa ON K2P 0M8	SE	249.40	152

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug 2024; Oct 2024 has found that there are 27 SPL site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	222 Nepean Street, Ottawa Ottawa ON	WNW	73.58	11
Enbridge Gas Distribution Inc.	Bank St and Nepean St Ottawa ON	NNW	100.12	20
PRIVATE RESIDENCE	177 NIPEON STREET FURNACE OIL TANK OTTAWA CITY ON	N	125.87	36
AULT FOODS	453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SW	142.54	49
AULT FOODS	453 COOPER STREET OTTAWA WINCHESTER 490 GORDON STREET OTTAWA CITY ON K2P 0H1	SW	142.54	49
	239 Nepean St OTTAWA ON	W	163.59	65
TRANSPORT TRUCK	KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SW	187.97	85
	290-292 Kent Street UTM Zone:18 Easting:445333.64 Northing: 5029231.41 Ottawa ON	SW	218.95	100
UNKNOWN	SOMERSET AND KENT STREET OTTAWA CITY ON	SSW	232.98	119
	in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON	N	234.18	123

Lower Elevation	Address	Direction	Distance (m)	Map Key
PRIVATE BUSINESS	232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	N	30.51	2
OTTAWA HYDRO	375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	E	134.34	46
Claridge Homes (Carson) Inc.	287 Lisgar Avenue Ottawa ON K2P 1K8	NE	157.60	63
296 Bank Street	296 Bank Street OTTAWA ON	SE	197.37	92
Parson Refrigeration (1985) Ltd.	296 Bank St Ottawa ON	SE	197.37	92
Parson Refrigeration (1985) Ltd.	296 Bank St. Ottawa ON K2P 1X8	SE	197.37	92
	296 Bank Street, Ottawa ON	SE	197.37	92
Enbridge Gas Distribution Inc.	338 Sommerset West Ottawa ON	ESE	224.49	106
PRIVATE BUSINESS	340 LAURIER AVE (N.O.S.) OTTAWA CITY ON	WNW	224.75	107
DARLING INTERNATIONAL CANADA INC.	OTTAWA ON	NNE	225.74	108
PRIVATE OWNER	220 KENT ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W	233.27	120
SHELL CANADA PRODUCTS LTD.	154 O'CONNOR ST. SHELL CANADA GAS STATION SERVICE STATION OTTAWA CITY ON K2P 1T5	NNE	234.32	124

SHELL CANADA PRODUCTS LTD.	154 O'CONNER STREET SERVICE STATION OTTAWA CITY ON	NNE	234.32	124
Enbridge Gas Distribution Inc.	331 Cooper St. Ottawa ON	ENE	246.38	142
Kent Towers<UNOFFICIAL>	199 Kent st Ottawa ON	WNW	247.96	145
PRIVATE OWNER	280 GLOUCESTER ST(ST. PATRICK CHURCH) STORAGE TANK/BARREL OTTAWA CITY ON K1R 5E4	W	248.21	147
Enbridge Gas Distribution Inc.	384 MacLaren St Ottawa ON K2P 0M8	SE	248.87	151

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 34 WWIS site(s) within approximately 0.25 kilometers of the project property.

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	195 BANK ST. OTTAWA ON ***Well ID:*** 7246053	NNW	145.09	50
	ON ***Well ID:*** 1503876	NW	145.22	51
	281 kent st Ottawa ON ***Well ID:*** 7354243	SW	167.02	68
	281 kent st Ottawa ON ***Well ID:*** 7354245	SW	187.37	84
	81 kent st Ottawa ON ***Well ID:*** 7354244	SW	195.27	91

Equal/Higher Elevation	Address	Direction	Distance (m)	Map Key
	429 MC LEARN Ottawa ON ***Well ID:*** 7233874	S	218.40	99
	429 MC LEARN OTTAWA ON ***Well ID:*** 7233875	S	231.07	117
	KENT ST Ottawa ON ***Well ID:*** 7344660	SSW	232.46	118
	19 MCLAREN ON ***Well ID:*** 7233876	S	235.93	128
	KENT ST Ottawa ON ***Well ID:*** 7344655	SSW	236.33	129
	ON ***Well ID:*** 7211109	SSW	245.64	139

Lower Elevation	Address	Direction	Distance (m)	Map Key
	ON ***Well ID:*** 7296899	NNE	120.08	29
	355 COOPER ST OTTAWA ON ***Well ID:*** 7305580	ENE	126.36	37
	355 COOPER ST OTTAWA ON ***Well ID:*** 7305582	ENE	133.08	42
	355 COOPER ST OTTAWA ON ***Well ID:*** 7305579	ENE	133.38	44
	315 COOPER ST Ottawa ON ***Well ID:*** 7312996	E	146.92	55

355 COOPER ST OTTAWA ON ***Well ID:*** 7305581	ENE	156.82	**59**
KENT ST Ottawa ON ***Well ID:*** 7344656	WSW	164.80	**67**
SOMERSET ROADWAY OTTAWA ON ***Well ID:*** 1535586	ESE	168.56	**74**
296 BANK ST. OTTAWA ON ***Well ID:*** 7246842	SE	186.43	**83**
296 BANK ST. OTTAWA ON ***Well ID:*** 7246843	SE	186.43	**83**
355 COOPER ST Ottawa ON ***Well ID:*** 7312995	ENE	189.56	**87**
338 SOMERSET STREET WEST OTTAWA ON ***Well ID:*** 7046637	ESE	206.06	**95**
154 O'CONNOR STREET Ottawa ON ***Well ID:*** 7130914	NNE	207.00	**96**
311 SOMERSET Ottawa ON ***Well ID:*** 7391114	E	210.21	**97**
311 SOMERSET Ottawa ON ***Well ID:*** 7391113	E	217.64	**98**
311 Somerset St W Ottawa ON ***Well ID:*** 7382859	E	219.40	**101**
154 O'CONNOR ST Ottawa ON ***Well ID:*** 7139448	NNE	230.88	**116**
311 SONERSET Ottawa ON	E	233.51	**121**

Well ID: 7391115

ON	NE	234.03	**122**

Well ID: 7391814

311 Somerset St W Ottawa ON	E	235.66	**126**

Well ID: 7382782

ON	E	237.32	**130**

Well ID: 7211110

KENT ST Ottawa ON	W	238.72	**132**

Well ID: 7344659

311 SOMERSET Ottawa ON	E	240.21	**133**

Well ID: 7391112

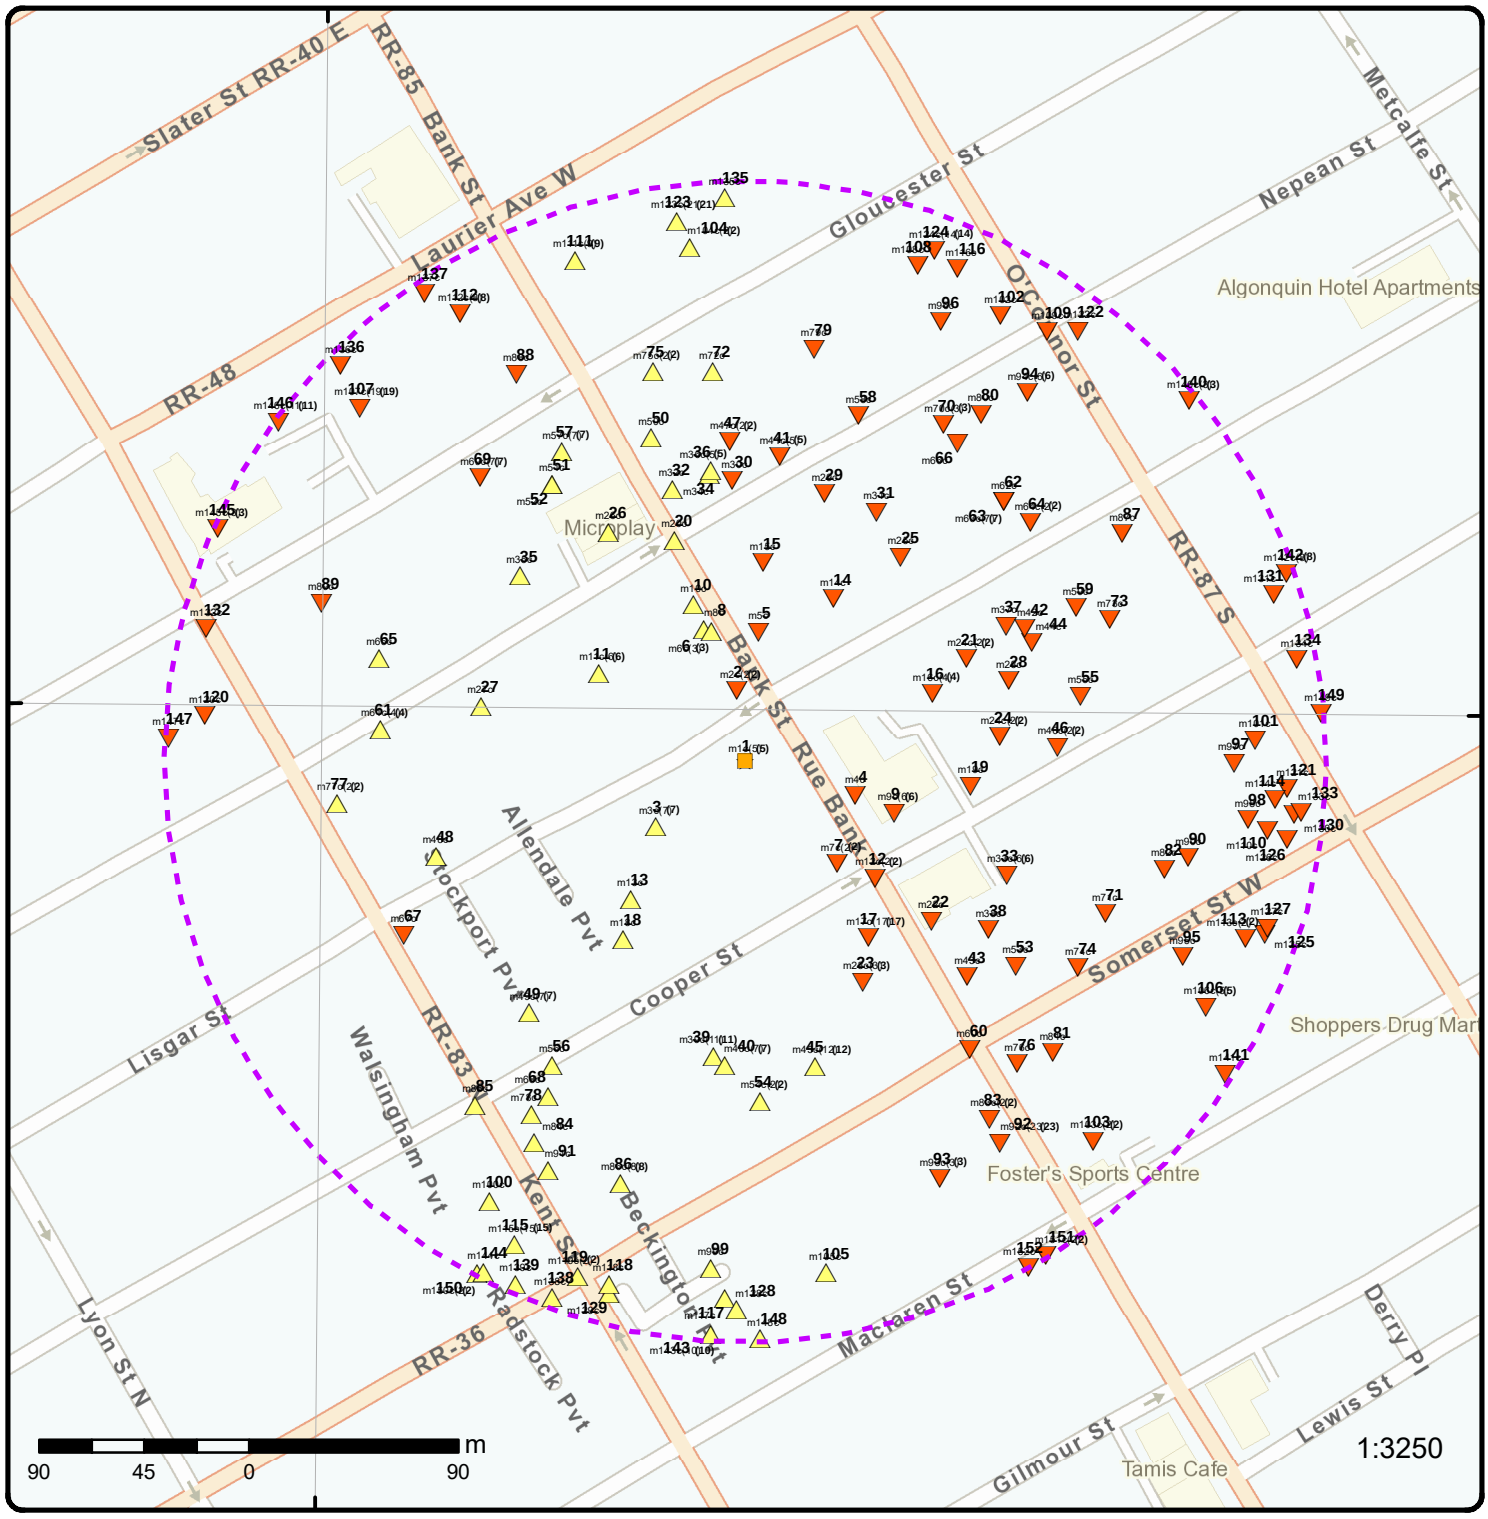

Map: 0.25 Kilometer Radius

Order Number: 25011400345

Address: 240 Bank Street, Ottawa, ON

- Project Property
- Buffer Outline
- Eris Sites with Higher Elevation
- Eris Sites with Same Elevation
- Eris Sites with Lower Elevation
- Eris Sites with Unknown Elevation
- Freeways; Highways
- Traffic Circle; Ramp
- Major Arterial; Minor Arterial
- Local Road
- Service Road; Traffic Circle; Ramp
- Rail
- Beach
- Airport
- Industrial Area
- Military Base
- Aircraft Roads
- Native Reservation
- Hospital
- Shopping & Sports Area
- University/College
- Cemetery; Golf Course
- Parkt (National)
- Park (City/County)

Source: © 2021 ESRI StreetMap Premium.

© ERIS Information Limited Partnership

75°42'W

45°25'30"N

45°25'30"N

Aerial **Year: 2023**

Address: 240 Bank Street, Ottawa, ON

Source: ESRI World Imagery

Order Number: 25011400345

ERIS

© ERIS Information Limited Partnership

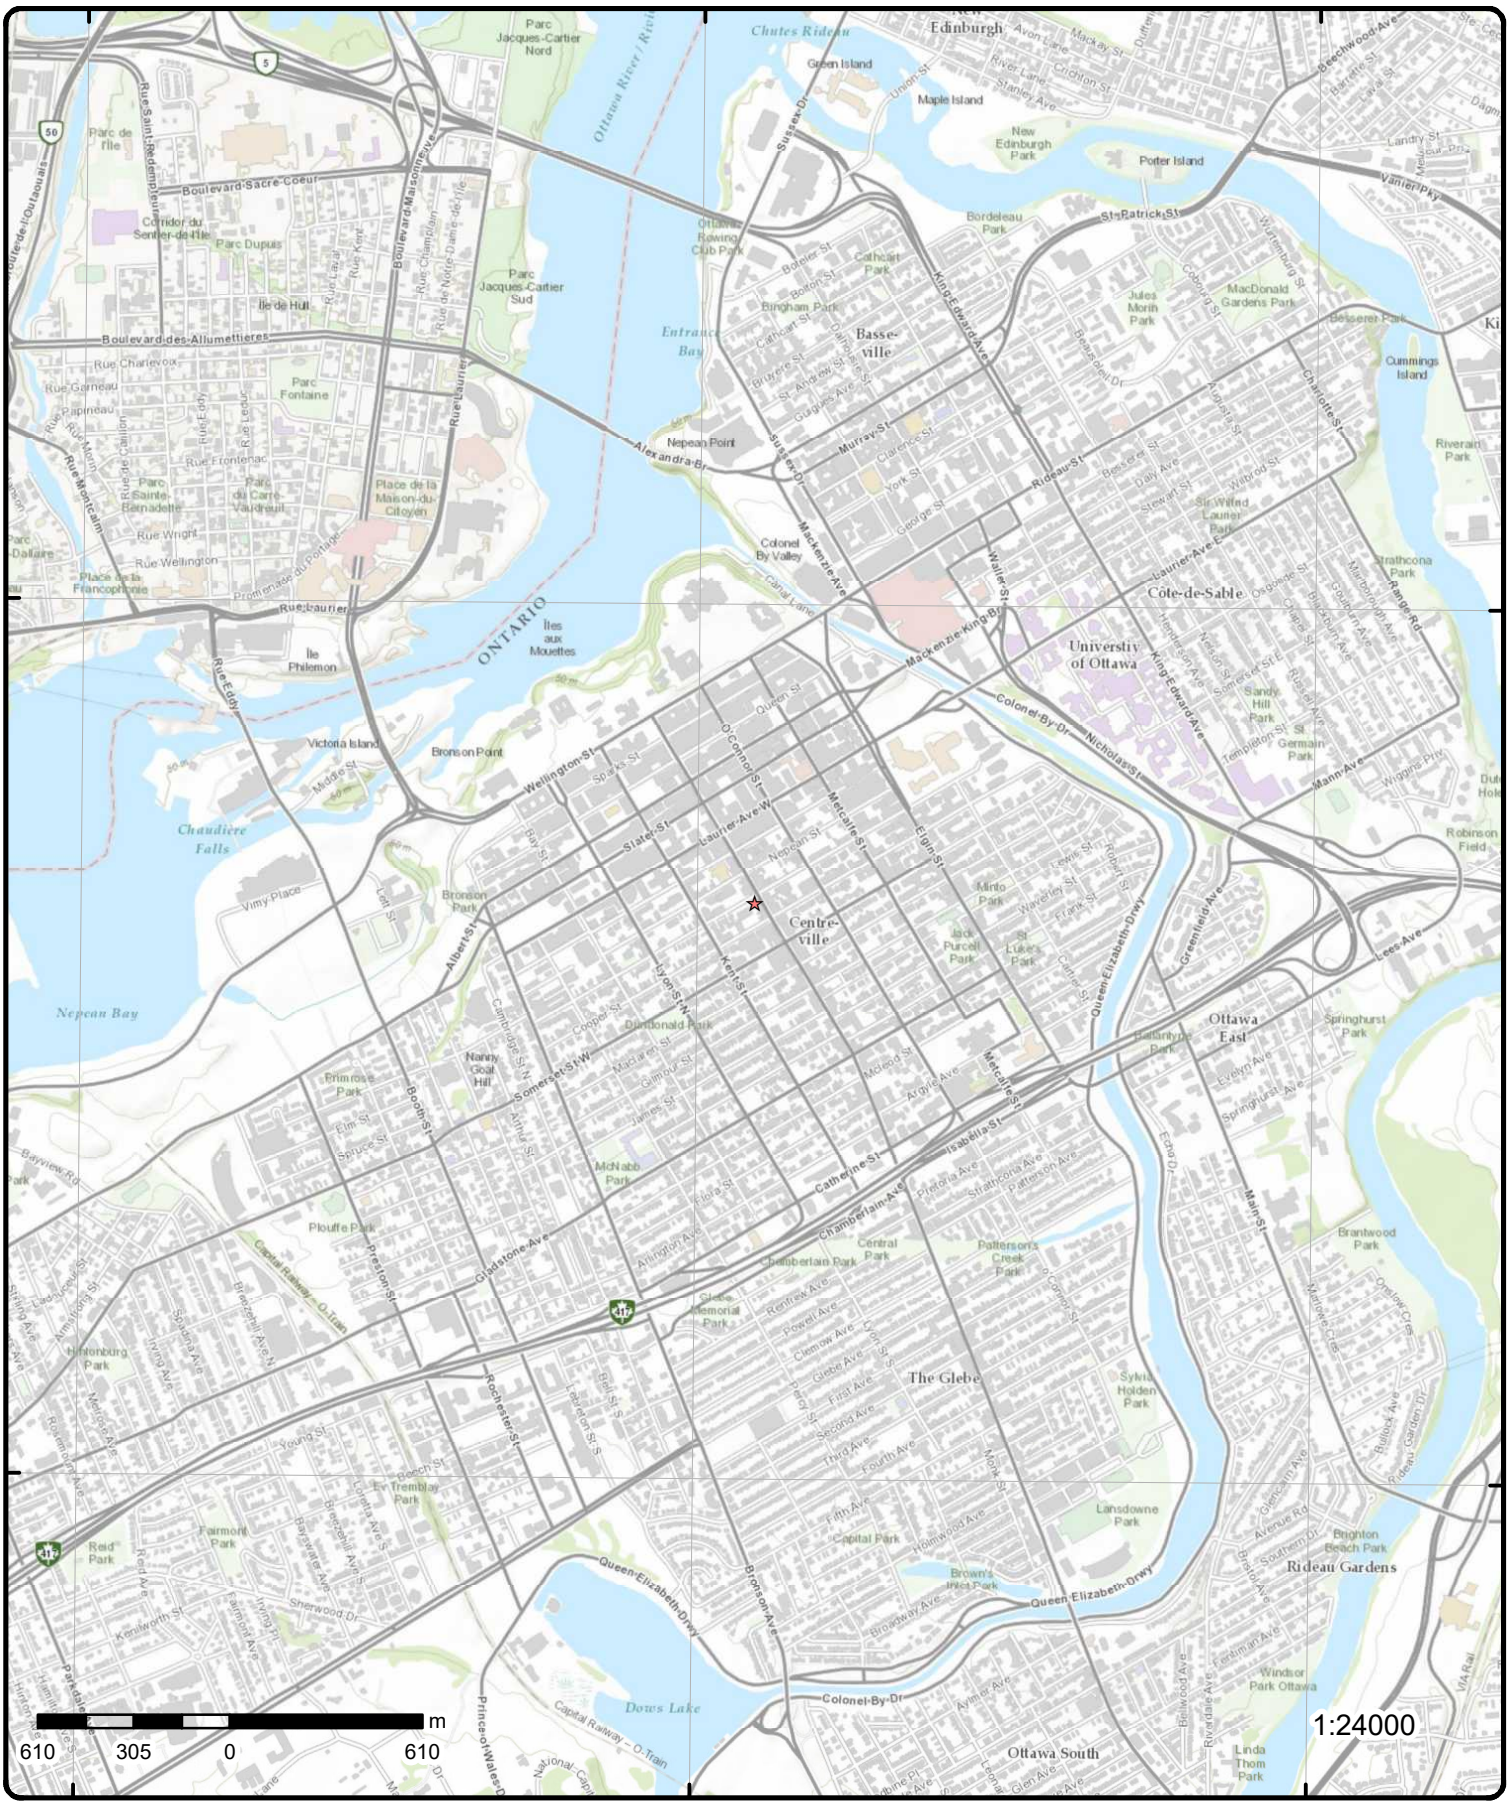

Topographic Map

Address: 240 Bank Street, ON

Source: ESRI World Topographic Map

Order Number: 25011400345

© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS

Order No:	20050923002	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Basic Report	**Client Prov/State:**	ON
Report Date:	10/3/2005	**Search Radius (km):**	0.25
Date Received:	9/23/2005	**X:**	-75.697626
Previous Site Name:		**Y:**	45.416523
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	2 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS

Order No:	20120207002	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	2/13/2012 9:30:56 AM	**Search Radius (km):**	0.25
Date Received:	2/7/2012 9:28:54 AM	**X:**	-75.697546
Previous Site Name:		**Y:**	45.416509
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	3 of 5	-/0.0	77.8 / 0.00	Al's Care Pharmacy 240 Bank Street Ottawa ON K2P1X4	GEN

Generator Info

Generator No:	ON2848712	**Choice of Contact:**	CO_ADMIN
Approval Years:	2014	**Contaminated Fac:**	No
Status:		**MHSW Facility:**	No
PO Box No:		**SIC Code:**	446110
Country:	Canada		
Co Admin:	Julia Moussa		
Phone No Admin:	6134222900 Ext.		
SIC Description:	446110		

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	4 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS

Order No:	20181010039	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	15-OCT-18	**Search Radius (km):**	.25
Date Received:	10-OCT-18	**X:**	-75.697626
Previous Site Name:		**Y:**	45.41644
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	5 of 5	-/0.0	77.8 / 0.00	240 Bank Street Ottawa ON K2P 1X4	EHS

Order No:	20200224086	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	27-FEB-20	**Search Radius (km):**	.25
Date Received:	24-FEB-20	**X:**	-75.6976257
Previous Site Name:		**Y:**	45.41644
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
2	1 of 2	N/30.5	77.6 / -0.24	PRIVATE BUSINESS 232 BANK ST STORAGE TANK OTTAWA ON K2P 1X1	SPL

Ref No:	186320	**Municipality No:**	20107
Year:		**Nature of Damage:**	
Incident Dt:	9/7/2000	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	9/8/2000	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	OTHER CONTAINER LEAK		
Incident Preceding Spill:			
Incident Reason:	DAMAGE BY MOVING EQUIPMENT		
Incident Summary:	COM/LEV/VIN: LEAK FROM OIL TANK 5L TO GND. CLEAN-ED.		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

2	*2 of 2*	*N/30.5*	*77.6 / -0.24*	***J Levinston Holding*** ***212 - 232 Bank st.*** ***Ottawa ON K2P 1X1***	***GEN***

Generator Info

Generator No: ON3771486
Approval Years: 2010
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Residential Building Construction

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 236110

Waste Detail(s)

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

3	*1 of 7*	*WSW/47.6*	*77.9 / 0.07*	***REVENUE CANADA TAXATION*** ***CUSTOMS & EXCISE 360 LISGAR STREET*** ***OTTAWA ON K2P 2E4***	***GEN***

Generator Info

Generator No: ON0426519
Approval Years: 94,95,96,97,98
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: TAXATION ADMIN.

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8153

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

---

3 ***2 of 7*** ***WSW/47.6*** ***77.9 / 0.07*** ***REVENUE CANADA TAXATION*** ***GEN***
360 LISGAR STREET
OTTAWA ON K1A 0L9

Generator Info

Generator No: ON0426519
Approval Years: 99,00,01
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: TAXATION ADMIN.

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8153

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

---

3 ***3 of 7*** ***WSW/47.6*** ***77.9 / 0.07*** ***URBANDALE CORPORATION*** ***GEN***
360 Lisgar Street
Ottawa ON

Generator Info

Generator No: ON2940601
Approval Years: 03,04,05
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 242
Waste Class Name: HALOGENATED PESTICIDES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

---

3 ***4 of 7*** ***WSW/47.6*** ***77.9 / 0.07*** ***Bell Canada*** ***GEN***
360 Lisgar st
Ottawa ON K2P 2E4

Generator Info

Generator No: ON2601606
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin: Julie Labelle
Phone No Admin: 514-870-0688 Ext.
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510

Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 517110, 517210, 517510

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

---

3 ***5 of 7*** ***WSW/47.6*** ***77.9 / 0.07*** ***Bell Canada*** ***GEN***
360 Lisgar st
Ottawa ON K2P 2E4

Generator Info

Generator No: ON2601606
Approval Years: 2016
Status:
PO Box No:

Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 517110, 517210, 517510

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Country: Canada
Co Admin: Chloé Labelle
Phone No Admin: 514-391-1021 Ext.
SIC Description: WIRED TELECOMMUNICATIONS CARRIERS, WIRELESS TELECOMMUNICATIONS CARRIERS (EXCEPT SATELLITE), 517510

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

3	6 of 7	WSW/47.6	77.9 / 0.07	**BELLCANADA** **360 LISGAR STREET** **OTTAWA ON K2P 2E4**	GEN

Generator Info

Generator No: ON6704214
Approval Years: 2014
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: POWER AND COMMUNICATION LINE AND RELATED STRUCTURES CONSTRUCTION

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 237130

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

3	7 of 7	WSW/47.6	77.9 / 0.07	**Bell Canada** **360 Lisgar st** **Ottawa ON K2P 2E4**	GEN

Generator Info

Generator No: ON2601606
Approval Years: As of Dec 2018
Status: Registered
PO Box No:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: Alkaline slutions - containing heavy metals

Waste Detail(s)

Waste Class: 112 C
Waste Class Name: Acid solutions - containing heavy metals

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: Waste compressed gases including cylinders

2017 Generator Info

Gen No: ON2601606
ID: 10396
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 517110
NAICS Code2: 517210
NAICS Code3: 517510
Gen Name: Bell Canada
Gen Div:
Gen Op Name: Bell Canada
Gen Op Div:
Site Adrs1: 360 Lisgar st
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2P 2E4
Site Country: Canada
Co Official: Martin Girard
Co Admin: ChloÚ Labelle

Choice of Contact: CO_ADMIN
Phone No Official: 514-870-6540 Ext.
Phone No Admin: 514-391-1021 Ext.
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2018 Generator Info

Gen No: ON2601606
ID: 10152
Contaminated Fac: N

Choice of Contact: CO_ADMIN
Phone No Official: 514-870-6540 Ext.
Phone No Admin: 514-391-1021 Ext.

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	517110	**County Out:**	
NAICS Code2:	517210	**District:**	402
NAICS Code3:	517510		
Gen Name:	Bell Canada		
Gen Div:			
Gen Op Name:	Bell Canada		
Gen Op Div:			
Site Adrs1:	360 Lisgar st		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2E4		
Site Country:	Canada		
Co Official:	Martin Girard		
Co Admin:	ChloÚ Labelle		

---

4 | ***1 of 1*** | ***ESE/49.4*** | ***76.9 / -0.93*** | ***251 Bank Street
Ottawa ON K2P 1X3*** | ***EHS***

Order No:	24082900023	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	04-SEP-24	**Search Radius (km):**	.25
Date Received:	29-AUG-24	**X:**	-75.6970523
Previous Site Name:		**Y:**	45.416337
Lot/Building Size:			
Additional Info Ordered:			

---

5 | ***1 of 1*** | ***N/56.0*** | ***77.6 / -0.23*** | ***WALLACK'S ART & DRAFTING
231 BANK ST
OTTAWA ON K2P 1W9*** | ***SCT***

Established:	
Plant Size (ft²):	0
Employment:	20

--Details--

Description:	MEASURING & CONTROLLING DEVICES, N.E.C.
SIC/NAICS Code:	3829
Description:	LEAD PENCILS, CRAYONS, & ARTISTS' MATERIALS
SIC/NAICS Code:	3952
Description:	MARKING DEVICES
SIC/NAICS Code:	3953

---

6 | ***1 of 3*** | ***NNW/57.9*** | ***77.9 / 0.07*** | ***BICYCLE REVIVAL LTD.
224 BANK STREET
OTTAWA ON K2P 1X1*** | ***GEN***

Generator Info

Generator No:	ON1177400	**Choice of Contact:**	
Approval Years:	89	**Contaminated Fac:**	
Status:		**MHSW Facility:**	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

PO Box No: ***SIC Code:*** 9949
Country:
Co Admin:
Phone No Admin:
SIC Description: OTHER REPAIR SERV.

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

6	*2 of 3*	*NNW/57.9*	*77.9 / 0.07*	***BICYCLE REVIVAL LTD. 04-341*** ***224 BANK STREET*** ***OTTAWA ON K2P 1X1***	*GEN*

Generator Info

Generator No: ON1177400 ***Choice of Contact:***
Approval Years: 92,93,94,95,96,97,98 ***Contaminated Fac:***
Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 9949
Country:
Co Admin:
Phone No Admin:
SIC Description: OTHER REPAIR SERV.

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

6	*3 of 3*	*NNW/57.9*	*77.9 / 0.07*	***BICYCLE REVIVAL LIMITED*** ***224 BANK STREET*** ***OTTAWA ON K2P 1X1***	*GEN*

Generator Info

Generator No: ON1177400 ***Choice of Contact:***
Approval Years: 99,00,01 ***Contaminated Fac:***
Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 9949
Country:
Co Admin:
Phone No Admin:
SIC Description: OTHER REPAIR SERV.

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

7	*1 of 2*	*SE/59.2*	*76.9 / -0.93*	***FOCUS CENTRE, THE*** ***254 BANK STREET*** ***OTTAWA ON K2P 1X4***	*GEN*

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON1882400	***Choice of Contact:***	
Approval Years:	94,95,96,97,98,99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	6571
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	CAMERA/PHOTO. SUPPLY		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

7	*2 of 2*	*SE/59.2*	*76.9 / -0.93*	***Easy Drain Plumbing*** ***254 Bank Str*** ***Ottawa ON***	***GEN***

Generator Info

Generator No:	ON4987732	***Choice of Contact:***	
Approval Years:	2013	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	812115
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	262
Waste Class Name:	DETERGENTS/SOAPS

8	*1 of 1*	*NNW/59.8*	*77.9 / 0.07*	***COOKWARE CENTRE (THE)*** ***220 BANK ST*** ***OTTAWA ON K2P 1X1***	***SCT***

Established:	1959
Plant Size (ft²):	0
Employment:	0

--Details--

Description:	Service Establishment Machinery, Equipment and Supplies Wholesaler-Distributors
SIC/NAICS Code:	417920

9	*1 of 6*	*ESE/67.9*	*76.9 / -0.93*	***251-259 Bank Street (395-397 Cooper St)*** ***Ottawa ON***	***EHS***

Order No:	20040428001	***Nearest Intersection:***	Bank St & Cooper St
Status:	C	***Municipality:***	
Report Type:	Custom Report	***Client Prov/State:***	ON
Report Date:	5/6/04	***Search Radius (km):***	0.25
Date Received:	4/28/04	***X:***	-75.69682
Previous Site Name:		***Y:***	45.416444
Lot/Building Size:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					

9	2 of 6	ESE/67.9	76.9 / -0.93	**Capital Xtra - Div. of Pink** **251 Bank St Unit 503** **Ottawa ON K2P 1X3**	SCT

Established: 1994
Plant Size (ft²): 1800
Employment: 3

--Details--
Description: Newspaper Publishers
SIC/NAICS Code: 511110

9	3 of 6	ESE/67.9	76.9 / -0.93	**McKenzie Publishing Inc.** **251A Bank St Suite 500** **Ottawa ON K2P 1X3**	SCT

Established: 01-JUL-96
Plant Size (ft²): 1000
Employment:

--Details--
Description: Periodical Publishers
SIC/NAICS Code: 511120

9	4 of 6	ESE/67.9	76.9 / -0.93	**Akiva Publishing Inc.** **251 Bank St Suite 206** **Ottawa ON K2P 1X3**	SCT

Established:
Plant Size (ft²):
Employment:

--Details--
Description: Internet Publishing and Broadcasting and Web Search Portals
SIC/NAICS Code: 519130

Description: Book Publishers
SIC/NAICS Code: 511130

Description: Periodical Publishers
SIC/NAICS Code: 511120

9	5 of 6	ESE/67.9	76.9 / -0.93	**251 Bank Street** **Ottawa ON**	EHS

Order No: 20110609005
Status: C
Report Type: Custom Report
Report Date: 6/15/2011
Date Received: 6/9/2011 8:51:43 AM
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.696931
Y: 45.416234

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
9	6 of 6	ESE/67.9	76.9 / -0.93	251 Bank St Ottawa ON K2P1X3	EHS

Order No:	20170306014	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	09-MAR-17	**Search Radius (km):**	.25
Date Received:	06-MAR-17	**X:**	-75.696806
Previous Site Name:		**Y:**	45.416301
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
10	1 of 1	NNW/71.1	77.9 / 0.07	212 Bank Street , Ottawa ON	INC

Incident No:	388460	**Any Health Impact:**	No
Incident ID:	2540090	**Any Enviro Impact:**	Unknown
Instance No:		**Service Intrp:**	No
Status Code:	Causal Analysis Complete	**Was Prop Damaged:**	Unknown
Incident Status:		**Reside App. Type:**	
Incident Severity:		**Commer App. Type:**	
Task No:	2894418	**Indus App. Type:**	
Attribute Category:	FS-Perform L1 Near Miss Insp	**Institut App. Type:**	
Context:		**Depth Ground Cover:**	
Date of Occurrence:	2010/05/21 00:00:00	**Operation Pressure:**	
Time of Occurrence:	12:00:00	**Equipment Type:**	
Occr Insp Start Dt:	2010/05/21 00:00:00	**Equipment Model:**	
Incident Creat On:		**Serial No:**	
Instance Creat Dt:		**Cylinder Capacity:**	
Instance Install Dt:		**Cylinder Cap Units:**	
Approx Quant Rel:	Unknown	**Cylinder Mat Type:**	
Tank Capacity:		**Pump Flow Rate Cap:**	
Fuels Occur Type:	Other	**Contam. Migrated:**	Unknown
Occur Type Rpt:		**Near Body of Water:**	No
Occur Category:		**Drainage System:**	Unknown
Fuel Type Involved:	Fuel Oil	**Sub Surface Contam:**	Unknown
Fuel Type Reported:		**Tank Material Type:**	
Enforcement Policy:	NULL	**Tank Storage Type:**	
Prc Escalation Req:	NULL	**Tank Location Type:**	
Item:			
Item Description:			
Device Installed Location:			
Venting Type:			
Vent Conn Mater:			
Vent Chimney Mater:			
Pipeline Type:			
Pipeline Involved:			
Pipe Material:			
Regulator Location:			
Regulator Type:			
Liquid Prop Make:			
Liquid Prop Model:			
Liquid Prop Serial No:			
Liquid Prop Notes:			
Inventory Address:	212 Bank Street , Ottawa - Near Miss		
Invent Postal Code:			
Notes:			
Contact Natural Env:	Unknown		
Aff Prop Use Water:	No		
Occurence Narrative:	Discovery of abandoned UST.		
Operation Type Involved:	Commercial (e.g. restaurant, business unit, etc)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	1 of 6	WNW/73.6	77.9 / 0.07	DEPARTMENT OF NATIONAL DEFENCE VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN

Generator Info

Generator No:	ON0046594	**Choice of Contact:**	
Approval Years:	95	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	2 of 6	WNW/73.6	77.9 / 0.07	DEPT OF NATIONAL DEFENCE, CDN. FORCES VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN

Generator Info

Generator No:	ON0046594	**Choice of Contact:**	
Approval Years:	96,97	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	3 of 6	WNW/73.6	77.9 / 0.07	DEPT. OF NATIONAL DEFENCE VANIER BUILDING 222 NEPEAN STREET OTTAWA ON K2B 0B8	GEN

Generator Info

Generator No:	ON0046594	**Choice of Contact:**	
Approval Years:	98,99,00,01	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

---

11 ***4 of 6*** ***WNW/73.6*** ***77.9 / 0.07*** ***222 Nepean Street Ottawa ON K2P 0B8*** ***EHS***

Order No: 20111208034
Status: C
Report Type: Standard Report
Report Date: 12/19/2011 4:17:41 PM
Date Received: 12/8/2011 4:17:41 PM
Previous Site Name: Unknown
Lot/Building Size: 2428 Square meters
Additional Info Ordered:

Nearest Intersection:
Municipality: Ottawa
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.698633
Y: 45.41695

---

11 ***5 of 6*** ***WNW/73.6*** ***77.9 / 0.07*** ***222 Nepean Street, Ottawa Ottawa ON*** ***SPL***

Ref No: 3052-A9WKJ9
Year:
Incident Dt: 2016/05/13
Dt MOE Arvl on Scn:
MOE Reported Dt: 2016/05/13
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Vanier Building<UNOFFICIAL>
Site Address: 222 Nepean Street, Ottawa
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill: Leak/Break
Incident Reason: Unknown / N/A
Incident Summary: Refrigerant leak from 2 stages of unit, 240+ pounds of R22 to atm
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 240 lb
Contaminant Qty 1: 240
Contaminant Unit: lb
Contaminant Code: 38
Contaminant Name: REFRIGERANT GAS, N.O.S.
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Air

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Unknown / N/A
SAC Action Class: Notifications
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

11 | ***6 of 6*** | ***WNW/73.6*** | ***77.9 / 0.07*** | ***Bona Building Management***
222 Nepean St
Ottawa ON K1R5G2 | ***GEN***

Generator Info

Generator No: ON3438000
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

2021 Generator Info

Gen No: ON3438000
ID: 12990
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 531310
NAICS Code2:
NAICS Code3:
Gen Name: Bona Building Management
Gen Div:
Gen Op Name: Bona Building Management
Gen Op Div:
Site Adrs1: 222 Nepean St
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K1R5G2
Site Country: Canada
Co Official: Bourco Bourco
Co Admin:
Choice of Contact: CO_OFFICIAL
Phone No Official: 3439618166 Ext.
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2021 Generator Manifest

ID: 33024
Generator No: ON3438000
Receiver Type: 035
Waste Char: L
Sum Received Qty: 490.0
Waste Class Name: ALIPHATIC SOLVENTS
Count Manifests: 2
District: 402

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Code:	212				

12 **1 of 2** **ESE/75.1** **76.9 / -0.93** **OTTAWA CITY**
COOPER ST./BANK ST.
OTTAWA CITY ON **CA**

Certificate #: 3-0942-90-
Application Year: 90
Issue Date: 6/5/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

12 **2 of 2** **ESE/75.1** **76.9 / -0.93** **R.M. OF OTTAWA-CARLETON**
COOPER ST./BANK ST.
OTTAWA CITY ON **CA**

Certificate #: 7-0785-90-
Application Year: 90
Issue Date: 6/5/1990
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

13 **1 of 1** **SW/77.0** **77.9 / 0.07** **Youth Services Bureau of Ottawa**
433 COOPER ST/366 LISGAR STREET, OTTAWA
OTTAWA ON **RSC**

RSC No:	2091	**X:**	-75.69847162568209
RA No:		**Y:**	45.416435005054375
Status:	FILED	**Latitude:**	45.41643501
Filing Date:		**Longitude:**	-75.69847163
Date Ack:		**UTM Coordinates:**	
Date Returned:		**Latitude Longitude:**	
Approval Date:	November 14, 2005	**Accuracy Estimate:**	
Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	K2P 0H1
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	Joseph B Bennett
CPU Issu Sect 1686:		**Consultant:**	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Business Name: Youth Services Bureau of Ottawa
Address: 433 COOPER ST/366 LISGAR STREET, OTTAWA
Legal Desc:
Site Pin: 04114-0253 LT
Asmt Roll No:
Project Type: PRE2011
Approval Type: RSC based on Phase One and Two ESAs
Applicable Standards:
PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2091

14	1 of 1	NE/79.7	76.9 / -0.93	**Canadian Bible Society** **315 Lisgar St** **Ottawa ON K2P 0E1**	SCT

Established: 01-DEC-05
Plant Size (ft²): 3000
Employment:

--Details--
Description: Professional Organizations
SIC/NAICS Code: 813920

15	1 of 1	N/85.7	76.7 / -1.10	**178 Nepean, 219 & 223 Bank** **Ottawa ON K2P 1W9**	EHS

Order No: 22042800477
Status: C
Report Type: Standard Report
Report Date: 03-MAY-22
Date Received: 28-APR-22
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6975686
Y: 45.4172349

16	1 of 4	ENE/85.8	76.9 / -0.93	**Canus Plastics Inc.** **300 Lisgar St** **Ottawa ON K2P 0E2**	SCT

Established: 8/1/1949
Plant Size (ft²): 22000
Employment:

--Details--
Description: Plastic Film and Sheet Manufacturing
SIC/NAICS Code: 326114

Description: Chemical (except Agricultural) and Allied Product Wholesaler-Distributors
SIC/NAICS Code: 418410

Description: Other Paper and Disposable Plastic Product Wholesaler-Distributors
SIC/NAICS Code: 418220

Description: Showcase, Partition, Shelving and Locker Manufacturing
SIC/NAICS Code: 337215

Description: All Other Miscellaneous Fabricated Metal Product Manufacturing
SIC/NAICS Code: 332999

Description: Industrial Machinery, Equipment and Supplies Wholesaler-Distributors
SIC/NAICS Code: 417230

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Description: Office and Store Machinery and Equipment Wholesaler-Distributors
SIC/NAICS Code: 417910

Description: Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors
SIC/NAICS Code: 416120

Description: Unlaminated Plastic Profile Shape Manufacturing
SIC/NAICS Code: 326121

Description: Sign Manufacturing
SIC/NAICS Code: 339950

Description: All Other Plastic Product Manufacturing
SIC/NAICS Code: 326198

Description: Other Specialty-Line Building Supplies Wholesaler-Distributors
SIC/NAICS Code: 416390

---

16 | **2 of 4** | **ENE/85.8** | **76.9 / -0.93** | **Canus Signs Plastics Ltd.**
300 Lisgar St
Ottawa ON K2P 0E2 | **SCT**

Established: 1955
Plant Size (ft²):
Employment: 25

--Details--
Description: All Other Plastic Product Manufacturing
SIC/NAICS Code: 326198

Description: Sign Manufacturing
SIC/NAICS Code: 339950

Description: Plastic Bottle Manufacturing
SIC/NAICS Code: 326160

---

16 | **3 of 4** | **ENE/85.8** | **76.9 / -0.93** | **300 Lisgar Street**
Ottawa ON K2P 0E2 | **EHS**

Order No: 20090807045
Status: C
Report Type: Standard Report
Report Date: 8/18/2009
Date Received: 8/7/2009
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Sire Plans

Nearest Intersection: Lisgar Street and Bank Street (Site located east of intersection)
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.696446
Y: 45.416825

---

16 | **4 of 4** | **ENE/85.8** | **76.9 / -0.93** | **Soho Lisgar Inc.**
300 Lisgar Street, Ottawa, Ontario, K2P 1T6
OTTAWA ON | **RSC**

RSC No: 113750
RA No:
Status: FILED
Filing Date:
Date Ack:
Date Returned:

X: -75.6966629720621
Y: 45.416941121398054
Latitude: 45.41694112
Longitude: -75.69666297
UTM Coordinates:
Latitude Longitude:

Approval Date:	June 23, 2011	**Accuracy Estimate:**	
Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	Mark S D'Arcy
CPU Issu Sect 1686:		**Consultant:**	
Business Name:	Soho Lisgar Inc.		
Address:	300 Lisgar Street, Ottawa, Ontario, K2P 1T6		
Legal Desc:			
Site Pin:	04115-0309 LT		
Asmt Roll No:			
Project Type:	PRE2011		
Approval Type:	RSC based on Phase One and Two ESAs		
Applicable Standards:			
PDF Link:	https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=113750		

17	*1 of 17*	***SE/92.7***	***76.9 / -0.93***	***DRAICCHIO'S TAILORING & CLEANING*** ***272 BANK STREET*** ***OTTAWA ON K2P 1X6***	***GEN***

Generator Info

Generator No:	ON1392900	**Choice of Contact:**	
Approval Years:	90,97,98,99,00,01,02,03,04,05,06,07,08	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

17	*2 of 17*	***SE/92.7***	***76.9 / -0.93***	***DRAICCHIO'S TAILORING & CLEANING 12-549*** ***272 BANK STREET*** ***OTTAWA ON K2P 1X6***	***GEN***

Generator Info

Generator No:	ON1392900	**Choice of Contact:**	
Approval Years:	92,93,94,95,96	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

---

17 | ***3 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***DRAICCHIO'S TAILORING & CLEANING*** | ***GEN***
272 BANK STREET
OTTAWA ON K2P 1X6

Generator Info

Generator No:	ON1392900	***Choice of Contact:***	
Approval Years:	2009	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	812320
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Dry Cleaning and Laundry Services (except Coin-Operated)		

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

---

17 | ***4 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***DRAICCHIO'S TAILORING & CLEANING*** | ***GEN***
272 BANK STREET
OTTAWA ON K2P 1X6

Generator Info

Generator No:	ON1392900	***Choice of Contact:***	
Approval Years:	2010	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	812320
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Dry Cleaning and Laundry Services (except Coin-Operated)		

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

---

17 | ***5 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***DRAICCHIO'S TAILORING & CLEANING*** | ***GEN***
272 BANK STREET
OTTAWA ON K2P 1X6

Generator Info

Generator No:	ON1392900	***Choice of Contact:***	
Approval Years:	2011	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	812320
Country:			
Co Admin:			

Phone No Admin:
SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	6 of 17	SE/92.7	76.9 / -0.93	DRAICCHIO'S TAILORING & CLEANING 272 BANK STREET OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No: ON1392900
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 812320

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	7 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON	GEN

Generator Info

Generator No: ON4418802
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Dry Cleaning and Laundry Services (except Coin-Operated)

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 812320

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	8 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON	GEN

Generator Info

Generator No: ON4418802
Approval Years: 2013
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 812320

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

---

17 | ***9 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***7695713 canada inc.***
272 BANK ST
OTTAWA ON K2P1X6 | ***GEN***

Generator Info

Generator No: ON4418802
Approval Years: 2016
Status:
PO Box No:
Country: Canada
Co Admin: MANUEL ML LEBRON
Phone No Admin: 6132332965 Ext.
SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)
Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 812320

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

---

17 | ***10 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***7695713 canada inc.***
272 BANK ST
OTTAWA ON K2P1X6 | ***GEN***

Generator Info

Generator No: ON4418802
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin: MANUEL ML LEBRON
Phone No Admin: 6132332965 Ext.
SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)
Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 812320

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

---

17 | ***11 of 17*** | ***SE/92.7*** | ***76.9 / -0.93*** | ***7695713 canada inc.***
272 BANK ST
OTTAWA ON K2P1X6 | ***GEN***

Generator Info

Generator No: ON4418802
Approval Years: 2014
Choice of Contact: CO_OFFICIAL
Contaminated Fac: No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status: ***MHSW Facility:*** No
PO Box No: ***SIC Code:*** 812320
Country: Canada
Co Admin: aida af flores de lebron
Phone No Admin: 613-234-1284 Ext.
SIC Description: DRY CLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

17	12 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN

Generator Info

Generator No: ON4418802 ***Choice of Contact:***
Approval Years: As of Dec 2018 ***Contaminated Fac:***
Status: Registered ***MHSW Facility:***
PO Box No: ***SIC Code:***
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Waste Detail(s)

Waste Class: 213 L
Waste Class Name: Petroleum distillates

17	13 of 17	SE/92.7	76.9 / -0.93	Draicchio's Tailoring&Cleaning 272 Bank St Ottawa ON K2P1X6	CDRY

Legal Name of Company:
Region:
Type of Reporter:

Waste Quantity by Year

Reporting Year: 2004
Quantity of PERC (kg): 89.1
Total Waste Water (kg): 92
Total Waste Water (L): -
Total Residue (kg): 92
Total Residue (L): -
Total Mix (kg): 184
Total Mix (L): -
Request for Confidentiality: No
Reason For Confidentiality: N/A

17	14 of 17	SE/92.7	76.9 / -0.93	Downtown Cobler 272 Bank St Ottawa ON K2P1X6	CDRY

Legal Name of Company:
Region: Ontario

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Type of Reporter: Dry Cleaner

Waste Quantity by Year

Reporting Year: 2021
Quantity of PERC (kg): 0
Total Waste Water (kg): 0
Total Waste Water (L): 0
Total Residue (kg): 0
Total Residue (L): 0
Total Mix (kg): 0
Total Mix (L): 0
Request for Confidentiality: no
Reason For Confidentiality:

17	15 of 17	SE/92.7	76.9 / -0.93	7695713 canada inc. 272 BANK ST OTTAWA ON K2P1X6	GEN

Generator Info

Generator No: ON4418802
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 213 L
Waste Class Name: Petroleum distillates

17	16 of 17	SE/92.7	76.9 / -0.93	DOWNTOWN COBBLER DOWNTOWN COBBLER 272 BANK ST OTTAWA ON k2p1x6	GEN

Generator Info

Generator No: ON4418802
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 213 L
Waste Class Name: Petroleum distillates

17	17 of 17	SE/92.7	76.9 / -0.93	Downtown Tailoring 272 BANK ST	GEN

Generator Info

Generator No:	ON4418802	***Choice of Contact:***	
Approval Years:	As of Oct 2022	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:	n/a	***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	213 L
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	241 H
Waste Class Name:	HALOGENATED SOLVENTS

2017 Generator Info

Gen No:	ON4418802	***Choice of Contact:***	CO_ADMIN
ID:	17578	***Phone No Official:***	6132038099 Ext.
Contaminated Fac:	N	***Phone No Admin:***	6132332965 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	812320	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	7695713 canada inc.		
Gen Div:			
Gen Op Name:	DRAICCHIO'S TAILORING & CLEANING		
Gen Op Div:			
Site Adrs1:	272 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K2P1X6		
Site Country:	Canada		
Co Official:	MANUEL ML LEBRON		
Co Admin:	MANUEL ML LEBRON		

2017 Generator Manifest

ID:	41082	***Sum Received Qty:***	80.0
Generator No:	ON4418802	***Waste Class Name:***	HALOGENATED SOLVENTS
Receiver Type:	040	***Count Manifests:***	2
Waste Char:	H	***District:***	805
Waste Code:	241		

2018 Generator Info

Gen No:	ON4418802	***Choice of Contact:***	CO_ADMIN

ID:	17611	**Phone No Official:**	6132038099 Ext.
Contaminated Fac:	N	**Phone No Admin:**	6132332965 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	812320	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name: 7695713 canada inc.
Gen Div:
Gen Op Name: DRAICCHIO'S TAILORING & CLEANING
Gen Op Div:
Site Adrs1: 272 BANK ST
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: OTTAWA
Province Out:
Site Postal Code: K2P1X6
Site Country: Canada
Co Official: MANUEL ML LEBRON
Co Admin: MANUEL ML LEBRON

2018 Generator Manifest

ID:	40965	**Sum Received Qty:**	60.0
Generator No:	ON4418802	**Waste Class Name:**	HALOGENATED SOLVENTS
Receiver Type:	040	**Count Manifests:**	1
Waste Char:	H	**District:**	805
Waste Code:	241		

2019 Generator Info

Gen No:	ON4418802	**Choice of Contact:**	CO_ADMIN
ID:	17503	**Phone No Official:**	6132038099 Ext.
Contaminated Fac:	N	**Phone No Admin:**	6132332965 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	812320	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name: 7695713 canada inc.
Gen Div:
Gen Op Name: DRAICCHIO'S TAILORING & CLEANING
Gen Op Div:
Site Adrs1: 272 BANK ST
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: OTTAWA
Province Out:
Site Postal Code: K2P1X6
Site Country: Canada
Co Official: MANUEL ML LEBRON
Co Admin: MANUEL ML LEBRON

2019 Generator Manifest

ID:	40283	**Sum Received Qty:**	24.0
Generator No:	ON4418802	**Waste Class Name:**	HALOGENATED SOLVENTS
Receiver Type:	040	**Count Manifests:**	1
Waste Char:	H	**District:**	805
Waste Code:	241		

2020 Generator Info

Gen No:	ON4418802	***Choice of Contact:***	CO_OFFICIAL
ID:	17205	***Phone No Official:***	6132038099 Ext.
Contaminated Fac:	N	***Phone No Admin:***	6132038099 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	812320	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	DOWNTOWN COBBLER		
Gen Div:	DOWNTOWN COBBLER		
Gen Op Name:	DOWNTOWN COBBLER		
Gen Op Div:			
Site Adrs1:	272 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	k2p1x6		
Site Country:	Canada		
Co Official:	MANUEL ML LEBRON		
Co Admin:	MANUEL MANUEL LEBRON		

2021 Generator Info

Gen No:	ON4418802	***Choice of Contact:***	CO_OFFICIAL
ID:	17274	***Phone No Official:***	6132038099 Ext.
Contaminated Fac:	N	***Phone No Admin:***	6132038099 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	812320	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Downtown Tailoring		
Gen Div:	DOWNTOWN TAILORING		
Gen Op Name:	Downtown Tailoring		
Gen Op Div:	DOWNTOWN TAILORING		
Site Adrs1:	272 BANK ST		
Site Bldg:	Downtown Tailoring		
Site Pobox:	n/a		
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K2P 1X6		
Site Country:	Canada		
Co Official:	MANUEL ML LEBRON		
Co Admin:	MANUEL M.L LEBRON		

2021 Generator Manifest

ID:	38317	***Sum Received Qty:***	20.0
Generator No:	ON4418802	***Waste Class Name:***	HALOGENATED SOLVENTS
Receiver Type:	040	***Count Manifests:***	1
Waste Char:	H	***District:***	805
Waste Code:	241		

18	***1 of 1***	***SW/92.7***	***77.9 / 0.07***	***437 Cooper Street Ottawa ON K2P 0H1***	***EHS***

Order No:	24022901100	***Nearest Intersection:***	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	05-MAR-24	**Search Radius (km):**	.25
Date Received:	29-FEB-24	**X:**	-75.6983206
Previous Site Name:		**Y:**	45.4157749
Lot/Building Size:			
Additional Info Ordered:			

---

19 | **1 of 1** | **E/97.5** | **76.9 / -0.93** | **ON** | **BORE**

Borehole ID:	613297	**Inclin FLG:**	No
OGF ID:	215514598	**SP Status:**	Initial Entry
Status:		**Surv Elev:**	No
Type:	Borehole	**Piezometer:**	No
Use:		**Primary Name:**	
Completion Date:		**Municipality:**	
Static Water Level:	11.9	**Lot:**	
Primary Water Use:		**Township:**	
Sec. Water Use:		**Latitude DD:**	45.416378
Total Depth m:	-999	**Longitude DD:**	-75.696417
Depth Ref:	Ground Surface	**UTM Zone:**	18
Depth Elev:		**Easting:**	445511
Drill Method:		**Northing:**	5029442
Orig Ground Elev m:	72.9	**Location Accuracy:**	
Elev Reliabil Note:		**Accuracy:**	Not Applicable
DEM Ground Elev m:	72.7		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218394556	**Mat Consistency:**	Firm
Top Depth:	0	**Material Moisture:**	
Bottom Depth:	2.3	**Material Texture:**	
Material Color:		**Non Geo Mat Type:**	
Material 1:	Sand	**Geologic Formation:**	
Material 2:		**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	SAND. FIRM.		

Geology Stratum ID:	218394562	**Mat Consistency:**	
Top Depth:	9.1	**Material Moisture:**	
Bottom Depth:		**Material Texture:**	
Material Color:		**Non Geo Mat Type:**	
Material 1:	Bedrock	**Geologic Formation:**	
Material 2:	Shale	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	BEDROCK. FOSSILIFEROUS, WATER STABLE AT 200.3 FEET.0050 043 00080 058 00115 062 00 **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	218394559	**Mat Consistency:**	Firm
Top Depth:	6.2	**Material Moisture:**	
Bottom Depth:	7.3	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Clay	**Geologic Formation:**	
Material 2:	Silt	**Geologic Group:**	

Material 3: ***Geologic Period:***
Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: CLAY. GREY,FIRM.

Geology Stratum ID: 218394561 ***Mat Consistency:*** Compact
Top Depth: 8.8 ***Material Moisture:***
Bottom Depth: 9.1 ***Material Texture:***
Material Color: ***Non Geo Mat Type:***
Material 1: Till ***Geologic Formation:***
Material 2: ***Geologic Group:***
Material 3: ***Geologic Period:***
Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: TILL. COMPACT.

Geology Stratum ID: 218394557 ***Mat Consistency:*** Soft
Top Depth: 2.3 ***Material Moisture:***
Bottom Depth: 5 ***Material Texture:***
Material Color: Grey ***Non Geo Mat Type:***
Material 1: Clay ***Geologic Formation:***
Material 2: ***Geologic Group:***
Material 3: ***Geologic Period:***
Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: CLAY. GREY,SOFT.

Geology Stratum ID: 218394558 ***Mat Consistency:*** Soft
Top Depth: 5 ***Material Moisture:***
Bottom Depth: 6.2 ***Material Texture:***
Material Color: ***Non Geo Mat Type:***
Material 1: Clay ***Geologic Formation:***
Material 2: Silt ***Geologic Group:***
Material 3: ***Geologic Period:***
Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: CLAY. SOFT.

Geology Stratum ID: 218394560 ***Mat Consistency:*** Firm
Top Depth: 7.3 ***Material Moisture:***
Bottom Depth: 8.8 ***Material Texture:***
Material Color: Grey ***Non Geo Mat Type:***
Material 1: Clay ***Geologic Formation:***
Material 2: Till ***Geologic Group:***
Material 3: ***Geologic Period:***
Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: CLAY. GREY,FIRM.

Source

Source Type: Data Survey ***Source Appl:*** Spatial/Tabular
Source Orig: Geological Survey of Canada ***Source Iden:*** 1
Source Date: 1956-1972 ***Scale or Res:*** Varies
Confidence: H ***Horizontal:*** NAD27
Observatio: ***Verticalda:*** Mean Average Sea Level
Source Name: Urban Geology Automated Information System (UGAIS)
Source Details: File: OTTAWA2.txt RecordID: 058050 NTS_Sheet: 31G05G
Confiden 1: Logged by professional. Exact and complete description of material and properties.

Source List

Source Identifier: 1 ***Horizontal Datum:*** NAD27
Source Type: Data Survey ***Vertical Datum:*** Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Source Date: 1956-1972 **Projection Name:** Universal Transverse Mercator
Scale or Resolution: Varies
Source Name: Urban Geology Automated Information System (UGAIS)
Source Originators: Geological Survey of Canada

---

20 **1 of 1** **NNW/100.1** **77.9 / 0.07** **Enbridge Gas Distribution Inc.** **SPL**
Bank St and Nepean St
Ottawa ON

Ref No: 8824-9TL9VT
Year:
Incident Dt: 2/10/2015
Dt MOE Arvl on Scn:
MOE Reported Dt: 2/10/2015
Dt Document Closed:
Site No: NA
MOE Response: N
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Gas Meter<UNOFFICIAL>
Site Address: Bank St and Nepean St
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Enbridge Gas Distribution Inc.
Client Type:
Source Type:
Incident Cause: Collision/Accident
Incident Preceding Spill:
Incident Reason: Operator/Human Error
Incident Summary: TSSA: gas meter struck by snowplow
Environment Impact:
Health Env Consequence:
Nature of Impact: Air
Contaminant Qty: 0 other - see incident description
Contaminant Qty 1: 0
Contaminant Unit: other - see incident description
Contaminant Code: 35
Contaminant Name: NATURAL GAS, COMPRESSED (METHANE)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

21 **1 of 2** **ENE/105.0** **76.9 / -0.93** **Canus Plastics Inc.** **GEN**
300 Lisgar St.
Ottawa ON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON3474706	***Choice of Contact:***	
Approval Years:	2009	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	326198
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	All Other Plastic Product Manufacturing		

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
21	2 of 2	ENE/105.0	76.9 / -0.93	Bassi Construction 300 lisgar st ottawa ON K2P 0E2	GEN

Generator Info

Generator No:	ON5537998	***Choice of Contact:***	
Approval Years:	2011	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	236220
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	1 of 1	ESE/105.4	76.9 / -0.93	GLASER PHARMACY LTD. 267 BANK STREET OTTAWA ON K2P 1X3	GEN

Generator Info

Generator No:	ON1565711	***Choice of Contact:***	
Approval Years:	99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	6031
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	PHARMACIES		

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
23	1 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY 276 BANK ST OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No:	ON9068684	***Choice of Contact:***	
Approval Years:	As of Jul 2020	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
23	2 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC SWIFT COMPOUNDING PHARMACY 276 BANK ST OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No:	ON9068684	***Choice of Contact:***	
Approval Years:	As of Nov 2021	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
23	3 of 3	SE/107.6	76.9 / -0.93	COOPER PHARMACY INC 276 BANK ST OTTAWA ON K2P 1X6	GEN

Generator Info

Generator No:	ON9068684	***Choice of Contact:***	
Approval Years:	As of Oct 2022	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

2020 Generator Info

Gen No:	ON9068684	***Choice of Contact:***	CO_OFFICIAL
ID:	36378	***Phone No Official:***	6134222202 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	446110	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	COOPER PHARMACY INC		
Gen Div:	SWIFT COMPOUNDING PHARMACY		
Gen Op Name:	SWIFT COMPOUNDING PHARMACY		
Gen Op Div:			
Site Adrs1:	276 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K2P 1X6		
Site Country:	Canada		
Co Official:	ALY EL DEFRAWY		
Co Admin:			

2021 Generator Info

Gen No:	ON9068684	***Choice of Contact:***	CO_OFFICIAL
ID:	37309	***Phone No Official:***	6134222202 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	446110	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	COOPER PHARMACY INC		
Gen Div:	SWIFT COMPOUNDING PHARMACY		
Gen Op Name:	SWIFT COMPOUNDING PHARMACY		
Gen Op Div:			
Site Adrs1:	276 BANK ST		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: OTTAWA
Province Out:
Site Postal Code: K2P 1X6
Site Country: Canada
Co Official: ALY EL DEFRAWY
Co Admin:

2021 Generator Manifest

ID:	62978	**Sum Received Qty:**	14.05
Generator No:	ON9068684	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	2
Waste Char:	A	**District:**	402
Waste Code:	261		

---

24 | **1 of 2** | **E/110.1** | **76.9 / -0.93** | **379 Cooper Street Ottawa ON K2P 0G8** | **EHS**

Order No:	20180712164	**Nearest Intersection:**	
Status:	C	**Municipality:**	Ottawa
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	19-JUL-18	**Search Radius (km):**	.25
Date Received:	12-JUL-18	**X:**	-75.696233
Previous Site Name:		**Y:**	45.416539
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos		

---

24 | **2 of 2** | **E/110.1** | **76.9 / -0.93** | **379 Cooper Street Ottawa ON K2P 0G8** | **EHS**

Order No:	21051300364	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Site Report	**Client Prov/State:**	ON
Report Date:	14-MAY-21	**Search Radius (km):**	.001
Date Received:	13-MAY-21	**X:**	-75.6962569
Previous Site Name:		**Y:**	45.4165681
Lot/Building Size:			
Additional Info Ordered:			

---

25 | **1 of 1** | **NE/110.3** | **76.9 / -0.93** | **309 Lisgar Avenue Ottawa ON** | **EHS**

Order No:	20110307024	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	3/9/2011	**Search Radius (km):**	0.25
Date Received:	3/7/2011 12:24:30 PM	**X:**	-75.696832
Previous Site Name:		**Y:**	45.417327
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory		

---

26 | **1 of 1** | **NW/114.9** | **77.9 / 0.07** | **BAYVIEW PROPERTY MANAGEMENT 210 BANK STREET OTTAWA ON K2P 1W8** | **GEN**

Generator Info

Generator No:	ON7938408	***Choice of Contact:***	
Approval Years:	07,08	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	531310
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Real Estate Property Managers		

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

---

27 | ***1 of 1*** | ***W/116.2*** | ***77.9 / 0.07*** | ***226 Nepean St Ottawa ON K2P0B8*** | ***EHS***

Order No:	20180404190	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Standard Report	***Client Prov/State:***	ON
Report Date:	10-APR-18	***Search Radius (km):***	.25
Date Received:	04-APR-18	***X:***	-75.699113
Previous Site Name:		***Y:***	45.416671
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans		

---

28 | ***1 of 1*** | ***ENE/118.6*** | ***76.9 / -0.93*** | ***300 Lisgar St and 375 Cooper St Ottawa ON*** | ***EHS***

Order No:	20060914012	***Nearest Intersection:***	Lisgar Street and O'Connor Street
Status:	C	***Municipality:***	
Report Type:	Complete Report	***Client Prov/State:***	ON
Report Date:	9/25/2006	***Search Radius (km):***	0.25
Date Received:	9/14/2006	***X:***	-75.696169
Previous Site Name:		***Y:***	45.416845
Lot/Building Size:			
Additional Info Ordered:			

---

29 | ***1 of 1*** | ***NNE/120.1*** | ***76.9 / -0.95*** | ***ON*** | ***WWIS***

Well ID:	7296899	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:		***Data Entry Status:***	Yes
Use 2nd:		***Data Src:***	
Final Well Status:		***Date Received:***	10/06/2017
Water Type:		***Selected Flag:***	TRUE
Casing Material:		***Abandonment Rec:***	
Audit No:	C30157	***Contractor:***	7328
Tag:	A203689	***Form Version:***	8
Constructn Method:		***Owner:***	
Elevation (m):		***County:***	OTTAWA-CARLETON
Elevatn Reliabilty:		***Lot:***	
Depth to Bedrock:		***Concession:***	
Well Depth:		***Concession Name:***	
Overburden/Bedrock:		***Easting NAD83:***	
Pump Rate:		***Northing NAD83:***	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Static Water Level: | **Zone:**
Clear/Cloudy: | **UTM Reliability:**
Municipality: NEPEAN TOWNSHIP
Site Info:

Additional Detail(s) (Map)

Bore Hole ID: 1006764387 | **Tag No:** A203689
Depth M: | **Contractor:** 7328
Year Completed: 2017 | **Latitude:** 45.4175047288114
Well Completed Dt: 08/24/2017 | **Longitude:** -75.697232269949
Audit No: C30157 | **Y:** 45.417504721938684
Path: | **X:** -75.69723210832771

Bore Hole Information

Bore Hole ID: 1006764387 | **Elevation:**
DP2BR: | **Elevrc:**
Spatial Status: | **Zone:** 18
Code OB: | **East83:** 445448.00
Code OB Desc: | **North83:** 5029568.00
Open Hole: | **Org CS:** UTM83
Cluster Kind: | **UTMRC:** 4
Date Completed: 08/24/2017 | **UTMRC Desc:** margin of error : 30 m - 100 m
Remarks: | **Location Method:** wwr
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

30	1 of 1	N/120.8	77.3 / -0.47	**177 Nepean St** **Ottawa ON K2P 1W7**	EHS

Order No: 20191101030 | **Nearest Intersection:**
Status: C | **Municipality:**
Report Type: Standard Report | **Client Prov/State:** ON
Report Date: 06-NOV-19 | **Search Radius (km):** .25
Date Received: 01-NOV-19 | **X:** -75.69774
Previous Site Name: | **Y:** 45.417552
Lot/Building Size:
Additional Info Ordered:

31	1 of 1	NE/121.1	76.9 / -0.93	**PE3651 - 293 Lisgar Street & 176 Nepean Street** **Ottawa ON K2P 0B6**	EHS

Order No: 20292400956 | **Nearest Intersection:**
Status: C | **Municipality:**
Report Type: Standard Report | **Client Prov/State:** ON
Report Date: 29-SEP-20 | **Search Radius (km):** .25
Date Received: 24-SEP-20 | **X:** -75.6969478
Previous Site Name: | **Y:** 45.4174346
Lot/Building Size:
Additional Info Ordered:

32	1 of 1	NNW/121.2	77.9 / 0.07	**205 Bank Street** **Ottawa ON K2P 1W7**	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Order No:	20120329004	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	4/4/2012 9:17:04 AM	**Search Radius (km):**	0.25
Date Received:	3/29/2012 9:15:30 AM	**X:**	-75.698073
Previous Site Name:		**Y:**	45.417517
Lot/Building Size:			
Additional Info Ordered:			

33	1 of 6	ESE/122.7	76.9 / -0.93	**The Ottawa Xpress** **396 Cooper St Suite 204** **Ottawa ON K2P 2H7**	SCT

Established: 1992
Plant Size (ft²):
Employment: 15

--Details--
Description: Newspaper Publishers
SIC/NAICS Code: 511110

33	2 of 6	ESE/122.7	76.9 / -0.93	**The Ottawa X Press - Div. of Communications Voir Inc.** **396 Cooper St Suite 204** **Ottawa ON K2P 2H7**	SCT

Established: 1992
Plant Size (ft²):
Employment: 15

--Details--
Description: Newspaper Publishers
SIC/NAICS Code: 511110

33	3 of 6	ESE/122.7	76.9 / -0.93	**Communications Voir Inc.** **396 Cooper St Suite 204** **Ottawa ON K2P 2H7**	SCT

Established: 1992
Plant Size (ft²):
Employment: 15

--Details--
Description: Newspaper Publishers
SIC/NAICS Code: 511110

33	4 of 6	ESE/122.7	76.9 / -0.93	**Communications Voir Inc.** **396 Cooper St Suite 204** **Ottawa ON K2P 2H7**	SCT

Established: 2000
Plant Size (ft²):
Employment: 15

--Details--

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Newspaper Publishers			
SIC/NAICS Code:		511110			

33	5 of 6	ESE/122.7	76.9 / -0.93	**Ottawa X Press** **396 Cooper St Suite 204** **Ottawa ON K2P 2H7**	SCT

Established:
Plant Size (ft²):
Employment: 14

--Details--
Description: Periodical Publishers
SIC/NAICS Code: 511120

33	6 of 6	ESE/122.7	76.9 / -0.93	**Imagnan Corp.** **396 Cooper St Suite 203** **Ottawa ON K2P 2H7**	SCT

Established: 1995
Plant Size (ft²):
Employment: 5

--Details--
Description: All Other Industrial Machinery Manufacturing
SIC/NAICS Code: 333299

34	1 of 1	N/124.5	77.9 / 0.07	**203 Bank St** **Ottawa ON K2P1W7**	EHS

Order No: 20150804104
Status: C
Report Type: Custom Report
Report Date: 10-AUG-15
Date Received: 04-AUG-15
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.697868
Y: 45.417577

35	1 of 1	WNW/125.7	77.9 / 0.07	**215 Nepean St** **Ottawa ON K2P2K5**	EHS

Order No: 20150731085
Status: C
Report Type: Standard Report
Report Date: 10-AUG-15
Date Received: 31-JUL-15
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.698906
Y: 45.417178

36	1 of 5	N/125.9	77.9 / 0.07	**CAPITAL XTRA INC.** **177 NEPEAN ST SUITE 500** **OTTAWA ON K2P 0B4**	SCT

Established: 1994
Plant Size (ft²): 1800
Employment: 7

--Details--
Description: Newspaper Publishers
SIC/NAICS Code: 511110

---

36 | **2 of 5** | **N/125.9** | **77.9 / 0.07** | **PRIVATE RESIDENCE**
177 NIPEON STREET FURNACE OIL TANK
OTTAWA CITY ON | **SPL**

Ref No: 164499
Year:
Incident Dt: //
Dt MOE Arvl on Scn:
MOE Reported Dt: 2/9/1999
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: UNDERGROUND TANK LEAK
Incident Preceding Spill:
Incident Reason: UNKNOWN
Incident Summary: PVT OWNER- UNK QTY FURNACE OIL TO GND, LEAK IN BURIED TANK.
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
36	3 of 5	N/125.9	77.9 / 0.07	District Realty Corporation 177 Nepean Street Ottawa ON K2P 0B4	GEN

Generator Info

Generator No:	ON3439760	***Choice of Contact:***	
Approval Years:	05	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	531310
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Real Estate Property Managers		

Waste Detail(s)

Waste Class:	243
Waste Class Name:	PCB'S

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
36	4 of 5	N/125.9	77.9 / 0.07	Mel Cohen Realty Ltd. 177 Nepean Street Ottawa ON	CA

Certificate #:	4169-6X5R3J
Application Year:	2007
Issue Date:	1/18/2007
Approval Type:	Air
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
36	5 of 5	N/125.9	77.9 / 0.07	Mel Cohen Realty Ltd. 177 Nepean Street Ottawa ON K1Y 2E9	ECA

Approval No:	4169-6X5R3J	***MOE District:***	Ottawa
Approval Date:	2007-01-18	***City:***	
Status:	Approved	***Longitude:***	-75.697105
Record Type:	ECA	***Latitude:***	45.417862
Link Source:	IDS	***Geometry X:***	
SWP Area Name:	Rideau Valley	***Geometry Y:***	
Approval Type:	ECA-AIR		
Project Type:	AIR		
Business Name:	Mel Cohen Realty Ltd.		
Address:	177 Nepean Street		
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/7918-6JULYV-14.pdf		
PDF Site Location:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
37	1 of 1	ENE/126.4	76.9 / -0.93	355 COOPER ST OTTAWA ON	WWIS

Well ID: 7305580
Construction Date:
Use 1st: Test Hole
Use 2nd: Monitoring
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: Z212307
Tag: A182697
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 02/13/2018
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305580.pdf

Additional Detail(s) (Map)

Well Completed Date: 01/09/2018
Year Completed: 2018
Depth (m): 7.62
Latitude: 45.4169977753238
Longitude: -75.6962291165246
X: -75.69622895463574
Y: 45.41699776833719
Path: 730\7305580.pdf

Bore Hole Information

Bore Hole ID: 1006985634
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 01/09/2018
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445526.00
North83: 5029511.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1007145607
Layer: 2
Color: 6
General Color: BROWN

Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 0.6100000143051147
Formation End Depth: 4.570000171661377
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007145606
Layer: 1
Color: 6
General Color: BROWN
Material 1: 11
Material 1 Desc: GRAVEL
Material 2:
Material 2 Desc:
Material 3: 77
Material 3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 0.6100000143051147
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007145608
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 4.570000171661377
Formation End Depth: 7.619999885559082
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007145617
Layer: 2
Plug From: 0.3100000023841858
Plug To: 3.9600000381469727
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007145618
Layer: 3
Plug From: 3.9600000381469727
Plug To: 7.619999885559082
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145616
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1007145615
Method Construction Code:	D
Method Construction:	Direct Push
Other Method Construction:	

Pipe Information

Pipe ID:	1007145605
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1007145611
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	4.570000171661377
Casing Diameter:	4.03000020980835
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1007145612
Layer:	1
Slot:	10
Screen Top Depth:	4.570000171661377
Screen End Depth:	7.619999885559082
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	4.840000152587891

Water Details

Water ID:	1007145610
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	m

Hole Diameter

Hole ID:	1007145609
Diameter:	8.25

Depth From: 0.0
Depth To: 7.619999885559082
Hole Depth UOM: m
Hole Diameter UOM: cm

---

38 | **1 of 1** | **ESE/127.2** | **76.9 / -0.93** | **275 Bank St, Ottawa ON K2P2L6** | **EHS**

Order No: 20160210002
Status: C
Report Type: Custom Report
Report Date: 16-FEB-16
Date Received: 10-FEB-16
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.696311
Y: 45.415823

---

39 | **1 of 11** | **S/127.5** | **77.9 / 0.07** | **Centretown Community Health Centre Inc., 420 Cooper Street, Ottawa ON K2P 2N6** | **GEN**

Generator Info

Generator No: ON9263707
Approval Years: 2010
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Community Health Centres
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621494

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

39 | **2 of 11** | **S/127.5** | **77.9 / 0.07** | **Centretown Community Health Centre Inc., 420 Cooper Street, Ottawa ON K2P 2N6** | **GEN**

Generator Info

Generator No: ON9263707
Approval Years: 2011
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Community Health Centres
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621494

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

39 ***3 of 11*** ***S/127.5*** ***77.9 / 0.07*** ***Centretown Community Health Centre Inc.*** ***GEN***
420 Cooper Street
Ottawa ON K2P 2N6

Generator Info

Generator No: ON9263707
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Community Health Centres

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621494

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

39 ***4 of 11*** ***S/127.5*** ***77.9 / 0.07*** ***Centretown Community Health Centre Inc.*** ***GEN***
420 Cooper Street
Ottawa ON

Generator Info

Generator No: ON9263707
Approval Years: 2013
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621494

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

39 | ***5 of 11*** | ***S/127.5*** | ***77.9 / 0.07*** | ***Centretown Community Health Centre Inc.*** ***420 Cooper Street*** ***Ottawa ON K2P 2N6*** | ***GEN***

Generator Info

Generator No: ON9263707
Approval Years: 2016
Status:
PO Box No:
Country: Canada
Co Admin: Dan McNamara
Phone No Admin: 613-233-4443 Ext.2173
SIC Description: 621494

Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 621494

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

39 | ***6 of 11*** | ***S/127.5*** | ***77.9 / 0.07*** | ***Centretown Community Health Centre Inc.*** ***420 Cooper Street*** ***Ottawa ON K2P 2N6*** | ***GEN***

Generator Info

Generator No: ON9263707
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin: Dan McNamara
Phone No Admin: 613-233-4443 Ext.2173
SIC Description: 621494

Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 621494

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	7 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No:	ON9263707	***Choice of Contact:***	CO_ADMIN
Approval Years:	2014	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	621494
Country:	Canada		
Co Admin:	Dan McNamara		
Phone No Admin:	613-233-4443 Ext.2173		
SIC Description:	621494		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	8 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No:	ON9263707	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	9 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No: ON9263707
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	10 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No: ON9263707
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
39	11 of 11	S/127.5	77.9 / 0.07	Centretown Community Health Centre Inc. 420 Cooper Street Ottawa ON K2P 2N6	GEN

Generator Info

Generator No: ON9263707
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Phone No Admin:
SIC Description:

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: PATHOLOGICAL WASTES

2017 Generator Info

Gen No: ON9263707
ID: 36175
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 621494
NAICS Code2:
NAICS Code3:
Gen Name: Centretown Community Health Centre Inc.
Gen Div:
Gen Op Name: Centretown Community Health Centre
Gen Op Div:
Site Adrs1: 420 Cooper Street
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2P 2N6
Site Country: Canada
Co Official: Christine Nadori
Co Admin: Dan McNamara
Choice of Contact: CO_ADMIN
Phone No Official: 613-233-4443 Ext.2135
Phone No Admin: 613-233-4443 Ext.2173
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2017 Generator Manifest

ID: 64530
Generator No: ON9263707
Receiver Type: 030
Waste Char: P
Waste Code: 312
Sum Received Qty: 172.94
Waste Class Name: PATHOLOGICAL WASTES
Count Manifests: 7
District: 402

2017 Generator Manifest

ID: 64529
Generator No: ON9263707
Receiver Type: 030
Waste Char: A
Waste Code: 261
Sum Received Qty: 35.46
Waste Class Name: PHARMACEUTICALS
Count Manifests: 7
District: 402

2018 Generator Info

Gen No: ON9263707
ID: 36886
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 621494
Choice of Contact: CO_ADMIN
Phone No Official: 613-233-4443 Ext.2135
Phone No Admin: 613-233-4443 Ext.2173
County Ont: OTTAWA CARLTON (RM)
County Out:

NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Centretown Community Health Centre Inc.		
Gen Div:			
Gen Op Name:	Centretown Community Health Centre		
Gen Op Div:			
Site Adrs1:	420 Cooper Street		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2N6		
Site Country:	Canada		
Co Official:	Christine Nadori		
Co Admin:	Dan McNamara		

2018 Generator Manifest

ID:	65024	**Sum Received Qty:**	153.9
Generator No:	ON9263707	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	6
Waste Char:	P	**District:**	402
Waste Code:	312		

2018 Generator Manifest

ID:	65023	**Sum Received Qty:**	36.6
Generator No:	ON9263707	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	6
Waste Char:	A	**District:**	402
Waste Code:	261		

2019 Generator Info

Gen No:	ON9263707	**Choice of Contact:**	CO_ADMIN
ID:	37416	**Phone No Official:**	613-233-4443 Ext.2135
Contaminated Fac:	N	**Phone No Admin:**	613-233-4443 Ext.2173
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	621494	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Centretown Community Health Centre Inc.		
Gen Div:			
Gen Op Name:	Centretown Community Health Centre		
Gen Op Div:			
Site Adrs1:	420 Cooper Street		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2N6		
Site Country:	Canada		
Co Official:	Christine Nadori		
Co Admin:	Dan McNamara		

2019 Generator Manifest

ID:	65024	**Sum Received Qty:**	186.0

Generator No:	ON9263707	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	7
Waste Char:	P	**District:**	402
Waste Code:	312		

2019 Generator Manifest

ID:	65023	**Sum Received Qty:**	30.0
Generator No:	ON9263707	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	6
Waste Char:	A	**District:**	402
Waste Code:	261		

2020 Generator Info

Gen No:	ON9263707	**Choice of Contact:**	CO_OFFICIAL
ID:	37158	**Phone No Official:**	613-233-4443 Ext.2135
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	621494	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name:	Centretown Community Health Centre Inc.
Gen Div:	
Gen Op Name:	Centretown Community Health Centre
Gen Op Div:	
Site Adrs1:	420 Cooper Street
Site Bldg:	
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K2P 2N6
Site Country:	Canada
Co Official:	Julie Genzel
Co Admin:	

2020 Generator Manifest

ID:	61129	**Sum Received Qty:**	61.7
Generator No:	ON9263707	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	4
Waste Char:	P	**District:**	402
Waste Code:	312		

2020 Generator Manifest

ID:	61126	**Sum Received Qty:**	20.1
Generator No:	ON9263707	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	A	**District:**	305
Waste Code:	261		

2020 Generator Manifest

ID:	61127	**Sum Received Qty:**	27.9
Generator No:	ON9263707	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	P	**District:**	305
Waste Code:	312		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

2020 Generator Manifest

ID:	61128	***Sum Received Qty:***	21.1
Generator No:	ON9263707	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	4
Waste Char:	A	***District:***	402
Waste Code:	261		

2021 Generator Info

Gen No:	ON9263707	***Choice of Contact:***	CO_OFFICIAL
ID:	38127	***Phone No Official:***	613-233-4443 Ext.2135
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	621494	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Centretown Community Health Centre Inc.		
Gen Div:			
Gen Op Name:	Centretown Community Health Centre		
Gen Op Div:			
Site Adrs1:	420 Cooper Street		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2N6		
Site Country:	Canada		
Co Official:	Julie Genzel		
Co Admin:			

2021 Generator Manifest

ID:	63922	***Sum Received Qty:***	36.38
Generator No:	ON9263707	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	7
Waste Char:	A	***District:***	402
Waste Code:	261		

2021 Generator Manifest

ID:	63923	***Sum Received Qty:***	141.4
Generator No:	ON9263707	***Waste Class Name:***	PATHOLOGICAL WASTES
Receiver Type:	030	***Count Manifests:***	7
Waste Char:	P	***District:***	402
Waste Code:	312		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	1 of 7	S/131.1	77.9 / 0.07	***GVT. OF CAN. - R.C.M.P.*** ***OTTAWA A DIVISION, DRUG SECTION 400*** ***COOPER STREET*** ***OTTAWA ON K1A 0R4***	GEN

Generator Info

Generator No:	ON0283126	***Choice of Contact:***	
Approval Years:	86,87,88,89,90,92,93,97,98,99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	0007

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Country:
Co Admin:
Phone No Admin:
SIC Description: LETTER ACKNOWLEDG.

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	2 of 7	S/131.1	77.9 / 0.07	GVT. OF CAN. - R.C.M.P. 18-132 OTTAWA A DIVISION, DRUG SECTION 400 COOPER STREET OTTAWA ON K1A 0R4	GEN

Generator Info

Generator No: ON0283126
Approval Years: 94,95,96
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: POLICE SERVICES
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8123

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	3 of 7	S/131.1	77.9 / 0.07	400 Cooper Street Ottawa ON K2P 2H8	EHS

Order No: 20050121005
Status: C
Report Type:
Report Date: 1/31/2005
Date Received: 1/21/2005
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection: Cooper St & Bank St
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.697694
Y: 45.415475

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	4 of 7	S/131.1	77.9 / 0.07	400 Cooper Street, Ottawa ON K2P 2H8	EHS

Order No: 20070201023
Nearest Intersection:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status:	C	**Municipality:**	
Report Type:	CAN - Custom Report	**Client Prov/State:**	
Report Date:	2/7/2007	**Search Radius (km):**	0.25
Date Received:	2/1/2007	**X:**	-75.697734
Previous Site Name:		**Y:**	45.415526
Lot/Building Size:			
Additional Info Ordered:			

---

40 | ***5 of 7*** | ***S/131.1*** | ***77.9 / 0.07*** | ***400 Cooper Street Ottawa ON K2P 2N1*** | ***EHS***

Order No:	20190926204	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	QC
Report Date:	01-OCT-19	**Search Radius (km):**	.25
Date Received:	26-SEP-19	**X:**	-75.697355
Previous Site Name:		**Y:**	45.415736
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory		

---

40 | ***6 of 7*** | ***S/131.1*** | ***77.9 / 0.07*** | ***400 Cooper Building Inc. 400 Cooper Street Ottawa ON K2P 2H8*** | ***GEN***

Generator Info

Generator No:	ON3843447	**Choice of Contact:**	
Approval Years:	As of Oct 2022	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	OIL SKIMMINGS & SLUDGES

---

40 | ***7 of 7*** | ***S/131.1*** | ***77.9 / 0.07*** | ***400 Cooper Street Ottawa ON K2P 2N1*** | ***EHS***

Order No:	22011700090	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	QC
Report Date:	24-JAN-22	**Search Radius (km):**	.25
Date Received:	17-JAN-22	**X:**	-75.6973548
Previous Site Name:		**Y:**	45.4157364
Lot/Building Size:			
Additional Info Ordered:			

---

41 | ***1 of 5*** | ***N/131.9*** | ***76.9 / -0.95*** | ***E.A.S. ILLUSTRATORS & PRINTERS LTD 171 NEPEAN ST. OTTAWA ON K2P 0B4*** | ***GEN***

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON1203100	***Choice of Contact:***	
Approval Years:	89	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	2811
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	BUSINESS FORMS PRINT		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
41	2 of 5	N/131.9	76.9 / -0.95	***E.A.S. ILLUSTRATORS & PRINTERS LTD14-740*** ***171 NEPEAN ST.*** ***OTTAWA ON K2P 0B4***	GEN

Generator Info

Generator No:	ON1203100	***Choice of Contact:***	
Approval Years:	92,93,94,95,96	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	2811
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	BUSINESS FORMS PRINT		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
41	3 of 5	N/131.9	76.9 / -0.95	***E.A.S. (OUT OF BUS) 14-740*** ***171 NEPEAN ST.*** ***OTTAWA ON K2P 0B4***	GEN

Generator Info

Generator No:	ON1203100	***Choice of Contact:***	
Approval Years:	97,98	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	2811
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	BUSINESS FORMS PRINT.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
41	4 of 5	N/131.9	76.9 / -0.95	ARMCO PRINT 02-638 171 NEPEAN STREET OTTAWA ON K2P 0B4	GEN

Generator Info

Generator No:	ON1550000	**Choice of Contact:**	
Approval Years:	92,93,96,97,98	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2819
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER COMM. PRINTING		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
41	5 of 5	N/131.9	76.9 / -0.95	ARMCO PRINT 02-638 171 NEPEAN STREET OTTAWA ON K2P 0B4	GEN

Generator Info

Generator No:	ON1550000	**Choice of Contact:**	
Approval Years:	94,95	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2819
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER COMM. PRINTING		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
42	1 of 1	ENE/133.1	76.9 / -0.93	355 COOPER ST OTTAWA ON	WWIS

Well ID:	7305582	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	02/13/2018
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z212306	**Contractor:**	7241
Tag:	A182722	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	

Static Water Level: **Zone:**
Clear/Cloudy: **UTM Reliability:**
Municipality: OTTAWA CITY
Site Info:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305582.pdf

Additional Detail(s) (Map)

Well Completed Date: 01/09/2018
Year Completed: 2018
Depth (m): 3.96
Latitude: 45.4169893978879
Longitude: -75.6961267659723
X: -75.69612660422017
Y: 45.416989391278506
Path: 730\7305582.pdf

Bore Hole Information

Bore Hole ID: 1006985640 **Elevation:**
DP2BR: **Elevrc:**
Spatial Status: **Zone:** 18
Code OB: **East83:** 445534.00
Code OB Desc: **North83:** 5029510.00
Open Hole: **Org CS:** UTM83
Cluster Kind: **UTMRC:** 4
Date Completed: 01/09/2018 **UTMRC Desc:** margin of error : 30 m - 100 m
Remarks: **Location Method:** wwr
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Overburden and Bedrock Materials Interval

Formation ID: 1007145636
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 1.8300000429153442
Formation End Depth: 3.9600000381469727
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007145635
Layer: 2
Color: 6
General Color: BROWN
Material 1: 05

Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 0.3100000023841858
Formation End Depth: 1.8300000429153442
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007145634
Layer: 1
Color: 2
General Color: GREY
Material 1: 11
Material 1 Desc: GRAVEL
Material 2:
Material 2 Desc:
Material 3: 77
Material 3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 0.3100000023841858
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007145646
Layer: 3
Plug From: 0.9100000262260437
Plug To: 3.9600000381469727
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007145644
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007145645
Layer: 2
Plug From: 0.3100000023841858
Plug To: 0.9100000262260437
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1007145643
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID:	1007145633
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1007145639
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	0.9100000262260437
Casing Diameter:	3.450000047683716
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1007145640
Layer:	1
Slot:	10
Screen Top Depth:	0.9100000262260437
Screen End Depth:	3.9600000381469727
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	4.210000038146973

Water Details

Water ID:	1007145638
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	m

Hole Diameter

Hole ID:	1007145637
Diameter:	5.679999828338623
Depth From:	0.0
Depth To:	3.9600000381469727
Hole Depth UOM:	m
Hole Diameter UOM:	cm

---

43 | ***1 of 1*** | ***SE/133.2*** | ***76.9 / -0.93*** | ***275 Bank Street Ottawa ON K2P 2L6*** | ***EHS***

Order No:	20101027019	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Custom Report	***Client Prov/State:***	ON
Report Date:	11/2/2010	***Search Radius (km):***	0.25
Date Received:	10/27/2010 11:39:28 AM	***X:***	-75.696426
Previous Site Name:		***Y:***	45.415638
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
44	1 of 1	ENE/133.4	76.9 / -0.90	355 COOPER ST OTTAWA ON	WWIS

Well ID:	7305579	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Test Hole	**Date Received:**	02/13/2018
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z212304	**Contractor:**	7241
Tag:	A182713	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305579.pdf

Additional Detail(s) (Map)

Well Completed Date:	01/09/2018
Year Completed:	2018
Depth (m):	7.62
Latitude:	45.4169356279409
Longitude:	-75.6960877624537
X:	-75.69608760028636
Y:	45.41693562108875
Path:	730\7305579.pdf

Bore Hole Information

Bore Hole ID:	1006985631	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445537.00
Code OB Desc:		**North83:**	5029504.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	01/09/2018	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1007145594
Layer:	3
Color:	2

General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.570000171661377
Formation End Depth:	7.619999885559082
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1007145593
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.6100000143051147
Formation End Depth:	4.570000171661377
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1007145592
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	28
Material 2 Desc:	SAND
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.6100000143051147
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145604
Layer:	3
Plug From:	3.9600000381469727
Plug To:	7.619999885559082
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145603
Layer:	2
Plug From:	0.3100000023841858
Plug To:	3.9600000381469727
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145602
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1007145601
Method Construction Code:	D
Method Construction:	Direct Push
Other Method Construction:	

Pipe Information

Pipe ID:	1007145591
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1007145597
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	4.570000171661377
Casing Diameter:	4.03000020980835
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1007145598
Layer:	1
Slot:	10
Screen Top Depth:	4.570000171661377
Screen End Depth:	7.619999885559082
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	4.820000171661377

Water Details

Water ID:	1007145596
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	m

Hole Diameter

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Hole ID: 1007145595
Diameter: 8.25
Depth From: 0.0
Depth To: 7.619999885559082
Hole Depth UOM: m
Hole Diameter UOM: cm

---

45 | **1 of 12** | **SSE/134.3** | **78.0 / 0.16** | **Ontario Addiction Treatment Centres**
401 Somerset Street, West
Ottawa ON K2P 0K1 | **GEN**

Generator Info

Generator No: ON8183220
Approval Years: 2010
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Offices of Physicians

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

45 | **2 of 12** | **SSE/134.3** | **78.0 / 0.16** | **Dedicated National Pharmacy (In Receivership)**
401 Somerset St West
Ottawa ON K2P 0K1 | **GEN**

Generator Info

Generator No: ON8383037
Approval Years: 2010
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Pharmacies and Drug Stores

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 446110

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

45 | **3 of 12** | **SSE/134.3** | **78.0 / 0.16** | **Dedicated National Pharmacy (In Receivership)**
401 Somerset St West
Ottawa ON K2P 0K1 | **GEN**

Generator Info

Generator No: ON8383037
Approval Years: 2011
Status:

Choice of Contact:
Contaminated Fac:
MHSW Facility:

PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Pharmacies and Drug Stores

SIC Code: 446110

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

45 ***4 of 12*** ***SSE/134.3*** ***78.0 / 0.16*** ***Ontario Addiction Treatment Centres*** ***GEN***
401 Somerset Street, West
Ottawa ON K2P 0K1

Generator Info

Generator No: ON8183220
Approval Years: 2011
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Offices of Physicians

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

45 ***5 of 12*** ***SSE/134.3*** ***78.0 / 0.16*** ***Ontario Addiction Treatment Centres*** ***GEN***
401 Somerset Street, West
Ottawa ON K2P 0K1

Generator Info

Generator No: ON8183220
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Offices of Physicians

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 621110

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

45 ***6 of 12*** ***SSE/134.3*** ***78.0 / 0.16*** ***Ontario Addiction Treatment Centres*** ***GEN***
401 Somerset Street, West
Ottawa ON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	
Approval Years:	2013	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	621110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

45	***7 of 12***	***SSE/134.3***	***78.0 / 0.16***	***Ontario Addiction Treatment Centres*** ***401 Somerset Street, West*** ***Ottawa ON K2P0K1***	***GEN***

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2015	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	621110
Country:	Canada		
Co Admin:	Rhonda Daiter		
Phone No Admin:	4168166110 Ext.		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

45	***8 of 12***	***SSE/134.3***	***78.0 / 0.16***	***Ontario Addiction Treatment Centres*** ***401 Somerset Street, West*** ***Ottawa ON K2P0K1***	***GEN***

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2016	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	621110
Country:	Canada		
Co Admin:	Rhonda Daiter		
Phone No Admin:	4168166110 Ext.		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
45	9 of 12	SSE/134.3	78.0 / 0.16	Ontario Addiction Treatment Centres 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2014	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	621110
Country:	Canada		
Co Admin:	Rhonda Daiter		
Phone No Admin:	4168166110 Ext.		
SIC Description:	OFFICES OF PHYSICIANS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
45	10 of 12	SSE/134.3	78.0 / 0.16	Canadian Addiction Treatment Clinics LP 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
45	11 of 12	SSE/134.3	78.0 / 0.16	Canadian Addiction Treatment Clinics LP 401 Somerset Street, West Ottawa ON K2P0K1	GEN

Generator Info

Generator No:	ON8183220	***Choice of Contact:***	
Approval Years:	As of Jul 2020	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
45	12 of 12	SSE/134.3	78.0 / 0.16	**Canadian Addiction Treatment Clinics LP** **401 Somerset Street, West** **Ottawa ON K2P0K1**	GEN

Generator Info

Generator No:	ON8183220	**Choice of Contact:**	
Approval Years:	As of Jan 2021	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

2017 Generator Info

Gen No:	ON8183220	**Choice of Contact:**	CO_OFFICIAL
ID:	32026	**Phone No Official:**	647-988-4071 Ext.
Contaminated Fac:	N	**Phone No Admin:**	647-208-8510 Ext.
MHSW Facility:	N	**County Ont:**	RENFREW
NAICS Code1:	621110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		
Gen Op Div:	O.A.T.C. Ottawa		
Site Adrs1:	401 Somerset Street, West		
Site Bldg:	OATC Ottawa		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P0K1		
Site Country:	Canada		
Co Official:	Raffi Laras		
Co Admin:	Robyn Yack		

2018 Generator Info

Gen No:	ON8183220	**Choice of Contact:**	CO_OFFICIAL
ID:	32626	**Phone No Official:**	647-208-8510 Ext.
Contaminated Fac:	N	**Phone No Admin:**	613-915-5245 Ext.
MHSW Facility:	N	**County Ont:**	RENFREW
NAICS Code1:	621110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		

Gen Op Div:	O.A.T.C. Ottawa
Site Adrs1:	401 Somerset Street, West
Site Bldg:	OATC Ottawa
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K2P0K1
Site Country:	Canada
Co Official:	Robyn Yack
Co Admin:	Lai Leon

2019 Generator Info

Gen No:	ON8183220	**Choice of Contact:**	CO_OFFICIAL
ID:	32999	**Phone No Official:**	4372150418 Ext.
Contaminated Fac:	N	**Phone No Admin:**	613-915-5245 Ext.
MHSW Facility:	N	**County Ont:**	RENFREW
NAICS Code1:	621110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		
Gen Op Div:	O.A.T.C. Ottawa		
Site Adrs1:	401 Somerset Street, West		
Site Bldg:	OATC Ottawa		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P0K1		
Site Country:	Canada		
Co Official:	Michael Liu		
Co Admin:	Lai Leon		

2020 Generator Info

Gen No:	ON8183220	**Choice of Contact:**	CO_OFFICIAL
ID:	32723	**Phone No Official:**	4372150418 Ext.
Contaminated Fac:	N	**Phone No Admin:**	613-915-5245 Ext.
MHSW Facility:	N	**County Ont:**	RENFREW
NAICS Code1:	621110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Canadian Addiction Treatment Clinics LP		
Gen Div:			
Gen Op Name:	Ontario Addiction Treatment Centres		
Gen Op Div:	O.A.T.C. Ottawa		
Site Adrs1:	401 Somerset Street, West		
Site Bldg:	OATC Ottawa		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P0K1		
Site Country:	Canada		
Co Official:	Michael Liu		
Co Admin:	Lai Leon		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	1 of 2	E/134.3	76.9 / -0.90	OTTAWA HYDRO 375 COOPER STREET TRANSFORMER OTTAWA CITY ON K2P 0G8	SPL

Ref No:	117139	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	8/13/1995	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	8/13/1995	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	COOLING SYSTEM LEAK		
Incident Preceding Spill:			
Incident Reason:	UNKNOWN		
Incident Summary:	OTTAWA HYDRO-15 LITERS TRANSFORMER OIL TO GRND, PCB TEST PENDING.		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	2 of 2	E/134.3	76.9 / -0.90	375 Cooper Street Ottawa ON K2P 0G8	EHS

Order No:	20090506031	**Nearest Intersection:**	Cooper Street and Bank Street
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	5/14/2009	**Search Radius (km):**	0.25
Date Received:	5/6/2009	**X:**	-75.696198
Previous Site Name:		**Y:**	45.41659

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size:					
Additional Info Ordered:					

47	1 of 2	N/137.5	77.3 / -0.47	JacintalInk 207 Bank St Suite 242 Ottawa ON K2P 2N2	SCT

Established: 2002
Plant Size (ft²):
Employment: 2

--Details--
Description: Other Publishers
SIC/NAICS Code: 511190

47	2 of 2	N/137.5	77.3 / -0.47	To Be Publications Inc. 207 Bank St Ottawa ON K2P 2N2	SCT

Established: 01-JUN-02
Plant Size (ft²):
Employment:

--Details--
Description: Periodical Publishers
SIC/NAICS Code: 511120

48	1 of 1	WSW/139.1	77.9 / 0.07	ON	BORE

Borehole ID:	613293	**Inclin FLG:**	No
OGF ID:	215514594	**SP Status:**	Initial Entry
Status:		**Surv Elev:**	No
Type:	Borehole	**Piezometer:**	No
Use:		**Primary Name:**	
Completion Date:	JAN-1965	**Municipality:**	
Static Water Level:	12.2	**Lot:**	
Primary Water Use:		**Township:**	
Sec. Water Use:		**Latitude DD:**	45.41609
Total Depth m:	-999	**Longitude DD:**	-75.699353
Depth Ref:	Ground Surface	**UTM Zone:**	18
Depth Elev:		**Easting:**	445281
Drill Method:		**Northing:**	5029412
Orig Ground Elev m:	73.2	**Location Accuracy:**	
Elev Reliabil Note:		**Accuracy:**	Not Applicable
DEM Ground Elev m:	73.3		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218394541	**Mat Consistency:**	Firm
Top Depth:	2.1	**Material Moisture:**	
Bottom Depth:	5.2	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Clay	**Geologic Formation:**	

Material 2:	Silt	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	CLAY. GREY,FIRM.		

Geology Stratum ID:	218394543	**Mat Consistency:**	
Top Depth:	9.8	**Material Moisture:**	
Bottom Depth:	14.3	**Material Texture:**	
Material Color:	Black	**Non Geo Mat Type:**	
Material 1:	Bedrock	**Geologic Formation:**	
Material 2:	Shale	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	BEDROCK. BLACK,FRACTURED.		

Geology Stratum ID:	218394542	**Mat Consistency:**	Compact
Top Depth:	5.2	**Material Moisture:**	
Bottom Depth:	9.8	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Till	**Geologic Formation:**	
Material 2:	Sand	**Geologic Group:**	
Material 3:	Silt	**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	TILL. GREY,COMPACT.		

Geology Stratum ID:	218394544	**Mat Consistency:**	
Top Depth:	14.3	**Material Moisture:**	
Bottom Depth:		**Material Texture:**	
Material Color:	Black	**Non Geo Mat Type:**	
Material 1:	Bedrock	**Geologic Formation:**	
Material 2:	Limestone	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	BEDROCK,LIMESTONE. BLACK,FOSSILIFEROUS, WATER STABLE AT 200.3 FEET.0050 043 00080 058 0 **Note: Many records provided by the department have a truncated [Stratum Description] field.		

Geology Stratum ID:	218394540	**Mat Consistency:**	Compact
Top Depth:	0	**Material Moisture:**	
Bottom Depth:	2.1	**Material Texture:**	
Material Color:		**Non Geo Mat Type:**	
Material 1:	Sand	**Geologic Formation:**	
Material 2:	Silt	**Geologic Group:**	
Material 3:	Gravel	**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	SAND. COMPACT.		

Source

Source Type:	Data Survey	**Source Appl:**	Spatial/Tabular
Source Orig:	Geological Survey of Canada	**Source Iden:**	1
Source Date:	1956-1972	**Scale or Res:**	Varies
Confidence:		**Horizontal:**	NAD27
Observatio:		**Verticalda:**	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: OTTAWA2.txt RecordID: 058010 NTS_Sheet: 31G05G		
Confiden 1:			

Source List

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Source Identifier: 1
Source Type: Data Survey
Source Date: 1956-1972
Scale or Resolution: Varies
Source Name: Urban Geology Automated Information System (UGAIS)
Source Originators: Geological Survey of Canada
Horizontal Datum: NAD27
Vertical Datum: Mean Average Sea Level
Projection Name: Universal Transverse Mercator

---

49 | **1 of 7** | **SW/142.5** | **77.9 / 0.07**

SEALTEST
DIVISION OF AULT FOODS; 453 COOPER STREET
OTTAWA ON K2P 0H1

NPCB

Company Code: O0463
Industry: Food/Beverage/Water
Site Status:
Transaction Date: 10/29/1990
Inspection Date: 11/26/1987

---

49 | **2 of 7** | **SW/142.5** | **77.9 / 0.07**

AULT FOODS
453 COOPER STREET OTTAWA WINCHESTER
490 GORDON STREET
OTTAWA CITY ON K2P 0H1

SPL

Ref No: 8572
Year:
Incident Dt: 8/24/1988
Dt MOE Arvl on Scn:
MOE Reported Dt: 8/24/1988
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: VALVE/FITTING LEAK OR FAILURE
Incident Preceding Spill:
Incident Reason: MATERIAL FAILURE
Incident Summary: AULT FOODS- AMMONIA LEAK TO ATMOSPHERE FROM VALVE IN COOLING SYSTEM
Environment Impact:
Health Env Consequence:
Nature of Impact: OTHER
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Contaminant UN No 1:	
Receiving Medium:	AIR
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	
SAC Action Class:	
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	3 of 7	SW/142.5	77.9 / 0.07	AULT FOODS 453 COOPER ST.AT KENT ST. OTTAWA OTTAWA DAIRY OTTAWA CITY ON K2P 0H1	SPL

Ref No:	42547	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	10/24/1990	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	10/24/1990	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	OTHER CAUSE (N.O.S.)		
Incident Preceding Spill:			
Incident Reason:	UNKNOWN		
Incident Summary:	AULT FOODS-130L. DIESEL :TO GROUND AND SEWERS.		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:	Other		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND / WATER		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported:					
System Facility Address:					

49	4 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITED 453 COOPER STREET OTTAWA ON K2P 0H1	GEN

Generator Info

Generator No:	ON0632408	Choice of Contact:	
Approval Years:	88	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	1041
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	FLUID MILK IND.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

49	5 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITED 453 COOPER STREET OTTAWA ON K2P 0H1	GEN

Generator Info

Generator No:	ON0632408	Choice of Contact:	
Approval Years:	89,90	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	1041
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	FLUID MILK IND.		

Waste Detail(s)

Waste Class:	122
Waste Class Name:	ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	6 of 7	SW/142.5	77.9 / 0.07	AULT FOODS LIMITE(OUT OF BUSINESS)03-320 453 COOPER STREET OTTAWA ON K2P 0H1	GEN

Generator Info

Generator No: ON0632408
Approval Years: 92,93,94,95,96,97,98
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: FLUID MILK IND.

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 1041

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	7 of 7	SW/142.5	77.9 / 0.07	453 Cooper Street Ottawa ON K2P 0H1	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Order No:	23111500012	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	20-NOV-23	**Search Radius (km):**	.25
Date Received:	15-NOV-23	**X:**	-75.6988326
Previous Site Name:		**Y:**	45.4154862
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory		

50	1 of 1	NNW/145.1	77.9 / 0.07	195 BANK ST. OTTAWA ON	WWIS

Well ID:	7246053	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:	0	**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	08/05/2015
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z209011	**Contractor:**	7241
Tag:	A178455	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	LANARK
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	DRUMMOND TOWNSHIP		
Site Info:			

Bore Hole Information

Bore Hole ID:	1005541565	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	399333.00
Code OB Desc:		**North83:**	4973764.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	9
Date Completed:	07/04/2015	**UTMRC Desc:**	unknown UTM
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1005693476
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06

Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	1.5
Formation End Depth:	8.84000015258789
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1005693475
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	01
Material 1 Desc:	FILL
Material 2:	85
Material 2 Desc:	SOFT
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.5
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1005693486
Layer:	3
Plug From:	7.010000228881836
Plug To:	8.84000015258789
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1005693484
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1005693485
Layer:	2
Plug From:	0.3100000023841858
Plug To:	7.010000228881836
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1005693483
Method Construction Code:	D
Method Construction:	Direct Push
Other Method Construction:	

Pipe Information

Pipe ID: 1005693474
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1005693479
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 7.320000171661377
Casing Diameter: 4.03000020980835
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1005693480
Layer: 1
Slot: 10
Screen Top Depth: 7.320000171661377
Screen End Depth: 8.84000015258789
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 4.820000171661377

Water Details

Water ID: 1005693478
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole Diameter

Hole ID: 1005693477
Diameter: 8.25
Depth From: 0.0
Depth To: 8.84000015258789
Hole Depth UOM: m
Hole Diameter UOM: cm

---

51 | ***1 of 1*** | ***NW/145.2*** | ***77.9 / 0.07*** | ***ON*** | ***WWIS***

Well ID: 1503876
Construction Date:
Use 1st: Domestic
Use 2nd: 0
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No:
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 03/20/1948
Selected Flag: TRUE
Abandonment Rec:
Contractor: 3566
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:

Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1503876.pdf

Additional Detail(s) (Map)

Well Completed Date:	02/12/1948
Year Completed:	1948
Depth (m):	22.86
Latitude:	45.4175315702752
Longitude:	-75.6987318200623
X:	-75.6987316583455
Y:	45.41753156300752
Path:	150\1503876.pdf

Bore Hole Information

Bore Hole ID:	10025919	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445330.70
Code OB Desc:		**North83:**	5029572.00
Open Hole:		**Org CS:**	
Cluster Kind:		**UTMRC:**	9
Date Completed:	02/12/1948	**UTMRC Desc:**	unknown UTM
Remarks:		**Location Method:**	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	930997781
Layer:	2
Color:	
General Color:	
Material 1:	17
Material 1 Desc:	SHALE
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	28.0
Formation End Depth:	75.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	930997780

Layer:	1
Color:	
General Color:	
Material 1:	06
Material 1 Desc:	SILT
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	28.0
Formation End Depth UOM:	ft

Method of Construction & Well Use

Method Construction ID:	961503876
Method Construction Code:	1
Method Construction:	Cable Tool
Other Method Construction:	

Pipe Information

Pipe ID:	10574489
Casing No:	1
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	930044586
Layer:	2
Material:	4
Open Hole or Material:	OPEN HOLE
Depth From:	
Depth To:	75.0
Casing Diameter:	4.0
Casing Diameter UOM:	inch
Casing Depth UOM:	ft

Construction Record - Casing

Casing ID:	930044585
Layer:	1
Material:	1
Open Hole or Material:	STEEL
Depth From:	
Depth To:	30.0
Casing Diameter:	4.0
Casing Diameter UOM:	inch
Casing Depth UOM:	ft

Results of Well Yield Testing

Pumping Test Method Desc:	PUMP
Pump Test ID:	991503876
Pump Set At:	
Static Level:	8.0
Final Level After Pumping:	12.0
Recommended Pump Depth:	
Pumping Rate:	10.0
Flowing Rate:	

Recommended Pump Rate:	10.0
Levels UOM:	ft
Rate UOM:	GPM
Water State After Test Code:	1
Water State After Test:	CLEAR
Pumping Test Method:	1
Pumping Duration HR:	0
Pumping Duration MIN:	30
Flowing:	No

Water Details

Water ID:	933456890
Layer:	1
Kind Code:	1
Kind:	FRESH
Water Found Depth:	
Water Found Depth UOM:	ft

---

52 | ***1 of 1*** | ***NW/145.4*** | ***77.9 / 0.07*** | ***ON*** | ***BORE***

Borehole ID:	613321	**Inclin FLG:**	No
OGF ID:	215514620	**SP Status:**	Initial Entry
Status:		**Surv Elev:**	No
Type:	Borehole	**Piezometer:**	No
Use:		**Primary Name:**	
Completion Date:	FEB-1948	**Municipality:**	
Static Water Level:	11.0	**Lot:**	
Primary Water Use:		**Township:**	
Sec. Water Use:		**Latitude DD:**	45.417533
Total Depth m:	22.9	**Longitude DD:**	-75.698732
Depth Ref:	Ground Surface	**UTM Zone:**	18
Depth Elev:		**Easting:**	445331
Drill Method:		**Northing:**	5029572
Orig Ground Elev m:	67.1	**Location Accuracy:**	
Elev Reliabil Note:		**Accuracy:**	Not Applicable
DEM Ground Elev m:	72.5		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218394641	**Mat Consistency:**	
Top Depth:	0	**Material Moisture:**	
Bottom Depth:	8.5	**Material Texture:**	
Material Color:		**Non Geo Mat Type:**	
Material 1:	Silt	**Geologic Formation:**	
Material 2:		**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	SILT.		

Geology Stratum ID:	218394642	**Mat Consistency:**	Loose
Top Depth:	8.5	**Material Moisture:**	
Bottom Depth:	22.9	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Shale	**Geologic Formation:**	
Material 2:		**Geologic Group:**	
Material 3:		**Geologic Period:**	

Material 4: ***Depositional Gen:***
Gsc Material Description:
Stratum Description: SHALE. 0075ED. BEDROCK. BEDROCK. STIFF. CLAY. GREY,STIFF. SAND. LOOSE, WATER **Note: Many records provided by the department have a truncated [Stratum Description] field.

Source

Source Type: Data Survey
Source Orig: Geological Survey of Canada
Source Date: 1956-1972
Confidence:
Observatio:
Source Name: Urban Geology Automated Information System (UGAIS)
Source Details: File: OTTAWA2.txt RecordID: 05829 NTS_Sheet:
Confiden 1:
Source Appl: Spatial/Tabular
Source Iden: 1
Scale or Res: Varies
Horizontal: NAD27
Verticalda: Mean Average Sea Level

Source List

Source Identifier: 1
Source Type: Data Survey
Source Date: 1956-1972
Scale or Resolution: Varies
Source Name: Urban Geology Automated Information System (UGAIS)
Source Originators: Geological Survey of Canada
Horizontal Datum: NAD27
Vertical Datum: Mean Average Sea Level
Projection Name: Universal Transverse Mercator

---

53 ***1 of 1*** ***ESE/146.0*** ***76.9 / -0.93*** ***Biz Point Inc.***
273 Bank St
Ottawa ON K2P 1X5 ***SCT***

Established: 2004
Plant Size (ft²):
Employment:

--Details--
Description: Digital Printing
SIC/NAICS Code: 323115

---

54 ***1 of 2*** ***S/146.3*** ***77.9 / 0.07*** ***OTTAWA COMMUNITY HOUSING CORPORATION***
395 SOMERSET STREET
OTTAWA ON ***GEN***

Generator Info

Generator No: ON3877609
Approval Years: 2011
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 531112

---

54 ***2 of 2*** ***S/146.3*** ***77.9 / 0.07*** ***Black & McDonald Ltd.***
395 Somerset
Ottawa ON K2L 4X8 ***GEN***

Generator Info

Generator No:	ON5677772	***Choice of Contact:***	
Approval Years:	As of Oct 2019	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

2019 Generator Info

Gen No:	ON5677772	***Choice of Contact:***	CO_OFFICIAL
ID:	22730	***Phone No Official:***	613-731-1182 Ext.2518
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	531310	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Black & McDonald Ltd.		
Gen Div:			
Gen Op Name:	Black & McDonald Ltd.		
Gen Op Div:			
Site Adrs1:	395 Somerset		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2L 4X8		
Site Country:	Canada		
Co Official:	Olivier OO Obiono		
Co Admin:			

2020 Generator Info

Gen No:	ON5677772	***Choice of Contact:***	CO_OFFICIAL
ID:	22463	***Phone No Official:***	613-731-1182 Ext.2518
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	531310	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Black & McDonald Ltd.		
Gen Div:			
Gen Op Name:	Black & McDonald Ltd.		
Gen Op Div:			
Site Adrs1:	395 Somerset		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2L 4X8		

Site Country: Canada
Co Official: Olivier OO Obiono
Co Admin:

---

55 **1 of 1** **E/146.9** **76.2 / -1.62** **315 COOPER ST Ottawa ON** **WWIS**

Well ID:	7312996	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring	**Data Entry Status:**	
Use 2nd:	Test Hole	**Data Src:**	
Final Well Status:	Test Hole	**Date Received:**	06/19/2018
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z277582	**Contractor:**	7241
Tag:	A215904	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7312996.pdf

Additional Detail(s) (Map)

Well Completed Date:	03/02/2018
Year Completed:	2018
Depth (m):	6.096
Latitude:	45.4167302493654
Longitude:	-75.6958168402749
X:	-75.69581667838541
Y:	45.41673024236072
Path:	731\7312996.pdf

Bore Hole Information

Bore Hole ID:	1007108673	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445558.00
Code OB Desc:		**North83:**	5029481.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	03/02/2018	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1007367777
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	08
Material 1 Desc:	FINE SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	06
Material 3 Desc:	SILT
Formation Top Depth:	1.0
Formation End Depth:	10.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1007367776
Layer:	1
Color:	8
General Color:	BLACK
Material 1:	02
Material 1 Desc:	TOPSOIL
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1007367778
Layer:	3
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	10.0
Formation End Depth:	20.0
Formation End Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID:	1007367787
Layer:	2
Plug From:	1.0
Plug To:	9.0
Plug Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID:	1007367788

Layer: 3
Plug From: 9.0
Plug To: 20.0
Plug Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1007367786
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 1007367785
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1007367775
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1007367781
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 10.0
Casing Diameter: 1.3799999952316284
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1007367782
Layer: 1
Slot: 10
Screen Top Depth: 10.0
Screen End Depth: 20.0
Screen Material: 5
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.6799999475479126

Water Details

Water ID: 1007367780
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID:	1007367779
Diameter:	2.375
Depth From:	0.0
Depth To:	20.0
Hole Depth UOM:	ft
Hole Diameter UOM:	inch

56 ***1 of 1*** ***SW/154.9*** ***77.9 / 0.07*** ***ON*** ***BORE***

Borehole ID:	613280	***Inclin FLG:***	No
OGF ID:	215514581	***SP Status:***	Initial Entry
Status:		***Surv Elev:***	No
Type:	Borehole	***Piezometer:***	No
Use:		***Primary Name:***	
Completion Date:		***Municipality:***	
Static Water Level:	12.2	***Lot:***	
Primary Water Use:		***Township:***	
Sec. Water Use:		***Latitude DD:***	45.415283
Total Depth m:	-999	***Longitude DD:***	-75.698704
Depth Ref:	Ground Surface	***UTM Zone:***	18
Depth Elev:		***Easting:***	445331
Drill Method:		***Northing:***	5029322
Orig Ground Elev m:	73.2	***Location Accuracy:***	
Elev Reliabil Note:		***Accuracy:***	Not Applicable
DEM Ground Elev m:	73.1		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218394474	***Mat Consistency:***	
Top Depth:	0	***Material Moisture:***	
Bottom Depth:	18.3	***Material Texture:***	
Material Color:		***Non Geo Mat Type:***	
Material 1:	Till	***Geologic Formation:***	
Material 2:		***Geologic Group:***	
Material 3:		***Geologic Period:***	
Material 4:		***Depositional Gen:***	
Gsc Material Description:			
Stratum Description:	TILL.		

Geology Stratum ID:	218394475	***Mat Consistency:***	Dense
Top Depth:	18.3	***Material Moisture:***	
Bottom Depth:		***Material Texture:***	
Material Color:		***Non Geo Mat Type:***	
Material 1:	Bedrock	***Geologic Formation:***	
Material 2:		***Geologic Group:***	
Material 3:		***Geologic Period:***	
Material 4:		***Depositional Gen:***	
Gsc Material Description:			
Stratum Description:	BEDROCK. WATER STABLE AT 200.0 FEET. UNSPECIFIED. DENSE. UNSPECIFIED. DENSE. UNSPECIFIED.		

Source

Source Type:	Data Survey	***Source Appl:***	Spatial/Tabular
Source Orig:	Geological Survey of Canada	***Source Iden:***	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Source Date:	1956-1972	**Scale or Res:**	Varies
Confidence:	M	**Horizontal:**	NAD27
Observatio:		**Verticalda:**	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: OTTAWA2.txt RecordID: 057880 NTS_Sheet: 31G05G		
Confiden 1:	Logs are approximately correct. Lack of information. Doubtful terminology.		

Source List

Source Identifier:	1	**Horizontal Datum:**	NAD27
Source Type:	Data Survey	**Vertical Datum:**	Mean Average Sea Level
Source Date:	1956-1972	**Projection Name:**	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Originators:	Geological Survey of Canada		

---

57 ***1 of 7*** ***NW/154.9*** ***77.9 / 0.07*** ***OTTAWA MAGAZINE INC.***
192 BANK STREET
OTTAWA ON K2P 1W8 ***GEN***

Generator Info

Generator No:	ON0897800	**Choice of Contact:**	
Approval Years:	86,87,88,89,90	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND.		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

---

57 ***2 of 7*** ***NW/154.9*** ***77.9 / 0.07*** ***OTTAWA MAGAZINE INC.***
192 BANK STREET
OTTAWA ON K2P 1W8 ***GEN***

Generator Info

Generator No:	ON0897800	**Choice of Contact:**	
Approval Years:	92,93,97,98	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	3 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INC. 29-278 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0897800	**Choice of Contact:**	
Approval Years:	94,95,96	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	4 of 7	NW/154.9	77.9 / 0.07	OTTAWA MAGAZINE INCORPORATED 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0897800	**Choice of Contact:**	
Approval Years:	99,00,01	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND.		

Waste Detail(s)

Waste Class:	123
Waste Class Name:	ALKALINE PHOSPHATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	5 of 7	NW/154.9	77.9 / 0.07	OTTAWA(SEE&USE ON0897800 OTTAWA) 192 BANK STREET OTTAWA ON K2P 1W8	GEN

Generator Info

Generator No:	ON0923900	**Choice of Contact:**	
Approval Years:	86,87,88,89,90	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND.		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Class: 123
Waste Class Name: ALKALINE PHOSPHATES

---

57 | **6 of 7** | **NW/154.9** | **77.9 / 0.07** | **OTTAWA(SEE&USE ON0897800 OTTAWA) 29-290**
192 BANK STREET
OTTAWA ON K2P 1W8 | **GEN**

Generator Info

Generator No:	ON0923900	**Choice of Contact:**	
Approval Years:	92,93,94,95,96,97,98	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	2839
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PUBLISHING IND		

---

57 | **7 of 7** | **NW/154.9** | **77.9 / 0.07** | **Cdn Council Tobacco Control**
192 Bank St
Ottawa ON K2P 1W8 | **SCT**

Established: 01-DEC-74
Plant Size (ft²): 5000
Employment:

--Details--
Description: Other Membership Organizations
SIC/NAICS Code: 813990

Description: Social Advocacy Organizations
SIC/NAICS Code: 813310

---

58 | **1 of 1** | **NNE/156.4** | **76.9 / -0.93** | **153 Nepean Street**
Ottawa ON K2P 0B5 | **EHS**

Order No:	20090909031	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	9/10/2009	**Search Radius (km):**	0.25
Date Received:	9/9/2009	**X:**	-75.69705
Previous Site Name:		**Y:**	45.417807
Lot/Building Size:			
Additional Info Ordered:			

---

59 | **1 of 1** | **ENE/156.8** | **76.9 / -0.90** | **355 COOPER ST**
OTTAWA ON | **WWIS**

Well ID:	7305581	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	02/13/2018
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z212305	**Contractor:**	7241

Tag:	A182694	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305581.pdf

Additional Detail(s) (Map)

Well Completed Date:	01/09/2018
Year Completed:	2018
Depth (m):	7.62
Latitude:	45.4170721165401
Longitude:	-75.6958466010876
X:	-75.69584643863357
Y:	45.41707210997362
Path:	730\7305581.pdf

Bore Hole Information

Bore Hole ID:	1006985637	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445556.00
Code OB Desc:		**North83:**	5029519.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	01/09/2018	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1007145622
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	05
Material 2 Desc:	CLAY
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.570000171661377
Formation End Depth:	7.619999885559082
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1007145620
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	01
Material 1 Desc:	FILL
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.8300000429153442
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1007145621
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	1.8300000429153442
Formation End Depth:	4.570000171661377
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145630
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145631
Layer:	2
Plug From:	0.3100000023841858
Plug To:	3.9600000381469727
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007145632
Layer:	3
Plug From:	3.9600000381469727
Plug To:	7.619999885559082
Plug Depth UOM:	m

Method of Construction & Well

Use

Method Construction ID: 1007145629
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1007145619
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1007145625
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 4.570000171661377
Casing Diameter: 4.03000020980835
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1007145626
Layer: 1
Slot: 19
Screen Top Depth: 457.0
Screen End Depth: 7.619999885559082
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 4.820000171661377

Water Details

Water ID: 1007145624
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole Diameter

Hole ID: 1007145623
Diameter: 8.25
Depth From: 0.0
Depth To: 7.619999885559082
Hole Depth UOM: m
Hole Diameter UOM: cm

60	*1 of 1*	*SE/157.1*	*76.9 / -0.93*	***Ottawa Dairy Well*** ***Nepean ON***	*OOGW*

Licence No: F019784 ***Well Compl:*** 31692

Well ID:	32035	**County:**	Ottawa/Carleton
Well Compl ID:	31692	**Block:**	
W Class ID:	2366	**Lot:**	D
UWI Code:	F019784	**Conc:**	CBF
Permit Date:		**Surface Lat NAD83:**	45.41535722
Depth(m):	365.76	**Surface Long NAD83:**	-75.69641
Well Pool:		**Bottom Lat NAD83:**	45.41535722
Completion Date:		**Bottom Long NAD83:**	-75.69641
Depth Reached:		**Lot Sides (m):**	X
Capped Date:		**E/W (m):**	X
Class ID:		**Latitude Nad27:**	
DB Source:		**Longitude Nad27:**	
Status as of:	August 2024	**bottom lat27:**	
Start Date:		**bottom long27:**	
SPUD Date:		**Lateral:**	No
Class:	NFW	**Accuracy:**	500.00
Grnd Elev:	72.6	**Method:**	Part Lot Centroid
KB Elev:		**Parent:**	
TVD:	365.76	**Prod Top:**	
PBTD:		**Prod Bot:**	
TD Form:	March	**PROPD Depth:**	365.76
Workover D:		**Location Method:**	Part Lot Centroid
Operator:	Unknown	**Location Accuracy:**	Within 500 metres
Township:	Nepean	**Dt Obtained:**	2009-6-5 0:00:00
Target:	ORD	**Well Status Type:**	Natural Gas Well
Classification:	NEW FIELD WILDCAT	**Well Status Mode:**	No Well Found

Well Name: Ottawa Dairy Well
Target Desc: GEOLOGICAL AGE OF FORMATION REACHED
Status Type Desc: A WELL PRESENTLY OR FORMERLY USED TO PRODUCE NATURAL GAS FROM A RESERVOIR
Status Mode Desc: A WELL THAT COULD NOT BE LOCATED IN THE FIELD BY A PETROLEUM INSPECTOR
Classification Desc:
Cement Rec:
Comments: By J.Clark [OGSR] using PetroGIS.

Details

License No:	F019784	**Elevation (m):**	
Geology Formation:	March	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 362.16
Top (m):	362.16		

License No:	F019784	**Elevation (m):**	
Geology Formation:	March	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 362.16
Top (m):	362.16		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Trenton Group	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 145.76
Top (m):	145.76		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Beekmantown Group	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 289.01
Top (m):	289.01		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Rockcliffe	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 238.72
Top (m):	238.72		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Trenton Group	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 145.76
Top (m):	145.76		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Lindsay	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 145.76
Top (m):	145.76		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Oxford	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 289.01
Top (m):	289.01		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Lindsay	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 145.76
Top (m):	145.76		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Oxford	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 289.01
Top (m):	289.01		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Beekmantown Group	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	FORM 7	**Elevatn / Top (m):**	/ 289.01
Top (m):	289.01		

License No:	F019784	**Elevation (m):**	1
Geology Formation:	Lindsay	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF - QA Code	**Elevatn / Top (m):**	1 / -1
Top (m):	-1		

License No:	F019784	**Elevation (m):**	
Geology Formation:	Rockcliffe	**Static Level (m):**	n/a
Type of Water:	n/a	**Geology/Water:**	Geology
Source:	MNRF	**Elevatn / Top (m):**	/ 238.72
Top (m):	238.72		

---

61 | ***1 of 4*** | ***W/157.4*** | ***77.9 / 0.07*** | ***MCEVOY-SHIELDS FUNERAL HOMES LTD.***
235 KENT STREET
OTTAWA ON K2P 1Z9 | ***GEN***

Generator Info

Generator No:	ONF047200	**Choice of Contact:**	
Approval Years:	88,89,90,00,01	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	9731
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	FUNERAL HOMES		

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

61 ***2 of 4*** ***W/157.4*** ***77.9 / 0.07*** ***MCEVOY-SHIELDS FUNERAL HOMES LTD. 44-472***
235 KENT STREET
OTTAWA ON K2P 1Z9 ***GEN***

Generator Info

Generator No: ONF047200
Approval Years: 92,93,94,95,96,97,98,99
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: FUNERAL HOMES

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 9731

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

61 ***3 of 4*** ***W/157.4*** ***77.9 / 0.07*** ***Service Corporation International Canada***
235 Kent Street
Ottawa ON K2P 1Z9 ***GEN***

Generator Info

Generator No: ON4365854
Approval Years: 02,03,04
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Funeral Homes

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 812210

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

61 ***4 of 4*** ***W/157.4*** ***77.9 / 0.07*** ***Charlesfort Development Corporation***
235 Kent Street
Ottawa ON K2P 1Z9 ***GEN***

Generator Info

Generator No: ON8782981
Approval Years: 06

Choice of Contact:
Contaminated Fac:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Residential Building Construction

MHSW Facility:
SIC Code: 236110

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

---

62 | ***1 of 1*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***287 Lisgar Street Ottawa ON*** | ***EHS***

Order No: 20150506131
Status: C
Report Type: Standard Report
Report Date: 13-MAY-15
Date Received: 06-MAY-15
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: City Directory

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.696248
Y: 45.41748

---

63 | ***1 of 7*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***Claridge Homes Corporation 287 Lisgar Ottawa ON*** | ***GEN***

Generator Info

Generator No: ON8802785
Approval Years: 2011
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 236110

---

63 | ***2 of 7*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***CLARIDGE HOMES (CENTRETOWN) INC. 287 LISGAR STREET OTTAWA ON*** | ***GEN***

Generator Info

Generator No: ON5102371

Choice of Contact:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Real Estate Property Managers
Contaminated Fac:
MHSW Facility:
SIC Code: 531310

---

63 | ***3 of 7*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***Claridge Homes (287 Lisgar) Inc.***
287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA
ON | ***PTTW***

EBR Registry No: 012-4615
Ministry Ref No: 3167-9YDHTN
Notice Type: Instrument Decision
Notice Stage:
Notice Date: November 18, 2015
Proposal Date: July 14, 2015
Year: 2015
Instrument Type: (OWRA s. 34) - Permit to Take Water
Off Instrument Name:
Posted By:
Company Name: Claridge Homes (287 Lisgar) Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 210 Gladstone Avenue , Suite 2001, Ottawa Ontario, Canada K2P 0Y6
Comment Period:
URL:
Summary:
Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

287 Lisgar Street City of Ottawa, Ontario CITY OF OTTAWA

---

63 | ***4 of 7*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***Claridge Homes Limited Partnership***
287 Lisgar Street
Ottawa ON K2P 0E1 | ***GEN***

Generator Info

Generator No: ON6723433
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: REAL ESTATE PROPERTY MANAGERS
Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 531310

Waste Detail(s)

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

---

63 | ***5 of 7*** | ***NE/157.6*** | ***76.9 / -0.93*** | ***Claridge Homes***
287 Lisgar Street
Ottawa ON K2P 0E1 | ***GEN***

Generator Info

Generator No:	ON5558599	***Choice of Contact:***	
Approval Years:	As of Dec 2017	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

2017 Generator Info

Gen No:	ON5558599	***Choice of Contact:***	CO_OFFICIAL
ID:	21964	***Phone No Official:***	613-293-5467 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	236110	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Claridge Homes		
Gen Div:			
Gen Op Name:	Claridge Homes		
Gen Op Div:			
Site Adrs1:	287 Lisgar Street		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 0E1		
Site Country:	Canada		
Co Official:	MICHEL Bourgon		
Co Admin:			

2017 Generator Manifest

ID:	46722	***Sum Received Qty:***	36580.0
Generator No:	ON5558599	***Waste Class Name:***	LIGHT FUELS
Receiver Type:	035	***Count Manifests:***	4
Waste Char:	L	***District:***	402
Waste Code:	221		

63	***6 of 7***	***NE/157.6***	***76.9 / -0.93***	***CLARIDGE HOMES (287 LISGAR) INC.*** ***287 LISGAR STREET ON*** ***Ottawa ON***	***RSC***

RSC No:	225922	***X:***	-75.69631167598878
RA No:		***Y:***	45.41751727450763
Status:	FILED	***Latitude:***	45.41751728
Filing Date:		***Longitude:***	-75.69631168
Date Ack:		***UTM Coordinates:***	
Date Returned:		***Latitude Longitude:***	
Approval Date:	July 17, 2019	***Accuracy Estimate:***	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	K2P 0E1
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	PAUL HURST
CPU Issu Sect 1686:		**Consultant:**	

Business Name: CLARIDGE HOMES (287 LISGAR) INC.
Address: 287 LISGAR STREET ON
Legal Desc:
Site Pin: 04115-0250 (LT)
Asmt Roll No:
Project Type: POST2011
Approval Type: RSC based on Phase One and Two ESAs with RA
Applicable Standards:
PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=225922

63	7 of 7	NE/157.6	76.9 / -0.93	***Claridge Homes (Carson) Inc.*** ***287 Lisgar Avenue*** ***Ottawa ON K2P 1K8***	SPL

Ref No:	5656-BLBMXB	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	2020/01/30	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	2020/01/30	**Impact to Health:**	2 - Minor Environment
Dt Document Closed:	2020/07/17	**Agency Involved:**	

Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Condo high rise<UNOFFICIAL>
Site Address: 287 Lisgar Avenue
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Claridge Homes (Carson) Inc.
Client Type: Corporation
Source Type: Tank - Above Ground
Incident Cause:
Incident Preceding Spill: Overflow/Surcharge
Incident Reason: Operator/Human Error
Incident Summary: TSSA FSB: 3L diesel fuel to concrete during re-fill
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 3 L
Contaminant Qty 1: 3
Contaminant Unit: L
Contaminant Code: 13
Contaminant Name: DIESEL FUEL
Contaminant Limit 1:

Contam Limit Freq 1:	n/a
Contaminant UN No 1:	1202
Receiving Medium:	Land
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	Miscellaneous Industrial
SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

---

64 **1 of 2** **ENE/160.0** **76.9 / -0.89** **City of Ottawa** **ECA**

Ottawa ON K2G 6J8

Approval No:	9955-6EPKBN	**MOE District:**	Ottawa
Approval Date:	2005-07-28	**City:**	
Status:	Approved	**Longitude:**	-75.6961
Record Type:	ECA	**Latitude:**	45.4174
Link Source:	IDS	**Geometry X:**	
SWP Area Name:	Rideau Valley	**Geometry Y:**	
Approval Type:	ECA-Municipal Drinking Water Systems		
Project Type:	Municipal Drinking Water Systems		
Business Name:	City of Ottawa		
Address:			
Full Address:			
Full PDF Link:			
PDF Site Location:			

---

64 **2 of 2** **ENE/160.0** **76.9 / -0.89** **City of Ottawa**
Laurier Avenue at the Rideau Canal
Ottawa ON K1P 1J1 **ECA**

Approval No:	3577-4ZUKD2	**MOE District:**	Ottawa
Approval Date:	2001-08-24	**City:**	
Status:	Approved	**Longitude:**	-75.6961
Record Type:	ECA	**Latitude:**	45.4174
Link Source:	IDS	**Geometry X:**	
SWP Area Name:	Rideau Valley	**Geometry Y:**	
Approval Type:	ECA-Municipal and Private Water Works		
Project Type:	Municipal and Private Water Works		
Business Name:	City of Ottawa		
Address:	Laurier Avenue at the Rideau Canal		
Full Address:			
Full PDF Link:			
PDF Site Location:			

---

65 **1 of 1** **W/163.6** **78.0 / 0.16** **239 Nepean St**
OTTAWA ON **SPL**

Ref No:	1-DCDCT	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	3/5/2021 12:00:00 AM	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	4/23/2021 2:26:38 PM	**Impact to Health:**	0 No Impact
Dt Document Closed:	6/14/2021 12:16:52 PM	**Agency Involved:**	
Site No:			
MOE Response:	Desktop Response		
Site County/District:			

Site Geo Ref Meth:	
Site District Office:	Ottawa District Office
Nearest Watercourse:	
Site Name:	
Site Address:	239 Nepean St
Site Region:	
Site Municipality:	OTTAWA
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	
Client Type:	
Source Type:	Container/Drum/Tote
Incident Cause:	
Incident Preceding Spill:	Accident/Collision
Incident Reason:	Unknown
Incident Summary:	Aroma: Grease Spill to Asphalt
Environment Impact:	1 Minor Impact
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	0 other - see notes
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	
Contaminant Name:	GREASE (N.O.S.)
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	Land
Activity Preceding Spill:	
Property 2nd Watershed:	Lower Ottawa
Property Tertiary Watershed:	02LA-Rideau
Sector Type:	LIMITED-SERVICE EATING PLACES
SAC Action Class:	
Call Report Locatn Geodata:	{"integration_ids":["PR00003907176"],"wkts":["POINT (-75.6996737000 45.4168536000)"],"creation_date":"2021-04-23"}
Time Reported:	
System Facility Address:	

66 | ***1 of 1*** | ***NE/164.4*** | ***76.9 / -0.93*** | ***Nepean Street Ottawa ON K2P 0B6*** | ***EHS***

Order No:	20191216143	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	22-JAN-20	**Search Radius (km):**	.25
Date Received:	16-DEC-19	**X:**	-75.69650595
Previous Site Name:		**Y:**	45.4177047
Lot/Building Size:			
Additional Info Ordered:			

67 | ***1 of 1*** | ***WSW/164.8*** | ***77.8 / -0.01*** | ***KENT ST Ottawa ON*** | ***WWIS***

Well ID:	7344656	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:		**Data Entry Status:**	
Use 2nd:		**Data Src:**	

Final Well Status:	Abandoned-Other	**Date Received:**	10/22/2019
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	Yes
Audit No:	Z286433	**Contractor:**	7543
Tag:	A191626	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344656.pdf

Additional Detail(s) (Map)

Well Completed Date:	09/19/2019
Year Completed:	2019
Depth (m):	
Latitude:	45.41578047162
Longitude:	-75.6995243523525
X:	-75.69952418970436
Y:	45.41578046508941
Path:	734\7344656.pdf

Bore Hole Information

Bore Hole ID:	1007687167	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445267.00
Code OB Desc:		**North83:**	5029378.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	09/19/2019	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1008087392
Layer:	3
Plug From:	0.0
Plug To:	0.5
Plug Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID:	1008087390

Layer:	1
Plug From:	115.0
Plug To:	351.0
Plug Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID:	1008087391
Layer:	2
Plug From:	0.5
Plug To:	115.0
Plug Depth UOM:	ft

Pipe Information

Pipe ID:	1008084812
Casing No:	0
Comment:	
Alt Name:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1008090670
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	ft
Rate UOM:	GPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Water Details

Water ID:	1008090120
Layer:	1
Kind Code:	8
Kind:	Untested
Water Found Depth:	25.0
Water Found Depth UOM:	ft

Hole Diameter

Hole ID:	1008088008
Diameter:	2.0
Depth From:	6.0
Depth To:	35.0
Hole Depth UOM:	ft
Hole Diameter UOM:	Inch

68	***1 of 1***	***SW/167.0***	***78.9 / 1.07***	***281 kent st Ottawa ON***	***WWIS***

Well ID:	7354243	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	02/19/2020
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z302715	**Contractor:**	7241
Tag:	A282350	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008173940	**Tag No:**	A282350
Depth M:	7.13	**Contractor:**	7241
Year Completed:	2020	**Latitude:**	45.4151642801855
Well Completed Dt:	01/24/2020	**Longitude:**	-75.6987243509288
Audit No:	Z302715	**Y:**	45.415164273072726
Path:		**X:**	-75.69872418905746

Bore Hole Information

Bore Hole ID:	1008173940	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445329.00
Code OB Desc:		**North83:**	5029309.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	01/24/2020	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008251397
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	28
Material 2 Desc:	SAND
Material 3:	85
Material 3 Desc:	SOFT

Formation Top Depth:	4.0
Formation End Depth:	7.130000114440918
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251395
Layer:	1
Color:	8
General Color:	BLACK
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	27
Material 2 Desc:	OTHER
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251396
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	0.3100000023841858
Formation End Depth:	4.0
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1008252365
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1008252366
Layer:	2
Plug From:	0.3100000023841858
Plug To:	3.7200000286102295
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1008252367
Layer:	3
Plug From:	3.7200000286102295

Plug To: 7.130000114440918
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1008253333
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1008250036
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1008253675
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 4.03000020980835
Casing Diameter: 4.03000020980835
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1008254026
Layer: 1
Slot: 10
Screen Top Depth: 4.03000020980835
Screen End Depth: 7.130000114440918
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 4.820000171661377

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1008254369
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Hole Diameter

Hole ID:	1008252992
Diameter:	8.300000190734863
Depth From:	0.0
Depth To:	7.130000114440918
Hole Depth UOM:	m
Hole Diameter UOM:	cm

---

69 ***1 of 7*** ***NW/167.0*** ***77.6 / -0.24*** ***City of Ottawa 210 Gloucester Ottawa ON K2P 2K4*** ***GEN***

Generator Info

Generator No:	ON7180209	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2016	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	913910
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	913910		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

---

69 ***2 of 7*** ***NW/167.0*** ***77.6 / -0.24*** ***City of Ottawa 210 Gloucester Ottawa ON K2P 2K4*** ***GEN***

Generator Info

Generator No:	ON7180209	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2015	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	913910
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	913910		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

---

69 ***3 of 7*** ***NW/167.0*** ***77.6 / -0.24*** ***City of Ottawa 210 Gloucester Ottawa ON K2P 2K4*** ***GEN***

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator No: ON7180209
Approval Years: 2014
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: 913910
Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 913910

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

69	*4 of 7*	*NW/167.0*	*77.6 / -0.24*	***City of Ottawa Parks, Bldg & Grounds Services Branch*** ***210 Gloucester*** ***Ottawa ON K2P 2K4***	***GEN***

Generator Info

Generator No: ON7180209
Approval Years: As of Dec 2018
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

69	*5 of 7*	*NW/167.0*	*77.6 / -0.24*	***City of Ottawa Parks, Bldg & Grounds Services Branch*** ***210 Gloucester*** ***Ottawa ON K2P 2K4***	***GEN***

Generator Info

Generator No: ON7180209
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
69	6 of 7	NW/167.0	77.6 / -0.24	City of Ottawa Parks, Bldg & Grounds Services Branch 210 Gloucester Ottawa ON K2P 2K4	GEN

Generator Info

Generator No:	ON7180209	***Choice of Contact:***	
Approval Years:	As of Nov 2021	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
69	7 of 7	NW/167.0	77.6 / -0.24	City of Ottawa 210 Gloucester Ottawa ON K2P 2K4	GEN

Generator Info

Generator No:	ON7180209	***Choice of Contact:***	
Approval Years:	As of Oct 2022	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	OIL SKIMMINGS & SLUDGES

2017 Generator Info

Gen No:	ON7180209	***Choice of Contact:***	CO_OFFICIAL
ID:	28165	***Phone No Official:***	613-580-2424 Ext.12085
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	913910	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	City of Ottawa		
Gen Div:	Parks, Bldg & Grounds Services Branch		
Gen Op Name:	City of Ottawa		
Gen Op Div:	Parks, Bldg & Grounds Services Branch		
Site Adrs1:	210 Gloucester		
Site Bldg:	Parking Garage #3		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			

Site City:	Ottawa
Province Out:	
Site Postal Code:	K2P 2K4
Site Country:	Canada
Co Official:	Randy Villeneuve
Co Admin:	

2018 Generator Info

Gen No:	ON7180209	**Choice of Contact:**	CO_OFFICIAL
ID:	28621	**Phone No Official:**	613-580-2424 Ext.12085
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	913910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name:	City of Ottawa
Gen Div:	Parks, Bldg & Grounds Services Branch
Gen Op Name:	City of Ottawa
Gen Op Div:	Parks, Bldg & Grounds Services Branch
Site Adrs1:	210 Gloucester
Site Bldg:	Parking Garage #3
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K2P 2K4
Site Country:	Canada
Co Official:	Randy Villeneuve
Co Admin:	

2019 Generator Info

Gen No:	ON7180209	**Choice of Contact:**	CO_OFFICIAL
ID:	28914	**Phone No Official:**	613-580-2424 Ext.12085
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	913910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name:	City of Ottawa
Gen Div:	Parks, Bldg & Grounds Services Branch
Gen Op Name:	City of Ottawa
Gen Op Div:	Parks, Bldg & Grounds Services Branch
Site Adrs1:	210 Gloucester
Site Bldg:	Parking Garage #3
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K2P 2K4
Site Country:	Canada
Co Official:	Randy Villeneuve
Co Admin:	

2020 Generator Info

Gen No:	ON7180209	**Choice of Contact:**	CO_OFFICIAL
ID:	28602	**Phone No Official:**	613-580-2424 Ext.12085
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)

NAICS Code1:	913910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	City of Ottawa		
Gen Div:	Parks, Bldg & Grounds Services Branch		
Gen Op Name:	City of Ottawa		
Gen Op Div:	Parks, Bldg & Grounds Services Branch		
Site Adrs1:	210 Gloucester		
Site Bldg:	Parking Garage #3		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2K4		
Site Country:	Canada		
Co Official:	Randy Villeneuve		
Co Admin:			

2020 Generator Manifest

ID:	51015	**Sum Received Qty:**	2000.0
Generator No:	ON7180209	**Waste Class Name:**	OIL SKIMMINGS & SLUDGES
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	L	**District:**	402
Waste Code:	251		

2021 Generator Info

Gen No:	ON7180209	**Choice of Contact:**	CO_OFFICIAL
ID:	29163	**Phone No Official:**	613-580-2424 Ext.12085
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	913910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	City of Ottawa		
Gen Div:	Parks, Bldg & Grounds Services Branch		
Gen Op Name:	City of Ottawa		
Gen Op Div:	Parks, Bldg & Grounds Services Branch		
Site Adrs1:	210 Gloucester		
Site Bldg:	Parking Garage #3		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2K4		
Site Country:	Canada		
Co Official:	Daniel Alves		
Co Admin:			

---

70 ***1 of 3*** ***NE/168.1*** ***76.9 / -0.93*** ***KOFFMAN SIGNS***
146 NEPEAN ST
OTTAWA ON K2P 0B6 ***SCT***

Established:	1956
Plant Size (ft²):	0
Employment:	8

--Details--
Description: Sign Manufacturing

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

SIC/NAICS Code: 339950

---

70 **2 of 3** **NE/168.1** **76.9 / -0.93** **Koffman Signs Ltd.** **SCT**
146 Nepean St
Ottawa ON K2P 0B6

Established: 1956
Plant Size (ft²): 2000
Employment:

--Details--
Description: Sign Manufacturing
SIC/NAICS Code: 339950

---

70 **3 of 3** **NE/168.1** **76.9 / -0.93** **Marilena Guerra** **GEN**
146 Nepean Street
Ottawa ON

Generator Info

Generator No: ON7033731
Approval Years: 2013
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: FACILITIES SUPPORT SERVICES

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 561210

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

---

71 **1 of 1** **ESE/168.2** **76.4 / -1.38** **343 Somerset Street West** **EHS**
Ottawa ON

Order No: 20140905028
Status: C
Report Type: Custom Report
Report Date: 10-SEP-14
Date Received: 05-SEP-14
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.69567
Y: 45.415889

---

72 **1 of 1** **N/168.3** **77.9 / 0.07** **170 Gloucester Street** **EHS**
Ottawa ON K2P 0A6

Order No: 20181210018
Status: C
Report Type: Standard Report
Report Date: 14-DEC-18
Date Received: 10-DEC-18
Previous Site Name:
Lot/Building Size:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.697857
Y: 45.417974

Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory

---

73 **1 of 1** **ENE/168.3** **76.2 / -1.62** **355 Cooper St**
Ottawa ON K2P0G8 **EHS**

Order No:	20170821056	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	28-AUG-17	**Search Radius (km):**	.25
Date Received:	21-AUG-17	**X:**	-75.695658
Previous Site Name:		**Y:**	45.417026
Lot/Building Size:			

Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory

---

74 **1 of 1** **ESE/168.6** **77.0 / -0.82** **SOMERSET ROADWAY**
OTTAWA ON **WWIS**

Well ID:	1535586	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:		**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	06/24/2005
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z30507	**Contractor:**	1844
Tag:	A020628	**Form Version:**	3
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1535586.pdf

Additional Detail(s) (Map)

Well Completed Date:	04/27/2005
Year Completed:	2005
Depth (m):	6
Latitude:	45.4156771009064
Longitude:	-75.6958166864399
X:	-75.69581652396467
Y:	45.415677094118095
Path:	153\1535586.pdf

Bore Hole Information

Bore Hole ID:	11316125	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445557.00
Code OB Desc:		**North83:**	5029364.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	04/27/2005	**UTMRC Desc:**	margin of error : 30 m - 100 m

Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	932996683
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	1.2000000476837158
Formation End Depth:	6.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	932996682
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.800000011920929
Formation End Depth:	1.2000000476837158
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	932996681
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	0.800000011920929
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID: 933271640
Layer: 1
Plug From: 0.0
Plug To: 2.5
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 961535586
Method Construction Code: B
Method Construction: Other Method
Other Method Construction:

Pipe Information

Pipe ID: 11330980
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930855429
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0
Casing Diameter: 50.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 933413326
Layer: 1
Slot: #10
Screen Top Depth: 3.0
Screen End Depth: 6.0
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.5

Hole Diameter

Hole ID: 11533635
Diameter: 20.0
Depth From: 0.0
Depth To: 6.0
Hole Depth UOM: m
Hole Diameter UOM: cm

75	***1 of 2***	***NNW/172.4***	***77.9 / 0.07***	***O'Brien Publishing Inc.*** ***176 Gloucester St Suite 400*** ***Ottawa ON K2P 0A6***	***SCT***

Established: 01-AUG-82
Plant Size (ft²): 5000

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Employment:

--Details--
Description: Periodical Publishers
SIC/NAICS Code: 511120

---

75 | ***2 of 2*** | ***NNW/172.4*** | ***77.9 / 0.07*** | ***176 Gloucester St Ottawa ON K2P0A6*** | ***EHS***

Order No: 20170523032
Status: C
Report Type: Standard Report
Report Date: 26-MAY-17
Date Received: 23-MAY-17
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.698263
Y: 45.417922

---

76 | ***1 of 1*** | ***SE/175.0*** | ***76.9 / -0.93*** | ***PE4776 - 352 Somerset Street West Ottawa ON K2P 0J9*** | ***EHS***

Order No: 21120900110
Status: C
Report Type: Standard Report
Report Date: 14-DEC-21
Date Received: 09-DEC-21
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6961474
Y: 45.415304

---

77 | ***1 of 2*** | ***W/176.6*** | ***77.9 / 0.07*** | ***HUDSON PARK CONDOS 245 KENT STREET OTTAWA ON K2P 0A5*** | ***GEN***

Generator Info

Generator No: ON7365454
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: LESSORS OF RESIDENTIAL BUILDINGS AND DWELLINGS (EXCEPT SOCIAL HOUSING PROJECTS)
Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 531111

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

---

77 | ***2 of 2*** | ***W/176.6*** | ***77.9 / 0.07*** | ***Charlesfort Development Corporation 235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9 OTTAWA ON*** | ***RSC***

RSC No: 45110
X: -75.69971671492041

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

RA No:		**Y:**	45.41583329997496
Status:	FILED	**Latitude:**	45.4158333
Filing Date:		**Longitude:**	-75.69971671
Date Ack:		**UTM Coordinates:**	
Date Returned:		**Latitude Longitude:**	
Approval Date:	June 2, 2008	**Accuracy Estimate:**	
Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	BESR Administrator
CPU Issu Sect 1686:		**Consultant:**	

Business Name: Charlesfort Development Corporation
Address: 235 and 245 Kent Street, Ottawa, Ontario, K2P 1Z9
Legal Desc:
Site Pin: 04114-0378 (LT); 04114-0379 (LT); 04114-0380 (LT)
Asmt Roll No:
Project Type: PRE2011
Approval Type: RSC based on Phase One and Two ESAs
Applicable Standards:
PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=45110

---

78 | ***1 of 1*** | ***SW/177.2*** | ***78.9 / 1.07*** | ***281 Kent Street Ottawa ON K2P 2H8*** | ***EHS***

Order No:	20191126061	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	29-NOV-19	**Search Radius (km):**	.25
Date Received:	26-NOV-19	**X:**	-75.698814
Previous Site Name:		**Y:**	45.415095
Lot/Building Size:			

Additional Info Ordered: Fire Insur. Maps and/or Site Plans

---

79 | ***1 of 1*** | ***NNE/179.8*** | ***76.8 / -0.96*** | ***Regional Group 152 Gloucester St Ottawa ON K2P 0A6*** | ***GEN***

Generator Info

Generator No:	ON5614596	**Choice of Contact:**	
Approval Years:	As of Dec 2017	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class: 221 L
Waste Class Name: Light fuels

2017 Generator Info

Gen No:	ON5614596	***Choice of Contact:***	CO_OFFICIAL
ID:	22176	***Phone No Official:***	613-822-0624 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	531111	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Regional Group		
Gen Div:			
Gen Op Name:	Regional Group		
Gen Op Div:			
Site Adrs1:	152 Gloucester St		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 0A6		
Site Country:	Canada		
Co Official:	Manny Agulink		
Co Admin:			

2017 Generator Manifest

ID:	46933	***Sum Received Qty:***	200.0
Generator No:	ON5614596	***Waste Class Name:***	LIGHT FUELS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	L	***District:***	402
Waste Code:	221		

---

80 | ***1 of 1*** | ***NE/180.4*** | ***76.9 / -0.93*** | ***ENBRIDGE GAS INC***
142 NEPEAN ST,,OTTAWA,ON,K2P 2N2,CA
ON | ***PINC***

Incident Id:		***Pipe Material:***	
Incident No:	2859636	***Fuel Category:***	
Incident Reported Dt:	6/3/2020	***Health Impact:***	
Type:	FS-Pipeline Incident	***Environment Impact:***	
Status Code:		***Property Damage:***	
Tank Status:	Pipeline Damage Reason Est	***Service Interrupt:***	
Task No:		***Enforce Policy:***	
Spills Action Centre:		***Public Relation:***	
Fuel Type:		***Pipeline System:***	
Fuel Occurrence Tp:		***PSIG:***	
Date of Occurrence:		***Attribute Category:***	
Occurrence Start Dt:		***Regulator Location:***	
Depth:		***Method Details:***	
Customer Acct Name:	ENBRIDGE GAS INC		
Incident Address:	142 NEPEAN ST,,OTTAWA,ON,K2P 2N2,CA		
Operation Type:			
Pipeline Type:			
Regulator Type:			
Summary:			
Reported By:			
Affiliation:			
Occurrence Desc:			
Damage Reason:			
Notes:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
81	1 of 1	ESE/182.1	76.9 / -0.93	352/348/346 Somerset & 349 MacLaren Ottawa ON	EHS

Order No:	20001102002	**Nearest Intersection:**	Bank and Somerset
Status:	C	**Municipality:**	
Report Type:	Site Report	**Client Prov/State:**	ON
Report Date:	11/3/00	**Search Radius (km):**	0.25
Date Received:	11/2/00	**X:**	-75.695818
Previous Site Name:		**Y:**	45.415198
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
82	1 of 1	E/186.3	75.9 / -1.93	ALLAN KWAI 331 SOMERSET ST. W., SWM OTTAWA CITY ON K2P 0J8	CA

Certificate #:	3-1581-97-
Application Year:	97
Issue Date:	10/28/1997
Approval Type:	Municipal sewage
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
83	1 of 2	SE/186.4	76.9 / -0.93	296 BANK ST. OTTAWA ON	WWIS

Well ID:	7246842	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:	0	**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	08/24/2015
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z208884	**Contractor:**	7241
Tag:	A165621	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246842.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/17/2015
Year Completed:	2015
Depth (m):	6.096
Latitude:	45.4150891021901

Longitude: -75.6962951247751
X: -75.69629496298303
Y: 45.41508909517127
Path: 724\7246842.pdf

Bore Hole Information

Bore Hole ID: 1005625955
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 07/17/2015
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445519.00
North83: 5029299.00
Org CS: G83dd
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1005704585
Layer: 1
Color: 2
General Color: GREY
Material 1:
Material 1 Desc:
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock Materials Interval

Formation ID: 1005704587
Layer: 3
Color:
General Color:
Material 1: 34
Material 1 Desc: TILL
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 10.0
Formation End Depth: 20.0
Formation End Depth UOM: ft

Overburden and Bedrock Materials Interval

Formation ID: 1005704586

Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3:
Material 3 Desc:
Formation Top Depth: 1.0
Formation End Depth: 10.0
Formation End Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704596
Layer: 2
Plug From: 1.0
Plug To: 9.0
Plug Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704597
Layer: 3
Plug From: 9.0
Plug To: 20.0
Plug Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704595
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 1005704594
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1005704584
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1005704590
Layer: 1
Material: 5
Open Hole or Material: PLASTIC

Depth From:	0.0
Depth To:	10.0
Casing Diameter:	1.3799999952316284
Casing Diameter UOM:	inch
Casing Depth UOM:	ft

Construction Record - Screen

Screen ID:	1005704591
Layer:	1
Slot:	10
Screen Top Depth:	10.0
Screen End Depth:	20.0
Screen Material:	5
Screen Depth UOM:	ft
Screen Diameter UOM:	inch
Screen Diameter:	1.059999942779541

Water Details

Water ID:	1005704589
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	ft

Hole Diameter

Hole ID:	1005704588
Diameter:	2.375
Depth From:	0.0
Depth To:	20.0
Hole Depth UOM:	ft
Hole Diameter UOM:	inch

---

83 | ***2 of 2*** | ***SE/186.4*** | ***76.9 / -0.93*** | ***296 BANK ST. OTTAWA ON*** | ***WWIS***

Well ID:	7246843	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:	0	**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	08/24/2015
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z208885	**Contractor:**	7241
Tag:	A163032	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246843.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/17/2015
Year Completed:	2015
Depth (m):	3.048
Latitude:	45.4150891021901
Longitude:	-75.6962951247751
X:	-75.69629496298303
Y:	45.41508909517127
Path:	724\7246843.pdf

Bore Hole Information

Bore Hole ID:	1005625970	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445519.00
Code OB Desc:		***North83:***	5029299.00
Open Hole:		***Org CS:***	G83dd
Cluster Kind:		***UTMRC:***	4
Date Completed:	07/17/2015	***UTMRC Desc:***	margin of error : 30 m - 100 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1005704599
Layer:	1
Color:	2
General Color:	GREY
Material 1:	
Material 1 Desc:	
Material 2:	73
Material 2 Desc:	HARD
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1005704600
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	1.0
Formation End Depth:	10.0
Formation End Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704609
Layer: 2
Plug From: 1.0
Plug To: 2.5
Plug Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704610
Layer: 3
Plug From: 2.5
Plug To: 10.0
Plug Depth UOM: ft

Annular Space/Abandonment Sealing Record

Plug ID: 1005704608
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 1005704607
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1005704598
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1005704603
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0
Casing Diameter: 1.3799999952316284
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1005704604
Layer: 1
Slot: 10

Screen Top Depth:	3.0
Screen End Depth:	10.0
Screen Material:	5
Screen Depth UOM:	ft
Screen Diameter UOM:	inch
Screen Diameter:	1.659999966621399

Water Details

Water ID:	1005704602
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	ft

Hole Diameter

Hole ID:	1005704601
Diameter:	2.375
Depth From:	0.0
Depth To:	10.0
Hole Depth UOM:	ft
Hole Diameter UOM:	inch

---

84 | ***1 of 1*** | ***SW/187.4*** | ***78.9 / 1.07*** | ***281 kent st Ottawa ON*** | ***WWIS***

Well ID:	7354245	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	02/19/2020
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z302708	**Contractor:**	7241
Tag:	A269066	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008173994	**Tag No:**	A269066
Depth M:	6.1	**Contractor:**	7241
Year Completed:	2020	**Latitude:**	45.4149837991
Well Completed Dt:	01/20/2020	**Longitude:**	-75.6987988081002
Audit No:	Z302708	**Y:**	45.41498379233774
Path:		**X:**	-75.69879864591043

Bore Hole Information

Bore Hole ID:	1008173994	**Elevation:**	
DP2BR:		**Elevrc:**	

Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445323.00
Code OB Desc:		***North83:***	5029289.00
Open Hole:		***Org CS:***	UTM83
Cluster Kind:		***UTMRC:***	4
Date Completed:	01/20/2020	***UTMRC Desc:***	margin of error : 30 m - 100 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008251401
Layer:	1
Color:	8
General Color:	BLACK
Material 1:	27
Material 1 Desc:	OTHER
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251403
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	28
Material 2 Desc:	SAND
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.0
Formation End Depth:	6.099999904632568
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251402
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	0.3100000023841858

Formation End Depth: 4.0
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252372
Layer: 2
Plug From: 0.3100000023841858
Plug To: 2.7899999618530273
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252373
Layer: 3
Plug From: 2.7899999618530273
Plug To: 6.099999904632568
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252371
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1008253335
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1008250038
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1008253677
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 4.03000020980835
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1008254028

Layer: 1
Slot: 10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 4.820000171661377

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1008254371
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1008252994
Diameter: 8.300000190734863
Depth From: 0.0
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

---

85 | ***1 of 1*** | ***SW/188.0*** | ***78.9 / 1.07*** | ***TRANSPORT TRUCK KENT ST & COOPER ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON*** | ***SPL***

Ref No: 86705
Year:
Incident Dt: 6/9/1993
Dt MOE Arvl on Scn:
MOE Reported Dt: 6/9/1993
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Northing:	
Easting:	
Entity Operating Name:	
Client Name:	
Client Type:	
Source Type:	
Incident Cause:	PIPE/HOSE LEAK
Incident Preceding Spill:	
Incident Reason:	EQUIPMENT FAILURE
Incident Summary:	SEALTEST DAIRY-10L DIESELFUEL TO PAVED LOT,CLEANUPCOMPLETED.
Environment Impact:	NOT ANTICIPATED
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	
Contaminant Name:	
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	LAND
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	
SAC Action Class:	
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

86	***1 of 8***	***SSW/189.0***	***77.8 / 0.01***	***SOMERSET SUNOCO*** ***429 SOMERSET ST*** ***OTTAWA ON K2P0K1***	***PRT***

Location ID:	11098
Type:	retail
Expiry Date:	1996-03-31
Capacity (L):	75009
Licence #:	0055856001

86	***2 of 8***	***SSW/189.0***	***77.8 / 0.01***	***CLARRIDGE HOMES*** ***419-429 SOMERSET STREET*** ***OTTAWA ON K2P 2P5***	***GEN***

Generator Info

Generator No:	ON8399115	***Choice of Contact:***	
Approval Years:	01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	7512
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	NON-RES. BLDG. OPER.		

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	3 of 8	SSW/189.0	77.8 / 0.01	Clarridge Homes 419-429 SOMERSET ST. OTTAWA ON K1N 6W8	GEN

Generator Info

Generator No:	ON8399115	***Choice of Contact:***	
Approval Years:	02,03,04	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	531111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Lessors of Res. Buildings (exc. Soc. Housing)		

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	4 of 8	SSW/189.0	77.8 / 0.01	SAVEWAY GAS & FUELS LTD 429 SOMERSET ST W OTTAWA ON K2P 0K1	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10169745	***Expired Date:***	8/1/1990
Status:	EXPIRED	***Max Hazard Rank:***	
Instance ID:		***Facility Location:***	
Instance Type:	FS Facility	***Facility Type:***	
Instance Creation Dt:		***Fuel Type 2:***	
Instance Install Dt:		***Fuel Type 3:***	
Item Description:		***Panam Related:***	
Manufacturer:		***Panam Venue Nm:***	
Model:		***External Identifier:***	
Serial No:		***Item:***	
ULC Standard:		***Piping Steel:***	
Quantity:		***Piping Galvanized:***	
Unit of Measure:		***Tank Single Wall St:***	
Overfill Prot Type:		***Piping Underground:***	
Creation Date:		***Tank Underground:***	
Next Periodic Str DT:		***Source:***	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	5 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON K2P 0K1	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	9822476	**Expired Date:**	11/8/1996
Status:	EXPIRED	**Max Hazard Rank:**	
Instance ID:		**Facility Location:**	
Instance Type:	FS Facility	**Facility Type:**	
Instance Creation Dt:		**Fuel Type 2:**	
Instance Install Dt:		**Fuel Type 3:**	
Item Description:		**Panam Related:**	
Manufacturer:		**Panam Venue Nm:**	
Model:		**External Identifier:**	
Serial No:		**Item:**	
ULC Standard:		**Piping Steel:**	
Quantity:		**Piping Galvanized:**	
Unit of Measure:		**Tank Single Wall St:**	
Overfill Prot Type:		**Piping Underground:**	
Creation Date:		**Tank Underground:**	
Next Periodic Str DT:		**Source:**	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
86	6 of 8	SSW/189.0	77.8 / 0.01	MARK TAZA 429 SOMERSET ST W OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	10907010	**Expired Date:**	
Status:	EXPIRED	**Max Hazard Rank:**	
Instance ID:	51574	**Facility Location:**	
Instance Type:	FS Piping	**Facility Type:**	
Instance Creation Dt:		**Fuel Type 2:**	
Instance Install Dt:		**Fuel Type 3:**	
Item Description:		**Panam Related:**	
Manufacturer:		**Panam Venue Nm:**	
Model:		**External Identifier:**	
Serial No:		**Item:**	
ULC Standard:		**Piping Steel:**	
Quantity:		**Piping Galvanized:**	
Unit of Measure:		**Tank Single Wall St:**	
Overfill Prot Type:		**Piping Underground:**	
Creation Date:		**Tank Underground:**	
Next Periodic Str DT:		**Source:**	
TSSA Base Sched Cycle 2:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

TSSAMax Hazard Rank 1:
TSSA Risk Based Periodic Yn:
TSSA Volume of Directives:
TSSA Periodic Exempt:
TSSA Statutory Interval:
TSSA Recd Insp Interva:
TSSA Recd Tolerance:
TSSA Program Area:
TSSA Program Area 2:
Description: FS Piping
Original Source: EXP
Record Date: Up to Mar 2012

---

86 | ***7 of 8*** | ***SSW/189.0*** | ***77.8 / 0.01*** | ***MARK TAZA 429 SOMERSET ST W OTTAWA ON*** | ***EXP***

Inventory No: 10907002
Inventory Status: EXPIRED
Installation Year: 1992
Capacity: 27280
Capacity Unit:
Tank Type:
Manufacturer:
Model:
Description: AS PER REPORT E053213
Previous Fuel Type: Gasoline

Tank Material: Fiberglass (FRP)
Corrosion Protect: Fiberglass
Overfill Protection:
Inventory Context: FS Liquid Fuel Tank
Inventory Item: FS LIQUID FUEL TANK

---

86 | ***8 of 8*** | ***SSW/189.0*** | ***77.8 / 0.01*** | ***MARK TAZA 429 SOMERSET ST W OTTAWA ON*** | ***EXP***

Inventory No: 10906990
Inventory Status: EXPIRED
Installation Year: 1992
Capacity: 45460
Capacity Unit:
Tank Type:
Manufacturer:
Model:
Description: AS PER REPORT E053213
Previous Fuel Type: Gasoline

Tank Material: Fiberglass (FRP)
Corrosion Protect: Fiberglass
Overfill Protection:
Inventory Context: FS Liquid Fuel Tank
Inventory Item: FS LIQUID FUEL TANK

---

87 | ***1 of 1*** | ***ENE/189.6*** | ***76.2 / -1.61*** | ***355 COOPER ST Ottawa ON*** | ***WWIS***

Well ID: 7312995
Construction Date:
Use 1st: Test Hole
Use 2nd: Monitoring
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: Z212308
Tag: A199385
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 06/19/2018
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:
Easting NAD83:

Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:
Northing NAD83:
Zone:
UTM Reliability:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7312995.pdf

Additional Detail(s) (Map)

Well Completed Date: 03/02/2018
Year Completed: 2018
Depth (m): 6.1
Latitude: 45.4173616927019
Longitude: -75.6955945372303
X: -75.6955943750171
Y: 45.4173616862778
Path: 731\7312995.pdf

Bore Hole Information

Bore Hole ID: 1007108655
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 03/02/2018
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:
Elevation:
Elevrc:
Zone: 18
East83: 445576.00
North83: 5029551.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1007367753
Layer: 1
Color: 6
General Color: BROWN
Material 1: 01
Material 1 Desc: FILL
Material 2: 28
Material 2 Desc: SAND
Material 3: 11
Material 3 Desc: GRAVEL
Formation Top Depth: 0.0
Formation End Depth: 1.2200000286102295
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007367754
Layer: 2
Color: 6
General Color: BROWN

Material 1: 05
Material 1 Desc: CLAY
Material 2: 28
Material 2 Desc: SAND
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 1.2200000286102295
Formation End Depth: 3.0999999046325684
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1007367755
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 85
Material 2 Desc: SOFT
Material 3:
Material 3 Desc:
Formation Top Depth: 3.0999999046325684
Formation End Depth: 6.099999904632568
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007367763
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007367764
Layer: 2
Plug From:
Plug To:
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1007367765
Layer: 3
Plug From:
Plug To:
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1007367762
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID:	1007367752
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1007367758
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	3.0999999046325684
Casing Diameter:	4.070000171661377
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1007367759
Layer:	1
Slot:	10
Screen Top Depth:	3.0999999046325684
Screen End Depth:	6.099999904632568
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	4.820000171661377

Water Details

Water ID:	1007367757
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	m

Hole Diameter

Hole ID:	1007367756
Diameter:	8.25
Depth From:	0.0
Depth To:	6.099999904632568
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
88	1 of 1	NW/193.5	77.6 / -0.23	186 Bank St Ottawa ON K2P1W6	EHS

Order No:	20161128012	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Standard Report	***Client Prov/State:***	ON
Report Date:	01-DEC-16	***Search Radius (km):***	.25
Date Received:	28-NOV-16	***X:***	-75.698933
Previous Site Name:		***Y:***	45.417958
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
89	1 of 1	WNW/194.6	76.9 / -0.93	230 Gloucester St Ottawa ON K2P0A9	EHS

Order No:	20140428057	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	02-MAY-14	**Search Radius (km):**	.25
Date Received:	28-APR-14	**X:**	-75.699994
Previous Site Name:		**Y:**	45.417065
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
90	1 of 1	E/195.0	75.9 / -1.93	327 Somerset St W Ottawa ON K2P0J8	EHS

Order No:	20151130011	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	03-DEC-15	**Search Radius (km):**	.25
Date Received:	30-NOV-15	**X:**	-75.695217
Previous Site Name:		**Y:**	45.416108
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
91	1 of 1	SW/195.3	78.9 / 1.07	81 kent st Ottawa ON	WWIS

Well ID:	7354244	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Test Hole	**Data Entry Status:**	
Use 2nd:	Monitoring	**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	02/19/2020
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z302714	**Contractor:**	7241
Tag:	A269067	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008173985	**Tag No:**	A269067
Depth M:	6.1	**Contractor:**	7241
Year Completed:	2020	**Latitude:**	45.4148762609929
Well Completed Dt:	01/20/2020	**Longitude:**	-75.6987207988945
Audit No:	Z302714	**Y:**	45.41487625439337
Path:		**X:**	-75.69872063714445

Bore Hole Information

Bore Hole ID:	1008173985	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445329.00
Code OB Desc:		**North83:**	5029277.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	01/20/2020	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008251399
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	0.3100000023841858
Formation End Depth:	4.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251400
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	28
Material 2 Desc:	SAND
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.0
Formation End Depth:	6.099999904632568
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1008251398
Layer:	1
Color:	8
General Color:	BLACK
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	27
Material 2 Desc:	OTHER
Material 3:	77

Material 3 Desc: LOOSE
Formation Top Depth: 0.0
Formation End Depth: 0.3100000023841858
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252370
Layer: 3
Plug From: 2.7899999618530273
Plug To: 6.099999904632568
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252369
Layer: 2
Plug From: 0.3100000023841858
Plug To: 2.7899999618530273
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1008252368
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1008253334
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1008250037
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1008253676
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 4.03000020980835
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1008254027
Layer: 1
Slot: 10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 4.820000171661377

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1008254370
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1008252993
Diameter: 8.300000190734863
Depth From: 0.0
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

---

92 | ***1 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***HARTMAN'S YOUR INDEPENDENT GROCER***
296 BANK STREET
OTTAWA ON K2P 1X8 | ***PES***

Detail Licence No:
Licence No:
Status:
Approval Date:
Report Source:
Licence Type: Vendor
Licence Type Code:
Licence Class:
Licence Control:
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code:
Oper Phone No:
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	2 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK STREET OTTAWA ON K2P 1X8	PES

Detail Licence No:	23-01-10066-0	**Operator Box:**	
Licence No:	10066	**Operator Class:**	
Status:		**Operator No:**	
Approval Date:		**Operator Type:**	
Report Source:		**Oper Area Code:**	
Licence Type:	Limited Vendor	**Oper Phone No:**	
Licence Type Code:	23	**Operator Ext:**	
Licence Class:	01	**Operator Lot:**	
Licence Control:	0	**Oper Concession:**	
Latitude:		**Operator Region:**	4
Longitude:		**Operator District:**	2
Lot:		**Operator County:**	15
Concession:		**Op Municipality:**	
Region:	4	**Post Office Box:**	
District:	2	**MOE District:**	
County:	15	**SWP Area Name:**	
Trade Name:			
PDF URL:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	3 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES

Detail Licence No:		**Operator Box:**	
Licence No:		**Operator Class:**	
Status:		**Operator No:**	
Approval Date:		**Operator Type:**	
Report Source:		**Oper Area Code:**	
Licence Type:	Limited Vendor	**Oper Phone No:**	
Licence Type Code:	23	**Operator Ext:**	
Licence Class:		**Operator Lot:**	
Licence Control:		**Oper Concession:**	
Latitude:		**Operator Region:**	
Longitude:		**Operator District:**	
Lot:		**Operator County:**	
Concession:		**Op Municipality:**	
Region:		**Post Office Box:**	
District:		**MOE District:**	
County:		**SWP Area Name:**	
Trade Name:			
PDF URL:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	4 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES

Detail Licence No:		**Operator Box:**	
Licence No:		**Operator Class:**	
Status:		**Operator No:**	
Approval Date:		**Operator Type:**	
Report Source:		**Oper Area Code:**	
Licence Type:	Vendor	**Oper Phone No:**	
Licence Type Code:		**Operator Ext:**	
Licence Class:		**Operator Lot:**	
Licence Control:		**Oper Concession:**	
Latitude:		**Operator Region:**	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

---

92 | 5 of 23 | SE/197.4 | 76.9 / -0.93 | **Parson Refrigeration (1985) Ltd.**
296 Bank St.
Ottawa ON K2P 1X8 | SPL

Ref No: 5430-849QV8
Year:
Incident Dt:
Dt MOE Arvl on Scn:
MOE Reported Dt: 4/6/2010
Dt Document Closed:
Site No:
MOE Response: No Field Response
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Hartman's Independant Grocer<UNOFFICIAL>
Site Address:
Site Region:
Site Municipality:
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Parson Refrigeration (1985) Ltd.
Client Type:
Source Type:
Incident Cause: Valve / Fitting Leak Or Failure
Incident Preceding Spill:
Incident Reason: Spill
Incident Summary: Parsons Ref: 235 lbs R507 to Air
Environment Impact: Not Anticipated
Health Env Consequence:
Nature of Impact: Air Pollution
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code: 38
Contaminant Name: REFRIGERANT GAS, N.O.S.
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	6 of 23	SE/197.4	76.9 / -0.93	Bank and Somerset Holdings Limited 296 Bank Street Ottawa ON K2P 1X8	CA

Certificate #: 5155-5W4MG7
Application Year: 2004
Issue Date: 3/1/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	7 of 23	SE/197.4	76.9 / -0.93	HARTMAN'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P 1X8	PES

Detail Licence No: 23-01-16480-0
Licence No:
Status:
Approval Date:
Report Source:
Licence Type: LIMITED
Licence Type Code:
Licence Class:
Licence Control:
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code:
Oper Phone No:
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	8 of 23	SE/197.4	76.9 / -0.93	Parson Refrigeration (1985) Ltd. 296 Bank St Ottawa ON	SPL

Ref No: 7666-9ZVTFZ
Year:
Incident Dt: 8/30/2015
Dt MOE Arvl on Scn:
MOE Reported Dt: 8/30/2015
Dt Document Closed: 10/1/2015
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Your Independent Grocer<UNOFFICIAL>
Site Address: 296 Bank St
Site Region:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Site Municipality:	Ottawa
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	Parson Refrigeration (1985) Ltd.
Client Type:	
Source Type:	
Incident Cause:	
Incident Preceding Spill:	
Incident Reason:	Equipment Failure
Incident Summary:	Parson's Refrigeration 136 kgs R507 to atm
Environment Impact:	
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	136 kg
Contaminant Qty 1:	136
Contaminant Unit:	kg
Contaminant Code:	38
Contaminant Name:	REFRIGERANT GAS, N.O.S.
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	Unknown / N/A
SAC Action Class:	Air Spills - Gases and Vapours
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

92	***9 of 23***	***SE/197.4***	***76.9 / -0.93***	***296 Bank St Ottawa ON K2P1X8***	***EHS***

Order No:	20150427034	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	11-MAY-15	**Search Radius (km):**	.25
Date Received:	04-MAY-15	**X:**	-75.696543
Previous Site Name:		**Y:**	45.41482
Lot/Building Size:			
Additional Info Ordered:	City Directory		

92	***10 of 23***	***SE/197.4***	***76.9 / -0.93***	***MASSINE ENTERPRISES INC. O/A MASSINE'S YOUR INDEPENDENT GROCER 296 BANK ST OTTAWA ON K2P1X8***	***PES***

Detail Licence No:		**Operator Box:**	
Licence No:	17671	**Operator Class:**	
Status:		**Operator No:**	
Approval Date:		**Operator Type:**	
Report Source:	Legacy Licenses (Excluding TS)	**Oper Area Code:**	613
Licence Type:	Limited Vendor	**Oper Phone No:**	2348692
Licence Type Code:	23	**Operator Ext:**	
Licence Class:	01	**Operator Lot:**	
Licence Control:		**Oper Concession:**	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

---

92 | ***11 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***LOBLAWS INC O/A BANK STREET YOUR INDEPENDENT GROCER***
296 BANK ST
OTTAWA ON K2P1X8 | ***PES***

Detail Licence No:
Licence No: 17343
Status:
Approval Date:
Report Source: Legacy Licenses (Excluding TS)
Licence Type: Limited Vendor
Licence Type Code: 23
Licence Class: 01
Licence Control:
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code: 613
Oper Phone No: 2348692
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

---

92 | ***12 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***HARTMAN'S YOUR INDEPENDENT GROCER***
296 BANK ST
OTTAWA ON K2P1X8 | ***PES***

Detail Licence No:
Licence No: 16480
Status:
Approval Date:
Report Source: Legacy Licenses (Excluding TS)
Licence Type: Limited Vendor
Licence Type Code: 23
Licence Class: 01
Licence Control:
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code: 613
Oper Phone No: 2348692
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

---

92 | ***13 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***Bank and Somerset Holdings Limited***
296 Bank Street
Ottawa ON K2P 1X8 | ***ECA***

Approval No:	5155-5W4MG7	**MOE District:**	Ottawa
Approval Date:	2004-03-01	**City:**	
Status:	Approved	**Longitude:**	-75.6962
Record Type:	ECA	**Latitude:**	45.41505
Link Source:	IDS	**Geometry X:**	
SWP Area Name:	Rideau Valley	**Geometry Y:**	

Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Bank and Somerset Holdings Limited
Address: 296 Bank Street
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/5932-5SUMTJ-14.pdf
PDF Site Location:

---

92 **14 of 23** **SE/197.4** **76.9 / -0.93** **Loblaw Companies Limited**
296 Bank St.
Ottawa ON K2P 1X8
GEN

Generator Info

Generator No:	ON9102901	**Choice of Contact:**	CO_OFFICIAL
Approval Years:	2016	**Contaminated Fac:**	No
Status:		**MHSW Facility:**	No
PO Box No:		**SIC Code:**	445110
Country:	Canada		
Co Admin:			
Phone No Admin:			

SIC Description: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

92 **15 of 23** **SE/197.4** **76.9 / -0.93** **Loblaw Companies Limited**
296 Bank St.
Ottawa ON K2P 1X8
GEN

Generator Info

Generator No:	ON9102901	**Choice of Contact:**	CO_OFFICIAL
Approval Years:	2015	**Contaminated Fac:**	No
Status:		**MHSW Facility:**	No
PO Box No:		**SIC Code:**	445110
Country:	Canada		
Co Admin:			
Phone No Admin:			

SIC Description: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

92 **16 of 23** **SE/197.4** **76.9 / -0.93** **LOBLAWS INC.**
296 Bank St.
GEN

Ottawa ON K2P 1X8

Generator Info

Generator No:	ON9102901	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

---

92 ***17 of 23*** ***SE/197.4*** ***76.9 / -0.93*** ***HARTMAN'S YOUR INDEPENDENT GROCER*** ***PES***
296 BANK ST
OTTAWA ON K2P1X8

Detail Licence No:		***Operator Box:***	
Licence No:	10066	***Operator Class:***	
Status:		***Operator No:***	
Approval Date:		***Operator Type:***	
Report Source:	Legacy Licenses (Excluding TS)	***Oper Area Code:***	613
Licence Type:	Retail Vendor Class 03	***Oper Phone No:***	2348692
Licence Type Code:	21	***Operator Ext:***	
Licence Class:	03	***Operator Lot:***	
Licence Control:		***Oper Concession:***	
Latitude:		***Operator Region:***	
Longitude:		***Operator District:***	
Lot:		***Operator County:***	
Concession:		***Op Municipality:***	
Region:		***Post Office Box:***	
District:		***MOE District:***	
County:		***SWP Area Name:***	
Trade Name:			
PDF URL:			

---

92 ***18 of 23*** ***SE/197.4*** ***76.9 / -0.93*** ***HARTMAN'S YOUR INDEPENDENT GROCER*** ***PES***
296 BANK ST
OTTAWA ON K2P1X8

Detail Licence No:	23-01-10066-0	***Operator Box:***	
Licence No:	10066	***Operator Class:***	
Status:		***Operator No:***	

Approval Date:		**Operator Type:**	
Report Source:	Legacy Licenses (Excluding TS)	**Oper Area Code:**	613
Licence Type:	Limited Vendor	**Oper Phone No:**	2348692
Licence Type Code:	23	**Operator Ext:**	
Licence Class:	01	**Operator Lot:**	
Licence Control:	0	**Oper Concession:**	
Latitude:		**Operator Region:**	4
Longitude:		**Operator District:**	2
Lot:		**Operator County:**	15
Concession:		**Op Municipality:**	
Region:	4	**Post Office Box:**	
District:	2	**MOE District:**	
County:	15	**SWP Area Name:**	
Trade Name:			
PDF URL:			

---

92 | ***19 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***LOBLAWS INC.***
296 Bank St.
Ottawa ON K2P 1X8 | ***GEN***

Generator Info

Generator No:	ON9102901	**Choice of Contact:**	
Approval Years:	As of Jul 2020	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

---

92 | ***20 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***LOBLAWS INC.***
296 Bank St.
Ottawa ON K2P 1X8 | ***GEN***

Generator Info

Generator No:	ON9102901	**Choice of Contact:**	
Approval Years:	As of Nov 2021	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		

Co Admin:
Phone No Admin:
SIC Description:

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Waste Detail(s)

Waste Class: 212 I
Waste Class Name: Aliphatic solvents and residues

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

---

92 | ***21 of 23*** | ***SE/197.4*** | ***76.9 / -0.93*** | ***LOBLAWS INC.***
296 Bank St.
Ottawa ON K2P 1X8 | ***GEN***

Generator Info

Generator No: ON9102901
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 212 I
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: PATHOLOGICAL WASTES

2017 Generator Info

Gen No: ON9102901
ID: 35559
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 445110
NAICS Code2:
Choice of Contact: CO_ADMIN
Phone No Official: 905 459 2500 Ext.61368
Phone No Admin: 8552770388 Ext.
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

NAICS Code3:
Gen Name: LOBLAWS INC.
Gen Div:
Gen Op Name: Your Independent Grocer
Gen Op Div:
Site Adrs1: 296 Bank St.
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2P 1X8
Site Country: Canada
Co Official: Dan Romano
Co Admin: Craig Hudak

2017 Generator Manifest

ID: 63768
Generator No: ON9102901
Receiver Type: 030
Waste Char: P
Waste Code: 312
Sum Received Qty: 9.7
Waste Class Name: PATHOLOGICAL WASTES
Count Manifests: 1
District: 402

2018 Generator Info

Gen No: ON9102901
ID: 36248
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 445110
NAICS Code2:
NAICS Code3:
Choice of Contact: CO_ADMIN
Phone No Official: 905 459 2500 Ext.61368
Phone No Admin: 8552770388 Ext.
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402
Gen Name: LOBLAWS INC.
Gen Div:
Gen Op Name: Your Independent Grocer
Gen Op Div:
Site Adrs1: 296 Bank St.
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2P 1X8
Site Country: Canada
Co Official: Dan Romano
Co Admin: Craig Hudak

2018 Generator Manifest

ID: 64264
Generator No: ON9102901
Receiver Type: 030
Waste Char: P
Waste Code: 312
Sum Received Qty: 1.9
Waste Class Name: PATHOLOGICAL WASTES
Count Manifests: 1
District: 402

2019 Generator Info

Gen No: ON9102901
ID: 36752
Choice of Contact: CO_ADMIN
Phone No Official: 905 459 2500 Ext.61368

Contaminated Fac:	N	**Phone No Admin:**	8552770388 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	445110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	LOBLAWS INC.		
Gen Div:			
Gen Op Name:	Your Independent Grocer		
Gen Op Div:			
Site Adrs1:	296 Bank St.		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 1X8		
Site Country:	Canada		
Co Official:	Dan Romano		
Co Admin:	Craig Hudak		

2019 Generator Manifest

ID:	64282	**Sum Received Qty:**	9.0
Generator No:	ON9102901	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	312		

2020 Generator Info

Gen No:	ON9102901	**Choice of Contact:**	CO_ADMIN
ID:	36494	**Phone No Official:**	905 459 2500 Ext.61368
Contaminated Fac:	N	**Phone No Admin:**	8552770388 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	445110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	LOBLAWS INC.		
Gen Div:			
Gen Op Name:	Your Independent Grocer		
Gen Op Div:			
Site Adrs1:	296 Bank St.		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 1X8		
Site Country:	Canada		
Co Official:	Morgan Lamprey		
Co Admin:	Craig Hudak		

2020 Generator Manifest

ID:	60391	**Sum Received Qty:**	11.0
Generator No:	ON9102901	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	312		

2020 Generator Manifest

ID:	60390	***Sum Received Qty:***	7.0
Generator No:	ON9102901	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	1
Waste Char:	A	***District:***	402
Waste Code:	261		

2021 Generator Info

Gen No:	ON9102901	***Choice of Contact:***	CO_ADMIN
ID:	37441	***Phone No Official:***	905 459 2500 Ext.61368
Contaminated Fac:	N	***Phone No Admin:***	8552770388 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	445110	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	LOBLAWS INC.		
Gen Div:			
Gen Op Name:	Your Independent Grocer		
Gen Op Div:			
Site Adrs1:	296 Bank St.		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 1X8		
Site Country:	Canada		
Co Official:	Morgan Lamprey		
Co Admin:	Craig Hudak		

2021 Generator Manifest

ID:	63136	***Sum Received Qty:***	2.56
Generator No:	ON9102901	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	1
Waste Char:	A	***District:***	402
Waste Code:	261		

2021 Generator Manifest

ID:	63137	***Sum Received Qty:***	36.28
Generator No:	ON9102901	***Waste Class Name:***	PATHOLOGICAL WASTES
Receiver Type:	030	***Count Manifests:***	2
Waste Char:	P	***District:***	402
Waste Code:	312		

92	***22 of 23***	***SE/197.4***	***76.9 / -0.93***	***296 Bank Street 296 Bank Street OTTAWA ON***	***SPL***

Ref No:	1-1Z3N61	***Municipality No:***	
Year:		***Nature of Damage:***	
Incident Dt:	7/24/2022 8:00:00 PM	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	7/25/2022 12:46:27 AM	***Impact to Health:***	0 No Impact
Dt Document Closed:	7/28/2022 12:31:04 PM	***Agency Involved:***	
Site No:			
MOE Response:	Desktop Response		
Site County/District:			

Site Geo Ref Meth:	
Site District Office:	Ottawa District Office
Nearest Watercourse:	
Site Name:	296 Bank Street
Site Address:	296 Bank Street
Site Region:	
Site Municipality:	OTTAWA
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	MASSINE'S YOUR INDEPENDENT GROCER
Client Type:	Private Business
Source Type:	Valve/Fitting/Piping
Incident Cause:	
Incident Preceding Spill:	Process Upset
Incident Reason:	Equipment failure/malfunction
Incident Summary:	Refrigerant Leak R507
Environment Impact:	0 No Impact
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	10 kilogram (kg)
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	
Contaminant Name:	REFRIGERANT GAS R 404A
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	Air; Land
Activity Preceding Spill:	Normal operations
Property 2nd Watershed:	Lower Ottawa
Property Tertiary Watershed:	02KF - Central Ottawa - Mississippi
Sector Type:	SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES
SAC Action Class:	Ozone Depleting Substances
Call Report Locatn Geodata:	{"integration_ids":["PR00003948017"],"wkts":["POINT (-75.6963383000 45.4149865000)","POINT (-75.6963383000 45.4149865000)"],"creation_date":"2022-07-25"}
Time Reported:	
System Facility Address:	296 BANK ST, OTTAWA, ON K2P 1X8

92	23 of 23	SE/197.4	76.9 / -0.93	296 Bank Street, Ottawa ON	SPL

Ref No:	1-1UZA1O	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	6/26/2022 8:13:43 PM	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	6/26/2022 8:13:47 PM	**Impact to Health:**	0 No Impact
Dt Document Closed:	8/3/2022 9:40:27 AM	**Agency Involved:**	
Site No:			

MOE Response:	Desktop Response
Site County/District:	
Site Geo Ref Meth:	
Site District Office:	Ottawa District Office
Nearest Watercourse:	
Site Name:	
Site Address:	296 Bank Street, Ottawa
Site Region:	
Site Municipality:	
Site Lot:	
Site Conc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: MASSINE'S YOUR INDEPENDENT GROCER
Client Type: Private Business
Source Type:
Incident Cause:
Incident Preceding Spill: Leak/Break
Incident Reason:
Incident Summary: Parson Refrigeration: 136.5 kg R507A to atmosphere - Independent
Environment Impact: 1 Minor Impact
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 136.5 kilogram (kg)
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name: REFRIGERANT GASES (N.O.S.)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill: Normal operations
Property 2nd Watershed: Lower Ottawa
Property Tertiary Watershed:
Sector Type: REFRIGERATED WAREHOUSING AND STORAGE
SAC Action Class:
Call Report Locatn Geodata: {"integration_ids":["PR00003948017"],"wkts":["POINT (-75.6963383000 45.4149865000)"],"creation_date":"2022-06-26"}
Time Reported:
System Facility Address:

93	1 of 3	SE/198.0	76.9 / -0.93	**380 &386 Somerset St W/296 Bank St** **Ottawa ON**	EHS

Order No: 20040317015
Status: C
Report Type: Custom Report
Report Date: 3/26/04
Date Received: 3/17/04
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection: Bank St & Sommerset St W
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.696447
Y: 45.415117

93	2 of 3	SE/198.0	76.9 / -0.93	**DUFRESNE PILING COMPANY (1967) LTD.** **380 SOMERSET STREET WEST** **OTTAWA ON K2P 2R2**	GEN

Generator Info

Generator No: ON3389146
Approval Years: 04
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Contract Drilling (except Oil and Gas)
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 213117

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
93	3 of 3	SE/198.0	76.9 / -0.93	380 Somerset St W Ottawa ON K2P2R2	EHS

Order No:	20160106113	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	13-JAN-16	**Search Radius (km):**	.25
Date Received:	06-JAN-16	**X:**	-75.696869
Previous Site Name:		**Y:**	45.41488
Lot/Building Size:			
Additional Info Ordered:	City Directory		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	1 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE CRAD/DSIS-NATIONAL DEFENCE HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	GEN

Generator Info

Generator No:	ON0046540	**Choice of Contact:**	
Approval Years:	86,87,88,89,90	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	2 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE 190 O'CONNOR STREET DIRECTORATE, SCIENTIFIC INFORMAT.SERVICE OTTAWA ON K1A 1G8	GEN

Generator Info

Generator No:	ON0046540	**Choice of Contact:**	
Approval Years:	92,93,97	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	3 of 6	NE/199.7	76.9 / -0.93	GVT. OF CAN. - NATIONAL DEFENCE 18-192 CRAD/DSIS-NATIONAL DEFENCE	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				HEADQUARTERS 190 O'CONNOR ST. OTTAWA ON K1A 1G8	

Generator Info

Generator No:	ON0046540	**Choice of Contact:**	
Approval Years:	94,95,96	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	4 of 6	NE/199.7	76.9 / -0.93	DEPT. OF NATIONAL DEFENCE DEFENCE RESEARCH DEVELOPMENT BRANCH 190 O'CONNOR STREET OTTAWA ON K1A 0K2	GEN

Generator Info

Generator No:	ON0046540	**Choice of Contact:**	
Approval Years:	98,99,00,01,04	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	5 of 6	NE/199.7	76.9 / -0.93	Canadian Council on Social 190 O'Connor St Suite 100 Ottawa ON K2P 2R3	SCT

Established:	1920
Plant Size (ft²):	
Employment:	13

--Details--

Description:	Periodical Publishers
SIC/NAICS Code:	511120
Description:	Social Advocacy Organizations
SIC/NAICS Code:	813310
Description:	Civic and Social Organizations
SIC/NAICS Code:	813410
Description:	Business Associations
SIC/NAICS Code:	813910

---

94 | ***6 of 6*** | ***NE/199.7*** | ***76.9 / -0.93*** | ***190 O'connor St Ottawa ON K2P2R3*** | ***EHS***

Order No:	20150123005	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Custom Report	***Client Prov/State:***	ON
Report Date:	28-JAN-15	***Search Radius (km):***	.25
Date Received:	23-JAN-15	***X:***	-75.69601
Previous Site Name:		***Y:***	45.417916
Lot/Building Size:			
Additional Info Ordered:			

---

95 | ***1 of 1*** | ***ESE/206.1*** | ***75.9 / -1.93*** | ***338 SOMERSET STREET WEST OTTAWA ON*** | ***WWIS***

Well ID:	7046637	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:		***Data Entry Status:***	
Use 2nd:		***Data Src:***	
Final Well Status:	Observation Wells	***Date Received:***	07/17/2007
Water Type:		***Selected Flag:***	TRUE
Casing Material:		***Abandonment Rec:***	
Audit No:	Z74024	***Contractor:***	7241
Tag:	A061568	***Form Version:***	3
Constructn Method:		***Owner:***	
Elevation (m):		***County:***	OTTAWA-CARLETON
Elevatn Reliabilty:		***Lot:***	
Depth to Bedrock:		***Concession:***	
Well Depth:		***Concession Name:***	
Overburden/Bedrock:		***Easting NAD83:***	
Pump Rate:		***Northing NAD83:***	
Static Water Level:		***Zone:***	
Clear/Cloudy:		***UTM Reliability:***	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7046637.pdf

Additional Detail(s) (Map)

Well Completed Date:	06/22/2007
Year Completed:	2007
Depth (m):	8.23
Latitude:	45.4157256058949
Longitude:	-75.6952421522528
X:	-75.69524199044142
Y:	45.41572559951513

Path: 704\7046637.pdf

Bore Hole Information

Bore Hole ID:	23046637	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445602.00
Code OB Desc:		***North83:***	5029369.00
Open Hole:		***Org CS:***	UTM83
Cluster Kind:		***UTMRC:***	3
Date Completed:	06/22/2007	***UTMRC Desc:***	margin of error : 10 - 30 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	30346637
Layer:	3
Color:	6
General Color:	BROWN
Material 1:	06
Material 1 Desc:	SILT
Material 2:	05
Material 2 Desc:	CLAY
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	1.5
Formation End Depth:	3.6600000858306885
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	30446637
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	3.6600000858306885
Formation End Depth:	6.099999904632568
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	30246637
Layer:	2
Color:	6
General Color:	BROWN

Material 1: 06
Material 1 Desc: SILT
Material 2: 28
Material 2 Desc: SAND
Material 3: 05
Material 3 Desc: CLAY
Formation Top Depth: 0.9100000262260437
Formation End Depth: 1.5
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 30546637
Layer: 5
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 91
Material 2 Desc: WATER-BEARING
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 6.099999904632568
Formation End Depth: 8.229999542236328
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 30146637
Layer: 1
Color: 6
General Color: BROWN
Material 1: 02
Material 1 Desc: TOPSOIL
Material 2: 81
Material 2 Desc: SANDY
Material 3: 11
Material 3 Desc: GRAVEL
Formation Top Depth: 0.0
Formation End Depth: 0.9100000262260437
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 44001302
Layer: 2
Plug From: 0.3100000023841858
Plug To:
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 44001303
Layer: 3
Plug From:
Plug To:
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID:	44001304
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	25946637
Method Construction Code:	B
Method Construction:	Other Method
Other Method Construction:	

Pipe Information

Pipe ID:	29046637
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	42146637
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	4.880000114440918
Casing Diameter:	3.809999942779541
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	43146637
Layer:	1
Slot:	10
Screen Top Depth:	4.880000114440918
Screen End Depth:	8.229999542236328
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	

Hole Diameter

Hole ID:	46000804
Diameter:	8.890000343322754
Depth From:	0.0
Depth To:	8.229999542236328
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
96	*1 of 1*	*NNE/207.0*	*76.9 / -0.93*	*154 O'CONNOR STREET Ottawa ON*	*WWIS*

Well ID: 7130914 ***Flowing (Y/N):***

Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Test Hole	**Date Received:**	10/01/2009
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	M04512	**Contractor:**	1844
Tag:	A074637	**Form Version:**	5
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/25/2009
Year Completed:	2009
Depth (m):	
Latitude:	45.4184813159654
Longitude:	-75.6965029748894
X:	-75.69650281301982
Y:	45.41848130899689
Path:	713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/25/2009
Year Completed:	2009
Depth (m):	
Latitude:	45.4182748476945
Longitude:	-75.6964109677093
X:	-75.69641080581984
Y:	45.41827484126243
Path:	713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date:	07/25/2009
Year Completed:	2009
Depth (m):	6.1
Latitude:	45.4183986736524
Longitude:	-75.6967703654323
X:	-75.69677020277072
Y:	45.41839866740095
Path:	713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date: 07/24/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4182463650946
Longitude: -75.696653461001
X: -75.69665329876628
Y: 45.41824635803526
Path: 713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date: 07/24/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4184908620674
Longitude: -75.6964136232383
X: -75.69641346122059
Y: 45.41849085549298
Path: 713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date: 07/25/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4181746720951
Longitude: -75.6966014544894
X: -75.69660129172455
Y: 45.41817466498256
Path: 713\7130914.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7130914.pdf

Additional Detail(s) (Map)

Well Completed Date: 07/24/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4183812181676
Longitude: -75.6966806818897
X: -75.69668052039385
Y: 45.41838121127087
Path: 713\7130914.pdf

Bore Hole Information

Bore Hole ID: 1002832735
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 07/25/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:

Elevation:
Elevrc:
Zone: 18
East83: 445513.00
North83: 5029653.00
Org CS: UTM83
UTMRC: 3
UTMRC Desc: margin of error : 10 - 30 m
Location Method: wwr

Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Annular Space/Abandonment Sealing Record

Plug ID: 1002832739
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1002832738
Method Construction Code:
Method Construction:
Other Method Construction: GEOPROBE

Pipe Information

Pipe ID: 1002832740
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1002832742
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 3.799999952316284
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1002832741
Layer:
Slot:
Screen Top Depth: 3.799999952316284
Screen End Depth: 6.800000190734863
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1002832743
Pump Set At:
Static Level:
Final Level After Pumping:

Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM:
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1002832737
Diameter: 20.0
Depth From:
Depth To: 6.800000190734863
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1002832771
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 07/25/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445498.00
North83: 5029642.00
Org CS: UTM83
UTMRC: 3
UTMRC Desc: margin of error : 10 - 30 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1002832775
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1002832774
Method Construction Code:
Method Construction:
Other Method Construction: GEOPROBE

Pipe Information

Pipe ID: 1002832776
Casing No: 0

Comment:
Alt Name:

Construction Record - Casing

Casing ID:	1002832778
Layer:	
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	
Depth To:	3.0
Casing Diameter:	
Casing Diameter UOM:	
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1002832777
Layer:	
Slot:	
Screen Top Depth:	3.0
Screen End Depth:	5.900000095367432
Screen Material:	
Screen Depth UOM:	m
Screen Diameter UOM:	
Screen Diameter:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1002832779
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	
Rate UOM:	
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1002832773
Diameter:	20.0
Depth From:	
Depth To:	5.900000095367432
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Bore Hole Information

Bore Hole ID:	1002832753	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445494.00

Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 07/24/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:
North83: 5029650.00
Org CS: UTM83
UTMRC: 3
UTMRC Desc: margin of error : 10 - 30 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1002832757
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1002832756
Method Construction Code:
Method Construction:
Other Method Construction: GEOPROBE

Pipe Information

Pipe ID: 1002832758
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1002832760
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 3.0
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1002832759
Layer:
Slot:
Screen Top Depth: 3.0
Screen End Depth: 6.099999904632568
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1002832761
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	
Rate UOM:	
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1002832755
Diameter:	20.0
Depth From:	
Depth To:	6.099999904632568
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Bore Hole Information

Bore Hole ID:	1002730412	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445485.00
Code OB Desc:		***North83:***	5029667.00
Open Hole:	No	***Org CS:***	UTM83
Cluster Kind:		***UTMRC:***	3
Date Completed:	07/25/2009	***UTMRC Desc:***	margin of error : 10 - 30 m
Remarks:		***Location Method:***	wwr

Location Method Desc:	on Water Well Record
Elevrc Desc:	
Location Source Date:	
Improvement Location Source:	
Improvement Location Method:	
Source Revision Comment:	
Supplier Comment:	

Overburden and Bedrock Materials Interval

Formation ID:	1002832795
Layer:	5
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	84
Material 2 Desc:	SILTY
Material 3:	28
Material 3 Desc:	SAND
Formation Top Depth:	1.5
Formation End Depth:	4.800000190734863

Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1002832791
Layer: 1
Color:
General Color:
Material 1: 27
Material 1 Desc: OTHER
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 0.10000000149011612
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1002832793
Layer: 3
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 01
Material 2 Desc: FILL
Material 3:
Material 3 Desc:
Formation Top Depth: 0.4000000059604645
Formation End Depth: 0.5
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1002832796
Layer: 6
Color: 8
General Color: BLACK
Material 1: 17
Material 1 Desc: SHALE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 4.800000190734863
Formation End Depth: 6.099999904632568
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1002832794
Layer: 4
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY

Material 2:	01
Material 2 Desc:	FILL
Material 3:	81
Material 3 Desc:	SANDY
Formation Top Depth:	0.5
Formation End Depth:	1.5
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1002832792
Layer:	2
Color:	2
General Color:	GREY
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	01
Material 3 Desc:	FILL
Formation Top Depth:	0.10000000149011612
Formation End Depth:	0.4000000059604645
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1002832799
Layer:	1
Plug From:	0.10000000149011612
Plug To:	2.4000000953674316
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1002832802
Method Construction Code:	H
Method Construction:	Geoprobe
Other Method Construction:	

Pipe Information

Pipe ID:	1002832789
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Screen

Screen ID:	1002832800
Layer:	1
Slot:	10
Screen Top Depth:	
Screen End Depth:	
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	3.799999952316284

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1002832790
Pump Set At:	
Static Level:	6.800000190734863
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	
Water State After Test Code:	0
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1002832798
Diameter:	10.0
Depth From:	4.800000190734863
Depth To:	6.099999904632568
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Hole Diameter

Hole ID:	1002832797
Diameter:	20.0
Depth From:	0.0
Depth To:	4.800000190734863
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Bore Hole Information

Bore Hole ID:	1002832744	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445513.00
Code OB Desc:		***North83:***	5029677.00
Open Hole:		***Org CS:***	UTM83
Cluster Kind:	This is a record from cluster log sheet	***UTMRC:***	3
Date Completed:	07/24/2009	***UTMRC Desc:***	margin of error : 10 - 30 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1002832748
Layer:	

Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID:	1002832747
Method Construction Code:	
Method Construction:	
Other Method Construction:	GEOPROBE

Pipe Information

Pipe ID:	1002832749
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1002832751
Layer:	
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	
Depth To:	3.0
Casing Diameter:	
Casing Diameter UOM:	
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1002832750
Layer:	
Slot:	
Screen Top Depth:	3.0
Screen End Depth:	6.099999904632568
Screen Material:	
Screen Depth UOM:	m
Screen Diameter UOM:	
Screen Diameter:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1002832752
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	
Rate UOM:	
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1002832746
Diameter:	20.0
Depth From:	
Depth To:	6.099999904632568
Hole Depth UOM:	m
Hole Diameter UOM:	cm

Bore Hole Information

Bore Hole ID:	1002832762	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445492.00
Code OB Desc:		***North83:***	5029665.00
Open Hole:		***Org CS:***	UTM83
Cluster Kind:	This is a record from cluster log sheet	***UTMRC:***	3
Date Completed:	07/24/2009	***UTMRC Desc:***	margin of error : 10 - 30 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1002832766
Layer:	
Plug From:	
Plug To:	
Plug Depth UOM:	

Method of Construction & Well Use

Method Construction ID:	1002832765
Method Construction Code:	
Method Construction:	
Other Method Construction:	GEOPROBE

Pipe Information

Pipe ID:	1002832767
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1002832769
Layer:	
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	
Depth To:	3.0

Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1002832768
Layer:
Slot:
Screen Top Depth: 3.0
Screen End Depth: 6.099999904632568
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1002832770
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM:
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1002832764
Diameter: 20.0
Depth From:
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1002832780
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 07/25/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445506.00
North83: 5029676.00
Org CS: UTM83
UTMRC: 3
UTMRC Desc: margin of error : 10 - 30 m
Location Method: wwr

Supplier Comment:

Annular Space/Abandonment Sealing Record

Plug ID: 1002832784
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1002832783
Method Construction Code:
Method Construction:
Other Method Construction: GEOPROBE

Pipe Information

Pipe ID: 1002832785
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1002832787
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 3.700000047683716
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1002832786
Layer:
Slot:
Screen Top Depth: 3.700000047683716
Screen End Depth: 6.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1002832788
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:

Levels UOM:
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1002832782
Diameter: 20.0
Depth From:
Depth To: 6.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

---

97 | ***1 of 1*** | ***E/210.2*** | ***75.9 / -1.93*** | ***311 SOMERSET Ottawa ON*** | ***WWIS***

Well ID: 7391114
Construction Date:
Use 1st: Monitoring and Test Hole
Use 2nd:
Final Well Status: Monitoring and Test Hole
Water Type:
Casing Material:
Audit No: Z364138
Tag: A302951
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 06/29/2021
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391114.pdf

Additional Detail(s) (Map)

Well Completed Date: 05/25/2021
Year Completed: 2021
Depth (m):
Latitude: 45.4164743671495
Longitude: -75.6949701625181
X: -75.69497000126127
Y: 45.41647436047882
Path: 739\7391114.pdf

Bore Hole Information

Bore Hole ID: 1008704352
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:

Elevation:
Elevrc:
Zone: 18
East83: 445624.00
North83: 5029452.00

Open Hole:
Cluster Kind:
Date Completed: 05/25/2021
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1009852403
Layer: 3
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 28
Material 2 Desc: SAND
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 2.130000114440918
Formation End Depth: 3.6600000858306885
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1009852404
Layer: 4
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 3.6600000858306885
Formation End Depth: 10.359999656677246
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1009852405
Layer: 5
Color: 2
General Color: GREY
Material 1: 06
Material 1 Desc: SILT
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 10.359999656677246
Formation End Depth: 14.329999923706055
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID:	1009852402
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.3100000023841858
Formation End Depth:	2.130000114440918
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852401
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	02
Material 1 Desc:	TOPSOIL
Material 2:	
Material 2 Desc:	
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853461
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853462
Layer:	2
Plug From:	0.3100000023841858
Plug To:	10.970000267028809
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853463
Layer:	3
Plug From:	10.970000267028809
Plug To:	14.329999923706055
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1009854839
Method Construction Code:	5
Method Construction:	Air Percussion
Other Method Construction:	

Pipe Information

Pipe ID:	1009764984
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1009855217
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	11.279999732971191
Casing Diameter:	
Casing Diameter UOM:	
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1009855613
Layer:	1
Slot:	10
Screen Top Depth:	11.279999732971191
Screen End Depth:	14.329999923706055
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	6.03000020980835

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1009856077
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	LPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	No

Hole Diameter

Hole ID:	1009854398

Diameter:	11.430000305175781
Depth From:	0.0
Depth To:	2.130000114440918
Hole Depth UOM:	m
Hole Diameter UOM:	cm

98 **1 of 1** **E/217.6** **75.9 / -1.93** **311 SOMERSET Ottawa ON** **WWIS**

Well ID:	7391113	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	06/29/2021
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z364081	**Contractor:**	7241
Tag:	A302973	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391113.pdf

Additional Detail(s) (Map)

Well Completed Date:	05/26/2021
Year Completed:	2021
Depth (m):	
Latitude:	45.4162588191639
Longitude:	-75.6948908336928
X:	-75.69489067198141
Y:	45.416258812091236
Path:	739\7391113.pdf

Bore Hole Information

Bore Hole ID:	1008704349	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445630.00
Code OB Desc:		**North83:**	5029428.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	05/26/2021	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1009852399
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	3.6600000858306885
Formation End Depth:	11.279999732971191
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852400
Layer:	5
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	11.279999732971191
Formation End Depth:	13.100000381469727
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852396
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	28
Material 2 Desc:	SAND
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852398
Layer:	3
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	28
Material 2 Desc:	SAND
Material 3:	85

Material 3 Desc:	SOFT
Formation Top Depth:	2.440000057220459
Formation End Depth:	3.6600000858306885
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852397
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.3100000023841858
Formation End Depth:	2.440000057220459
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853458
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853460
Layer:	3
Plug From:	9.75
Plug To:	13.100000381469727
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853459
Layer:	2
Plug From:	0.3100000023841858
Plug To:	9.75
Plug Depth UOM:	m

Method of Construction & Well Use

Method Construction ID:	1009854838
Method Construction Code:	5
Method Construction:	Air Percussion
Other Method Construction:	

Pipe Information

Pipe ID:	1009764983
Casing No:	0

Comment:
Alt Name:

Construction Record - Casing

Casing ID:	1009855216
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	10.050000190734863
Casing Diameter:	5.199999809265137
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1009855612
Layer:	1
Slot:	10
Screen Top Depth:	10.050000190734863
Screen End Depth:	13.100000381469727
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	6.03000020980835

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1009856076
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	LPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	No

Hole Diameter

Hole ID:	1009854397
Diameter:	11.430000305175781
Depth From:	0.0
Depth To:	13.100000381469727
Hole Depth UOM:	m
Hole Diameter UOM:	cm

99	***1 of 1***	***S/218.4***	***77.9 / 0.07***	***429 MC LEARN Ottawa ON***	***WWIS***

Well ID:	7233874	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:	Monitoring and Test Hole	***Data Entry Status:***	

Use 2nd:	0	**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	12/15/2014
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z198211	**Contractor:**	7241
Tag:	A173760	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233874.pdf

Additional Detail(s) (Map)

Well Completed Date:	11/06/2014
Year Completed:	2014
Depth (m):	5.1
Latitude:	45.4145037046233
Longitude:	-75.6978215771411
X:	-75.69782141489169
Y:	45.414503698277464
Path:	723\7233874.pdf

Bore Hole Information

Bore Hole ID:	1005260594	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445399.00
Code OB Desc:		**North83:**	5029235.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	11/06/2014	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1005436481
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	05
Material 2 Desc:	CLAY
Material 3:	84
Material 3 Desc:	SILTY

Formation Top Depth:	1.2200000286102295
Formation End Depth:	3.0999999046325684
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1005436483
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.880000114440918
Formation End Depth:	5.099999904632568
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1005436482
Layer:	3
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	84
Material 2 Desc:	SILTY
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	3.0999999046325684
Formation End Depth:	4.880000114440918
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1005436480
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	01
Material 1 Desc:	FILL
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	28
Material 3 Desc:	SAND
Formation Top Depth:	0.0
Formation End Depth:	1.2200000286102295
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1005436491
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858

Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436492
Layer: 2
Plug From: 0.3100000023841858
Plug To: 2.740000009536743
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436493
Layer: 3
Plug From: 2.740000009536743
Plug To: 6.099999904632568
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1005436490
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID: 1005436479
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1005436486
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 5.199999809265137
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1005436487
Layer: 1
Slot: 10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.03000020980835

Water Details

Water ID: 1005436485
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole Diameter

Hole ID: 1005436484
Diameter: 15.319999694824219
Depth From: 0.0
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

---

100 | ***1 of 1*** | ***SW/219.0*** | ***78.9 / 1.07*** | ***290-292 Kent Street UTM Zone:18 Easting: 445333.64 Northing:5029231.41 Ottawa ON*** | ***SPL***

Ref No: 4021-AWFPQL
Year:
Incident Dt: 2018/03/01
Dt MOE Arvl on Scn:
MOE Reported Dt: 2018/03/01
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: drain/ CB<UNOFFICIAL>
Site Address: 290-292 Kent Street UTM Zone:18 Easting:445333.64 Northing:5029231.41
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type: Unknown / N/A
Incident Cause:
Incident Preceding Spill: Dumping
Incident Reason: Deliberate Act
Incident Summary: City of Ottawa: cooking grease to drive, walk, CB
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 0 other - see incident description
Contaminant Qty 1: 0
Contaminant Unit: other - see incident description
Contaminant Code: 46
Contaminant Name: COOKING GREASE
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1: n/a
Receiving Medium: Land; Surface Water; Source Water Zone
Activity Preceding Spill:
Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 2 - Minor Environment
Agency Involved:

Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Unknown / N/A
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

101 | ***1 of 1*** | ***E/219.4*** | ***75.9 / -1.93*** | ***311 Somerset St W Ottawa ON*** | ***WWIS***

Well ID:	7382859	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:	Monitoring and Test Hole	***Data Entry Status:***	
Use 2nd:		***Data Src:***	
Final Well Status:	Observation Wells	***Date Received:***	03/17/2021
Water Type:		***Selected Flag:***	TRUE
Casing Material:		***Abandonment Rec:***	
Audit No:	Z343100	***Contractor:***	7241
Tag:	A302968	***Form Version:***	7
Constructn Method:		***Owner:***	
Elevation (m):		***County:***	OTTAWA-CARLETON
Elevatn Reliabilty:		***Lot:***	
Depth to Bedrock:		***Concession:***	
Well Depth:		***Concession Name:***	
Overburden/Bedrock:		***Easting NAD83:***	
Pump Rate:		***Northing NAD83:***	
Static Water Level:		***Zone:***	
Clear/Cloudy:		***UTM Reliability:***	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008639565	***Tag No:***	A302968
Depth M:		***Contractor:***	7241
Year Completed:	2021	***Latitude:***	45.4165650729785
Well Completed Dt:	02/19/2021	***Longitude:***	-75.6948562475249
Audit No:	Z343100	***Y:***	45.41656506610067
Path:		***X:***	-75.69485608593011

Bore Hole Information

Bore Hole ID:	1008639565	***Elevation:***	
DP2BR:		***Elevrc:***	
Spatial Status:		***Zone:***	18
Code OB:		***East83:***	445633.00
Code OB Desc:		***North83:***	5029462.00
Open Hole:		***Org CS:***	UTM83
Cluster Kind:		***UTMRC:***	4
Date Completed:	02/19/2021	***UTMRC Desc:***	margin of error : 30 m - 100 m
Remarks:		***Location Method:***	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1009823647
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	05
Material 2 Desc:	CLAY
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	4.0
Formation End Depth:	10.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823645
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	
Material 2 Desc:	
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	0.0
Formation End Depth:	2.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823646
Layer:	2
Color:	2
General Color:	GREY
Material 1:	01
Material 1 Desc:	FILL
Material 2:	
Material 2 Desc:	
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	2.0
Formation End Depth:	4.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823648
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	85
Material 3 Desc:	SOFT

Formation Top Depth: 10.0
Formation End Depth: 22.5
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009824853
Layer: 3
Plug From: 11.5
Plug To: 22.5
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009824851
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009824852
Layer: 2
Plug From: 1.0
Plug To: 11.5
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1009826151
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1009718441
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009826572
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 12.5
Casing Diameter: 2.046999931335449
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID:	1009826983
Layer:	1
Slot:	10
Screen Top Depth:	12.5
Screen End Depth:	22.5
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	2.369999885559082

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1009827398
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	LPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1009825711
Diameter:	4.5
Depth From:	0.0
Depth To:	22.5
Hole Depth UOM:	m
Hole Diameter UOM:	cm

---

102 | ***1 of 1*** | ***NE/220.8*** | ***76.9 / -0.93*** | ***172 O'Connor
Ottawa ON K2P 1T5*** | ***EHS***

Order No:	20080327001	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Complete Report	**Client Prov/State:**	ON
Report Date:	4/4/2008	**Search Radius (km):**	0.25
Date Received:	3/27/2008	**X:**	-75.69635
Previous Site Name:		**Y:**	45.418209
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps And /or Site Plans		

---

103 | ***1 of 2*** | ***SE/221.6*** | ***76.9 / -0.87*** | ***FOSTER SPORT CENTER
305 BANK STREET
OTTAWA ON K2P 1X7*** | ***GEN***

Generator Info

Generator No:	ON1098700	**Choice of Contact:**	
Approval Years:	88,89,90	**Contaminated Fac:**	
Status:		**MHSW Facility:**	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

PO Box No: ***SIC Code:*** 6542
Country:
Co Admin:
Phone No Admin:
SIC Description: BICYCLE SHOPS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

---

103 ***2 of 2*** ***SE/221.6*** ***76.9 / -0.87*** ***FOSTER SPORT CENTER 15-418*** ***GEN***
305 BANK STREET
OTTAWA ON K2P 1X7

Generator Info

Generator No: ON1098700 ***Choice of Contact:***
Approval Years: 92,93,94,95,96,97,98 ***Contaminated Fac:***
Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 6542
Country:
Co Admin:
Phone No Admin:
SIC Description: BICYCLE SHOPS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

---

104 ***1 of 2*** ***N/222.5*** ***77.9 / 0.07*** ***BLACK PHOTO(OUT OF BUS.)*** ***GEN***
181 BANK STREET, UNITS 121-122
L'ESPLANADE
OTTAWA ON K2P 1W5

Generator Info

Generator No: ON1338155 ***Choice of Contact:***
Approval Years: 97,98 ***Contaminated Fac:***
Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 6571
Country:
Co Admin:
Phone No Admin:
SIC Description: CAMERA/PHOTO. SUPPLY

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

---

104 ***2 of 2*** ***N/222.5*** ***77.9 / 0.07*** ***BLACK PHOTO CORPORATION*** ***GEN***
171-181 BANK STREET, UNITS 121-122
OTTAWA ON K2P 1W5

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON1338160	***Choice of Contact:***	
Approval Years:	97,98,99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	6571
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	CAMERA/PHOTO. SUPPLY		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

105	***1 of 1***	***SSE/222.5***	***77.9 / 0.07***	***PSL Mechanical*** ***415 McLaren St*** ***Ottawa ON K2P 2C8***	***GEN***

Generator Info

Generator No:	ON7631710	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	212 L
Waste Class Name:	Aliphatic solvents and residues

2018 Generator Info

Gen No:	ON7631710	***Choice of Contact:***	CO_OFFICIAL
ID:	30405	***Phone No Official:***	613-240-2795 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	238220	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	PSL Mechanical		
Gen Div:			
Gen Op Name:	PSL Mechanical		
Gen Op Div:			
Site Adrs1:	415 McLaren St		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P 2C8		
Site Country:	Canada		
Co Official:	Eric Eric		
Co Admin:			

2018 Generator Manifest

ID:	56888	***Sum Received Qty:***	780.0
Generator No:	ON7631710	***Waste Class Name:***	ALIPHATIC SOLVENTS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	L	***District:***	402
Waste Code:	212		

---

106 ***1 of 5*** ***ESE/224.5*** ***75.9 / -1.93*** ***CDIA Report Newsletter*** ***SCT***
338 Somerset St W Unit 4
Ottawa ON K2P 0J9

Established:
Plant Size (ft²):
Employment: 3

--Details--
Description: Periodical Publishers
SIC/NAICS Code: 511120

---

106 ***2 of 5*** ***ESE/224.5*** ***75.9 / -1.93*** ***Enbridge Gas Distribution Inc.*** ***SPL***
338 Sommerset West
Ottawa ON

Ref No:	5203-7QJJV4	***Municipality No:***	
Year:		***Nature of Damage:***	
Incident Dt:		***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	3/27/2009	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:	Vespa<UNOFFICIAL>		
Site Address:			
Site Region:			
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:	Enbridge Gas Distribution Inc.		
Client Type:			
Source Type:			
Incident Cause:	Other Transport Accident		
Incident Preceding Spill:			
Incident Reason:	Error- Operator error		
Incident Summary:	Enbridge, Regulator strike, Evac, rd closed, safe		
Environment Impact:	Confirmed		
Health Env Consequence:			
Nature of Impact:	Air Pollution; Human Health/Safety		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:	other - see incident description		
Contaminant Code:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Contaminant Name: NATURAL GAS (METHANE)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Pipeline
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

106 | **3 of 5** | **ESE/224.5** | **75.9 / -1.93** | **whatif? Technologies Inc.**
338 Somerset St W Unit 3
Ottawa ON K2P 0J9 | **SCT**

Established: 01-AUG-89
Plant Size (ft²): 1500
Employment:

--Details--
Description: Computer Systems Design and Related Services
SIC/NAICS Code: 541510

Description: Software Publishers
SIC/NAICS Code: 511210

---

106 | **4 of 5** | **ESE/224.5** | **75.9 / -1.93** | **338 SOMERSET STREET WEST**
OTTAWA ON | **HINC**

External File Num: FS INC 0903-01589
Fuel Occurrence Type: Vapour Release
Date of Occurrence: 3/27/2009
Fuel Type Involved: Natural Gas
Status Desc: Completed - No Action Required
Job Type Desc: Incident/Near-Miss Occurrence (FS)
Oper. Type Involved: Commercial (e.g. restaurant, business unit, etc)
Service Interruptions: No
Property Damage: No
Fuel Life Cycle Stage: Utilization
Root Cause:
Reported Details: Service riser damage due to mechanical impact.
Fuel Category: Gaseous Fuel
Occurrence Type: Incident
Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)
County Name: Ottawa
Approx. Quant. Rel:
Nearby body of water:
Enter Drainage Syst.:
Approx. Quant. Unit:
Environmental Impact:

---

106 | **5 of 5** | **ESE/224.5** | **75.9 / -1.93** | **338 Somerset Street West Ottawa Ontario**
Ottawa ON K2P 0J9 | **EHS**

Order No: 20191203166
Status: C
Report Type: Standard Report
Nearest Intersection:
Municipality:
Client Prov/State: ON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Report Date:	06-DEC-19	**Search Radius (km):**	.25
Date Received:	03-DEC-19	**X:**	-75.695144
Previous Site Name:		**Y:**	45.415602
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans		

---

107 **1 of 19** **WNW/224.8** **76.9 / -0.93** **QUADRELLE MANAGEMENT LTD.**
340 LAURIER AVENUE WEST
OTTAWA ON K1A 0P9
CA

Certificate #:	8-4113-98-
Application Year:	98
Issue Date:	8/27/1998
Approval Type:	Industrial air
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	350 KW EMERGENCY GENERATOR
Contaminants:	
Emission Control:	

---

107 **2 of 19** **WNW/224.8** **76.9 / -0.93** **PRIVATE BUSINESS**
340 LAURIER AVE (N.O.S.)
OTTAWA CITY ON
SPL

Ref No:	243533	**Municipality No:**	20107
Year:		**Nature of Damage:**	
Incident Dt:	10/29/2002	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	10/29/2002	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Incident Reason:	ERROR		
Incident Summary:	ONY ENTERPRISE: 1800 L ETHYLENE GLYCOL TO PROPERTY AND SEWER.		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Multi Media Pollution		
Contaminant Qty:			

Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND, WATER
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

107 | ***3 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***JER OTTAWA ULC***
340 LAURIER AVENUE WEST
OTTAWA ON K1A 0P9 | ***GEN***

Generator Info

Generator No: ON0383914
Approval Years: 01
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: OTHER SERVICES

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 9999

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 242
Waste Class Name: HALOGENATED PESTICIDES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Detail(s)

Waste Class: 266
Waste Class Name: PHENOLIC WASTES

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
107	4 of 19	WNW/224.8	76.9 / -0.93	JER OTTAWA ULC 340 LAURIER AVENUE WEST SIR WILFRID LAURIER BUILDING OTTAWA ON K1A 0P9	GEN

Generator Info

Generator No: ON0383914
Approval Years: 02,03,04
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 266
Waste Class Name: PHENOLIC WASTES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Detail(s)

Waste Class: 242
Waste Class Name: HALOGENATED PESTICIDES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

107	*5 of 19*	*WNW/224.8*	*76.9 / -0.93*	***OTTAWA 340 LAURIER AVENUE WEST INC.*** ***340 LAURIER AVENUE WEST*** ***OTTAWA ON K1A 0P9***	*GEN*

Generator Info

Generator No: ON4067296
Approval Years: 04,05
Status:
PO Box No:
Country:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 541611

Co Admin:
Phone No Admin:
SIC Description: Administrative Management and General Management Consulting Services

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

---

107 | ***6 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***Public Works and Government Services Canada***
340 Laurier Street
Ottawa ON K1P 5K3 | ***GEN***

Generator Info

Generator No: ON9217037
Approval Years: 04,05,06
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: All Other Waste Management Services

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 562990

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

---

107 | ***7 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***340 Laurier Avenue West, Ottawa ON K1A 0P9*** | ***EHS***

Order No:	20100713013	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	7/21/2010	**Search Radius (km):**	0.25
Date Received:	7/13/2010	**X:**	-75.699767
Previous Site Name:		**Y:**	45.417867
Lot/Building Size:			
Additional Info Ordered:			

---

107 | ***8 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***340 Laurier Avenue, Ottawa ON*** | ***EHS***

Order No:	20101012037	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	10/19/2010	**Search Radius (km):**	0.25
Date Received:	10/12/2010 3:43:56 PM	**X:**	-75.699927
Previous Site Name:		**Y:**	45.418037
Lot/Building Size:			
Additional Info Ordered:			

---

107 | ***9 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***Public Works and Government Services Canada, 340 Laurier Street, Ottawa ON*** | ***GEN***

Generator Info

Generator No:	ON9217037	**Choice of Contact:**	
Approval Years:	2009	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	562990
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	All Other Waste Management Services		

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

---

107 ***10 of 19*** ***WNW/224.8*** ***76.9 / -0.93*** ***OTTAWA - 340 LAURIER WEST INC*** ***EASR***
340 LAURIER AVENUE WEST
OTTAWA ON K1N 0P9

Approval No:	R-003-9302648588	***MOE District:***	
Status:	REGISTERED	***Municipality:***	OTTAWA
Date:	2013-01-30	***Latitude:***	
Record Type:	EASR	***Longitude:***	
Link Source:	MOFA	***Geometry X:***	
Project Type:	Heating System	***Geometry Y:***	
Full Address:			
Approval Type:	EASR-Heating System		
SWP Area Name:			
PDF NAICS Code:			
PDF URL:			
PDF Site Location:			

---

107 ***11 of 19*** ***WNW/224.8*** ***76.9 / -0.93*** ***O&Y ENTERPRISE*** ***NPRI***
340 LAURIER Avenue West
OTTAWA ON K1A0P8

NPRI ID:	8800001959	***Org ID:***	
Other ID:		***Submit Date:***	
No Other ID:		***Last Modified:***	
Track ID:		***Contact ID:***	
Report ID:		***Cont Type:***	MED
Report Type:		***Contact Title:***	Mr.
Rpt Type ID:		***Cont First Name:***	DAVID
Report Year:	2004	***Cont Last Name:***	CORDICK
Not-Current Rpt?:		***Contact Position:***	Property Manager
Yr of Last Filed Rpt:		***Contact Fax:***	
Fac ID:		***Contact Ph.:***	
Fac Name:	340 LAURIER AVE. WEST	***Cont Area Code:***	613
Fac Address1:		***Contact Tel.:***	7830917
Fac Address2:		***Contact Ext.:***	
Fac Postal Zip:		***Cont Fax Area Cde:***	613
Facility Lat:		***Contact Fax:***	2346581
Facility Long:		***Contact Email:***	dcordick@oyp.com
DLS (Last Filed Rpt):		***Latitude:***	
Facility DLS:		***Longitude:***	
Datum:		***UTM Zone:***	
Facility Cmnts:		***UTM Northing:***	
URL:		***UTM Easting:***	
No of Empl.:	1	***Waste Streams:***	
Parent Co.:		***No Streams:***	
No Parent Co.:		***Waste Off Sites:***	

Pollut Prev Cmnts: ***No Off Sites:***
Stacks: ***Shutdown:***
No of Stacks: ***No of Shutdown:***
Canadian SIC Code (2 digit):
Canadian SIC Code:
SIC Code Description:
American SIC Code:
NAICS Code (2 digit): 53
NAICS 2 Description: Real Estate and Rental and Leasing
NAICS Code (4 digit): 5311
NAICS 4 Description: Lessors of Real Estate
NAICS Code (6 digit): 531120
NAICS 6 Description: Lessors of Non-Residential Buildings (except Mini-Warehouses)

Substance Release Report

CAS No: 11104-93-1
Report ID:
Rpt Period: 2004
Subst Released: Nitrogen oxides (expressed as NO2)
Air:
Water:
Land:
Total Releases:
Units: tonnes

CAS No: 811-97-2
Report ID:
Rpt Period: 2004
Subst Released: HFC-134a Hydrofluorocarbon
Air:
Water:
Land:
Total Releases:
Units: tonnes

CAS No: 7446-09-5
Report ID:
Rpt Period: 2004
Subst Released: Sulphur dioxide
Air:
Water:
Land:
Total Releases:
Units: tonnes

---

107 ***12 of 19*** ***WNW/224.8*** ***76.9 / -0.93*** ***OTTAWA - 340 LAURIER WEST INC***
340 LAURIER AVENUE WEST
OTTAWA ON K1N 0P9 ***EASR***

Approval No: R-003-9302648588 ***MOE District:***
Status: REGISTERED ***Municipality:*** OTTAWA
Date: 2013-01-30 ***Latitude:***
Record Type: EASR ***Longitude:***
Link Source: MOFA ***Geometry X:***
Project Type: Heating System ***Geometry Y:***
Full Address:
Approval Type: EASR-Heating System
SWP Area Name:
PDF NAICS Code:
PDF URL:
PDF Site Location:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
107	13 of 19	WNW/224.8	76.9 / -0.93	Starlight Investments 340 Laurier Ave West Ottawa ON K1A 0P9	GEN

Generator Info

Generator No:	ON5301151	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2016	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	238220
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS		

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

2017 Generator Info

Gen No:	ON5301151	***Choice of Contact:***	CO_OFFICIAL
ID:	20988	***Phone No Official:***	613-913-0141 Ext.
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	238220	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Starlight Investments		
Gen Div:			
Gen Op Name:	Starlight Investments		
Gen Op Div:			
Site Adrs1:	340 Laurier Ave West		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K1A 0P9		
Site Country:	Canada		
Co Official:	Geof Gainsford		
Co Admin:			

2017 Generator Manifest

ID:	45429	***Sum Received Qty:***	8256.0
Generator No:	ON5301151	***Waste Class Name:***	ALIPHATIC SOLVENTS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	L	***District:***	402
Waste Code:	212		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
107	14 of 19	WNW/224.8	76.9 / -0.93	TNC 340 Laurier Ltd. 340 Laurier Ave West ottawa ON K1A 0P8	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator No: ON8056777
Approval Years: 2016
Status:
PO Box No:
Country: Canada
Co Admin: Shane Paulin
Phone No Admin: 613 274 3742 Ext.224
SIC Description: REAL ESTATE PROPERTY MANAGERS
Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 531310

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

---

107 | ***15 of 19*** | ***WNW/224.8*** | ***76.9 / -0.93*** | ***TNC 340 Laurier Ltd***
340 Laurier
Ottawa ON K1A 0P9 | ***GEN***

Generator Info

Generator No: ON2961230
Approval Years: 2014
Status:
PO Box No:
Country: Canada
Co Admin: Kevin Spirak
Phone No Admin: 6132743742 Ext.224
SIC Description: REAL ESTATE PROPERTY MANAGERS
Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 531310

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 135
Waste Class Name: REACTIVE ANION WASTES

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 211
Waste Class Name: AROMATIC SOLVENTS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

---

107 ***16 of 19*** ***WNW/224.8*** ***76.9 / -0.93*** ***Epic Realty Partners*** ***GEN***
340 Laurier Ave.
Ottawa ON K1P 5K3

Generator Info

Generator No:	ON6191200	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2014	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	521310
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	521310		

Waste Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

---

107 ***17 of 19*** ***WNW/224.8*** ***76.9 / -0.93*** ***Demo Core*** ***GEN***
340 Laurier Ave.
Ottawa ON K1A 0P9

Generator Info

Generator No:	ON8037772	***Choice of Contact:***	
Approval Years:	As of Nov 2021	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCB

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

Waste Detail(s)

Waste Class: 145 L

Waste Class Name: Wastes from the use of pigments, coatings and paints

2020 Generator Info

Gen No:	ON8037772	**Choice of Contact:**	CO_OFFICIAL
ID:	32097	**Phone No Official:**	613-806-1871 Ext.
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	562990	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name: Demo Core
Gen Div:
Gen Op Name: Demo Core
Gen Op Div:
Site Adrs1: 340 Laurier Ave.
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K1A 0P9
Site Country: Canada
Co Official: Richard Lovering
Co Admin:

2020 Generator Manifest

ID:	55217	**Sum Received Qty:**	1000.0
Generator No:	ON8037772	**Waste Class Name:**	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	L	**District:**	402
Waste Code:	145		

2020 Generator Manifest

ID:	55218	**Sum Received Qty:**	4200.0
Generator No:	ON8037772	**Waste Class Name:**	ALIPHATIC SOLVENTS
Receiver Type:	035	**Count Manifests:**	2
Waste Char:	L	**District:**	402
Waste Code:	212		

2021 Generator Info

Gen No:	ON8037772	**Choice of Contact:**	CO_OFFICIAL
ID:	32835	**Phone No Official:**	613-806-1871 Ext.
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	562990	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			

Gen Name: Demo Core
Gen Div:
Gen Op Name: Demo Core
Gen Op Div:
Site Adrs1: 340 Laurier Ave.
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Province Out:
Site Postal Code: K1A 0P9
Site Country: Canada
Co Official: Richard Lovering
Co Admin:

---

107 **18 of 19** **WNW/224.8** **76.9 / -0.93** **340 TNC Laurier Ltd.**
340 Laurier Avenue
Ottawa ON K1A 0P9 **GEN**

Generator Info

Generator No: ON5707800
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

---

107 **19 of 19** **WNW/224.8** **76.9 / -0.93** **340 TNC Laurier Ltd.**
340 Laurier Avenue
Ottawa ON K1A 0P9 **GEN**

Generator Info

Generator No: ON5707800
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: ALIPHATIC SOLVENTS

2021 Generator Info

Gen No: ON5707800
ID: 22859
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 531310
NAICS Code2:
NAICS Code3:
Gen Name: 340 TNC Laurier Ltd.
Gen Div:
Gen Op Name: 340 TNC Laurier Ltd.

Choice of Contact: CO_OFFICIAL
Phone No Official: 613-553-9967 Ext.
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

Gen Op Div:
Site Adrs1: 340 Laurier Avenue
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K1A 0P9
Site Country: Canada
Co Official: Kerrie Kossatz
Co Admin:

2021 Generator Manifest

ID:	45234	**Sum Received Qty:**	21790.0
Generator No:	ON5707800	**Waste Class Name:**	ALIPHATIC SOLVENTS
Receiver Type:	035	**Count Manifests:**	3
Waste Char:	L	**District:**	402
Waste Code:	212		

---

108 | ***1 of 1*** | ***NNE/225.7*** | ***76.9 / -0.93*** | ***DARLING INTERNATIONAL CANADA INC.*** | ***SPL***

OTTAWA ON

Ref No:	1-8BVEOL	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	Jun 27,2024 03:00:00 PM	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	Jun 28,2024 08:08:54 AM	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	

Site No:
MOE Response: Desktop Response
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa District Office
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: DARLING INTERNATIONAL CANADA INC.
Client Type: Private Business
Source Type: Truck - Transport/Hauling
Incident Cause:
Incident Preceding Spill: Leak/Break
Incident Reason: Human error (Specify)
Incident Summary: Darling International: 185 kg cooking oil to road way, cleaned
Environment Impact:
Health Env Consequence: Low
Nature of Impact:
Contaminant Qty: 180 kilogram (kg)
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name: COOKING OIL
Contaminant Limit 1:

Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Land
Activity Preceding Spill: Transportation
Property 2nd Watershed: Lower Ottawa
Property Tertiary Watershed: 02KF - Central Ottawa - Mississippi
Sector Type: RENDERING AND MEAT PROCESSING FROM CARCASSES
SAC Action Class:
Call Report Locatn Geodata: {"integration_ids":["PR00003890365"],"wkts":["POINT (-75.6967322000 45.4183908000)"],"creation_date":"2024-06-28"}
Time Reported:
System Facility Address:

---

109 | **1 of 1** | **NE/225.9** | **76.6 / -1.21** | **OTTAWA CITY - SOMERSET ST. O'CONNOR ST./NEPEAN ST. OTTAWA CITY ON** | **CA**

Certificate #: 3-0495-92-
Application Year: 92
Issue Date: 5/12/1992
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

---

110 | **1 of 1** | **E/226.5** | **75.9 / -1.93** | **311 Somerset Street West Ottawa ON K2P 0J8** | **EHS**

Order No: 21011400150
Status: C
Report Type: Custom Report
Report Date: 22-JAN-21
Date Received: 14-JAN-21
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6947834
Y: 45.4162153

---

111 | **1 of 9** | **NNW/227.7** | **77.9 / 0.07** | **OLYMPIA & YORK DEVELOPMENTS LTD. L'ESPLANADE LAURIER; 171 BANK STREET LEVEL II OTTAWA ON K2P 1W5** | **NPCB**

Company Code: O0163C
Industry: Other
Site Status:
Transaction Date: 10/8/1993
Inspection Date: 7/21/1993

--Details--
Label:
Serial No.:
PCB Type/Code: Inerteen
Location:
Item/State:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

No. of Items:
Manufacturer:
Status: In-Use
Contents: 1433.00 L

---

111 **2 of 9** **NNW/227.7** **77.9 / 0.07** **ROSTRUST INVESTMENTS INC.** **NPCB**
171 BANK STREET LEVEL II BANK STREET LEVEL II
OTTAWA ON

Company Code: O0163C
Industry:
Site Status:
Transaction Date:
Inspection Date:

--Details--
Label:
Serial No.:
PCB Type/Code:
Location:
Item/State:
No. of Items:
Manufacturer:
Status: In-Use
Contents:

---

111 **3 of 9** **NNW/227.7** **77.9 / 0.07** **171 Bank St** **EHS**
Ottawa ON K2P 1W5

Order No: 20000919004
Status: C
Report Type: Complete Report
Report Date: 9/21/00
Date Received: 9/14/00
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality: Ottawa Carleton
Client Prov/State: ON
Search Radius (km): 0.30
X: -75.697803
Y: 45.418652

---

111 **4 of 9** **NNW/227.7** **77.9 / 0.07** **CAMPBELL AND KENNEDY ELECTRIC LTD.** **GEN**
M2-171 BANK ST.
OTTAWA ON K2P 1W5

Generator Info

Generator No: ON0043400
Approval Years: 86,87,88,89,90,92,93,94
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: *** NOT DEFINED ***

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 0000

---

111 **5 of 9** **NNW/227.7** **77.9 / 0.07** **O & Y PROPERTIES INC.** **GEN**
171 BANK STREET L'ESPLANADE LAURIER
OTTAWA ON K2P 1W5

Generator Info

Generator No:	ON0383905	***Choice of Contact:***	
Approval Years:	94,95,96,97,98	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	7512
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	NON-RES. BLDG. OPER.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

---

111 ***6 of 9*** ***NNW/227.7*** ***77.9 / 0.07*** ***O & Y PROPERTIES INC.*** ***GEN***
L'ESPLANADE LAURIER 171 BANK STREET
OTTAWA ON K2P 1W5

Generator Info

Generator No:	ON0383905	***Choice of Contact:***	
Approval Years:	99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	7512
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	NON-RES. BLDG. OPER.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

---

111 ***7 of 9*** ***NNW/227.7*** ***77.9 / 0.07*** ***ROSTRUST INVESTMENTS INC.*** ***GEN***
171 BANK STREET (L'ESPLANADE LAURIER)
OTTAWA ON K2P 1W5

Generator Info

Generator No:	ON2079000	***Choice of Contact:***	
Approval Years:	95,96,97,98,99,00,01,02,03,04	***Contaminated Fac:***	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 7512
Country:
Co Admin:
Phone No Admin:
SIC Description: NON-RES. BLDG. OPER.

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCB'S

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

111	*8 of 9*	*NNW/227.7*	*77.9 / 0.07*	***ROSTRUST INVESTMENTS INC.*** ***171 BANK STREET LEVEL 2 L'Esplanade Laurier*** ***Ottawa ON K2P 1W5***	***NPCB***

Company Code: O0163C
Industry: Other
Site Status: In- Use
Transaction Date: 7/21/1993
Inspection Date: 7/21/1993

--Details--
Label:
Serial No.:
PCB Type/Code: Askarel/Askarel
Location:
Item/State:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

No. of Items:
Manufacturer:
Status: In-Use
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Inerteen
Location: Small Transformer Vault
Item/State:
No. of Items:
Manufacturer:
Status: In-Use
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Inerteen
Location: Trans. Vault/ P1 Level N. Side
Item/State:
No. of Items:
Manufacturer:
Status: In-Use
Contents:

111	*9 of 9*	*NNW/227.7*	*77.9 / 0.07*	***ROSTRUST INVESTMENTS INC.*** ***L'ESPLANADE LAURIER 171 BANK STREET*** ***LEVEL II*** ***OTTAWA ON K2P 1W5***	*NPCB*

Company Code: O0163C
Industry: OTHER
Site Status: INSPECTED SITES (NON FEDERAL)
Transaction Date: 10/6/1996
Inspection Date: 7/21/1993

--Details--
Label: OR21842
Serial No.:
PCB Type/Code: ASKAREL/ASKAREL
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: IN-USE
Contents: 3250 L

Label: OR21836
Serial No.: C-31S-0783
PCB Type/Code: ASKAREL/INERTEEN
Location: TRANS. VAULTLP1 LEVEL N. SIDE
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21837
Serial No.: B-31S-0783
PCB Type/Code: ASKAREL/INERTEEN
Location: TRANS. VAULTLP1 LEVEL N. SIDE
Item/State: TRANSFORMER/FULL
No. of Items: 1

Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21838
Serial No.: C-31S-0782
PCB Type/Code: ASKAREL/INERTEEN
Location: TRANS. VAULTLP1 LEVEL N. SIDE
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21839
Serial No.: A-31S-0782
PCB Type/Code: ASKAREL/INERTEEN
Location: TRANS. VAULTLP1 LEVEL N. SIDE
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21840
Serial No.: A-31S-0783
PCB Type/Code: ASKAREL/INERTEEN
Location: SMALL TRANSFORMER VAULT
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21841
Serial No.: B-31S-0782
PCB Type/Code: ASKAREL/INERTEEN
Location: SMALL TRANSFORMER VAULT
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer: WESTINGHOUSE
Status: IN-USE
Contents: 1433 L

Label: OR21843
Serial No.:
PCB Type/Code: ASKAREL/ASKAREL
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: IN-USE
Contents: 3250 L

---

112 | ***1 of 8*** | ***NW/228.1*** | ***76.8 / -0.96*** | ***SHOPPERS DRUG MART #988***
174 BANK ST
OTTAWA ON K2P1W6 | ***PES***

Detail Licence No:
Licence No: 16739
Status:
Approval Date:
Report Source: Legacy Licenses (Excluding TS)
Licence Type: Limited Vendor

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code: 613
Oper Phone No: 2325723

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Licence Type Code:	23	**Operator Ext:**	
Licence Class:	01	**Operator Lot:**	
Licence Control:		**Oper Concession:**	
Latitude:		**Operator Region:**	
Longitude:		**Operator District:**	
Lot:		**Operator County:**	
Concession:		**Op Municipality:**	
Region:		**Post Office Box:**	
District:		**MOE District:**	
County:		**SWP Area Name:**	
Trade Name:			
PDF URL:			

112	2 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN

Generator Info

Generator No:	ON6683154	**Choice of Contact:**	CO_ADMIN
Approval Years:	2016	**Contaminated Fac:**	No
Status:		**MHSW Facility:**	No
PO Box No:		**SIC Code:**	446110
Country:	Canada		
Co Admin:	Nastran Najafi-Fard		
Phone No Admin:	4164931220 Ext.3218		
SIC Description:	446110		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

112	3 of 8	NW/228.1	76.8 / -0.96	B. Surani Drugs Ltd. (910) 174 BANK ST OTTAWA ON K1P 5N7	GEN

Generator Info

Generator No:	ON6683154	**Choice of Contact:**	CO_ADMIN
Approval Years:	2015	**Contaminated Fac:**	No
Status:		**MHSW Facility:**	No
PO Box No:		**SIC Code:**	446110
Country:	Canada		
Co Admin:	Nastran Najafi-Fard		
Phone No Admin:	4164931220 Ext.3218		
SIC Description:	446110		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

112 | ***4 of 8*** | ***NW/228.1*** | ***76.8 / -0.96*** | ***B. Surani Drugs Ltd. (910)*** ***174 BANK ST*** ***OTTAWA ON K1P 5N7*** | ***GEN***

Generator Info

Generator No: ON6683154
Approval Years: As of Dec 2018
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

---

112 | ***5 of 8*** | ***NW/228.1*** | ***76.8 / -0.96*** | ***SHOPPERS DRUG MART #988*** ***174 BANK ST*** ***OTTAWA ON K2P1W6*** | ***PES***

Detail Licence No:
Licence No: 12805
Status:
Approval Date:
Report Source: Legacy Licenses (Excluding TS)
Licence Type: Limited Vendor
Licence Type Code: 23
Licence Class: 01
Licence Control:
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:
PDF URL:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code: 613
Oper Phone No: 2325723
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region:
Operator District:
Operator County:
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

---

112 | ***6 of 8*** | ***NW/228.1*** | ***76.8 / -0.96*** | ***B. Surani Drugs Ltd. (910)*** ***174 BANK ST*** ***OTTAWA ON K1P 5N7*** | ***GEN***

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON6683154	***Choice of Contact:***	
Approval Years:	As of Jul 2020	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

112	***7 of 8***	***NW/228.1***	***76.8 / -0.96***	***B. Surani Drugs Ltd. (910)*** ***174 BANK ST*** ***OTTAWA ON K1P 5N7***	***GEN***

Generator Info

Generator No:	ON6683154	***Choice of Contact:***	
Approval Years:	As of Nov 2021	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

112	***8 of 8***	***NW/228.1***	***76.8 / -0.96***	***B. Surani Drugs Ltd. (910)*** ***174 BANK ST*** ***OTTAWA ON K1P 5N7***	***GEN***

Generator Info

Generator No:	ON6683154	***Choice of Contact:***	
Approval Years:	As of Oct 2022	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	

PO Box No: ***SIC Code:***
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: PHARMACEUTICALS

2017 Generator Info

Gen No: ON6683154
ID: 26278
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 446110
NAICS Code2:
NAICS Code3:
Gen Name: B. Surani Drugs Ltd. (910)
Gen Div:
Gen Op Name: Shoppers Drug Mart 988
Gen Op Div:
Site Adrs1: 174 BANK ST
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: OTTAWA
Province Out:
Site Postal Code: K1P 5N7
Site Country: Canada
Co Official: Bashir Surani
Co Admin: Nastran Najafi-Fard
Choice of Contact: CO_ADMIN
Phone No Official: 613-232-5723 Ext.
Phone No Admin: 4164931220 Ext.3218
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2017 Generator Manifest

ID: 52105
Generator No: ON6683154
Receiver Type: 030
Waste Char: A
Waste Code: 261
Sum Received Qty: 5.0
Waste Class Name: PHARMACEUTICALS
Count Manifests: 1
District: 402

2018 Generator Info

Gen No: ON6683154
ID: 26637
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 446110
NAICS Code2:
NAICS Code3:
Gen Name: B. Surani Drugs Ltd. (910)
Gen Div:
Gen Op Name: Shoppers Drug Mart 988
Gen Op Div:
Choice of Contact: CO_ADMIN
Phone No Official: 613-232-5723 Ext.
Phone No Admin: 4164931220 Ext.
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

Site Adrs1:	174 BANK ST
Site Bldg:	
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	OTTAWA
Province Out:	
Site Postal Code:	K1P 5N7
Site Country:	Canada
Co Official:	Bashir Surani
Co Admin:	Pharmacy Operations Development

2018 Generator Manifest

ID:	52010	***Sum Received Qty:***	11.0
Generator No:	ON6683154	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	2
Waste Char:	A	***District:***	402
Waste Code:	261		

2018 Generator Manifest

ID:	52011	***Sum Received Qty:***	5.5
Generator No:	ON6683154	***Waste Class Name:***	PATHOLOGICAL WASTES
Receiver Type:	030	***Count Manifests:***	1
Waste Char:	P	***District:***	402
Waste Code:	312		

2019 Generator Info

Gen No:	ON6683154	***Choice of Contact:***	CO_ADMIN
ID:	26862	***Phone No Official:***	613-232-5723 Ext.
Contaminated Fac:	N	***Phone No Admin:***	4164931220 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	446110	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	B. Surani Drugs Ltd. (910)		
Gen Div:			
Gen Op Name:	Shoppers Drug Mart 988		
Gen Op Div:			
Site Adrs1:	174 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K1P 5N7		
Site Country:	Canada		
Co Official:	Bashir Surani		
Co Admin:	Pharmacy Operations Development		

2019 Generator Manifest

ID:	51959	***Sum Received Qty:***	13.0
Generator No:	ON6683154	***Waste Class Name:***	PHARMACEUTICALS
Receiver Type:	030	***Count Manifests:***	2
Waste Char:	A	***District:***	402
Waste Code:	261		

2019 Generator Manifest

ID:	51960	**Sum Received Qty:**	4.0
Generator No:	ON6683154	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	312		

2020 Generator Info

Gen No:	ON6683154	**Choice of Contact:**	CO_ADMIN
ID:	26587	**Phone No Official:**	613-232-5723 Ext.
Contaminated Fac:	N	**Phone No Admin:**	4164931220 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	446110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	B. Surani Drugs Ltd. (910)		
Gen Div:			
Gen Op Name:	Shoppers Drug Mart 988		
Gen Op Div:			
Site Adrs1:	174 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K1P 5N7		
Site Country:	Canada		
Co Official:	Bashir Surani		
Co Admin:	Pharmacy Operations Development		

2020 Generator Manifest

ID:	48490	**Sum Received Qty:**	7.0
Generator No:	ON6683154	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	261		

2020 Generator Manifest

ID:	48489	**Sum Received Qty:**	7.7
Generator No:	ON6683154	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	2
Waste Char:	A	**District:**	402
Waste Code:	261		

2020 Generator Manifest

ID:	48491	**Sum Received Qty:**	6.5
Generator No:	ON6683154	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	312		

2021 Generator Info

Gen No:	ON6683154	**Choice of Contact:**	CO_ADMIN
ID:	27053	**Phone No Official:**	613-232-5723 Ext.
Contaminated Fac:	N	**Phone No Admin:**	4164931220 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)

NAICS Code1:	446110	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	B. Surani Drugs Ltd. (910)		
Gen Div:			
Gen Op Name:	Shoppers Drug Mart 988		
Gen Op Div:			
Site Adrs1:	174 BANK ST		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K1P 5N7		
Site Country:	Canada		
Co Official:	Bashir Surani		
Co Admin:	Pharmacy Operations Development		

2021 Generator Manifest

ID:	50354	**Sum Received Qty:**	16.6
Generator No:	ON6683154	**Waste Class Name:**	PATHOLOGICAL WASTES
Receiver Type:	030	**Count Manifests:**	1
Waste Char:	P	**District:**	402
Waste Code:	312		

2021 Generator Manifest

ID:	50353	**Sum Received Qty:**	12.24
Generator No:	ON6683154	**Waste Class Name:**	PHARMACEUTICALS
Receiver Type:	030	**Count Manifests:**	2
Waste Char:	A	**District:**	402
Waste Code:	261		

---

113 ***1 of 2*** ***ESE/228.4*** ***75.9 / -1.93*** ***326 Somerset St W Ottawa ON K2P0J9*** ***EHS***

Order No:	20170203024	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	08-FEB-17	**Search Radius (km):**	.25
Date Received:	03-FEB-17	**X:**	-75.69486
Previous Site Name:		**Y:**	45.415713
Lot/Building Size:			
Additional Info Ordered:			

---

113 ***2 of 2*** ***ESE/228.4*** ***75.9 / -1.93*** ***EnviroCentre 326 Somerset St. West Ottawa ON K2P 0J9*** ***GEN***

Generator Info

Generator No:	ON4708690	**Choice of Contact:**	
Approval Years:	As of Nov 2021	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			

SIC Description:

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: Misc. waste organic chemicals

Waste Detail(s)

Waste Class: 263 L
Waste Class Name: Misc. waste organic chemicals

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: Waste compressed gases including cylinders

Waste Detail(s)

Waste Class: 148 C
Waste Class Name: Misc. wastes and inorganic chemicals

2021 Generator Info

Gen No: ON4708690
ID: 18572
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 541620
NAICS Code2:
NAICS Code3:
Gen Name: EnviroCentre
Gen Div:
Gen Op Name: EnviroCentre
Gen Op Div:
Site Adrs1: 326 Somerset St. West
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2P 0J9
Site Country: Canada
Co Official: Melanie Johnston
Co Admin:

Choice of Contact: CO_OFFICIAL
Phone No Official: 613-894-4121 Ext.
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2021 Generator Manifest

ID: 39879
Generator No: ON4708690
Receiver Type: 035
Waste Char: I
Waste Code: 263

Sum Received Qty: 240.0
Waste Class Name: ORGANIC LABORATORY CHEMICALS
Count Manifests: 1
District: 402

114	1 of 1	E/228.5	75.9 / -1.93	234 O'connor St Ottawa ON K2P1T9	EHS

Order No: 20150626030
Status: C

Nearest Intersection:
Municipality:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Report Type: Standard Report
Report Date: 06-JUL-15
Date Received: 26-JUN-15
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Client Prov/State: ON
Search Radius (km): .25
X: -75.694742
Y: 45.416336

---

115 | **1 of 15** | **SSW/230.4** | **78.9 / 1.07** | **BUDGET CAR & TRUCK RENTALS OF OTTAWA**
443 SOMERSET ST W
OTTAWA ON K1R 5J7 | **PRT**

Location ID: 11099
Type: private
Expiry Date:
Capacity (L): 22730.00
Licence #: 0001026975

---

115 | **2 of 15** | **SSW/230.4** | **78.9 / 1.07** | **443 Somerset St. West**
Ottawa ON K1R 5J7 | **EHS**

Order No: 20050328084
Status: C
Report Type:
Report Date: 4/6/2005
Date Received: 3/28/2005
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.698785
Y: 45.414569

---

115 | **3 of 15** | **SSW/230.4** | **78.9 / 1.07** | **BUDGET CAR & TRUCK RENTALS OF OTTAWA**
443 SOMERSET ST W
OTTAWA ON K1R 5J7 | **FSTH**

License Issue Date: 1/11/1991
Tank Status: Licensed
Tank Status As Of: August 2007
Operation Type: Private Fuel Outlet
Facility Type: Gasoline Station - Self Serve

--Details--
Status: Not-Active
Year of Installation: 1990
Corrosion Protection:
Capacity: 22500
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

---

115 | **4 of 15** | **SSW/230.4** | **78.9 / 1.07** | **Budget Car Inc**
443 Somerset St. West
Ottawa ON K1R 5J7 | **GEN**

Generator Info

Generator No: ON4197992
Approval Years: 06,07,08
Status:
PO Box No:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 532111

Country:
Co Admin:
Phone No Admin:
SIC Description: Passenger Car Rental

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

---

115 ***5 of 15*** ***SSW/230.4*** ***78.9 / 1.07*** ***Avraham Holdings Inc.*** ***443 SOMERSET ST W ON*** ***OTTAWA ON*** ***RSC***

RSC No:	46025	***X:***	-75.69887048934635
RA No:		***Y:***	45.41457830204852
Status:	FILED	***Latitude:***	45.4145783
Filing Date:		***Longitude:***	-75.69887049
Date Ack:		***UTM Coordinates:***	
Date Returned:		***Latitude Longitude:***	
Approval Date:	January 22, 2009	***Accuracy Estimate:***	
Cert Date:		***Measurement Method:***	
Cert Prop Use No:		***Mailing Address:***	
Curr Property Use:		***Telephone:***	
Intended Prop Use:		***Fax:***	
Restoration Type:		***Email:***	
Soil Type:		***Postal Code:***	K1R 5J7
Criteria:		***Ministry District:***	
Stratified (Y/N):		***MOE District:***	Ottawa
Audit (Y/N):		***SWP Area Name:***	Rideau Valley
Entire Leg Prop. (Y/N):		***Qual Person Name:***	Peter J. Roberts
CPU Issu Sect 1686:		***Consultant:***	

Business Name: Avraham Holdings Inc.
Address: 443 SOMERSET ST W ON
Legal Desc:
Site Pin: 04120-0037 (LT)
Asmt Roll No:
Project Type: PRE2011
Approval Type: RSC based on Phase One and Two ESAs
Applicable Standards:
PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=46025

---

115 ***6 of 15*** ***SSW/230.4*** ***78.9 / 1.07*** ***Budget Car Inc*** ***443 Somerset St. West*** ***Ottawa ON K1R 5J7*** ***GEN***

Generator Info

Generator No:	ON4197992	***Choice of Contact:***	
Approval Years:	2010	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	532111
Country:			
Co Admin:			
Phone No Admin:			

SIC Description: Passenger Car Rental

Waste Detail(s)

Waste Class: 150

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		INERT INORGANIC WASTES			

115 **7 of 15** **SSW/230.4** **78.9 / 1.07** **Budget Car Inc** **GEN**
443 Somerset St. West
Ottawa ON K1R 5J7

Generator Info

Generator No:	ON4197992	**Choice of Contact:**	
Approval Years:	2011	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	532111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Passenger Car Rental		

Waste Detail(s)

Waste Class:	150
Waste Class Name:	INERT INORGANIC WASTES

115 **8 of 15** **SSW/230.4** **78.9 / 1.07** **Budget Car Inc** **GEN**
443 Somerset St. West
Ottawa ON K1R 5J7

Generator Info

Generator No:	ON4197992	**Choice of Contact:**	
Approval Years:	2012	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	532111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Passenger Car Rental		

Waste Detail(s)

Waste Class:	150
Waste Class Name:	INERT INORGANIC WASTES

115 **9 of 15** **SSW/230.4** **78.9 / 1.07** **Budget Car Inc** **GEN**
443 Somerset St. West
Ottawa ON

Generator Info

Generator No:	ON4197992	**Choice of Contact:**	
Approval Years:	2013	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	532111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

---

115 ***10 of 15*** ***SSW/230.4*** ***78.9 / 1.07*** ***Budget Car Inc*** ***GEN***
443 Somerset St. West
Ottawa ON K1R 5J7

Generator Info

Generator No: ON4197992
Approval Years: 2016
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: 532111

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 532111

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

---

115 ***11 of 15*** ***SSW/230.4*** ***78.9 / 1.07*** ***Budget Car Inc*** ***GEN***
443 Somerset St. West
Ottawa ON K1R 5J7

Generator Info

Generator No: ON4197992
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: 532111

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 532111

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

---

115 ***12 of 15*** ***SSW/230.4*** ***78.9 / 1.07*** ***Budget Car Inc*** ***GEN***
443 Somerset St. West
Ottawa ON K1R 5J7

Generator Info

Generator No: ON4197992
Approval Years: 2014
Status:

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No

PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description: 532111
SIC Code: 532111

Waste Detail(s)

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

---

115 | ***13 of 15*** | ***SSW/230.4*** | ***78.9 / 1.07*** | ***Budget Car Inc*** ***443 Somerset St. West*** ***Ottawa ON K1R 5J7*** | ***GEN***

Generator Info

Generator No: ON4197992
Approval Years: As of Dec 2018
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 150 L
Waste Class Name: Inert organic wastes

---

115 | ***14 of 15*** | ***SSW/230.4*** | ***78.9 / 1.07*** | ***Budget Car Inc*** ***443 Somerset St. West*** ***Ottawa ON K1R 5J7*** | ***GEN***

Generator Info

Generator No: ON4197992
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 150 L
Waste Class Name: Inert organic wastes

2017 Generator Info

Gen No: ON4197992
ID: 16745
Contaminated Fac: N
MHSW Facility: N
Choice of Contact: CO_OFFICIAL
Phone No Official: 613-521-7541 Ext.257
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)

NAICS Code1:	532111	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Budget Car Inc		
Gen Div:			
Gen Op Name:	Budget Car Inc		
Gen Op Div:			
Site Adrs1:	443 Somerset St. West		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K1R 5J7		
Site Country:	Canada		
Co Official:	Jerome MacLean		
Co Admin:			

2018 Generator Info

Gen No:	ON4197992	***Choice of Contact:***	CO_OFFICIAL
ID:	16730	***Phone No Official:***	613-521-7541 Ext.257
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	532111	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Budget Car Inc		
Gen Div:			
Gen Op Name:	Budget Car Inc		
Gen Op Div:			
Site Adrs1:	443 Somerset St. West		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K1R 5J7		
Site Country:	Canada		
Co Official:	Jerome MacLean		
Co Admin:			

2019 Generator Info

Gen No:	ON4197992	***Choice of Contact:***	CO_OFFICIAL
ID:	16594	***Phone No Official:***	613-521-7541 Ext.257
Contaminated Fac:	N	***Phone No Admin:***	
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	532111	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Budget Car Inc		
Gen Div:			
Gen Op Name:	Budget Car Inc		
Gen Op Div:			
Site Adrs1:	443 Somerset St. West		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			

Site Postal Code: K1R 5J7
Site Country: Canada
Co Official: Jerome MacLean
Co Admin:

2020 Generator Info

Gen No: ON4197992
ID: 16310
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 532111
NAICS Code2:
NAICS Code3:
Gen Name: Budget Car Inc
Gen Div:
Gen Op Name: Budget Car Inc
Gen Op Div:
Site Adrs1: 443 Somerset St. West
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K1R 5J7
Site Country: Canada
Co Official: Jerome MacLean
Co Admin:

Choice of Contact: CO_OFFICIAL
Phone No Official: 613-521-7541 Ext.257
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

---

115 | ***15 of 15*** | ***SSW/230.4*** | ***78.9 / 1.07*** | ***BUDGET CAR & TRUCK RENTALS OF OTTAWA***
443 SOMERSET ST W
OTTAWA ON | ***EXP***

Inventory No: 10907017
Inventory Status: Inactive
Installation Year: 1990
Capacity: 22500
Capacity Unit:
Tank Type:
Manufacturer:
Model:
Description: UNDERGROUND TANK
Previous Fuel Type: Gasoline

Tank Material: Fiberglass (FRP)
Corrosion Protect: Coating
Overfill Protection:
Inventory Context: FS Liquid Fuel Tank
Inventory Item: FS LIQUID FUEL TANK

---

116 | ***1 of 1*** | ***NNE/230.9*** | ***76.9 / -0.93*** | ***154 O'CONNOR ST***
Ottawa ON | ***WWIS***

Well ID: 7139448
Construction Date:
Use 1st: Monitoring
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: M05547
Tag: A083149
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 02/02/2010
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1844
Form Version: 5
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:

Overburden/Bedrock: ***Easting NAD83:***
Pump Rate: ***Northing NAD83:***
Static Water Level: ***Zone:***
Clear/Cloudy: ***UTM Reliability:***
Municipality: OTTAWA CITY
Site Info:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/21/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4185876082455
Longitude: -75.696785470579
X: -75.69678530881946
Y: 45.4185876010596
Path: 713\7139448.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/18/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4183822314461
Longitude: -75.6965145379183
X: -75.69651437613874
Y: 45.41838222392617
Path: 713\7139448.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/17/2009
Year Completed: 2009
Depth (m): 11.3
Latitude: 45.4185977002246
Longitude: -75.6966066563327
X: -75.6966064938307
Y: 45.41859769295709
Path: 713\7139448.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/16/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4187143962036
Longitude: -75.6966592166827
X: -75.69665905512896
Y: 45.41871438942594
Path: 713\7139448.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/18/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4184994730278
Longitude: -75.6964776355485
X: -75.69647747424747
Y: 45.41849946626058
Path: 713\7139448.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7139448.pdf

Additional Detail(s) (Map)

Well Completed Date: 12/21/2009
Year Completed: 2009
Depth (m):
Latitude: 45.418595907093
Longitude: -75.6969006044651
X: -75.69690044225729
Y: 45.41859590032445
Path: 713\7139448.pdf

Bore Hole Information

Bore Hole ID: 1003266348
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 12/21/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445484.00
North83: 5029688.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1003266352
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1003266351
Method Construction Code:
Method Construction:
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266353

Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1003266355
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 7.699999809265137
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266354
Layer:
Slot:
Screen Top Depth: 7.699999809265137
Screen End Depth: 10.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1003266356
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1003266350
Diameter: 20.0
Depth From:
Depth To: 10.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1002934566 ***Elevation:***
DP2BR: ***Elevrc:***
Spatial Status: ***Zone:*** 18

Code OB:		**East83:**	445498.00
Code OB Desc:		**North83:**	5029689.00
Open Hole:	No	**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	3
Date Completed:	12/17/2009	**UTMRC Desc:**	margin of error : 10 - 30 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1003266359
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	01
Material 3 Desc:	FILL
Formation Top Depth:	0.6000000238418579
Formation End Depth:	1.2000000476837158
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1003266361
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	91
Material 3 Desc:	WATER-BEARING
Formation Top Depth:	3.0
Formation End Depth:	4.300000190734863
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1003266363
Layer:	6
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	81
Material 2 Desc:	SANDY
Material 3:	
Material 3 Desc:	
Formation Top Depth:	5.5
Formation End Depth:	6.0

Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1003266358
Layer: 1
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 01
Material 2 Desc: FILL
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 0.6000000238418579
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1003266360
Layer: 3
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 91
Material 2 Desc: WATER-BEARING
Material 3: 84
Material 3 Desc: SILTY
Formation Top Depth: 1.2000000476837158
Formation End Depth: 3.0
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1003266362
Layer: 5
Color: 2
General Color: GREY
Material 1: 06
Material 1 Desc: SILT
Material 2:
Material 2 Desc:
Material 3: 61
Material 3 Desc: CLAYEY
Formation Top Depth: 4.300000190734863
Formation End Depth: 5.5
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1003266364
Layer: 7
Color: 6
General Color: BROWN
Material 1: 17
Material 1 Desc: SHALE

Material 2:
Material 2 Desc:
Material 3: 68
Material 3 Desc: DRY
Formation Top Depth: 6.0
Formation End Depth: 11.300000190734863
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1003266367
Layer: 1
Plug From: 0.5
Plug To: 7.0
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1003266371
Method Construction Code: 5
Method Construction: Air Percussion
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266357
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1003266368
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 8.300000190734863
Casing Diameter: 5.099999904632568
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266369
Layer: 1
Slot: 10
Screen Top Depth:
Screen End Depth:
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 5.800000190734863

Hole Diameter

Hole ID: 1003266366
Diameter: 10.0
Depth From: 6.0

Depth To: 11.300000190734863
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole Diameter

Hole ID: 1003266365
Diameter: 20.0
Depth From: 0.0
Depth To: 6.0
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1003266312
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 12/21/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445475.00
North83: 5029689.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1003266316
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1003266315
Method Construction Code:
Method Construction:
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266317
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1003266319
Layer:
Material: 5

Open Hole or Material: PLASTIC
Depth From:
Depth To: 7.699999809265137
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266318
Layer:
Slot:
Screen Top Depth: 7.699999809265137
Screen End Depth: 10.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1003266320
Pump Set At:
Static Level: 7.699999809265137
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1003266314
Diameter: 20.0
Depth From:
Depth To: 10.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1003266330
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 12/18/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:

Elevation:
Elevrc:
Zone: 18
East83: 445508.00
North83: 5029678.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Annular Space/Abandonment Sealing Record

Plug ID: 1003266334
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1003266333
Method Construction Code:
Method Construction:
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266335
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1003266337
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 7.699999809265137
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266336
Layer:
Slot:
Screen Top Depth: 7.699999809265137
Screen End Depth: 10.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1003266338
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:

Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1003266332
Diameter: 20.0
Depth From:
Depth To: 10.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1003266339
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 12/18/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445505.00
North83: 5029665.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1003266343
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1003266342
Method Construction Code:
Method Construction:
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266344
Casing No: 0
Comment:

Alt Name:

Construction Record - Casing

Casing ID: 1003266346
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 7.699999809265137
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266345
Layer:
Slot:
Screen Top Depth: 7.699999809265137
Screen End Depth: 10.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1003266347
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1003266341
Diameter: 20.0
Depth From:
Depth To: 10.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

Bore Hole Information

Bore Hole ID: 1003266321
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Elevation:
Elevrc:
Zone: 18
East83: 445494.00
North83: 5029702.00

Open Hole:
Cluster Kind: This is a record from cluster log sheet
Date Completed: 12/16/2009
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1003266325
Layer:
Plug From:
Plug To:
Plug Depth UOM:

Method of Construction & Well Use

Method Construction ID: 1003266324
Method Construction Code:
Method Construction:
Other Method Construction: HSA

Pipe Information

Pipe ID: 1003266326
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1003266328
Layer:
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 7.699999809265137
Casing Diameter:
Casing Diameter UOM:
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1003266327
Layer:
Slot:
Screen Top Depth: 7.699999809265137
Screen End Depth: 10.699999809265137
Screen Material:
Screen Depth UOM: m
Screen Diameter UOM:
Screen Diameter:

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1003266329
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM:
Water State After Test Code:
Water State After Test:
Pumping Test Method:
Pumping Duration HR:
Pumping Duration MIN:
Flowing:

Hole Diameter

Hole ID: 1003266323
Diameter: 20.0
Depth From:
Depth To: 10.699999809265137
Hole Depth UOM: m
Hole Diameter UOM: cm

---

117 | **1 of 1** | **S/231.1** | **77.9 / 0.07** | **429 MC LEARN OTTAWA ON** | **WWIS**

Well ID: 7233875
Construction Date:
Use 1st: Monitoring and Test Hole
Use 2nd: 0
Final Well Status: Monitoring and Test Hole
Water Type:
Casing Material:
Audit No: Z198210
Tag: A173761
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 12/15/2014
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7241
Form Version: 7
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233875.pdf

Additional Detail(s) (Map)

Well Completed Date: 11/06/2014
Year Completed: 2014
Depth (m): 6.1
Latitude: 45.4143871652221
Longitude: -75.6977434596111
X: -75.6977432983287
Y: 45.41438715832119

Path: 723\7233875.pdf

Bore Hole Information

Bore Hole ID: 1005260617
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 11/06/2014
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445405.00
North83: 5029222.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1005436584
Layer: 3
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3: 84
Material 3 Desc: SILTY
Formation Top Depth: 3.0999999046325684
Formation End Depth: 4.880000114440918
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436583
Layer: 2
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 05
Material 2 Desc: CLAY
Material 3: 84
Material 3 Desc: SILTY
Formation Top Depth: 1.2200000286102295
Formation End Depth: 3.0999999046325684
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436582
Layer: 1
Color: 6
General Color: BROWN

Material 1: 01
Material 1 Desc: FILL
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 28
Material 3 Desc: SAND
Formation Top Depth: 0.0
Formation End Depth: 1.2200000286102295
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436585
Layer: 4
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 4.880000114440918
Formation End Depth: 6.099999904632568
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436595
Layer: 3
Plug From: 2.740000009536743
Plug To: 6.099999904632568
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436593
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436594
Layer: 2
Plug From: 0.3100000023841858
Plug To: 2.740000009536743
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1005436592
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction:

Pipe Information

Pipe ID:	1005436581
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1005436588
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	3.0999999046325684
Casing Diameter:	5.199999809265137
Casing Diameter UOM:	cm
Casing Depth UOM:	m

Construction Record - Screen

Screen ID:	1005436589
Layer:	1
Slot:	10
Screen Top Depth:	3.0999999046325684
Screen End Depth:	6.099999904632568
Screen Material:	5
Screen Depth UOM:	m
Screen Diameter UOM:	cm
Screen Diameter:	6.03000020980835

Water Details

Water ID:	1005436587
Layer:	
Kind Code:	
Kind:	
Water Found Depth:	
Water Found Depth UOM:	m

Hole Diameter

Hole ID:	1005436586
Diameter:	15.319999694824219
Depth From:	0.0
Depth To:	6.099999904632568
Hole Depth UOM:	m
Hole Diameter UOM:	cm

118 ***1 of 1*** ***SSW/232.5*** ***78.9 / 1.07*** ***KENT ST Ottawa ON*** ***WWIS***

Well ID:	7344660	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:		***Data Entry Status:***	
Use 2nd:		***Data Src:***	
Final Well Status:	Abandoned-Other	***Date Received:***	10/22/2019
Water Type:		***Selected Flag:***	TRUE
Casing Material:		***Abandonment Rec:***	Yes
Audit No:	Z286434	***Contractor:***	7543
Tag:		***Form Version:***	7

Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344660.pdf

Additional Detail(s) (Map)

Well Completed Date:	09/19/2019
Year Completed:	2019
Depth (m):	
Latitude:	45.4144372636735
Longitude:	-75.6983830952806
X:	-75.69838293273064
Y:	45.414437257125776
Path:	734\7344660.pdf

Bore Hole Information

Bore Hole ID:	1007687179	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445355.00
Code OB Desc:		**North83:**	5029228.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	09/19/2019	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Pipe Information

Pipe ID:	1008243515
Casing No:	0
Comment:	
Alt Name:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1008244307
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	

Levels UOM:	ft
Rate UOM:	GPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Water Details

Water ID:	1008244205
Layer:	1
Kind Code:	8
Kind:	Untested
Water Found Depth:	41.0
Water Found Depth UOM:	ft

Hole Diameter

Hole ID:	1008244050
Diameter:	2.0
Depth From:	6.0
Depth To:	46.0
Hole Depth UOM:	ft
Hole Diameter UOM:	Inch

---

119 ***1 of 2*** ***SSW/233.0*** ***78.9 / 1.07*** ***UNKNOWN***
SOMERSET AND KENT STREET
OTTAWA CITY ON ***SPL***

Ref No:	103840	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	8/11/1994	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	8/11/1994	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	

Site No:	
MOE Response:	
Site County/District:	
Site Geo Ref Meth:	
Site District Office:	
Nearest Watercourse:	
Site Name:	
Site Address:	
Site Region:	
Site Municipality:	OTTAWA CITY
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	
Client Type:	
Source Type:	
Incident Cause:	UNKNOWN
Incident Preceding Spill:	
Incident Reason:	UNKNOWN
Incident Summary:	OTTAWA HYDRO-GASOLINE FOUND IN EXCAVATION SITE.
Environment Impact:	CONFIRMED
Health Env Consequence:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Nature of Impact:	Soil contamination
Contaminant Qty:	
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	
Contaminant Name:	
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	LAND
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	
SAC Action Class:	
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

119	2 of 2	SSW/233.0	78.9 / 1.07	CLARIDGE HOMES (SOMERSET) INC. SOMERSET ST.W./KENT ST. OTTAWA CITY ON	CA

Certificate #:	3-1000-97-
Application Year:	97
Issue Date:	7/31/1997
Approval Type:	Municipal sewage
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

120	1 of 1	W/233.3	76.9 / -0.93	PRIVATE OWNER 220 KENT ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL

Ref No:	150427	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	12/17/1997	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	12/17/1997	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	CITY WORKS/SEWER, FIRE DEPT.
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			

Northing:	
Easting:	
Entity Operating Name:	
Client Name:	
Client Type:	
Source Type:	
Incident Cause:	OTHER CONTAINER LEAK
Incident Preceding Spill:	
Incident Reason:	UNKNOWN
Incident Summary:	PRIVATE OWNER - 30 L GASOLINE TO ROAD/CATCH BASIN. F/D, WORKS,SEWER.
Environment Impact:	POSSIBLE
Health Env Consequence:	
Nature of Impact:	Multi Media Pollution
Contaminant Qty:	
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	
Contaminant Name:	
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	LAND / WATER
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	
SAC Action Class:	
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

---

121 | ***1 of 1*** | ***E/233.5*** | ***75.9 / -1.93*** | ***311 SONERSET Ottawa ON*** | ***WWIS***

Well ID:	7391115	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	06/29/2021
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z364139	**Contractor:**	7241
Tag:	A302952	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391115.pdf

Additional Detail(s) (Map)

Well Completed Date:	05/25/2021
Year Completed:	2021
Depth (m):	
Latitude:	45.4163771485905

Longitude: -75.6946750112729
X: -75.69467484910098
Y: 45.41637714214935
Path: 739\7391115.pdf

Bore Hole Information

Bore Hole ID: 1008704355
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 05/25/2021
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445647.00
North83: 5029441.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1009852407
Layer: 2
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 0.3100000023841858
Formation End Depth: 2.740000009536743
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1009852408
Layer: 3
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 28
Material 2 Desc: SAND
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 2.740000009536743
Formation End Depth: 3.3499999046325684
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1009852410

Layer:	5
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	11.279999732971191
Formation End Depth:	14.9399995803833
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852409
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	3.3499999046325684
Formation End Depth:	11.279999732971191
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852406
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	28
Material 2 Desc:	SAND
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853464
Layer:	1
Plug From:	0.0
Plug To:	0.3100000023841858
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853465
Layer:	2
Plug From:	0.3100000023841858

Plug To: 11.579999923706055
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009853466
Layer: 3
Plug From: 11.579999923706055
Plug To: 14.9399995803833
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1009854840
Method Construction Code: 5
Method Construction: Air Percussion
Other Method Construction:

Pipe Information

Pipe ID: 1009764985
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009855218
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 11.890000343322754
Casing Diameter: 5.199999809265137
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1009855614
Layer: 1
Slot: 10
Screen Top Depth: 11.890000343322754
Screen End Depth: 14.9399995803833
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.03000020980835

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009856078
Pump Set At:
Static Level:
Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:

Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	LPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	No

Hole Diameter

Hole ID:	1009854399
Diameter:	11.430000305175781
Depth From:	0.0
Depth To:	14.9399995803833
Hole Depth UOM:	m
Hole Diameter UOM:	cm

---

122 **1 of 1** **NE/234.0** **76.6 / -1.21** **ON** **WWIS**

Well ID:	7391814	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:		**Data Entry Status:**	Yes
Use 2nd:		**Data Src:**	
Final Well Status:		**Date Received:**	07/07/2021
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	C52802	**Contractor:**	7329
Tag:	A290213	**Form Version:**	8
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008709217	**Tag No:**	A290213
Depth M:		**Contractor:**	7329
Year Completed:	2021	**Latitude:**	45.41814326594
Well Completed Dt:	03/10/2021	**Longitude:**	-75.6958469769054
Audit No:	C52802	**Y:**	45.41814325905426
Path:		**X:**	-75.69584681493654

Bore Hole Information

Bore Hole ID:	1008709217	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445557.00
Code OB Desc:		**North83:**	5029638.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	03/10/2021	**UTMRC Desc:**	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:
Location Method: wwr

---

123 ***1 of 21*** ***N/234.2*** ***77.9 / 0.07***

HEALTH AND WELFARE CANADA
HEALTH UNIT#28, 10TH FL., WEST TOWER 300
LAURIER AVE. WEST (TBC)
OTTAWA ON K1A 0R5

GEN

Generator Info

Generator No: ON0095618
Approval Years: 92,93,97
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: PUB. HEALTH CLINICS
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8635

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

123 ***2 of 21*** ***N/234.2*** ***77.9 / 0.07***

GVT OF CAN-HEALTH&WELFARE CAN.MED.16-304
SER.BR,UNIT#28,10TH FL. W. TOWER 300
LAURIER AVE. WEST,C/O 301 ELGIN ST
OTTAWA ON K1A 0L3

GEN

Generator Info

Generator No: ON0095618
Approval Years: 94,95,96
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: PUB. HEALTH CLINICS
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8635

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

123 ***3 of 21*** ***N/234.2*** ***77.9 / 0.07***

HEALTH AND WELFARE CANADA
300 LAURIER AVE. WEST (T.B.C) HEALTH UNIT
#28, 10TH FLOOR WEST TOWER
OTTAWA ON K1A 0R5

GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON0095618	***Choice of Contact:***	
Approval Years:	98,99,00,01	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	8635
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	PUB. HEALTH CLINICS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

123	***4 of 21***	***N/234.2***	***77.9 / 0.07***	***GVT. OF CAN.-SUPPLY AND SERVICES*** ***OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W*** ***OTTAWA ON K1A 0M7***	***GEN***

Generator Info

Generator No:	ON0249609	***Choice of Contact:***	
Approval Years:	86,87,88,89,90	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	2849
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PRINTING IND.		

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

123	***5 of 21***	***N/234.2***	***77.9 / 0.07***	***GVT. OF CAN.(OUT OF BUS) 18-208*** ***OLYMPIA PRINTING PLANT,LEVEL P1,W. TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W*** ***OTTAWA ON K1A 0M7***	***GEN***

Generator Info

Generator No:	ON0249609	***Choice of Contact:***	
Approval Years:	92,93,94,95,96,97	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	2849
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER PRINTING IND.		

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

---

123 | ***6 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***GVT. OF CAN.(OUT OF BUSINESS)*** ***OLYMPIA PRINTING PLANT,LEVEL P1,W.*** ***TOWER L'ESPLANADE LAURIER,300 LAURIER AVE. W*** ***OTTAWA ON K1A 0M7*** | ***GEN***

Generator Info

Generator No: ON0249609
Approval Years: 98
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: OTHER PRINTING IND.

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 2849

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

---

123 | ***7 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada*** ***300 Laurier Ave*** ***Ottawa ON K0A 0S5*** | ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: 04,05,06,07,08
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: All Other Waste Management Services

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 562990

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCB'S

---

123 | ***8 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***in front of 300 Laurier Avenue<UNOFFICIAL> Ottawa ON*** | ***SPL***

Ref No: 2068-69ELAE
Year:
Incident Dt: 2/8/2005
Dt MOE Arvl on Scn:
MOE Reported Dt: 2/8/2005
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: in front of 300 Laurier Avenue<UNOFFICIAL>
Site Address:
Site Region:
Site Municipality: Ottawa
Site Lot:

Municipality No:
Nature of Damage:
Discharger Report: 0
Material Group: Oil
Impact to Health:
Agency Involved:

Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Waste Management-25 L Hydraulic Oil to CB
Environment Impact: Possible
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Water
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other Motor Vehicle
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

123 | ***9 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON | ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: 2009
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Other Federal Government Public Administration

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 911910

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

---

123 | ***10 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON | ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: 2010
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Other Federal Government Public Administration

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 911910

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

123	*11 of 21*	*N/234.2*	*77.9 / 0.07*	***Public Works and Government Services Canada*** ***300 Laurier Ave*** ***Ottawa ON***	*GEN*

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	
Approval Years:	2011	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	911910
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Other Federal Government Public Administration		

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

---

123 | ***12 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON K0A 0S5 | ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: 2012
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: Other Federal Government Public Administration
Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 911910

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

---

123 ***13 of 21*** ***N/234.2*** ***77.9 / 0.07*** ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: 2013
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 911910

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

123	*14 of 21*	*N/234.2*	*77.9 / 0.07*	***Public Works and Government Services Canada*** ***300 Laurier Ave*** ***Ottawa ON K0A0S5***	*GEN*

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	CO_ADMIN
Approval Years:	2016	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	911910
Country:	Canada		
Co Admin:	Brian Stoneman		
Phone No Admin:	613-993-5639 Ext.		
SIC Description:	911910		

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

---

123 | ***15 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON K0A0S5 | ***GEN***

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	CO_ADMIN
Approval Years:	2015	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	911910
Country:	Canada		
Co Admin:	Brian Stoneman		
Phone No Admin:	613-993-5639 Ext.		
SIC Description:	911910		

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

---

123 | ***16 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Works and Government Services Canada***
300 Laurier Ave
Ottawa ON K0A0S5 | ***GEN***

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	CO_ADMIN
Approval Years:	2014	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	911910
Country:	Canada		
Co Admin:	Brian Stoneman		
Phone No Admin:	613-993-5639 Ext.		
SIC Description:	911910		

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 243
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 112
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

123	*17 of 21*	*N/234.2*	*77.9 / 0.07*	***Public Services & Procurement Canada RPB*** ***300 Laurier Ave*** ***Ottawa ON K0A 0S5***	*GEN*

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	212 L
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	148 C
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class:	221 I
Waste Class Name:	Light fuels

Waste Detail(s)

Waste Class:	243 D
Waste Class Name:	PCB

Waste Detail(s)

Waste Class:	331 I
Waste Class Name:	Waste compressed gases including cylinders

Waste Detail(s)

Waste Class:	252 L
Waste Class Name:	Waste crankcase oils and lubricants

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	Misc. waste organic chemicals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	145 I
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 112 C
Waste Class Name: Acid solutions - containing heavy metals

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: Alkaline slutions - containing heavy metals

Waste Detail(s)

Waste Class: 146 R
Waste Class Name: Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class: 145 L
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: Other specified inorganic sludges, slurries or solids

---

123 | ***18 of 21*** | ***N/234.2*** | ***77.9 / 0.07*** | ***Public Services & Procurement Canada RPB***
300 Laurier Ave
Ottawa ON K0A 0S5 | ***GEN***

Generator Info

Generator No: ON5652014
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 146 R
Waste Class Name: Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class: 145 L
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 112 C
Waste Class Name: Acid solutions - containing heavy metals

Waste Detail(s)

Waste Class: 148 C
Waste Class Name: Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class: 221 I
Waste Class Name: Light fuels

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCB

Waste Detail(s)

Waste Class: 145 I
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: Misc. waste organic chemicals

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: Waste compressed gases including cylinders

Waste Detail(s)

Waste Class: 252 L
Waste Class Name: Waste crankcase oils and lubricants

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: Alkaline slutions - containing heavy metals

123	19 of 21	N/234.2	77.9 / 0.07	**Public Services & Procurement Canada RPB** **300 Laurier Ave**	GEN

Generator Info

Generator No:	ON5652014	***Choice of Contact:***	
Approval Years:	As of Nov 2021	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	145 L
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	Misc. waste organic chemicals

Waste Detail(s)

Waste Class:	146 T
Waste Class Name:	Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class:	146 R
Waste Class Name:	Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class:	121 C
Waste Class Name:	Alkaline slutions - containing heavy metals

Waste Detail(s)

Waste Class:	243 D
Waste Class Name:	PCB

Waste Detail(s)

Waste Class:	212 L
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	112 C

Waste Class Name: Acid solutions - containing heavy metals

Waste Detail(s)

Waste Class: 148 C
Waste Class Name: Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: Waste compressed gases including cylinders

Waste Detail(s)

Waste Class: 145 I
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 221 I
Waste Class Name: Light fuels

Waste Detail(s)

Waste Class: 252 L
Waste Class Name: Waste crankcase oils and lubricants

123	20 of 21	N/234.2	77.9 / 0.07	**Public Services & Procurement Canada** **300 Laurier Ave** **Ottawa ON K0A 0S5**	GEN

Generator Info

Generator No: ON5652014
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 221 I
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 148 C
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 146 R
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 145 I
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 252 L
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 145 L
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 112 C
Waste Class Name: ACID WASTE - HEAVY METALS

2017 Generator Info

Gen No:	ON5652014	***Choice of Contact:***	CO_ADMIN
ID:	22333	***Phone No Official:***	613-736-3207 Ext.
Contaminated Fac:	N	***Phone No Admin:***	613-736-3207 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	911910	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			

Gen Name:	Public Services & Procurement Canada
Gen Div:	RPB
Gen Op Name:	PSPC
Gen Op Div:	ESD
Site Adrs1:	300 Laurier Ave
Site Bldg:	Esplanade Laurier
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K0A 0S5
Site Country:	Canada
Co Official:	Brian Stoneman
Co Admin:	Brian Stoneman

2017 Generator Manifest

ID:	47115	***Sum Received Qty:***	160.0
Generator No:	ON5652014	***Waste Class Name:***	WASTE OILS & LUBRICANTS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	L	***District:***	203
Waste Code:	252		

2017 Generator Manifest

ID:	47114	***Sum Received Qty:***	1140.0
Generator No:	ON5652014	***Waste Class Name:***	OTHER SPECIFIED INORGANICS
Receiver Type:	035	***Count Manifests:***	2
Waste Char:	T	***District:***	203
Waste Code:	146		

2018 Generator Info

Gen No:	ON5652014	***Choice of Contact:***	CO_ADMIN
ID:	22536	***Phone No Official:***	613-736-3207 Ext.
Contaminated Fac:	N	***Phone No Admin:***	613-736-3207 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	911910	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			

Gen Name:	Public Services & Procurement Canada
Gen Div:	RPB
Gen Op Name:	PSPC
Gen Op Div:	ESD
Site Adrs1:	300 Laurier Ave
Site Bldg:	Esplanade Laurier
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K0A 0S5
Site Country:	Canada

Co Official: Brian Stoneman
Co Admin: Brian Stoneman

2018 Generator Manifest

ID: 47000
Generator No: ON5652014
Receiver Type: 035
Waste Char: C
Waste Code: 121
Sum Received Qty: 269.0
Waste Class Name: ALKALINE WASTES - HEAVY METALS
Count Manifests: 2
District: 203

2018 Generator Manifest

ID: 47005
Generator No: ON5652014
Receiver Type: 035
Waste Char: L
Waste Code: 252
Sum Received Qty: 130.0
Waste Class Name: WASTE OILS & LUBRICANTS
Count Manifests: 2
District: 203

2018 Generator Manifest

ID: 47002
Generator No: ON5652014
Receiver Type: 035
Waste Char: T
Waste Code: 146
Sum Received Qty: 1390.0
Waste Class Name: OTHER SPECIFIED INORGANICS
Count Manifests: 8
District: 203

2018 Generator Manifest

ID: 47006
Generator No: ON5652014
Receiver Type: 035
Waste Char: I
Waste Code: 263
Sum Received Qty: 80.0
Waste Class Name: ORGANIC LABORATORY CHEMICALS
Count Manifests: 1
District: 203

2018 Generator Manifest

ID: 47004
Generator No: ON5652014
Receiver Type: 035
Waste Char: L
Waste Code: 212
Sum Received Qty: 3280.0
Waste Class Name: ALIPHATIC SOLVENTS
Count Manifests: 2
District: 203

2018 Generator Manifest

ID: 46999
Generator No: ON5652014
Receiver Type: 035
Waste Char: C
Waste Code: 112
Sum Received Qty: 132.0
Waste Class Name: ACID WASTE - HEAVY METALS
Count Manifests: 2
District: 203

2018 Generator Manifest

ID: 47001
Generator No: ON5652014
Receiver Type: 035
Waste Char: I
Waste Code: 145
Sum Received Qty: 180.0
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES
Count Manifests: 2
District: 203

2018 Generator Manifest

ID:	47003	***Sum Received Qty:***	1845.0
Generator No:	ON5652014	***Waste Class Name:***	ALIPHATIC SOLVENTS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	I	***District:***	203
Waste Code:	212		

2019 Generator Info

Gen No:	ON5652014	***Choice of Contact:***	CO_ADMIN
ID:	22615	***Phone No Official:***	613-736-3207 Ext.
Contaminated Fac:	N	***Phone No Admin:***	613-736-3207 Ext.
MHSW Facility:	N	***County Ont:***	OTTAWA CARLTON (RM)
NAICS Code1:	911910	***County Out:***	
NAICS Code2:		***District:***	402
NAICS Code3:			
Gen Name:	Public Services & Procurement Canada		
Gen Div:	RPB		
Gen Op Name:	PSPC		
Gen Op Div:	ESD		
Site Adrs1:	300 Laurier Ave		
Site Bldg:	Esplanade Laurier		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K0A 0S5		
Site Country:	Canada		
Co Official:	Brian Stoneman		
Co Admin:	Brian Stoneman		

2019 Generator Manifest

ID:	46688	***Sum Received Qty:***	40.0
Generator No:	ON5652014	***Waste Class Name:***	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	C	***District:***	203
Waste Code:	121		

2019 Generator Manifest

ID:	46690	***Sum Received Qty:***	50.0
Generator No:	ON5652014	***Waste Class Name:***	WASTE OILS & LUBRICANTS
Receiver Type:	035	***Count Manifests:***	1
Waste Char:	L	***District:***	203
Waste Code:	252		

2019 Generator Manifest

ID:	46689	***Sum Received Qty:***	870.0
Generator No:	ON5652014	***Waste Class Name:***	OTHER SPECIFIED INORGANICS
Receiver Type:	035	***Count Manifests:***	5
Waste Char:	T	***District:***	203
Waste Code:	146		

2020 Generator Info

Gen No:	ON5652014	***Choice of Contact:***	CO_OFFICIAL
ID:	22347	***Phone No Official:***	613-736-3207 Ext.
Contaminated Fac:	N	***Phone No Admin:***	613-816-2543 Ext.

MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	911910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Public Services & Procurement Canada		
Gen Div:	RPB		
Gen Op Name:	PSPC		
Gen Op Div:	ESD		
Site Adrs1:	300 Laurier Ave		
Site Bldg:	Esplanade Laurier		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K0A 0S5		
Site Country:	Canada		
Co Official:	Brian Stoneman		
Co Admin:	Andre Latreille		

2020 Generator Manifest

ID:	43330	**Sum Received Qty:**	20.0
Generator No:	ON5652014	**Waste Class Name:**	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	C	**District:**	203
Waste Code:	121		

2020 Generator Manifest

ID:	43333	**Sum Received Qty:**	8330.0
Generator No:	ON5652014	**Waste Class Name:**	ALIPHATIC SOLVENTS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	L	**District:**	402
Waste Code:	212		

2020 Generator Manifest

ID:	43332	**Sum Received Qty:**	120.0
Generator No:	ON5652014	**Waste Class Name:**	WASTE OILS & LUBRICANTS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	L	**District:**	203
Waste Code:	252		

2020 Generator Manifest

ID:	43331	**Sum Received Qty:**	790.0
Generator No:	ON5652014	**Waste Class Name:**	OTHER SPECIFIED INORGANICS
Receiver Type:	035	**Count Manifests:**	2
Waste Char:	T	**District:**	203
Waste Code:	146		

2021 Generator Info

Gen No:	ON5652014	**Choice of Contact:**	CO_OFFICIAL
ID:	22617	**Phone No Official:**	613-736-3207 Ext.
Contaminated Fac:	N	**Phone No Admin:**	613-816-2543 Ext.
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	911910	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Public Services & Procurement Canada		

Gen Div:	RPB
Gen Op Name:	PSPC
Gen Op Div:	ESD
Site Adrs1:	300 Laurier Ave
Site Bldg:	Esplanade Laurier
Site Pobox:	
Province In:	ONTARIO
Site Adrs2:	
Site City:	Ottawa
Province Out:	
Site Postal Code:	K0A 0S5
Site Country:	Canada
Co Official:	Brian Stoneman
Co Admin:	Andre Latreille

2021 Generator Manifest

ID:	44955	**Sum Received Qty:**	210.0
Generator No:	ON5652014	**Waste Class Name:**	OTHER SPECIFIED INORGANICS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	T	**District:**	203
Waste Code:	146		

2021 Generator Manifest

ID:	44954	**Sum Received Qty:**	5.0
Generator No:	ON5652014	**Waste Class Name:**	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	C	**District:**	203
Waste Code:	121		

2021 Generator Manifest

ID:	44956	**Sum Received Qty:**	160.0
Generator No:	ON5652014	**Waste Class Name:**	WASTE OILS & LUBRICANTS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	L	**District:**	203
Waste Code:	252		

123 ***21 of 21*** ***N/234.2*** ***77.9 / 0.07*** ***300 Laurier Avenue Ottawa ON*** ***FRST***

Tank System ID:	55263	**Tank Sys Prov F:**	Ontario
EC No:	55090	**Tank Sys PO BOX:**	
Internal No:		**Tank Sys Postal Cd:**	
Is Perm Withdrwl:	FALSE	**Sys Record City:**	
Removed Date:		**Sys Record Prov E:**	
Withdrawn Date:		**Sys Record Prov F:**	
Temp Withdrawn Dt:		**Sys Record PO BOX:**	
Tank Use E:	Power Generation	**Sys Rec Postal Cd:**	
Tank Use F:	Production d'énergie	**System Rec Same as:**	TRUE
Year of Manufact:		**Location Latitude:**	
Emerg Plan Same as:	TRUE	**Location Longitude:**	
Operator Contact:		**Creation Date:**	28-Oct-2020 00:00:00
Owner Contact:		**Creation By:**	Section 19
Tank System City:	Ottawa	**Modified Date:**	30-Nov-2020 00:00:00
Tank Sys Prov E:	Ontario	**Modified By:**	
Tank Use:			
Tank Manufacturer:	AT&S Division GilFab		
Tank System Address:	300 Laurier Avenue		
Sys Record Address:			
System Descr:	Emergency Generator-Based Building Storage Tanks System (3 AST) located at the Esplanade Laurier Building,		

300 Laurier Avenue, Ottawa, Ontario.
10,200 D / W steel pressure-rated main tanks supply the 1,217 L S / W steel day tank which is located in a steel rupture basin. The main tanks, duplex pumpset, pump control panel and automatic tank gauging system are located in Diesel Room P-301. The day tank is located in generator room P-124-B.

Certification System Installer:
Certification System Remover:
Group Name:
Master Group Name:
Owner Email:
Operator Email:
Land Owner E: Federal entity under Financial Administration Act
Land Owner F: Entité fédérale sous la loi sur la gestion des finances publiques

Service Months

Service Months E: August
Service Months F: Août

Service Months E: May
Service Months F: Mai

Service Months E: November
Service Months F: Novembre

Service Months E: July
Service Months F: Juillet

Service Months E: December
Service Months F: Décembre

Service Months E: February
Service Months F: Février

Service Months E: January
Service Months F: Janvier

Service Months E: October
Service Months F: Octobre

Service Months E: March
Service Months F: Mars

Service Months E: June
Service Months F: Juin

Service Months E: September
Service Months F: Septembre

Service Months E: April
Service Months F: Avril

Tanks Details

Tank ID: 91328
Tank Capacity: 1217
Tank Type E: Aboveground
Tank Type F: Hors sol
Date of Install: 2008
Date Withdrawn Tk:
Date Removed Tank:
Tank Desc: 1,217L S/W steel day tank which is located in a steel rupture basin located in generator room P-124-B.
Tank Stdd No E: ULC-S602
Tank Std No F: ULC-S602
Tank Std No Other:

Dt Wthdrwn Piping:
Date Remvd Piping:
Tk Type of Pump E: No oil-water separator
Tk Type of Pump F: Aucun Séparateur huile-eau
Piping Type E: Aboveground
Piping Type F: Hors sol
Piping Diam Unit: mm

Tank Constr Material E:	Steel
Tank Constr Material F:	Acier
Tank Constr Material Other:	
Internal No:	
Tank Content E:	Diesel
Tank Content F:	Diesel
Tank Content Other:	
Piping Diameter:	20;25;50
Spill Containment E:	None
Spill Containment F:	Aucun
Spill Containment Other:	
Product Transfer Area:	same as main tank #1
Date Wthdrwn Other Component:	
Date Removed Other Component:	

Piping Construction Materials

Component E:	Steel
Component F:	Acier
Other:	

Piping Secondary Containment

Tank ID:	91328
Component E:	None
Component F:	Aucun
Other:	

Tank Corrosion Protection

Component E:	Painted
Component F:	Peinturé
Other:	

Piping Corrosion Protection

Component E:	Painted
Component F:	Peinturé
Other:	

Tank Leak Detection

Component E:	Continuous external tank leak monitoring (Sensor cable system)
Component F:	Surveillance externe et en continu de l'étanchéité des reservoirs
Other:	

Tank Leak Detection

Component E:	Visual inspection
Component F:	Inspection visuelle
Other:	

Piping Leak Detection

Component E:	Visual inspection
Component F:	Inspection visuelle
Other:	

Sump Leak Detection

Component E: No sump for storage tank system
Component F: Aucun puisard pour le système de stockage
Other:

Tank Secondary Containment

Component E: Containment tank assembly
Component F: Ensemble réservoir de confinement
Other:

Tank Overflow Protection

Component E: Overfill alarm and overfill automatic shutoff
Component F: Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement
Other:

Tanks Details

Tank ID: 91326
Tank Capacity: 10200
Tank Type E: Aboveground
Tank Type F: Hors sol
Date of Install: 2008
Date Withdrawn Tk:
Date Removed Tank:
Dt Wthdrwn Piping:
Date Remvd Piping:
Tk Type of Pump E: No oil-water separator
Tk Type of Pump F: Aucun Séparateur huile-eau
Piping Type E: Aboveground
Piping Type F: Hors sol
Piping Diam Unit: mm
Tank Desc: 10,200L D/W steel pressure-rated main tank #1 supply the 1,217 L S/W steel day tank. Located in Diesel Room P-301
Tank Stdd No E: Other
Tank Std No F: Autre
Tank Std No Other: ASME Standard no additional information
Tank Constr Material E: Steel
Tank Constr Material F: Acier
Tank Constr Material Other:
Internal No: Diesel Tank #1 – 10-250-02
Tank Content E: Diesel
Tank Content F: Diesel
Tank Content Other:
Piping Diameter: 25;50;100
Spill Containment E: Spill box at fill point (aboveground tank)
Spill Containment F: Boîte de confinement de déversement au site de remplissage (réservoir hors sol)
Spill Containment Other:
Product Transfer Area: The PTA near the fill connection consists of concrete pad next to the entrance and exit to the parking garage. The fuel delivery truck parks on the asphalt on Gloucester Street on the East-Southeast side of the building approximately 10 metres from the fill station area. The truck will be visible from the fill connections during the entire product transfer operation.
Date Wthdrwn Other Component:
Date Removed Other Component:

Piping Construction Materials

Component E: Steel
Component F: Acier
Other:

Piping Secondary Containment

Tank ID: 91326

Component E: None
Component F: Aucun
Other:

Tank Corrosion Protection

Component E: Painted
Component F: Peinturé
Other:

Piping Corrosion Protection

Component E: Painted
Component F: Peinturé
Other:

Tank Leak Detection

Component E: Automatic tank gauging
Component F: Jaugeage automatique
Other:

Tank Leak Detection

Component E: Interstitial monitoring – double walled tank
Component F: Surveillance interstitielle- réservoir à double paroi
Other:

Tank Leak Detection

Component E: Visual inspection
Component F: Inspection visuelle
Other:

Piping Leak Detection

Component E: Visual inspection
Component F: Inspection visuelle
Other:

Sump Leak Detection

Component E: No sump for storage tank system
Component F: Aucun puisard pour le système de stockage
Other:

Tank Secondary Containment

Component E: Other impermeable barrier (specify)
Component F: Autre barrière imperméable (spécifiez)
Other: Concrete dyke

Tank Secondary Containment

Component E: Double Walled
Component F: Double paroi
Other:

Tank Overflow Protection

Component E: Overfill alarm and overfill automatic shutoff
Component F: Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement
Other:

Tank Overflow Protection

Component E: Method – trained personnel in attendance at all times
Component F: Méthode - Personels qualifiés présents en tout temps
Other:

Tanks Details

Tank ID: 91327
Tank Capacity: 10200
Tank Type E: Aboveground
Tank Type F: Hors sol
Date of Install: 2008
Date Withdrawn Tk:
Date Removed Tank:
Dt Wthdrwn Piping:
Date Remvd Piping:
Tk Type of Pump E: No oil-water separator
Tk Type of Pump F: Aucun Séparateur huile-eau
Piping Type E: Aboveground
Piping Type F: Hors sol
Piping Diam Unit: mm
Tank Desc: 10,200L D/W steel pressure-rated main tank #2 supply the 1,217 L S/W steel day tank. Located in Diesel Room P-301
Tank Stdd No E: Other
Tank Std No F: Autre
Tank Std No Other: ASME Standard no additional information
Tank Constr Material E: Steel
Tank Constr Material F: Acier
Tank Constr Material Other:
Internal No:
Tank Content E: Diesel
Tank Content F: Diesel
Tank Content Other:
Piping Diameter: 25;50;100
Spill Containment E: Spill box at fill point (aboveground tank)
Spill Containment F: Boîte de confinement de déversement au site de remplissage (réservoir hors sol)
Spill Containment Other:
Product Transfer Area: same as Main Tank #1
Date Wthdrwn Other Component:
Date Removed Other Component:

Piping Construction Materials

Component E: Steel
Component F: Acier
Other:

Piping Secondary Containment

Tank ID: 91327
Component E: None
Component F: Aucun
Other:

Tank Corrosion Protection

Component E: Painted
Component F: Peinturé
Other:

Piping Corrosion Protection

Component E: Painted
Component F: Peinturé
Other:

Tank Leak Detection

Component E: Automatic tank gauging
Component F: Jaugeage automatique
Other:

Tank Leak Detection

Component E: Visual inspection
Component F: Inspection visuelle
Other:

Tank Leak Detection

Component E: Interstitial monitoring – double walled tank
Component F: Surveillance interstitielle- réservoir à double paroi
Other:

Piping Leak Detection

Component E: Visual inspection
Component F: Inspection visuelle
Other:

Sump Leak Detection

Component E: No sump for storage tank system
Component F: Aucun puisard pour le système de stockage
Other:

Tank Secondary Containment

Component E: Other impermeable barrier (specify)
Component F: Autre barrière imperméable (spécifiez)
Other: Concrete dyke

Tank Secondary Containment

Component E: Double Walled
Component F: Double paroi
Other:

Tank Overflow Protection

Component E: Method – trained personnel in attendance at all times
Component F: Méthode - Personels qualifiés présents en tout temps
Other:

Tank Overflow Protection

Component E: Overfill alarm and overfill automatic shutoff
Component F: Alarme anti-débordement et dispositif d'arrêt automatique anti-débordement
Other:

---

124 **1 of 14** **NNE/234.3** **76.9 / -0.93** **SHELL CANADA PRODUCTS LTD.**
154 O'CONNER STREET SERVICE STATION
OTTAWA CITY ON **SPL**

Ref No: 105417
Year:
Incident Dt: 9/20/1994
Dt MOE Arvl on Scn:
MOE Reported Dt: 9/20/1994
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: UNDERGROUND TANK LEAK
Incident Preceding Spill:
Incident Reason: UNKNOWN
Incident Summary: SHELL-UKN QTY WASTE OIL TO GROUND,UG TANK FAILED PRESSURE TEST.
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

---

124 **2 of 14** **NNE/234.3** **76.9 / -0.93** **SHELL CANADA PRODUCTS LTD.**
154 O'CONNOR ST. SHELL CANADA GAS
STATION SERVICE STATION
OTTAWA CITY ON K2P 1T5 **SPL**

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Ref No:	93739	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	//	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	11/23/1993	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	UNDERGROUND TANK LEAK		
Incident Preceding Spill:			
Incident Reason:	CORROSION		
Incident Summary:	SHELL CANADA -1800L FURNACE OIL MISSING FROM UNDERGROUND STORAGE TANK.		
Environment Impact:	CONFIRMED		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

124	*3 of 14*	*NNE/234.3*	*76.9 / -0.93*	***BYTOWN TOWING & AUTOCARE LTD 154 O CONNOR ST AT GLOUCESTER OTTAWA ON***	***PRT***

Location ID:	11026
Type:	retail
Expiry Date:	1995-09-30
Capacity (L):	68100
Licence #:	0026886001

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
124	4 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	FSTH

License Issue Date: 9/6/2002
Tank Status: Pending Renewal
Tank Status As Of: August 2007
Operation Type: Retail Fuel Outlet
Facility Type: Gasoline Station - Full Serve

--Details--
Status: Active
Year of Installation: 1980
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Status: Active
Year of Installation: 1980
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Status: Active
Year of Installation: 1980
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
124	5 of 14	NNE/234.3	76.9 / -0.93	BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5	FSTH

License Issue Date: 9/6/2002
Tank Status: Licensed
Tank Status As Of: December 2008
Operation Type: Retail Fuel Outlet
Facility Type: Gasoline Station - Full Serve

--Details--
Status: Active
Year of Installation: 1979
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Status: Active
Year of Installation: 1979
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Status: Active
Year of Installation: 1979
Corrosion Protection:
Capacity: 22700
Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

Status: Active
Year of Installation: 1980
Corrosion Protection:
Capacity: 22700

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Tank Fuel Type: Liquid Fuel Single Wall UST - Gasoline

---

124 | **6 of 14** | **NNE/234.3** | **76.9 / -0.93** | **154 O'Connor Street Ottawa ON K2P 1T5** | **EHS**

Order No:	20090529016	**Nearest Intersection:**	O'Connor Street & Gloucester Street
Status:	C	**Municipality:**	Ottawa
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	6/9/2009	**Search Radius (km):**	0.25
Date Received:	5/29/2009	**X:**	-75.696715
Previous Site Name:		**Y:**	45.418523
Lot/Building Size:	Lot: 30 m X 30 m		

Additional Info Ordered: Fire Insur. Maps and/or Sire Plans

---

124 | **7 of 14** | **NNE/234.3** | **76.9 / -0.93** | **BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON** | **DTNK**

Delisted Expired Fuel Safety Facilities

Instance No:	10905102	**Expired Date:**	
Status:	EXPIRED	**Max Hazard Rank:**	
Instance ID:	51358	**Facility Location:**	
Instance Type:	FS Piping	**Facility Type:**	
Instance Creation Dt:		**Fuel Type 2:**	
Instance Install Dt:		**Fuel Type 3:**	
Item Description:		**Panam Related:**	
Manufacturer:		**Panam Venue Nm:**	
Model:		**External Identifier:**	
Serial No:		**Item:**	
ULC Standard:		**Piping Steel:**	
Quantity:		**Piping Galvanized:**	
Unit of Measure:		**Tank Single Wall St:**	
Overfill Prot Type:		**Piping Underground:**	
Creation Date:		**Tank Underground:**	
Next Periodic Str DT:		**Source:**	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Piping		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

---

124 | **8 of 14** | **NNE/234.3** | **76.9 / -0.93** | **BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON** | **DTNK**

Delisted Expired Fuel Safety Facilities

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Instance No:	10905070	**Expired Date:**	
Status:	EXPIRED	**Max Hazard Rank:**	
Instance ID:	51351	**Facility Location:**	
Instance Type:	FS Piping	**Facility Type:**	
Instance Creation Dt:		**Fuel Type 2:**	
Instance Install Dt:		**Fuel Type 3:**	
Item Description:		**Panam Related:**	
Manufacturer:		**Panam Venue Nm:**	
Model:		**External Identifier:**	
Serial No:		**Item:**	
ULC Standard:		**Piping Steel:**	
Quantity:		**Piping Galvanized:**	
Unit of Measure:		**Tank Single Wall St:**	
Overfill Prot Type:		**Piping Underground:**	
Creation Date:		**Tank Underground:**	
Next Periodic Str DT:		**Source:**	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Piping		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

124	*9 of 14*	*NNE/234.3*	*76.9 / -0.93*	***Shell Canada Products*** ***154 O+Connor Street*** ***Ottawa ON K2P 1T5***	***GEN***

Generator Info

Generator No:	ON7522524	**Choice of Contact:**	
Approval Years:	2009	**Contaminated Fac:**	
Status:		**MHSW Facility:**	
PO Box No:		**SIC Code:**	447190
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Other Gasoline Stations		

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

124	*10 of 14*	*NNE/234.3*	*76.9 / -0.93*	***Shell Canada Products*** ***154 O+Connor Street*** ***Ottawa ON K2P 1T5***	***GEN***

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info

Generator No:	ON7522524	***Choice of Contact:***	
Approval Years:	2010	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	447190
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Other Gasoline Stations		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

124	***11 of 14***	***NNE/234.3***	***76.9 / -0.93***	***BYTOWN TOWING & AUTOCARE LTD 154 O'CONNOR ST AT GLOUCESTER OTTAWA ON K2P 1T5***	***DTNK***

Delisted Expired Fuel Safety Facilities

Instance No:	9587344	***Expired Date:***	3/24/2013 15:03
Status:	EXPIRED	***Max Hazard Rank:***	
Instance ID:		***Facility Location:***	
Instance Type:	FS Facility	***Facility Type:***	
Instance Creation Dt:		***Fuel Type 2:***	
Instance Install Dt:		***Fuel Type 3:***	
Item Description:		***Panam Related:***	
Manufacturer:		***Panam Venue Nm:***	
Model:		***External Identifier:***	
Serial No:		***Item:***	
ULC Standard:		***Piping Steel:***	
Quantity:		***Piping Galvanized:***	
Unit of Measure:		***Tank Single Wall St:***	
Overfill Prot Type:		***Piping Underground:***	
Creation Date:		***Tank Underground:***	
Next Periodic Str DT:		***Source:***	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Date:		Up to May 2013			

124 **12 of 14** **NNE/234.3** **76.9 / -0.93** **BYTOWN TOWING & AUTOCARE LTD** **EXP**
154 O'CONNOR ST AT GLOUCESTER
OTTAWA ON

Inventory No:	10905094	**Tank Material:**	Fiberglass (FRP)
Inventory Status:	EXPIRED	**Corrosion Protect:**	Fiberglass
Installation Year:	1980	**Overfill Protection:**	
Capacity:	22700	**Inventory Context:**	FS Liquid Fuel Tank
Capacity Unit:		**Inventory Item:**	FS LIQUID FUEL TANK
Tank Type:			
Manufacturer:			
Model:			
Description:	2009VBS		
Previous Fuel Type:	Gasoline		

124 **13 of 14** **NNE/234.3** **76.9 / -0.93** **BYTOWN TOWING & AUTOCARE LTD** **EXP**
154 O'CONNOR ST AT GLOUCESTER
OTTAWA ON

Inventory No:	10905079	**Tank Material:**	Fiberglass (FRP)
Inventory Status:	EXPIRED	**Corrosion Protect:**	Fiberglass
Installation Year:	1980	**Overfill Protection:**	
Capacity:	22700	**Inventory Context:**	FS Liquid Fuel Tank
Capacity Unit:		**Inventory Item:**	FS LIQUID FUEL TANK
Tank Type:			
Manufacturer:			
Model:			
Description:	2009VBS; 2008V; Veeder Root		
Previous Fuel Type:	Gasoline		

124 **14 of 14** **NNE/234.3** **76.9 / -0.93** **BYTOWN TOWING & AUTOCARE LTD** **EXP**
154 O'CONNOR ST AT GLOUCESTER
OTTAWA ON

Inventory No:	10905061	**Tank Material:**	Fiberglass (FRP)
Inventory Status:	EXPIRED	**Corrosion Protect:**	Fiberglass
Installation Year:	1980	**Overfill Protection:**	
Capacity:	22700	**Inventory Context:**	FS Liquid Fuel Tank
Capacity Unit:		**Inventory Item:**	FS LIQUID FUEL TANK
Tank Type:			
Manufacturer:			
Model:			
Description:	2009VBS; 2008V; Veeder Root		
Previous Fuel Type:	Gasoline		

125 **1 of 1** **ESE/235.6** **75.9 / -1.93** **324 Somerset Street West** **EHS**
Ottawa ON K2P 0J9

Order No:	20041214013	**Nearest Intersection:**	Somerset Street West
Status:	C	**Municipality:**	
Report Type:	Custom Report	**Client Prov/State:**	ON
Report Date:	12/16/04	**Search Radius (km):**	0.25
Date Received:	12/14/04	**X:**	-75.694783
Previous Site Name:		**Y:**	45.415917
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
126	1 of 1	E/235.7	75.9 / -1.93	311 Somerset St W Ottawa ON	WWIS

Well ID:	7382782	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring and Test Hole	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Observation Wells	**Date Received:**	03/18/2021
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z338246	**Contractor:**	7241
Tag:	A302969	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1008639334	**Tag No:**	A302969
Depth M:		**Contractor:**	7241
Year Completed:	2021	**Latitude:**	45.416179135269
Well Completed Dt:	02/19/2021	**Longitude:**	-75.6946725832926
Audit No:	Z338246	**Y:**	45.41617912839754
Path:		**X:**	-75.6946724209724

Bore Hole Information

Bore Hole ID:	1008639334	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445647.00
Code OB Desc:		**North83:**	5029419.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	02/19/2021	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1009823460
Layer:	3
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	05

Material 2 Desc:	CLAY
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	5.0
Formation End Depth:	9.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823459
Layer:	2
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	01
Material 2 Desc:	FILL
Material 3:	73
Material 3 Desc:	HARD
Formation Top Depth:	2.0
Formation End Depth:	5.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823461
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	9.0
Formation End Depth:	20.0
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009823458
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	
Material 2 Desc:	
Material 3:	73
Material 3 Desc:	HARD
Formation Top Depth:	0.0
Formation End Depth:	2.0
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009824634

Layer: 3
Plug From: 9.0
Plug To: 20.0
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009824633
Layer: 2
Plug From: 1.0
Plug To: 9.0
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009824632
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1009826068
Method Construction Code: D
Method Construction: Direct Push
Other Method Construction:

Pipe Information

Pipe ID: 1009718364
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009826494
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 10.0
Casing Diameter: 2.046999931335449
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1009826907
Layer: 1
Slot: 10
Screen Top Depth: 10.0
Screen End Depth: 20.0
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 2.375

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1009827322
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	m
Rate UOM:	LPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Hole Diameter

Hole ID:	1009825630
Diameter:	4.5
Depth From:	0.0
Depth To:	20.0
Hole Depth UOM:	m
Hole Diameter UOM:	cm

---

127 ***1 of 1*** ***ESE/235.7*** ***75.9 / -1.93*** ***322 SOMERSET STREET WEST OTTAWA ON*** ***HINC***

External File Num:	FS INC 0611-04091
Fuel Occurrence Type:	Pipeline Strike
Date of Occurrence:	11/27/2006
Fuel Type Involved:	Natural Gas
Status Desc:	Completed - Causal Analysis(End)
Job Type Desc:	Incident/Near-Miss Occurrence (FS)
Oper. Type Involved:	Commercial (e.g. restaurant, business unit, etc)
Service Interruptions:	No
Property Damage:	No
Fuel Life Cycle Stage:	Utilization
Root Cause:	Root Cause: Equipment/Material/Component:No Procedures:Yes Maintenance:No Design:No Training: Yes Management:No Human Factors:No
Reported Details:	
Fuel Category:	Gaseous Fuel
Occurrence Type:	Incident
Affiliation:	Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)
County Name:	Ottawa
Approx. Quant. Rel:	
Nearby body of water:	
Enter Drainage Syst.:	
Approx. Quant. Unit:	
Environmental Impact:	

---

128 ***1 of 1*** ***S/235.9*** ***77.9 / 0.07*** ***19 MCLAREN ON*** ***WWIS***

Well ID:	7233876	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:	Monitoring and Test Hole	***Data Entry Status:***	

Use 2nd:	0	**Data Src:**	
Final Well Status:	Monitoring and Test Hole	**Date Received:**	12/15/2014
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z188288	**Contractor:**	7241
Tag:	A173762	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233876.pdf

Additional Detail(s) (Map)

Well Completed Date:	11/06/2014
Year Completed:	2014
Depth (m):	6.1
Latitude:	45.4143425525272
Longitude:	-75.6976790084398
X:	-75.69767884602885
Y:	45.41434254629924
Path:	723\7233876.pdf

Bore Hole Information

Bore Hole ID:	1005260627	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445410.00
Code OB Desc:		**North83:**	5029217.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	11/06/2014	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1005436710
Layer:	4
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	85
Material 3 Desc:	SOFT

Formation Top Depth: 4.880000114440918
Formation End Depth: 6.099999904632568
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436708
Layer: 2
Color: 6
General Color: BROWN
Material 1: 06
Material 1 Desc: SILT
Material 2: 28
Material 2 Desc: SAND
Material 3: 05
Material 3 Desc: CLAY
Formation Top Depth: 1.2200000286102295
Formation End Depth: 3.0999999046325684
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436709
Layer: 3
Color: 6
General Color: BROWN
Material 1: 06
Material 1 Desc: SILT
Material 2: 05
Material 2 Desc: CLAY
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 3.0999999046325684
Formation End Depth: 4.880000114440918
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1005436707
Layer: 1
Color: 6
General Color: BROWN
Material 1: 01
Material 1 Desc: FILL
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 28
Material 3 Desc: SAND
Formation Top Depth: 0.0
Formation End Depth: 1.2200000286102295
Formation End Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436720
Layer: 3
Plug From: 2.740000009536743
Plug To: 6.099999904632568

Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436718
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1005436719
Layer: 2
Plug From: 0.3100000023841858
Plug To: 2.740000009536743
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1005436717
Method Construction Code: 2
Method Construction: Rotary (Convent.)
Other Method Construction: AIR PERCUSSION AND DIRECT PUSH

Pipe Information

Pipe ID: 1005436706
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1005436713
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 3.0999999046325684
Casing Diameter: 5.199999809265137
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1005436714
Layer: 1
Slot: 10
Screen Top Depth: 3.0999999046325684
Screen End Depth: 6.099999904632568
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.03000020980835

Water Details

Water ID: 1005436712
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: m

Hole Diameter

Hole ID: 1005436711
Diameter: 15.319999694824219
Depth From: 0.0
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

---

129 **1 of 1** **SSW/236.3** **78.9 / 1.07** **KENT ST**
Ottawa ON
WWIS

Well ID: 7344655
Construction Date:
Use 1st:
Use 2nd:
Final Well Status:
Water Type:
Casing Material:
Audit No: Z287916
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 10/22/2019
Selected Flag: TRUE
Abandonment Rec: Yes
Contractor: 7543
Form Version: 7
Owner:
County: OTTAWA-CARLETON
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344655.pdf

Additional Detail(s) (Map)

Well Completed Date:
Year Completed:
Depth (m):
Latitude: 45.414401261268
Longitude: -75.6983826515015
X: -75.69838248986439
Y: 45.41440125401358
Path: 734\7344655.pdf

Bore Hole Information

Bore Hole ID: 1007687164
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:

Elevation:
Elevrc:
Zone: 18
East83: 445355.00
North83: 5029224.00
Org CS: UTM83

Cluster Kind:		**UTMRC:**	4
Date Completed:		**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Pipe Information

Pipe ID:	1008243512
Casing No:	0
Comment:	
Alt Name:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1008244304
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	ft
Rate UOM:	GPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

130 ***1 of 1*** ***E/237.3*** ***75.9 / -1.93*** ***ON*** ***WWIS***

Well ID:	7211110	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Abandoned-Other	**Date Received:**	11/14/2013
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	Yes
Audit No:	Z096856	**Contractor:**	6894
Tag:	A152341	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211110.pdf

Additional Detail(s) (Map)

Well Completed Date:
Year Completed:
Depth (m):
Latitude: 45.4162783751036
Longitude: -75.6946354577708
X: -75.69463529630052
Y: 45.416278368040004
Path: 721\7211110.pdf

Bore Hole Information

Bore Hole ID: 1004633069
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed:
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445650.00
North83: 5029430.00
Org CS: UTM83
UTMRC: 3
UTMRC Desc: margin of error : 10 - 30 m
Location Method: wwr

Annular Space/Abandonment Sealing Record

Plug ID: 1004895719
Layer: 1
Plug From: 57.0
Plug To: 0.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 1004895718
Method Construction Code:
Method Construction:
Other Method Construction:

Pipe Information

Pipe ID: 1004895711
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1004895715
Layer:
Material:
Open Hole or Material:

Depth From:
Depth To:
Casing Diameter:
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1004895716
Layer:
Slot:
Screen Top Depth:
Screen End Depth:
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water Details

Water ID: 1004895714
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID: 1004895713
Diameter:
Depth From:
Depth To:
Hole Depth UOM: ft
Hole Diameter UOM: inch

---

131 | ***1 of 1*** | ***ENE/238.3*** | ***75.9 / -1.93*** | ***335 Cooper Street Ottawa ON K2P 0G5*** | ***EHS***

Order No: 21041400015
Status: C
Report Type: Standard Report
Report Date: 19-APR-21
Date Received: 14-APR-21
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6947608
Y: 45.4171295

---

132 | ***1 of 1*** | ***W/238.7*** | ***76.6 / -1.23*** | ***KENT ST Ottawa ON*** | ***WWIS***

Well ID: 7344659
Construction Date:
Use 1st:
Use 2nd:
Final Well Status: Abandoned-Other
Water Type:
Casing Material:
Audit No: Z286432
Tag: A157400
Constructn Method:
Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 10/22/2019
Selected Flag: TRUE
Abandonment Rec: Yes
Contractor: 7543
Form Version: 7
Owner:

Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/734\7344659.pdf

Additional Detail(s) (Map)

Well Completed Date:	09/19/2019
Year Completed:	2019
Depth (m):	
Latitude:	45.4169618920396
Longitude:	-75.7006253201517
X:	-75.70062515816296
Y:	45.41696188495833
Path:	734\7344659.pdf

Bore Hole Information

Bore Hole ID:	1007687176	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445182.00
Code OB Desc:		**North83:**	5029510.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	4
Date Completed:	09/19/2019	**UTMRC Desc:**	margin of error : 30 m - 100 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1008087393
Layer:	2
Plug From:	0.5
Plug To:	21.0
Plug Depth UOM:	ft

Annular Space/Abandonment Sealing Record

Plug ID:	1008087395
Layer:	1
Plug From:	0.0
Plug To:	0.5
Plug Depth UOM:	ft

Annular Space/Abandonment

Sealing Record

Plug ID:	1008087394
Layer:	3
Plug From:	21.0
Plug To:	
Plug Depth UOM:	ft

Pipe Information

Pipe ID:	1008084813
Casing No:	0
Comment:	
Alt Name:	

Results of Well Yield Testing

Pumping Test Method Desc:	
Pump Test ID:	1008090671
Pump Set At:	
Static Level:	
Final Level After Pumping:	
Recommended Pump Depth:	
Pumping Rate:	
Flowing Rate:	
Recommended Pump Rate:	
Levels UOM:	ft
Rate UOM:	GPM
Water State After Test Code:	
Water State After Test:	
Pumping Test Method:	0
Pumping Duration HR:	
Pumping Duration MIN:	
Flowing:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
133	1 of 1	E/240.2	75.9 / -1.93	311 SOMERSET Ottawa ON	WWIS

Well ID:	7391112	***Flowing (Y/N):***	
Construction Date:		***Flow Rate:***	
Use 1st:	Monitoring and Test Hole	***Data Entry Status:***	
Use 2nd:		***Data Src:***	
Final Well Status:	Monitoring and Test Hole	***Date Received:***	06/29/2021
Water Type:		***Selected Flag:***	TRUE
Casing Material:		***Abandonment Rec:***	
Audit No:	Z364080	***Contractor:***	7241
Tag:	A302972	***Form Version:***	7
Constructn Method:		***Owner:***	
Elevation (m):		***County:***	OTTAWA-CARLETON
Elevatn Reliabilty:		***Lot:***	
Depth to Bedrock:		***Concession:***	
Well Depth:		***Concession Name:***	
Overburden/Bedrock:		***Easting NAD83:***	
Pump Rate:		***Northing NAD83:***	
Static Water Level:		***Zone:***	
Clear/Cloudy:		***UTM Reliability:***	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/739\7391112.pdf

Additional Detail(s) (Map)

Well Completed Date: 05/26/2021
Year Completed: 2021
Depth (m):
Latitude: 45.4162876088694
Longitude: -75.6945972286121
X: -75.69459706670887
Y: 45.41628760214662
Path: 739\7391112.pdf

Bore Hole Information

Bore Hole ID: 1008704346
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 05/26/2021
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83: 445653.00
North83: 5029431.00
Org CS: UTM83
UTMRC: 4
UTMRC Desc: margin of error : 30 m - 100 m
Location Method: wwr

Overburden and Bedrock Materials Interval

Formation ID: 1009852393
Layer: 3
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 28
Material 2 Desc: SAND
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 2.740000009536743
Formation End Depth: 3.9600000381469727
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1009852394
Layer: 4
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 3.9600000381469727
Formation End Depth: 10.670000076293945
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID:	1009852395
Layer:	5
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	10.670000076293945
Formation End Depth:	13.100000381469727
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852391
Layer:	1
Color:	2
General Color:	GREY
Material 1:	11
Material 1 Desc:	GRAVEL
Material 2:	28
Material 2 Desc:	SAND
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	0.3100000023841858
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1009852392
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.3100000023841858
Formation End Depth:	2.740000009536743
Formation End Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1009853456
Layer:	2
Plug From:	0.3100000023841858
Plug To:	9.75
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID: 1009853455
Layer: 1
Plug From: 0.0
Plug To: 0.3100000023841858
Plug Depth UOM: m

Annular Space/Abandonment Sealing Record

Plug ID: 1009853457
Layer: 3
Plug From: 9.75
Plug To: 13.100000381469727
Plug Depth UOM: m

Method of Construction & Well Use

Method Construction ID: 1009854837
Method Construction Code: 5
Method Construction: Air Percussion
Other Method Construction:

Pipe Information

Pipe ID: 1009764982
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1009855215
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 10.050000190734863
Casing Diameter: 5.199999809265137
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 1009855611
Layer: 1
Slot: 10
Screen Top Depth: 10.050000190734863
Screen End Depth: 13.100000381469727
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 6.03000020980835

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 1009856075
Pump Set At:
Static Level:

Final Level After Pumping:
Recommended Pump Depth:
Pumping Rate:
Flowing Rate:
Recommended Pump Rate:
Levels UOM: m
Rate UOM: LPM
Water State After Test Code:
Water State After Test:
Pumping Test Method: 0
Pumping Duration HR:
Pumping Duration MIN:
Flowing: No

Hole Diameter

Hole ID: 1009854396
Diameter: 11.430000305175781
Depth From: 0.0
Depth To: 13.100000381469727
Hole Depth UOM: m
Hole Diameter UOM: cm

---

134 | ***1 of 1*** | ***E/241.2*** | ***75.9 / -1.93*** | ***340 Cooper street Ottawa ON Ottawa ON K2P 0G7*** | ***EHS***

Order No: 24050100428
Status: C
Report Type: Standard Report
Report Date: 06-MAY-24
Date Received: 01-MAY-24
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6946303
Y: 45.4168781

---

135 | ***1 of 1*** | ***N/242.8*** | ***77.9 / 0.07*** | ***171 Bank Street Ottawa ON K2P 1W5*** | ***EHS***

Order No: 22121300111
Status: C
Report Type: Standard Report
Report Date: 16-DEC-22
Date Received: 13-DEC-22
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: City Directory
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.6977959
Y: 45.4186492

---

136 | ***1 of 1*** | ***NW/243.2*** | ***76.9 / -0.93*** | ***340 Laurier Ave W Ottawa ON K1P 5K3*** | ***EHS***

Order No: 20191127033
Status: C
Report Type: Standard Report
Report Date: 02-DEC-19
Date Received: 27-NOV-19
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:
Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.699898
Y: 45.417983

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
137	1 of 1	NW/244.0	76.8 / -0.96	Ambassador-Mondrian Inc. 324 LAURIER AVE W ON OTTAWA ON	RSC

RSC No:	40506	**X:**	-75.69833577615664
RA No:		**Y:**	45.418893184025585
Status:	FILED	**Latitude:**	45.41889318
Filing Date:		**Longitude:**	-75.69833578
Date Ack:		**UTM Coordinates:**	
Date Returned:		**Latitude Longitude:**	
Approval Date:	December 14, 2007	**Accuracy Estimate:**	
Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	K1P 0A4
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	Mark S D'Arcy
CPU Issu Sect 1686:		**Consultant:**	
Business Name:	Ambassador-Mondrian Inc.		
Address:	324 LAURIER AVE W ON		
Legal Desc:			
Site Pin:	04114 - 0045 LT		
Asmt Roll No:			
Project Type:	PRE2011		
Approval Type:	RSC based on Phase One and Two ESAs		
Applicable Standards:			
PDF Link:	https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=40506		

138	1 of 1	SSW/245.2	78.9 / 1.07	ON	BORE

Borehole ID:	613260	**Inclin FLG:**	No
OGF ID:	215514562	**SP Status:**	Initial Entry
Status:		**Surv Elev:**	No
Type:	Borehole	**Piezometer:**	No
Use:		**Primary Name:**	
Completion Date:	JAN-1965	**Municipality:**	
Static Water Level:	7.3	**Lot:**	
Primary Water Use:		**Township:**	
Sec. Water Use:		**Latitude DD:**	45.414383
Total Depth m:	-999	**Longitude DD:**	-75.698693
Depth Ref:	Ground Surface	**UTM Zone:**	18
Depth Elev:		**Easting:**	445331
Drill Method:		**Northing:**	5029222
Orig Ground Elev m:	74.3	**Location Accuracy:**	
Elev Reliabil Note:		**Accuracy:**	Not Applicable
DEM Ground Elev m:	74.3		
Concession:			
Location D:			
Survey D:			
Comments:			

Borehole Geology Stratum

Geology Stratum ID:	218394390	**Mat Consistency:**	Stiff
Top Depth:	1.2	**Material Moisture:**	
Bottom Depth:	2.4	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Clay	**Geologic Formation:**	

Material 2:	Silt	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	CLAY. GREY,STIFF.		

Geology Stratum ID:	218394391	**Mat Consistency:**	Hard
Top Depth:	2.4	**Material Moisture:**	
Bottom Depth:	9.3	**Material Texture:**	
Material Color:	Grey	**Non Geo Mat Type:**	
Material 1:	Till	**Geologic Formation:**	
Material 2:	Sand	**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	TILL. GREY,HARD.		

Geology Stratum ID:	218394389	**Mat Consistency:**	Compact
Top Depth:	0	**Material Moisture:**	
Bottom Depth:	1.2	**Material Texture:**	
Material Color:		**Non Geo Mat Type:**	
Material 1:	Fill	**Geologic Formation:**	
Material 2:		**Geologic Group:**	
Material 3:		**Geologic Period:**	
Material 4:		**Depositional Gen:**	fill
Gsc Material Description:			
Stratum Description:	FILL. COMPACT.		

Geology Stratum ID:	218394392	**Mat Consistency:**	Hard
Top Depth:	9.3	**Material Moisture:**	
Bottom Depth:		**Material Texture:**	
Material Color:	Black	**Non Geo Mat Type:**	
Material 1:	Bedrock	**Geologic Formation:**	
Material 2:	Shale	**Geologic Group:**	
Material 3:	Silt	**Geologic Period:**	
Material 4:		**Depositional Gen:**	
Gsc Material Description:			
Stratum Description:	BEDROCK. BLACK,FOSSILIFEROUS,FRACTURED,WATER STABLE AT 219.6 FEET.BEDROCK. BROWN, VERY HARD.		

Source

Source Type:	Data Survey	**Source Appl:**	Spatial/Tabular
Source Orig:	Geological Survey of Canada	**Source Iden:**	1
Source Date:	1956-1972	**Scale or Res:**	Varies
Confidence:		**Horizontal:**	NAD27
Observatio:		**Verticalda:**	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Details:	File: OTTAWA2.txt RecordID: 057680 NTS_Sheet: 31G05G		
Confiden 1:			

Source List

Source Identifier:	1	**Horizontal Datum:**	NAD27
Source Type:	Data Survey	**Vertical Datum:**	Mean Average Sea Level
Source Date:	1956-1972	**Projection Name:**	Universal Transverse Mercator
Scale or Resolution:	Varies		
Source Name:	Urban Geology Automated Information System (UGAIS)		
Source Originators:	Geological Survey of Canada		

139	*1 of 1*	*SSW/245.6*	*78.9 / 1.07*	*ON*	*WWIS*

Well ID:	7211109	**Flowing (Y/N):**	
Construction Date:		**Flow Rate:**	
Use 1st:	Monitoring	**Data Entry Status:**	
Use 2nd:		**Data Src:**	
Final Well Status:	Abandoned-Other	**Date Received:**	11/14/2013
Water Type:		**Selected Flag:**	TRUE
Casing Material:		**Abandonment Rec:**	
Audit No:	Z096858	**Contractor:**	6894
Tag:	A152335	**Form Version:**	7
Constructn Method:		**Owner:**	
Elevation (m):		**County:**	OTTAWA-CARLETON
Elevatn Reliabilty:		**Lot:**	
Depth to Bedrock:		**Concession:**	
Well Depth:		**Concession Name:**	
Overburden/Bedrock:		**Easting NAD83:**	
Pump Rate:		**Northing NAD83:**	
Static Water Level:		**Zone:**	
Clear/Cloudy:		**UTM Reliability:**	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/721\7211109.pdf

Additional Detail(s) (Map)

Well Completed Date:	
Year Completed:	
Depth (m):	
Latitude:	45.4144341369687
Longitude:	-75.6988942716743
X:	-75.69889410989069
Y:	45.41443413003447
Path:	721\7211109.pdf

Bore Hole Information

Bore Hole ID:	1004633020	**Elevation:**	
DP2BR:		**Elevrc:**	
Spatial Status:		**Zone:**	18
Code OB:		**East83:**	445315.00
Code OB Desc:		**North83:**	5029228.00
Open Hole:		**Org CS:**	UTM83
Cluster Kind:		**UTMRC:**	3
Date Completed:		**UTMRC Desc:**	margin of error : 10 - 30 m
Remarks:		**Location Method:**	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1004895710
Layer:	1
Plug From:	57.0
Plug To:	0.0
Plug Depth UOM:	ft

Method of Construction & Well Use

Method Construction ID: 1004895709
Method Construction Code:
Method Construction:
Other Method Construction:

Pipe Information

Pipe ID: 1004895702
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1004895706
Layer:
Material:
Open Hole or Material:
Depth From:
Depth To:
Casing Diameter:
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1004895707
Layer:
Slot:
Screen Top Depth:
Screen End Depth:
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water Details

Water ID: 1004895705
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID: 1004895704
Diameter:
Depth From:
Depth To:
Hole Depth UOM: ft
Hole Diameter UOM: inch

140	***1 of 3***	***ENE/246.0***	***75.9 / -1.93***	***257 Lisgar Street Ottawa ON K2P 0C7***	***EHS***

Order No: 20120807057 ***Nearest Intersection:***

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	16-AUG-12	**Search Radius (km):**	.25
Date Received:	07-AUG-12	**X:**	-75.695015
Previous Site Name:		**Y:**	45.418005
Lot/Building Size:			
Additional Info Ordered:			

140 **2 of 3** **ENE/246.0** **75.9 / -1.93** **Taggart Corporation Ltd.**
257 Lisgar Street
Otawa ON K2P 0C7
GEN

Generator Info

Generator No:	ON7376374	**Choice of Contact:**	
Approval Years:	As of Jan 2021	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

2020 Generator Info

Gen No:	ON7376374	**Choice of Contact:**	CO_OFFICIAL
ID:	29367	**Phone No Official:**	613-822-0624 Ext.
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	236210	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Taggart Corporation Ltd.		
Gen Div:			
Gen Op Name:	Taggart Corporation Ltd.		
Gen Op Div:			
Site Adrs1:	257 Lisgar Street		
Site Bldg:	Wentworth Plaza		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Otawa		
Province Out:			
Site Postal Code:	K2P 0C7		
Site Country:	Canada		
Co Official:	David Brouse		
Co Admin:			

140 **3 of 3** **ENE/246.0** **75.9 / -1.93** **Taggart Group Ltd**
257 Lisgar St
Ottawa ON K2P1P0
GEN

Generator Info

Generator No:	ON2733971	**Choice of Contact:**	
Approval Years:	As of Nov 2021	**Contaminated Fac:**	
Status:	Registered	**MHSW Facility:**	
PO Box No:		**SIC Code:**	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	243 D
Waste Class Name:	PCB

2021 Generator Info

Gen No:	ON2733971	**Choice of Contact:**	CO_OFFICIAL
ID:	10014	**Phone No Official:**	6132347000 Ext.
Contaminated Fac:	N	**Phone No Admin:**	
MHSW Facility:	N	**County Ont:**	OTTAWA CARLTON (RM)
NAICS Code1:	238210	**County Out:**	
NAICS Code2:		**District:**	402
NAICS Code3:			
Gen Name:	Taggart Group Ltd		
Gen Div:			
Gen Op Name:	Taggart Realty		
Gen Op Div:			
Site Adrs1:	257 Lisgar St		
Site Bldg:	Wentworth Centre		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2P1P0		
Site Country:	Canada		
Co Official:	Craig Humphrey		
Co Admin:			

2021 Generator Manifest

ID:	29236	**Sum Received Qty:**	18750.0
Generator No:	ON2733971	**Waste Class Name:**	PCBS
Receiver Type:	035	**Count Manifests:**	1
Waste Char:	D	**District:**	202
Waste Code:	243		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
141	1 of 1	ESE/246.3	75.9 / -1.95	341 Maclaren St Ottawa ON K2P2E2	EHS

Order No:	20170203026	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	08-FEB-17	**Search Radius (km):**	.25
Date Received:	03-FEB-17	**X:**	-75.695005
Previous Site Name:		**Y:**	45.415271
Lot/Building Size:			
Additional Info Ordered:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	1 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA

Certificate #: 7703-4KFM9J
Application Year: 00
Issue Date: 5/19/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: South Nepean Development Corporation
Client Address: 427 Laurier Ave. W., Unit 300
Client City: Ottawa
Client Postal Code:
Project Description: Storm and Sanitary Sewers to be constructed in the City of Nepean.
Contaminants:
Emission Control:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	2 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA

Certificate #: 3476-4KFMVT
Application Year: 00
Issue Date: 7/13/00
Approval Type: Municipal & Private water
Status: Revoked and/or Replaced
Application Type: New Certificate of Approval
Client Name: South Nepean Development Corporation
Client Address: 427 Laurier Ave. W., Unit 300
Client City: Ottawa
Client Postal Code:
Project Description: Watermains to be constructed in the City of Nepean
Contaminants:
Emission Control:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	3 of 8	ENE/246.4	75.9 / -1.93	Tartan Land Corporation 331 Cooper Street, Suite 400 Ottawa ON K2P 0G5	CA

Certificate #: 3735-4M5HET
Application Year: 00
Issue Date: 7/13/00
Approval Type: Municipal & Private water
Status: Approved
Application Type: Amended CofA
Client Name: South Nepean Development Corporation
Client Address: 427 Laurier Ave. W., Unit 300
Client City: Ottawa
Client Postal Code: K1R 7Y2
Project Description: Amend C/A to correct description of works
Contaminants:
Emission Control:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	4 of 8	ENE/246.4	75.9 / -1.93	South Nepean Development Corporation 331 Cooper Street, Suite 400 Ottawa ON K1R 7Y2	ECA

Approval No: 3735-4M5HET
Approval Date: 2000-07-13
Status: Approved
MOE District: Ottawa
City:
Longitude: -75.69465

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Record Type: ECA
Link Source: IDS
SWP Area Name: Rideau Valley
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: South Nepean Development Corporation
Address: 331 Cooper Street, Suite 400
Full Address:
Full PDF Link:
PDF Site Location:
Latitude: 45.417255
Geometry X:
Geometry Y:

---

142 **5 of 8** **ENE/246.4** **75.9 / -1.93** **South Nepean Development Corporation** **331 Cooper Street, Suite 400** **Ottawa ON** **ECA**

Approval No: 7703-4KFM9J
Approval Date: 2000-05-19
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name: Rideau Valley
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: South Nepean Development Corporation
Address: 331 Cooper Street, Suite 400
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3341-4K9RJV-14.pdf
PDF Site Location:
MOE District: Ottawa
City:
Longitude: -75.69465
Latitude: 45.417255
Geometry X:
Geometry Y:

---

142 **6 of 8** **ENE/246.4** **75.9 / -1.93** **South Nepean Development Corporation** **331 Cooper Street, Suite 400** **Ottawa ON** **ECA**

Approval No: 3476-4KFMVT
Approval Date: 2000-07-13
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name: Rideau Valley
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: South Nepean Development Corporation
Address: 331 Cooper Street, Suite 400
Full Address:
Full PDF Link:
PDF Site Location:
MOE District: Ottawa
City:
Longitude: -75.69465
Latitude: 45.417255
Geometry X:
Geometry Y:

---

142 **7 of 8** **ENE/246.4** **75.9 / -1.93** **Enbridge Gas Distribution Inc.** **331 Cooper St.** **Ottawa ON** **SPL**

Ref No: 2853-B52NE2
Year:
Incident Dt: 2018/09/28
Dt MOE Arvl on Scn:
MOE Reported Dt: 2018/09/28
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 0 - No Impact
Agency Involved:

Site Geo Ref Meth:	
Site District Office:	Ottawa
Nearest Watercourse:	
Site Name:	1 Inch IP Plastic Service Damage <UNOFFICIAL>
Site Address:	331 Cooper St.
Site Region:	Eastern
Site Municipality:	Ottawa
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	Enbridge Gas Distribution Inc.
Client Type:	Corporation
Source Type:	Valve/Fitting/Piping
Incident Cause:	
Incident Preceding Spill:	Leak/Break
Incident Reason:	Operator/Human Error
Incident Summary:	TSSA/FSB: 1" IP Plastic Line Strike - Made Safe
Environment Impact:	
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	0 other - see incident description
Contaminant Qty 1:	0
Contaminant Unit:	other - see incident description
Contaminant Code:	35
Contaminant Name:	NATURAL GAS (METHANE)
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	1075
Receiving Medium:	Air
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	Miscellaneous Industrial
SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
142	8 of 8	ENE/246.4	75.9 / -1.93	PIPELINE HIT 1" 331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA ON	PINC

Incident Id:		**Pipe Material:**	
Incident No:	2409866	**Fuel Category:**	
Incident Reported Dt:	10/1/2018	**Health Impact:**	
Type:	FS-Pipeline Incident	**Environment Impact:**	
Status Code:		**Property Damage:**	
Tank Status:	Pipeline Damage Reason Est	**Service Interrupt:**	
Task No:		**Enforce Policy:**	
Spills Action Centre:		**Public Relation:**	
Fuel Type:		**Pipeline System:**	
Fuel Occurrence Tp:		**PSIG:**	
Date of Occurrence:		**Attribute Category:**	
Occurrence Start Dt:		**Regulator Location:**	
Depth:		**Method Details:**	
Customer Acct Name:	PIPELINE HIT 1"		
Incident Address:	331 COOPER ST,,OTTAWA,ON,K2P 0G5,CA		
Operation Type:			
Pipeline Type:			
Regulator Type:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Summary:
Reported By:
Affiliation:
Occurrence Desc:
Damage Reason:
Notes:

---

143 | ***1 of 10*** | ***S/246.7*** | ***77.9 / 0.07*** | ***441 MACLAREN STREET OTTAWA ON K2P 2H3*** | ***EHS***

Order No:	20070216001	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	CAN - Custom Report	***Client Prov/State:***	
Report Date:	2/23/2007	***Search Radius (km):***	0.25
Date Received:	2/16/2007	***X:***	-75.69777
Previous Site Name:		***Y:***	45.414087
Lot/Building Size:			
Additional Info Ordered:	Fire Insur. Maps And /or Site Plans		

---

143 | ***2 of 10*** | ***S/246.7*** | ***77.9 / 0.07*** | ***441 MacLaren Ottawa ON*** | ***EHS***

Order No:	20111024070	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Standard Report	***Client Prov/State:***	ON
Report Date:	11/2/2011	***Search Radius (km):***	0.25
Date Received:	10/24/2011 3:21:35 PM	***X:***	0
Previous Site Name:		***Y:***	0
Lot/Building Size:	0.3 acres		
Additional Info Ordered:			

---

143 | ***3 of 10*** | ***S/246.7*** | ***77.9 / 0.07*** | ***Dental Anaesthesia Group 441 MacLaren Street Suite 370 Ottawa ON*** | ***GEN***

Generator Info

Generator No:	ON6259500	***Choice of Contact:***	
Approval Years:	2013	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	621210
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OFFICES OF DENTISTS		

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

---

143 | ***4 of 10*** | ***S/246.7*** | ***77.9 / 0.07*** | ***Sedation Dental Group Suite 370 441 MacLaren St Ottawa ON K2P 2H3*** | ***GEN***

Generator Info

Generator No:	ON8313130	***Choice of Contact:***	CO_ADMIN
Approval Years:	2016	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	621210
Country:	Canada		
Co Admin:	Penny Petersen		
Phone No Admin:	613-232-3725 Ext.225		
SIC Description:	OFFICES OF DENTISTS		

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	262
Waste Class Name:	DETERGENTS/SOAPS

Waste Detail(s)

Waste Class:	263
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	114
Waste Class Name:	OTHER INORGANIC ACID WASTES

---

143 ***5 of 10*** ***S/246.7*** ***77.9 / 0.07*** ***Elevation Elevator Inc.*** ***GEN***
441 MacLaren
Ottawa ON K2P 2R2

Generator Info

Generator No:	ON8244897	***Choice of Contact:***	CO_OFFICIAL
Approval Years:	2015	***Contaminated Fac:***	No
Status:		***MHSW Facility:***	No
PO Box No:		***SIC Code:***	238291
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	ELEVATOR AND ESCALATOR INSTALLATION CONTRACTORS		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

---

143 | **6 of 10** | **S/246.7** | **77.9 / 0.07** | **Sedation Dental Group**
Suite 370 441 MacLaren St
Ottawa ON K2P 2H3 | **GEN**

Generator Info

Generator No: ON8313130
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin: Penny Petersen
Phone No Admin: 613-232-3725 Ext.225
SIC Description: OFFICES OF DENTISTS
Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 621210

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

143 | **7 of 10** | **S/246.7** | **77.9 / 0.07** | **Dental Anaesthesia Group**
Suite 370 441 MacLaren St
Ottawa ON K2P 2H3 | **GEN**

Generator Info

Generator No: ON8313130
Approval Years: 2014
Status:
PO Box No:
Country: Canada
Co Admin: Penny Petersen
Phone No Admin: 613-232-3725 Ext.225
SIC Description: OFFICES OF DENTISTS
Choice of Contact: CO_ADMIN
Contaminated Fac: No
MHSW Facility: No
SIC Code: 621210

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 261
Waste Class Name: PHARMACEUTICALS

---

143 | **8 of 10** | **S/246.7** | **77.9 / 0.07** | **Sedation Dental Group**
Suite 370 441 MacLaren St | **GEN**

Ottawa ON K2P 2H3

Generator Info

Generator No:	ON8313130	***Choice of Contact:***	
Approval Years:	As of Dec 2018	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

Waste Detail(s)

Waste Class:	262 L
Waste Class Name:	Detergents and soaps

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	Misc. waste organic chemicals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	114 C
Waste Class Name:	Other inorganic acid wastes

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	Aliphatic solvents and residues

143	***9 of 10***	***S/246.7***	***77.9 / 0.07***	***Sedation Dental Group*** ***Suite 370 441 MacLaren St*** ***Ottawa ON K2P 2H3***	***GEN***

Generator Info

Generator No:	ON8313130	***Choice of Contact:***	
Approval Years:	As of Jul 2020	***Contaminated Fac:***	
Status:	Registered	***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:	Canada		
Co Admin:			
Phone No Admin:			

SIC Description:

Waste Detail(s)

Waste Class: 114 C
Waste Class Name: Other inorganic acid wastes

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: Misc. waste organic chemicals

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Waste Detail(s)

Waste Class: 262 L
Waste Class Name: Detergents and soaps

Waste Detail(s)

Waste Class: 212 I
Waste Class Name: Aliphatic solvents and residues

---

143 | ***10 of 10*** | ***S/246.7*** | ***77.9 / 0.07*** | ***Sedation Dental Group
Suite 370 441 MacLaren St
Ottawa ON K2P 2H3*** | ***GEN***

Generator Info

Generator No: ON8313130
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 261 A
Waste Class Name: Pharmaceuticals

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: Pathological wastes

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: Misc. waste organic chemicals

Waste Detail(s)

Waste Class: 262 L
Waste Class Name: Detergents and soaps

Waste Detail(s)

Waste Class: 114 C
Waste Class Name: Other inorganic acid wastes

Waste Detail(s)

Waste Class: 212 I
Waste Class Name: Aliphatic solvents and residues

---

144 | ***1 of 1*** | ***SW/246.7*** | ***78.9 / 1.07*** | ***447 Somerset Street West Ottawa ON K1R 5J7*** | ***EHS***

Order No: 20191128029
Status: C
Report Type: Site Report
Report Date: 29-NOV-19
Date Received: 28-NOV-19
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .001
X: -75.69907
Y: 45.414481

---

145 | ***1 of 3*** | ***WNW/248.0*** | ***75.7 / -2.08*** | ***I C ASSALY CONSTRUCTION 199 KENT ST OTTAWA ON K2P2K8*** | ***PRT***

Location ID: 19565
Type: retail
Expiry Date: 1993-01-31
Capacity (L): 1000
Licence #: 0076347020

---

145 | ***2 of 3*** | ***WNW/248.0*** | ***75.7 / -2.08*** | ***I C ASSALY CONSTRUCTION 199 KENT ST OTTAWA ON*** | ***DTNK***

Delisted Expired Fuel Safety Facilities

Instance No: 9893415
Status: EXPIRED
Instance ID: 397701
Instance Type: FS Facility
Instance Creation Dt:
Instance Install Dt:

Expired Date:
Max Hazard Rank:
Facility Location:
Facility Type:
Fuel Type 2:
Fuel Type 3:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Item Description:		**Panam Related:**	
Manufacturer:		**Panam Venue Nm:**	
Model:		**External Identifier:**	
Serial No:		**Item:**	
ULC Standard:		**Piping Steel:**	
Quantity:		**Piping Galvanized:**	
Unit of Measure:		**Tank Single Wall St:**	
Overfill Prot Type:		**Piping Underground:**	
Creation Date:		**Tank Underground:**	
Next Periodic Str DT:		**Source:**	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Propane Refill Cntr - Cylr Fill		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

145	3 of 3	WNW/248.0	75.7 / -2.08	**Kent Towers<UNOFFICIAL>** **199 Kent st** **Ottawa ON**	SPL

Ref No:	0255-BPBMVU	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	2020/04/28	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	2020/05/05	**Impact to Health:**	2 - Minor Environment
Dt Document Closed:	2020/07/17	**Agency Involved:**	
Site No:	NA		
MOE Response:	No		
Site County/District:			
Site Geo Ref Meth:			
Site District Office:	Ottawa		
Nearest Watercourse:			
Site Name:	Kent Towers<UNOFFICIAL>		
Site Address:	199 Kent st		
Site Region:	Eastern		
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:	5029544		
Easting:	445168		
Entity Operating Name:			
Client Name:	Kent Towers<UNOFFICIAL>		
Client Type:			
Source Type:	Tank - Indoors		
Incident Cause:			
Incident Preceding Spill:	Leak/Break		
Incident Reason:	Equipment Failure		
Incident Summary:	TSSA FSB: small amount dsl dripped inside to floor from tank		
Environment Impact:			
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:	0 other - see incident description		
Contaminant Qty 1:	0		
Contaminant Unit:	other - see incident description		
Contaminant Code:	13		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Contaminant Name: DIESEL FUEL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1: 1202
Receiving Medium: Land
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Communal
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

---

146 | **1 of 11** | **WNW/248.1** | **76.9 / -0.87** | **360 Laurier Ave West Ottawa ON K1P 1C8** | **EHS**

Order No: 20001109006
Status: C
Report Type: Complete Report
Report Date: 11/14/00
Date Received: 11/10/00
Previous Site Name:
Lot/Building Size: 11 story 13 underground parking
Additional Info Ordered:

Nearest Intersection: Kent St.
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.700168
Y: 45.41804

---

146 | **2 of 11** | **WNW/248.1** | **76.9 / -0.87** | **HEALTH AND WELFARE CANADA HEALTH UNIT#31, 2ND FL., NORONO BLDG. 360 LAURIER AVE. WEST (HWC) OTTAWA ON K1P 1C8** | **GEN**

Generator Info

Generator No: ON0095619
Approval Years: 92,93,97
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: PUB. HEALTH CLINICS

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8635

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

146 | **3 of 11** | **WNW/248.1** | **76.9 / -0.87** | **GVT OF CAN-HEALTH&WELFARE CAN.MED.16-305 SER.BR,UNIT#31,2ND FL.,NORONO BLDG. 360 LAURIER AVE. WEST,C/O 301 ELGIN ST OTTAWA ON K1P 1C8** | **GEN**

Generator Info

Generator No: ON0095619
Approval Years: 94,95,96

Choice of Contact:
Contaminated Fac:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 8635
Country:
Co Admin:
Phone No Admin:
SIC Description: PUB. HEALTH CLINICS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

146 ***4 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***HEALTH AND WELFARE CANADA***
360 LAURIER AVE. WEST (HWC) HEALTH UNIT
#31, 2ND FLOOR, NORONO BLDG.
OTTAWA ON K1P 5K3 ***GEN***

Generator Info

Generator No: ON0095619 ***Choice of Contact:***
Approval Years: 98,99,00,01 ***Contaminated Fac:***
Status: ***MHSW Facility:***
PO Box No: ***SIC Code:*** 8635
Country:
Co Admin:
Phone No Admin:
SIC Description: PUB. HEALTH CLINICS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

---

146 ***5 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***360 Laurier Avenue West***
Ottawa ON K1P 1C8 ***EHS***

Order No: 20051122010 ***Nearest Intersection:***
Status: C ***Municipality:***
Report Type: Custom Report ***Client Prov/State:*** ON
Report Date: 11/25/2005 ***Search Radius (km):*** 0.25
Date Received: 11/22/2005 ***X:*** -75.700331
Previous Site Name: ***Y:*** 45.417995
Lot/Building Size:
Additional Info Ordered:

---

146 ***6 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***360 Laurier Avenue West Limited***
360 Laurier Avenue West Ottawa K1P 6E2 CITY
OF OTTAWA
ON ***EBR***

EBR Registry No: 010-2243 ***Decision Posted:***
Ministry Ref No: 5377-794PWB ***Exception Posted:***
Notice Type: Instrument Decision ***Section:***
Notice Stage: ***Act 1:***
Notice Date: March 13, 2008 ***Act 2:***
Proposal Date: December 03, 2007 ***Site Location Map:***
Year: 2007
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:

Posted By:
Company Name: 360 Laurier Avenue West Limited
Site Address:
Location Other:
Proponent Name:
Proponent Address: 130 Slater Street, Ottawa Ontario, Canada K1P 6E2
Comment Period:
URL:
Summary:

Site Location Details:

360 Laurier Avenue West Ottawa K1P 6E2 CITY OF OTTAWA

---

146 ***7 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***360 Laurier Avenue West Limited*** ***CA***
360 Laurier Ave W
Ottawa ON

Certificate #: 0625-7CFSTA
Application Year: 2008
Issue Date: 3/7/2008
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

---

146 ***8 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***360 Laurier Avenue West Limited*** ***ECA***
360 Laurier Ave W
Ottawa ON K1P 6E2

Approval No: 0625-7CFSTA
Approval Date: 2008-03-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name: Rideau Valley
Approval Type: ECA-AIR
Project Type: AIR
Business Name: 360 Laurier Avenue West Limited
Address: 360 Laurier Ave W
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/5377-794PWB-13.pdf
PDF Site Location:

MOE District: Ottawa
City:
Longitude: -75.70044
Latitude: 45.417706
Geometry X:
Geometry Y:

---

146 ***9 of 11*** ***WNW/248.1*** ***76.9 / -0.87*** ***360 Laurier Avenue West*** ***EHS***
Ottawa ON K1P 1C8

Order No: 20180517212
Status: C
Report Type: Standard Report
Report Date: 22-MAY-18
Date Received: 17-MAY-18
Previous Site Name:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.700467
Y: 45.417716

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Lot/Building Size:
Additional Info Ordered:

---

146 **10 of 11** **WNW/248.1** **76.9 / -0.87**

360 Laurier Ave W
Ottawa ON K1P1C8

EHS

Order No:	20170601026	**Nearest Intersection:**	
Status:	C	**Municipality:**	
Report Type:	Standard Report	**Client Prov/State:**	ON
Report Date:	06-JUN-17	**Search Radius (km):**	.25
Date Received:	01-JUN-17	**X:**	-75.700442
Previous Site Name:		**Y:**	45.417707

Lot/Building Size:
Additional Info Ordered:

---

146 **11 of 11** **WNW/248.1** **76.9 / -0.87**

OTT A360 LAURIER INC.
360 Laurier AVE W
Ottawa ON

RSC

RSC No:	B-403-7293203464	**X:**	-75.70055555544451
RA No:		**Y:**	45.41777777684349
Status:	Active	**Latitude:**	45.41777778
Filing Date:		**Longitude:**	-75.70055556
Date Ack:		**UTM Coordinates:**	
Date Returned:		**Latitude Longitude:**	
Approval Date:	August 8, 2024	**Accuracy Estimate:**	
Cert Date:		**Measurement Method:**	
Cert Prop Use No:		**Mailing Address:**	
Curr Property Use:		**Telephone:**	
Intended Prop Use:		**Fax:**	
Restoration Type:		**Email:**	
Soil Type:		**Postal Code:**	K1P 1C8
Criteria:		**Ministry District:**	
Stratified (Y/N):		**MOE District:**	Ottawa
Audit (Y/N):		**SWP Area Name:**	Rideau Valley
Entire Leg Prop. (Y/N):		**Qual Person Name:**	Karyn Munch
CPU Issu Sect 1686:		**Consultant:**	

Business Name:	OTT A360 LAURIER INC.
Address:	360 Laurier AVE W
Legal Desc:	
Site Pin:	04114-0048 (LT)
Asmt Roll No:	
Project Type:	RSC based on Phase One and Two ESAs
Approval Type:	RSC-RSC based on Phase One and Two ESAs
Applicable Standards:	
PDF Link:	https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=3605420

---

147 **1 of 1** **W/248.2** **76.9 / -0.93**

PRIVATE OWNER
280 GLOUCESTER ST(ST. PATRICK CHURCH)
STORAGE TANK/BARREL
OTTAWA CITY ON K1R 5E4

SPL

Ref No:	100318	**Municipality No:**	20101
Year:		**Nature of Damage:**	
Incident Dt:	5/25/1994	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	5/25/1994	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	DEWAN FUELS
Site No:			
MOE Response:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: OTHER CONTAINER LEAK
Incident Preceding Spill:
Incident Reason: MATERIAL FAILURE
Incident Summary: ST.PATRICK CHURCH: UKN A-MOUNT OF FURNACE OIL TO SOIL
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

148	***1 of 1***	***S/248.2***	***77.9 / 0.07***	***2732685 Ontario Inc.*** ***429 MacLaren Street*** ***Ottawa ON K2P 0M7***	***GEN***

Generator Info

Generator No: ON9573081
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 261 L

Waste Class Name: PHARMACEUTICALS

Waste Detail(s)

Waste Class: 312 P
Waste Class Name: PATHOLOGICAL WASTES

---

149 | **1 of 1** | **E/248.4** | **75.9 / -1.93** | **KEN RALPH**
231 O'CONNOR ST,,OTTAWA,ON,K2P 1T8,CA
ON | **PINC**

Incident Id:
Incident No: 1602812
Incident Reported Dt: 3/24/2015
Type: FS-Pipeline Incident
Status Code:
Tank Status: Pipeline Damage Reason Est
Task No:
Spills Action Centre:
Fuel Type:
Fuel Occurrence Tp:
Date of Occurrence:
Occurrence Start Dt:
Depth:
Customer Acct Name: KEN RALPH
Incident Address: 231 O'CONNOR ST,,OTTAWA,ON,K2P 1T8,CA
Operation Type:
Pipeline Type:
Regulator Type:
Summary:
Reported By:
Affiliation:
Occurrence Desc:
Damage Reason:
Notes:

Pipe Material:
Fuel Category:
Health Impact:
Environment Impact:
Property Damage:
Service Interrupt:
Enforce Policy:
Public Relation:
Pipeline System:
PSIG:
Attribute Category:
Regulator Location:
Method Details:

---

150 | **1 of 2** | **SW/248.5** | **78.9 / 1.07** | **447 Somerset Street West**
Ottawa ON K1R 5J7 | **EHS**

Order No: 21102700721
Status: C
Report Type: Standard Report
Report Date: 01-NOV-21
Date Received: 27-OCT-21
Previous Site Name:
Lot/Building Size:
Additional Info Ordered: Fire Insur. Maps and/or Site Plans

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.699105
Y: 45.4144756

---

150 | **2 of 2** | **SW/248.5** | **78.9 / 1.07** | **447 Somerset Street West Ottawa ON**
Ottawa ON K1R 5J7 | **EHS**

Order No: 24061000493
Status: C
Report Type: Standard Report
Report Date: 13-JUN-24
Date Received: 10-JUN-24
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): .25
X: -75.699105
Y: 45.4144756

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
151	1 of 2	SE/248.9	76.9 / -0.93	384 MacLaren Street, Ottawa ON	INC

Incident No:	710966	**Any Health Impact:**	No
Incident ID:	2867936	**Any Enviro Impact:**	No
Instance No:		**Service Intrp:**	Yes
Status Code:	Causal Analysis Complete	**Was Prop Damaged:**	Yes
Incident Status:		**Reside App. Type:**	
Incident Severity:		**Commer App. Type:**	
Task No:	3664254	**Indus App. Type:**	
Attribute Category:	FS-Perform L1 Incident Insp	**Institut App. Type:**	
Context:		**Depth Ground Cover:**	N/A
Date of Occurrence:	2012/01/03 00:00:00	**Operation Pressure:**	65
Time of Occurrence:	01:49:00	**Equipment Type:**	
Occr Insp Start Dt:	2012/01/03 00:00:00	**Equipment Model:**	
Incident Creat On:		**Serial No:**	
Instance Creat Dt:		**Cylinder Capacity:**	
Instance Install Dt:		**Cylinder Cap Units:**	
Approx Quant Rel:		**Cylinder Mat Type:**	
Tank Capacity:		**Pump Flow Rate Cap:**	
Fuels Occur Type:	Vapour Release	**Contam. Migrated:**	
Occur Type Rpt:		**Near Body of Water:**	
Occur Category:		**Drainage System:**	
Fuel Type Involved:	Natural Gas	**Sub Surface Contam:**	
Fuel Type Reported:		**Tank Material Type:**	
Enforcement Policy:	NULL	**Tank Storage Type:**	
Prc Escalation Req:	NULL	**Tank Location Type:**	
Item:			
Item Description:			
Device Installed Location:			
Venting Type:			
Vent Conn Mater:			
Vent Chimney Mater:			
Pipeline Type:	Service / Riser Distribution Pipeline		
Pipeline Involved:			
Pipe Material:	Steel		
Regulator Location:	Outside		
Regulator Type:	Service Regulator (up to 60 psi intake)		
Liquid Prop Make:			
Liquid Prop Model:			
Liquid Prop Serial No:			
Liquid Prop Notes:			
Inventory Address:	384 MacLaren Street, Ottawa - Vapour Release		
Invent Postal Code:			
Notes:			
Contact Natural Env:			
Aff Prop Use Water:			
Occurence Narrative:	Sidewalk machine struck meter set, snapping off steel riser at ground level.		
Operation Type Involved:	Commercial (e.g. restaurant, business unit, etc)		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
151	2 of 2	SE/248.9	76.9 / -0.93	Enbridge Gas Distribution Inc. 384 MacLaren St Ottawa ON K2P 0M8	SPL

Ref No:	2456-8Q6D6F	**Municipality No:**	
Year:		**Nature of Damage:**	
Incident Dt:	03-JAN-12	**Discharger Report:**	
Dt MOE Arvl on Scn:		**Material Group:**	
MOE Reported Dt:	03-JAN-12	**Impact to Health:**	
Dt Document Closed:		**Agency Involved:**	
Site No:			
MOE Response:	Referral to others		
Site County/District:			

Site Geo Ref Meth:	
Site District Office:	
Nearest Watercourse:	
Site Name:	384 MacLaren St<UNOFFICIAL>
Site Address:	384 MacLaren St
Site Region:	
Site Municipality:	Ottawa
Site Lot:	
Site Conc:	
Site Geo Ref Accu:	
Site Map Datum:	
Northing:	
Easting:	
Entity Operating Name:	
Client Name:	Enbridge Gas Distribution Inc.
Client Type:	
Source Type:	
Incident Cause:	Discharge or Emission to Air
Incident Preceding Spill:	
Incident Reason:	Equipment/Vehicles
Incident Summary:	TSSA: 1/2 Inch Line Strike, made safe
Environment Impact:	Not Anticipated
Health Env Consequence:	
Nature of Impact:	
Contaminant Qty:	
Contaminant Qty 1:	
Contaminant Unit:	
Contaminant Code:	35
Contaminant Name:	NATURAL GAS (METHANE)
Contaminant Limit 1:	
Contam Limit Freq 1:	
Contaminant UN No 1:	
Receiving Medium:	Sewage - Municipal/Private and Commercial
Activity Preceding Spill:	
Property 2nd Watershed:	
Property Tertiary Watershed:	
Sector Type:	Pipeline
SAC Action Class:	TSSA - Fuel Safety Branch
Call Report Locatn Geodata:	
Time Reported:	
System Facility Address:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
152	1 of 1	SE/249.4	76.9 / -0.93	**Soundmaster Ltd.** **386 MacLaren St** **Ottawa ON K2P 0M8**	SCT

Established:	01-OCT-47
Plant Size (ft²):	2000
Employment:	

--Details--

Description:	Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing
SIC/NAICS Code:	334220
Description:	Semiconductor and Other Electronic Component Manufacturing
SIC/NAICS Code:	334410
Description:	Audio and Video Equipment Manufacturing
SIC/NAICS Code:	334310
Description:	Audio and Video Equipment Manufacturing
SIC/NAICS Code:	334310

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Unplottable Summary

Total: 95 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	City of Ottawa	Somerset St W	Ottawa ON	
CA	THE DOUGLAS MACDONALD DEV. CORP.	COMMERCIAL PLAZA BANK STREET	OTTAWA CITY ON	
CA	MINISTRY OF TRANSPORTATION	HIGHWAY #31, LAT. CATCHBASINS	OTTAWA CITY ON	
CA	OTTAWA CITY	COOPER ST.	OTTAWA CITY ON	
CA	MACDONALD DEVELOPMENT CORP.	BANK ST.	OTTAWA CITY ON	
CA	MACDONALD DEVELOPMENT CORP.-PLAZA	EASEMENT-BANK STREET	OTTAWA CITY ON	
CA	OTTAWA CITY	GLOUCESTER STREET	OTTAWA CITY ON	
CA	OTTAWA CITY	NEPEAN STREET	OTTAWA CITY ON	
CA	OSSORY CANADA INC.	PRIVATE BLDG. BANK ST.	OTTAWA CITY ON	
CA	R.M. OF OTTAWA-CARLETON	SOMERSET STREET	OTTAWA CITY ON	
CA	City of Ottawa	Somerset St W	Ottawa ON	
CA	The Filmore Inc.	Nepean Street	Ottawa ON	
CA	South Nepean Development Corporation		Ottawa ON	
CA	Urbandale Corporation		Ottawa ON	
CA	South Nepean Development Corporation		Ottawa ON	
CA	Urbandale Corporation		Ottawa ON	
CA	Claridge Homes (Church St.) Inc.		Ottawa ON	
CA	Claridge Homes (Cooper St) Inc.		Ottawa ON	

CA	R.M. OF OTTAWA-CARLETON	GLOUCESTER ST.	OTTAWA CITY ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	City of Ottawa	Bank St Bank Street from Somerset Street to Catherine Street	Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Tartan Land Corporation and 1503916 Ontario Limited		Ottawa ON
CA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON
CA	South Nepean Development Corporation		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	South Nepean Development Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Urbandale Corporation		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	Taggart Construction Limited	Mobile Facility	Ottawa ON
CA	Taggart Residential Developments Ltd.		Ottawa ON
CA	R.M. OF OTTAWA-CARLETON	MACLAREN ST/BANK ST/CARTIER ST	OTTAWA CITY ON

CA	OTTAWA CITY	MACLAREN ST. COMBINED SEWERS	OTTAWA CITY ON	
CA	OTTAWA CITY	GLOUCESTER ST./NEPEAN ST.	OTTAWA CITY ON	
CA	CITY OF OTTAWA - GLOUCESTER ST.	GLOUCESTER/LYON/BANK STS.	OTTAWA CITY ON	
CONV	Loblaw Companies Limited		Ottawa ON	
CONV	SHELL CANADA PRODUCTS LIMITED		DON MILLS ON	
CONV	Taggart Construction Limited		Ottawa ON	
CONV	Taggart Construction Limited	Bank Street	South Ottawa ON	
DTNK	UPI ENERGY LP*	HWY 31	OTTAWA ON	
DTNK	W O STINSON & SON LTD*	HWY 31	OTTAWA ON	
EBR	Taggart Construction Limited	Mobile Facility Ottawa Ontario Ottawa	ON	
ECA	The Bell Telephone Company of Canada or Bell Canada	Multiple Sites Across Ontario	Ottawa ON	H3B 2M8
ECA	South Nepean Development Corporation		Ottawa ON	K1P 0B6
ECA	Taggart Commercial Developments Ltd.		Ottawa ON	K2P 1P9
ECA	City of Ottawa	Somerset St W	Ottawa ON	K1P 1J1
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Taggart Construction Limited	Mobile Facility	Ottawa ON	K1V 8Y3
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	Taggart Aggregates Ltd.		Ottawa ON	K1V 8Y3
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON	K1P 1J1
ECA	City of Ottawa	Bank St	Ottawa ON	K2H 5E3

ECA	The Bell Telephone Company of Canada or Bell Canada	Multiple Sites Across Ontario	Ottawa ON	H3B 2M8
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	Taggart Aggregates Ltd.	Mobile Facility	Ottawa ON	K1V 8Y3
ECA	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9
ECA	South Nepean Development Corporation		Ottawa ON	K1P 0B6
ECA	Urbandale Corporation		Ottawa ON	K1G 2H5
ECA	City of Ottawa	Bank St from Laurier Avenue to Somerest Street	Ottawa ON	K1P 1J1
ECA	The Filmore Inc.	Nepean Street	Ottawa ON	K2A 0E7
EHS		Bank St	Ottawa ON	
EHS		Bank St	Ottawa ON	
GEN	Hydro Ottawa Ltd.	Bank St	Ottawa ON	
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	Department of National Defence		Ottawa ON	
OOGW	Ottawa Dairy Well		ON	
PRT	NAZIMA MEDEWAR	HWY 31	OTTAWA ON	
SPL	QUEENSWAY TANK LINES	CANADIAN TIRE GAS BAR BANK STREET TANK TRUCK (CARGO)	OTTAWA CITY ON	
SPL	LOBLAWS		OTTAWA CITY ON	
SPL	PIONEER PETROLEUMS LTD.	BANK STREET SOUTH PIONEER GAS STATION. SERVICE STATION	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	BANK STREET SERVICE STATION	OTTAWA CITY ON	
SPL	OTTAWA-CARLETON, R.M. OF	KENT ST REGULATOR TO OTTAWA RIVER ON N.R.C. PROPERTY SANITARY SEWER SYSTEM	OTTAWA CITY ON	

SPL	OC TRANSPO	BANK ST. SOUTH MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	Shell Canada Products Limited	Shell Canada	Ottawa ON	
SPL	Loblaw Properties Limited	Loblaws	Ottawa ON	
SPL	City of Ottawa	between O'Connor St & Bank St	Ottawa ON	
SPL	OLRT Constructors	Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean	Ottawa ON	
SPL	Bell Canada		Ottawa ON	
SPL		Kent Street near Bank Street	Ottawa ON	
SPL	Taggart Aggregates Ltd.		Ottawa ON	
SPL	Taggart Construction Limited		Ottawa ON	
WDS	Taggart Miller Environmental Services Inc.		Ottawa ON	K2P 1P9

Unplottable Report

Site: ***City of Ottawa***
Somerset St W Ottawa ON

Database: ***CA***

Certificate #:	6180-8JKNNV
Application Year:	2011
Issue Date:	7/22/2011
Approval Type:	Municipal and Private Sewage Works
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

Site: ***THE DOUGLAS MACDONALD DEV. CORP.***
COMMERCIAL PLAZA BANK STREET OTTAWA CITY ON

Database: ***CA***

Certificate #:	7-1304-86-
Application Year:	86
Issue Date:	10/28/1986
Approval Type:	Municipal water
Status:	Approved
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

Site: ***MINISTRY OF TRANSPORTATION***
HIGHWAY #31, LAT. CATCHBASINS OTTAWA CITY ON

Database: ***CA***

Certificate #:	3-1342-93-
Application Year:	93
Issue Date:	12/31/1993
Approval Type:	Municipal sewage
Status:	Preliminary approval
Application Type:	
Client Name:	
Client Address:	
Client City:	
Client Postal Code:	
Project Description:	
Contaminants:	
Emission Control:	

Site: ***OTTAWA CITY***
COOPER ST. OTTAWA CITY ON

Database: ***CA***

Certificate #:	3-1897-88-
Application Year:	88

Issue Date: 10/14/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***MACDONALD DEVELOPMENT CORP.***
BANK ST. OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-1072-88-
Application Year: 88
Issue Date: 9/28/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***MACDONALD DEVELOPMENT CORP.-PLAZA***
EASEMENT-BANK STREET OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-1864-86-
Application Year: 86
Issue Date: 12/19/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***OTTAWA CITY***
GLOUCESTER STREET OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-0827-86-
Application Year: 86
Issue Date: 7/2/1986
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***OTTAWA CITY***
NEPEAN STREET OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-0887-87-
Application Year: 87
Issue Date: 6/15/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***OSSORY CANADA INC.***
PRIVATE BLDG. BANK ST. OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-0515-87-
Application Year: 87
Issue Date: 4/23/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***R.M. OF OTTAWA-CARLETON***
SOMERSET STREET OTTAWA CITY ON

Database: ***CA***

Certificate #: 7-0096-88-
Application Year: 88
Issue Date: 2/10/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***City of Ottawa***
Somerset St W Ottawa ON

Database: ***CA***

Certificate #: 0195-8HMLH2
Application Year: 2011
Issue Date: 6/15/2011
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: ***The Filmore Inc.***
Nepean Street Ottawa ON

Database: ***CA***

Certificate #: 9532-62ULPC
Application Year: 2004
Issue Date: 7/14/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***South Nepean Development Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 9472-823Q7E
Application Year: 2010
Issue Date: 1/29/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 8787-5YQRUU
Application Year: 2004
Issue Date: 5/10/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***South Nepean Development Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 8529-72CKGR
Application Year: 2007
Issue Date: 5/7/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 8145-7TYK8L
Application Year: 2009
Issue Date: 7/17/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Claridge Homes (Church St.) Inc.***
Ottawa ON

Database: ***CA***

Certificate #: 7739-5NWLL5
Application Year: 2003
Issue Date: 6/27/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Claridge Homes (Cooper St) Inc.***
Ottawa ON

Database: ***CA***

Certificate #: 7666-5SKKLX
Application Year: 2003
Issue Date: 10/23/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***R.M. OF OTTAWA-CARLETON***
GLOUCESTER ST. OTTAWA CITY ON

Database: ***CA***

Certificate #: 7-0911-88-

Application Year: 88
Issue Date: 7/7/1988
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Residential Developments Ltd.***
Ottawa ON

Database: ***CA***

Certificate #: 7167-6SJU4P
Application Year: 2006
Issue Date: 8/17/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***City of Ottawa***
Bank St Bank Street from Somerset Street to Catherine Street Ottawa ON

Database: ***CA***

Certificate #: 7054-7L4LKY
Application Year: 2008
Issue Date: 11/28/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 6829-6Y7RQX
Application Year: 2007
Issue Date: 2/19/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 5942-6BWPUR
Application Year: 2005
Issue Date: 5/3/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Tartan Land Corporation and 1503916 Ontario Limited***
Ottawa ON

Database: ***CA***

Certificate #: 5203-6DCNQK
Application Year: 2005
Issue Date: 6/16/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***City of Ottawa***
Bank St from Laurier Avenue to Somerest Street Ottawa ON

Database: ***CA***

Certificate #: 4804-7DGNT6
Application Year: 2008
Issue Date: 4/8/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***South Nepean Development Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 4639-6ZBK9E
Application Year: 2007
Issue Date: 3/25/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:

Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Residential Developments Ltd.***
Ottawa ON

Database: ***CA***

Certificate #: 4595-77ZKND
Application Year: 2007
Issue Date: 10/15/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***South Nepean Development Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 4449-7XVU9J
Application Year: 2009
Issue Date: 11/18/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 3681-7QWNXY
Application Year: 2009
Issue Date: 4/9/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 2869-6KVTJC
Application Year: 2006
Issue Date: 1/12/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved

Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 2169-5WVM7Y
Application Year: 2004
Issue Date: 3/12/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 2160-765JJX
Application Year: 2007
Issue Date: 8/16/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 1998-6Y7KJ9
Application Year: 2007
Issue Date: 2/12/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 1830-6H3P2S
Application Year: 2005
Issue Date: 10/14/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 1712-6N6RR7
Application Year: 2006
Issue Date: 3/27/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Urbandale Corporation***
Ottawa ON

Database: ***CA***

Certificate #: 1130-6BLHGE
Application Year: 2005
Issue Date: 4/21/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Residential Developments Ltd.***
Ottawa ON

Database: ***CA***

Certificate #: 1090-89DRC4
Application Year: 2010
Issue Date: 9/23/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Residential Developments Ltd.***
Ottawa ON

Database: ***CA***

Certificate #: 1047-6MPLMW
Application Year: 2006
Issue Date: 3/24/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Construction Limited***
Mobile Facility Ottawa ON

Database: ***CA***

Certificate #: 0636-7KEL2F
Application Year: 2008
Issue Date: 11/19/2008
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Taggart Residential Developments Ltd.***
Ottawa ON

Database: ***CA***

Certificate #: 0092-6MUKH2
Application Year: 2006
Issue Date: 3/13/2006
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***R.M. OF OTTAWA-CARLETON***
MACLAREN ST/BANK ST/CARTIER ST OTTAWA CITY ON

Database: ***CA***

Certificate #: 7-0590-97-
Application Year: 97
Issue Date: 7/7/1997
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:

Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***OTTAWA CITY***
MACLAREN ST. COMBINED SEWERS OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-0270-97-
Application Year: 97
Issue Date: 5/7/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***OTTAWA CITY***
GLOUCESTER ST./NEPEAN ST. OTTAWA CITY ON

Database: ***CA***

Certificate #: 3-0550-94-
Application Year: 94
Issue Date: 5/27/1994
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***CITY OF OTTAWA - GLOUCESTER ST.***
GLOUCESTER/LYON/BANK STS. OTTAWA CITY ON

Database: ***CA***

Certificate #: 7-0091-90-
Application Year: 90
Issue Date: 2/16/1990
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: ***Loblaw Companies Limited***
Ottawa ON

Database: ***CONV***

File No: 097267
Crown Brief No:
Court Location:
Publication City:
Location:
Region:
Ministry District:

Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: On April 19, 2011, Loblaw Companies Limited/Les Compagnies Loblaw Limitee pleaded guilty to one violation under the Environmental Protection Act for causing the discharge of a refrigerant into the air within a building or into the natural environment. The Court heard that the company owns and operates a property in Ottawa. The company uses a refrigeration contractor to install, maintain and service the equipment at this location. During such work, a release of refrigerant was reported to the ministry. The release was inside a building that was vented via exhaust fans to the natural environment. The refrigerant contains hydrochlorofluorocarbon and is considered an ozone depleting substance. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch. The company was fined $30,000 plus a victim fine surcharge and was given 30 days to pay the fine.
Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section:
Act/Regulation/Section: EPA
Date of Offence:
Date of Conviction:
Date Charged: April 19, 2011
Charge Disposition: fine, victim fine surcharge
Fine: $30,000
Synopsis:

Site: ***SHELL CANADA PRODUCTS LIMITED***
DON MILLS ON

Database: ***CONV***

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGING A CONTAMINANT - ADVERSE EFFECT
Background:
URL:

Location:
Region: SOUTH EAST REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 13(1)
Act/Regulation/Section: EPA- -13(1)
Date of Offence:
Date of Conviction:
Date Charged: 92/05/12
Charge Disposition:
Fine: 90000
Synopsis:

Site: ***Taggart Construction Limited***
Ottawa ON

Database: ***CONV***

File No: 012802
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Location:
Region:
Ministry District:

Description: Taggart Construction Limited, Paterson Group Inc. and Robert Passmore have been fined $5,000 each, totalling $15,000 plus a victim fine surcharge, after pleading guilty on January 15, 2009 to violations under the Ontario Water Resources Act. Taggart Construction Limited and Paterson Group Inc. were convicted of failing to comply with a Provincial Officer Order by taking more than 50,000 litres of water per day, and Mr. Passmore was convicted of giving false or misleading information to the ministry. The parties were given six months to pay the fine. The Court heard that Taggart Construction Limited was contracted by a developer to install municipal services at a subdivision in Ottawa which required dewatering activities. After being issued a Provincial Officer Order to restrict water taking activities to below 50,000 litres per day until a permit had been obtained, Taggart hired Paterson Group Inc. to submit an application for the permit. Taggart then pumped over 50,000 litres of water based on information provided by Paterson Group employee, Mr. Passmore, that the go ahead to pump had been given when a permit had yet to be issued. In an interview with ministry investigators, Mr. Passmore denied giving Taggart verbal approval to pump in excess of 50,000 litres per day. Taggart Construction Limited, Paterson Group Inc. and Mr. Passmore were charged following an investigation by the Ministry of the Environment's Investigations and Enforcement Branch.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section:
Act/Regulation/Section: OWRA
Date of Offence:
Date of Conviction:
Date Charged: January 15, 2009
Charge Disposition: fine, victim fine surcharge
Fine: $5,000
Synopsis:

Site: ***Taggart Construction Limited***
Bank Street South Ottawa ON

Database: ***CONV***

File No: 010503
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Location:
Region:
Ministry District:

Description: On December 3, 2009, Taggart Construction Limited pleaded guilty to one violation under the Ontario Water Resources Act for failing to comply with a Provincial Officer Order to submit weekly water taking records showing daily water taking volumes. The company was contracted to install municipal services for the Findlay Creek Subdivision located on Bank Street in South Ottawa. A ministry inspection of the construction site in the fall of 2007 revealed concerns with water taking activities and a Provincial Officer Order was issued. One of the requirements

of the Order, related to keeping accurate water taking records and submitting them to the ministry, was not complied with. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch and was fined $5,000 plus victim fine surcharge. The company was given 30 days to pay the fine.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: Provincial Officer Order
Regulation:
Section:
Act/Regulation/Section: Provincial Officer Order
Date of Offence:
Date of Conviction:
Date Charged: December 3, 2009
Charge Disposition: fine, victim fine surcharge
Fine: $5,000
Synopsis:

Site: ***UPI ENERGY LP****
HWY 31 OTTAWA ON

Database: ***DTNK***

Delisted Expired Fuel Safety Facilities

Instance No: 10454099
Status: EXPIRED
Instance ID: 18935
Instance Type: FS Highway Tank - Gas/Diesel
Instance Creation Dt:
Instance Install Dt:
Item Description:
Manufacturer:
Model:
Serial No:
ULC Standard:
Quantity:
Unit of Measure:
Overfill Prot Type:
Creation Date:
Next Periodic Str DT:
TSSA Base Sched Cycle 2:
TSSAMax Hazard Rank 1:
TSSA Risk Based Periodic Yn:
TSSA Volume of Directives:
TSSA Periodic Exempt:
TSSA Statutory Interval:
TSSA Recd Insp Interva:
TSSA Recd Tolerance:
TSSA Program Area:
TSSA Program Area 2:
Description: FS HIGHWAY TANK - GASOLINE/DIESEL
Original Source: EXP
Record Date: Up to Mar 2012

Expired Date:
Max Hazard Rank:
Facility Location:
Facility Type:
Fuel Type 2:
Fuel Type 3:
Panam Related:
Panam Venue Nm:
External Identifier:
Item:
Piping Steel:
Piping Galvanized:
Tank Single Wall St:
Piping Underground:
Tank Underground:
Source:

Site: ***W O STINSON & SON LTD****
HWY 31 OTTAWA ON

Database: ***DTNK***

Delisted Expired Fuel Safety Facilities

Instance No:	10449391	***Expired Date:***	
Status:	EXPIRED	***Max Hazard Rank:***	
Instance ID:	18397	***Facility Location:***	
Instance Type:	FS Highway Tank - Gas/Diesel	***Facility Type:***	
Instance Creation Dt:		***Fuel Type 2:***	
Instance Install Dt:		***Fuel Type 3:***	
Item Description:		***Panam Related:***	
Manufacturer:		***Panam Venue Nm:***	
Model:		***External Identifier:***	
Serial No:		***Item:***	
ULC Standard:		***Piping Steel:***	
Quantity:		***Piping Galvanized:***	
Unit of Measure:		***Tank Single Wall St:***	
Overfill Prot Type:		***Piping Underground:***	
Creation Date:		***Tank Underground:***	
Next Periodic Str DT:		***Source:***	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS HIGHWAY TANK - GASOLINE/DIESEL		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

Site: ***Taggart Construction Limited***
Mobile Facility Ottawa Ontario Ottawa ON

Database: ***EBR***

EBR Registry No:	IA07E0165	***Decision Posted:***	
Ministry Ref No:	8556-6XWUA3	***Exception Posted:***	
Notice Type:	Instrument Decision	***Section:***	
Notice Stage:		***Act 1:***	
Notice Date:	December 09, 2008	***Act 2:***	
Proposal Date:	January 30, 2007	***Site Location Map:***	
Year:	2007		
Instrument Type:	(EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)		
Off Instrument Name:			
Posted By:			
Company Name:	Taggart Construction Limited		
Site Address:			
Location Other:			
Proponent Name:			
Proponent Address:	3187 Albion Rd S, Ottawa Ontario, K1V 8Y3		
Comment Period:			
URL:			
Summary:			

Site Location Details:

Mobile Facility Ottawa Ontario Ottawa

Site: ***The Bell Telephone Company of Canada or Bell Canada***
Multiple Sites Across Ontario Ottawa ON H3B 2M8

Database: ***ECA***

Approval No:	6207-CZZPLF	***MOE District:***	North Bay
Approval Date:	July 31, 2024	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	-9016878.7543000001
SWP Area Name:		***Geometry Y:***	5700582.7322999965
Approval Type:	ECA-AIR		
Project Type:	AIR		

Business Name: The Bell Telephone Company of Canada or Bell Canada
Address: Multiple Sites Across Ontario
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/4515-CV9N3P-14.pdf
PDF Site Location: Multiple Sites Across Ontario

Site: ***South Nepean Development Corporation*** ***Database:*** ***ECA***
Ottawa ON K1P 0B6

Approval No: 4449-7XVU9J
Approval Date: 2009-11-18
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: South Nepean Development Corporation
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3074-7XRQV2-14.pdf
PDF Site Location:

Site: ***Taggart Commercial Developments Ltd.*** ***Database:*** ***ECA***
Ottawa ON K2P 1P9

Approval No: 7279-9A3ND2
Approval Date: 2013-07-31
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Taggart Commercial Developments Ltd.
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8903-99ELG5-14.pdf
PDF Site Location:

Site: ***City of Ottawa*** ***Database:*** ***ECA***
Somerset St W Ottawa ON K1P 1J1

Approval No: 0195-8HMLH2
Approval Date: 2011-06-15
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Somerset St W
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3106-8HFGKN-14.pdf
PDF Site Location:

Site: ***Urbandale Corporation*** ***Database:*** ***ECA***
Ottawa ON K1G 2H5

Approval No: 4781-4ZEKPM
Approval Date: 2001-08-21
Status: Approved
MOE District:
City:
Longitude:

Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1402-4Z2HBD-14.pdf
PDF Site Location:
Latitude:
Geometry X:
Geometry Y:

Site: ***Urbandale Corporation***
Ottawa ON K1G 2H5

Database: ***ECA***

Approval No: 8787-5YQRUU
Approval Date: 2004-05-10
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3747-5YPLC8-14.pdf
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***Taggart Construction Limited***
Mobile Facility Ottawa ON K1V 8Y3

Database: ***ECA***

Approval No: 0636-7KEL2F
Approval Date: 2008-11-19
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Construction Limited
Address: Mobile Facility
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8556-6XWUA3-14.pdf
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***Urbandale Corporation***
Ottawa ON K1G 2H5

Database: ***ECA***

Approval No: 1830-6H3P2S
Approval Date: 2005-10-14
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/9122-6F6R74-14.pdf
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***Taggart Aggregates Ltd.***

Database: ***ECA***

Ottawa ON K1V 8Y3

Approval No:	3704-CEYLJQ	***MOE District:***	Ottawa
Approval Date:	August 7, 2022	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	-8458534.5194000006
SWP Area Name:	Rideau Valley	***Geometry Y:***	5654574.0473000035
Approval Type:	ECA-AIR		
Project Type:	AIR		
Business Name:	Taggart Aggregates Ltd.		
Address:			
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/0325-C63K3A-13.pdf		
PDF Site Location:	Portable Crushing Plant in Fernbank Quarry Lot Lots 13 and 14, Concession 10 Ottawa City, Ontario		

Site: ***Taggart Miller Environmental Services Inc.***
Ottawa ON K2P 1P9

Database: ***ECA***

Approval No:	0376-CZBQFJ	***MOE District:***	North Bay
Approval Date:	January 22, 2024	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	-9016878.7543000001
SWP Area Name:		***Geometry Y:***	5700582.7322999965
Approval Type:	ECA-INDUSTRIAL SEWAGE WORKS		
Project Type:	INDUSTRIAL SEWAGE WORKS		
Business Name:	Taggart Miller Environmental Services Inc.		
Address:			
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/5267-CWNM4G-14.pdf		
PDF Site Location:	Capital Region Resource Recovery Centre Lot 22-25, Concession XI Ottawa City,		

Site: ***City of Ottawa***
Bank St from Laurier Avenue to Somerest Street Ottawa ON K1P 1J1

Database: ***ECA***

Approval No:	4804-7DGNT6	***MOE District:***	
Approval Date:	2008-04-08	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	
SWP Area Name:		***Geometry Y:***	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS		
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS		
Business Name:	City of Ottawa		
Address:	Bank St from Laurier Avenue to Somerest Street		
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/2768-7DDL4E-14.pdf		
PDF Site Location:			

Site: ***City of Ottawa***
Bank St Ottawa ON K2H 5E3

Database: ***ECA***

Approval No:	0699-D49N2H	***MOE District:***	Ottawa
Approval Date:	April 18, 2024	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	-8415176.869
SWP Area Name:	South Nation	***Geometry Y:***	5672372.244
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS		
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS		

Business Name: City of Ottawa
Address: Bank St
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/2206-D3QL9H-14.pdf
PDF Site Location: Bank Street
City of Ottawa, Ontario

Site: ***The Bell Telephone Company of Canada or Bell Canada***
Multiple Sites Across Ontario Ottawa ON H3B 2M8

Database: ***ECA***

Approval No: 1529-B8QPS5
Approval Date: 2019-12-11
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: The Bell Telephone Company of Canada or Bell Canada
Address: Multiple Sites Across Ontario
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/9060-AW6T5N-14.pdf
PDF Site Location:

Site: ***Taggart Miller Environmental Services Inc.***
Ottawa ON K2P 1P9

Database: ***ECA***

Approval No: 2172-BAGR2C
Approval Date: 2019-10-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Miller Environmental Services Inc.
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/0412-AW7KNR-14.pdf
PDF Site Location:

Site: ***Taggart Aggregates Ltd.***
Mobile Facility Ottawa ON K1V 8Y3

Database: ***ECA***

Approval No: 2795-BB6LGF
Approval Date: 2019-09-03
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Taggart Aggregates Ltd.
Address: Mobile Facility
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1998-B6BKSQ-14.pdf
PDF Site Location:

Site: ***Taggart Miller Environmental Services Inc.***
Ottawa ON K2P 1P9

Database: ***ECA***

Approval No: 4742-B3ULFF
Approval Date: 2019-03-07
Status: Approved
MOE District:
City:
Longitude:

Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Taggart Miller Environmental Services Inc.
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/9364-AW7KFR-13.pdf
PDF Site Location:
Latitude:
Geometry X:
Geometry Y:

Site: ***South Nepean Development Corporation***
Ottawa ON K1P 0B6

Database: ***ECA***

Approval No: 9472-823Q7E
Approval Date: 2010-01-29
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: South Nepean Development Corporation
Address:
Full Address:
Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1781-7YHPPP-14.pdf
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***Urbandale Corporation***
Ottawa ON K1G 2H5

Database: ***ECA***

Approval No: 0666-5YQRZ3
Approval Date: 2004-05-10
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: Urbandale Corporation
Address:
Full Address:
Full PDF Link:
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***City of Ottawa***
Bank St from Laurier Avenue to Somerest Street Ottawa ON K1P 1J1

Database: ***ECA***

Approval No: 8654-7DGNMN
Approval Date: 2008-04-08
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: City of Ottawa
Address: Bank St from Laurier Avenue to Somerest Street
Full Address:
Full PDF Link:
PDF Site Location:
MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: ***The Filmore Inc.***

Database: ***ECA***

Nepean Street Ottawa ON K2A 0E7

Approval No:	9532-62ULPC	***MOE District:***	
Approval Date:	2004-07-14	***City:***	
Status:	Approved	***Longitude:***	
Record Type:	ECA	***Latitude:***	
Link Source:	IDS	***Geometry X:***	
SWP Area Name:		***Geometry Y:***	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS		
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS		
Business Name:	The Filmore Inc.		
Address:	Nepean Street		
Full Address:			
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/4647-5ZMJ4E-14.pdf		
PDF Site Location:			

Site: ***Database:*** ***EHS***

Bank St Ottawa ON

Order No:	20031121005	***Nearest Intersection:***	See Faxed Map
Status:	C	***Municipality:***	
Report Type:	Basic Report	***Client Prov/State:***	ON
Report Date:	11/25/03	***Search Radius (km):***	0.50
Date Received:	11/21/03	***X:***	-75.654252
Previous Site Name:		***Y:***	45.363635
Lot/Building Size:			
Additional Info Ordered:			

Site: ***Database:*** ***EHS***

Bank St Ottawa ON

Order No:	20060427021	***Nearest Intersection:***	
Status:	C	***Municipality:***	
Report Type:	Custom Report	***Client Prov/State:***	ON
Report Date:	5/5/2006	***Search Radius (km):***	0.25
Date Received:	4/26/2006	***X:***	-75.670288
Previous Site Name:		***Y:***	45.364953
Lot/Building Size:			
Additional Info Ordered:			

Site: ***Hydro Ottawa Ltd.*** ***Database:*** ***GEN***

Bank St Ottawa ON

Generator Info

Generator No:	ON8798860	***Choice of Contact:***	
Approval Years:	03,04	***Contaminated Fac:***	
Status:		***MHSW Facility:***	
PO Box No:		***SIC Code:***	
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Site: ***DEPARTMENT OF NATIONAL DEFENCE*** ***Database:*** ***NPCB***

OTTAWA ON K1R 3J7

Company Code:	O3014PH
Industry:	NATIONAL DEFENCE
Site Status:	DELETED FEDERAL SITES
Transaction Date:	12/6/1997
Inspection Date:	

Site: ***DEPARTMENT OF NATIONAL DEFENCE***
OTTAWA ON K1R 3J7

Database: ***NPCB***

Company Code: O3009
Industry: NATIONAL DEFENCE
Site Status: FEDERAL FACILITIES (IN USE)
Transaction Date: 2/11/1993
Inspection Date:

Site: ***DEPARTMENT OF NATIONAL DEFENCE***
OTTAWA ON K1R 3J7

Database: ***NPCB***

Company Code: O3014
Industry: NATIONAL DEFENCE
Site Status: DELETED FEDERAL SITES
Transaction Date: 12/8/1998
Inspection Date: 1/21/1994

--Details--
Label: DO02600
Serial No.: 162825
PCB Type/Code: MINERAL OIL/ULTRA LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 68 L

Label: DO02599
Serial No.: 851123
PCB Type/Code: MINERAL OIL/LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 91 L

Site: ***Department of National Defence***
Ottawa ON

Database: ***NPCB***

Company Code: O3014
Industry: National Defence
Site Status: Stored for Disposal
Transaction Date: 1/21/1994
Inspection Date: 1/21/1994

--Details--
Label:
Serial No.:
PCB Type/Code: Mineral Oil/Low
Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Ultra Low
Location:

Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Site: ***Ottawa Dairy Well***
ON

Database: ***OOGW***

Licence No:	N000085	***Well Compl:***	21017
Well ID:	21285	***County:***	Ottawa/Carleton
Well Compl ID:	21017	***Block:***	
W Class ID:		***Lot:***	
UWI Code:	N000085	***Conc:***	
Permit Date:		***Surface Lat NAD83:***	
Depth(m):		***Surface Long NAD83:***	
Well Pool:		***Bottom Lat NAD83:***	
Completion Date:		***Bottom Long NAD83:***	
Depth Reached:		***Lot Sides (m):***	X
Capped Date:		***E/W (m):***	X
Class ID:		***Latitude Nad27:***	
DB Source:		***Longitude Nad27:***	
Status as of:	August 2024	***bottom lat27:***	
Start Date:		***bottom long27:***	
SPUD Date:		***Lateral:***	No
Class:		***Accuracy:***	
Grnd Elev:		***Method:***	
KB Elev:		***Parent:***	
TVD:		***Prod Top:***	
PBTD:		***Prod Bot:***	
TD Form:		***PROPD Depth:***	
Workover D:		***Location Method:***	
Operator:	Unknown	***Location Accuracy:***	Unknown
Township:		***Dt Obtained:***	
Target:		***Well Status Type:***	Location
Classification:		***Well Status Mode:***	Unknown

Well Name: Ottawa Dairy Well
Target Desc:
Status Type Desc: A LOCATION FOR WHICH MINISTRY RECORDS INDICATE A WELL HAS BEEN DRILLED BUT FOR WHICH NO STATUS INFORMATION IS AVAILABLE
Status Mode Desc: A WELL FOR WHICH THERE IS NO AVAILABLE INFORMATION ON MODE IN MINISTRY RECORDS
Classification Desc:
Cement Rec:
Comments:

Site: ***NAZIMA MEDEWAR***
HWY 31 OTTAWA ON

Database: ***PRT***

Location ID: 11082
Type: retail
Expiry Date: 1996-03-31
Capacity (L): 36368
Licence #: 0016234001

Site: ***QUEENSWAY TANK LINES***
CANADIAN TIRE GAS BAR BANK STREET TANK TRUCK (CARGO) OTTAWA CITY ON

Database: ***SPL***

Ref No:	41622	***Municipality No:***	20101
Year:		***Nature of Damage:***	
Incident Dt:	10/2/1990	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	10/2/1990	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	MCCR
Site No:			
MOE Response:			
Site County/District:			

Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: CONTAINER OVERFLOW
Incident Preceding Spill:
Incident Reason: ERROR
Incident Summary: QUEENSWAY TANK LINES: 4 LGASOLINE SPILLED AT GAS BAR
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***LOBLAWS***
OTTAWA CITY ON

Database: ***SPL***

Ref No: 49925
Year:
Incident Dt: 5/1/1991
Dt MOE Arvl on Scn:
MOE Reported Dt: 5/1/1991
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: OVERSTRESS/OVERPRESSURE
Incident Summary: LOBLAWS - HYDRAULIC OIL TO GROUND AND CATCHBASIN FROM BROKEN HOSE
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Water course or lake
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***PIONEER PETROLEUMS LTD.***
BANK STREET SOUTH PIONEER GAS STATION. SERVICE STATION OTTAWA CITY ON

Database: ***SPL***

Ref No: 137358
Year:
Incident Dt: 2/20/1997
Dt MOE Arvl on Scn:
MOE Reported Dt: 2/20/1997
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: CONTAINER OVERFLOW
Incident Preceding Spill:
Incident Reason: ERROR
Incident Summary: PIONEER PETROLEUMS-4L GASOLINE TO GROUND,UNSAFESPILL RESPONSE BY STAFF.
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***ESSO PETROLEUM CANADA***
BANK STREET SERVICE STATION OTTAWA CITY ON

Database: ***SPL***

Ref No: 147934
Year:
Incident Dt: 10/16/1997
Dt MOE Arvl on Scn:
MOE Reported Dt: 10/16/1997
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: DAMAGE BY MOVING EQUIPMENT
Incident Summary: ESSO SERVICE STATION: 40 L GASOLINE TO GROUND
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No: 20101
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Site: ***OTTAWA-CARLETON, R.M. OF***
KENT ST REGULATOR TO OTTAWA RIVER ON N.R.C. PROPERTY SANITARY SEWER SYSTEM OTTAWA CITY ON

Database: ***SPL***

Ref No:	153191	***Municipality No:***	20101
Year:		***Nature of Damage:***	
Incident Dt:	3/9/1998	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	3/10/1998	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Incident Reason:	STORM/FLOOD/WIND		
Incident Summary:	OTTAWA CARLETON R.M.- LEAK OF RAW UNCHLORINATED SEWAGE, PIPE CRACKED.		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: ***OC TRANSPO***
BANK ST. SOUTH MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database: ***SPL***

Ref No:	223917	***Municipality No:***	20107
Year:		***Nature of Damage:***	
Incident Dt:	4/11/2002	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	4/11/2002	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			

Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: UNKNOWN
Incident Summary: SPILL OF DIESEL FUEL TO GRND, CLEAN UP CREW ON THE WAY
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Shell Canada Products Limited***
Shell Canada Ottawa ON

Database: ***SPL***

Ref No: 6267-5M2K7H
Year:
Incident Dt: 4/28/2003
Dt MOE Arvl on Scn:
MOE Reported Dt: 4/28/2003
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: LOADING RACK 1<UNOFFICIAL>
Site Address:
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Shell Canada Products Limited

Municipality No:
Nature of Damage:
Discharger Report:
Material Group: Oil
Impact to Health:
Agency Involved:

Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Shell - 1L gasoline
Environment Impact: Possible
Health Env Consequence:
Nature of Impact: Other Impact(s)
Contaminant Qty: 1 L
Contaminant Qty 1:
Contaminant Unit: L
Contaminant Code: 12
Contaminant Name: GASOLINE
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Land
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class: Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Loblaw Properties Limited***
Loblaws Ottawa ON

Database: ***SPL***

Ref No: 2287-7FNKE6
Year:
Incident Dt:
Dt MOE Arvl on Scn:
MOE Reported Dt: 6/16/2008
Dt Document Closed: 9/8/2008
Site No:
Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:
MOE Response: No Field Response
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Loblaws
Site Address:
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing: NA
Easting: NA
Entity Operating Name:
Client Name: Loblaw Properties Limited
Client Type:
Source Type:
Incident Cause: Discharge or Emission to Air
Incident Preceding Spill:
Incident Reason: Equipment Failure - Malfunction of system components
Incident Summary: Loblaws, 625 lb of R22 released to atmosphere.
Environment Impact: Not Anticipated
Health Env Consequence:
Nature of Impact: Air Pollution
Contaminant Qty: 625 lb
Contaminant Qty 1: 625
Contaminant Unit: lb
Contaminant Code: 38
Contaminant Name: FREON R-22 (CFC)

Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***City of Ottawa***
between O'Connor St & Bank St Ottawa ON

Database: ***SPL***

Ref No: 8730-97QGQG
Year:
Incident Dt: 15-MAY-13
Dt MOE Arvl on Scn:
MOE Reported Dt: 15-MAY-13
Dt Document Closed:
Site No:
MOE Response: No Field Response
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: Albert Street<UNOFFICIAL>
Site Address: between O'Connor St & Bank St
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: City of Ottawa
Client Type:
Source Type:
Incident Cause: Leak/Break
Incident Preceding Spill:
Incident Reason: Equipment Failure
Incident Summary: OC Transpo Bus, 20 L coolant to c/b
Environment Impact: Not Anticipated
Health Env Consequence:
Nature of Impact: Surface Water Pollution
Contaminant Qty: 20 L
Contaminant Qty 1: 20
Contaminant Unit: L
Contaminant Code: 27
Contaminant Name: COOLANT N.O.S.
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Motor Vehicle
SAC Action Class: Watercourse Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Site: ***OLRT Constructors***
Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean
Ottawa ON

Database: ***SPL***

Ref No:	2862-9XEKED	***Municipality No:***	
Year:		***Nature of Damage:***	
Incident Dt:	6/12/2015	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	6/12/2015	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	

Site No: 0706-92ET4A
MOE Response: N
Site County/District:
Site Geo Ref Meth: 1-10 metres eg. Good Quality GPS
Site District Office:
Nearest Watercourse:
Site Name: Ottawa Light Rail Transit - East Portal
Site Address: Road allowance between Broken Front Concessions C and D in front of Lot D geographic township of Nepean
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu: GIS Software
Site Map Datum: NAD83
Northing: 5030149
Easting: 446343
Entity Operating Name:
Client Name: OLRT Constructors
Client Type:
Source Type:
Incident Cause: Leak/Break
Incident Preceding Spill:
Incident Reason: Equipment Failure
Incident Summary: OLRT: hyd oil to grd, ctnd clng 2 L
Environment Impact:
Health Env Consequence:
Nature of Impact: Land
Contaminant Qty: 2 L
Contaminant Qty 1: 2
Contaminant Unit: L
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Bell Canada***
Ottawa ON

Database: ***SPL***

Ref No:	8881-9J2J33	***Municipality No:***	
Year:		***Nature of Damage:***	
Incident Dt:	2014/04/10	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	2014/04/10	***Impact to Health:***	
Dt Document Closed:	2014/11/04	***Agency Involved:***	

Site No: NA
MOE Response: Referral to others
Site County/District:
Site Geo Ref Meth:

Site District Office:
Nearest Watercourse:
Site Name: 3212 Richmond Rd<UNOFFICIAL>
Site Address:
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Bell Canada
Client Type:
Source Type:
Incident Cause: Leak/Break
Incident Preceding Spill:
Incident Reason: Equipment Failure
Incident Summary: Bell Canada: possible >100 kg freon to atm.
Environment Impact: Confirmed
Health Env Consequence:
Nature of Impact: Air Pollution
Contaminant Qty: 0 other - see incident description
Contaminant Qty 1: 0
Contaminant Unit: other - see incident description
Contaminant Code: 38
Contaminant Name: FREON R-22 (CFC)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Pipeline/Components
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site:
Kent Street near Bank Street Ottawa ON

Database: ***SPL***

Ref No: 5751-ABLQJZ
Year:
Incident Dt: 2016/07/06
Dt MOE Arvl on Scn:
MOE Reported Dt: 2016/07/06
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: CB in Roadway<UNOFFICIAL>
Site Address: Kent Street near Bank Street
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing: 5029483
Easting: 445423
Entity Operating Name:
Client Name:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Client Type:
Source Type:
Incident Cause:
Incident Preceding Spill: Operator/Human error
Incident Reason: Maintenance
Incident Summary: Ottawa: 45 kgs Aggregate to CB. Cntd, clnd.
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 45 kg
Contaminant Qty 1: 45
Contaminant Unit: kg
Contaminant Code: 99
Contaminant Name: SAND/GRAVEL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: Surface Water
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Communal
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Taggart Aggregates Ltd.***
Ottawa ON

Database: ***SPL***

Ref No: 6604-BAFN75
Year:
Incident Dt: 3/20/2019
Dt MOE Arvl on Scn:
MOE Reported Dt: 3/20/2019
Dt Document Closed: 3/22/2019
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Fernbank Quarry<UNOFFICIAL>
Site Address:
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Taggart Aggregates Ltd.
Client Type: Corporation
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Quarry blast causing rattling at residential properties
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 0 - No Impact
Agency Involved:

Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Taggart Construction Limited***
Ottawa ON

Database:
SPL

Ref No:	7584-BB3KRQ	***Municipality No:***	
Year:		***Nature of Damage:***	
Incident Dt:	4/4/2019	***Discharger Report:***	
Dt MOE Arvl on Scn:		***Material Group:***	
MOE Reported Dt:	4/9/2019	***Impact to Health:***	
Dt Document Closed:		***Agency Involved:***	

Site No: NA
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: 1896 John Quinn rd, Metcalfe<UNOFFICIAL>
Site Address:
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name: Taggart Construction Limited
Client Type: Corporation
Source Type:
Incident Cause:
Incident Preceding Spill:
Incident Reason:
Incident Summary: Mobile Crusher Relocation - 2019
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: ***Taggart Miller Environmental Services Inc.***
Ottawa ON K2P 1P9

Database: ***WDS***

Approval No:	4538-B8EMLT	***Total Area (ha):***	
Mob Unit Cert No:		***Landfill Cap (m³):***	
EBR Registry No:		***Transfer Area (ha):***	
Status:	Approved	***Transfer Cap (m³):***	
Facility Type:		***Transfer Cert No:***	
Record Type:	ECA	***Inciner. Area (ha):***	
Link Source:	IDS	***Inciner. Cap (t):***	
Project Type:	WASTE DISPOSAL SITES	***Process Area (m³):***	
Application Status:		***Process Cap (m³/d):***	
Issue Date:	2019-12-13	***Process Vol (m³):***	
Input Date:		***Process Feed (m³):***	
Date Received:		***Site Concession:***	
Est Closure Date:		***Site Region/County:***	
Mobile Capacity:		***SWP Area Name:***	
Mobile Units:		***MOE District:***	
Mobile Description:		***District Office:***	
Prop City:		***Latitude:***	
Prop Postal:		***Longitude:***	
Prop Phone:		***Geometry X:***	
Serial Link:		***Geometry Y:***	
Approval Type:	ECA-WASTE DISPOSAL SITES		
Proponent:			
Prop Address:			
Proponent County/District:			
Full Address:			
Site Lot:			
Waste Class Code:			
Waste Class:			
Waste Type:			
Waste Type Other:			
Waste Description:			
Landfill Monitoring:			
Landfill Ctrl Type:			
Site Closing Description:			
Project Description:			
Municipalities Served:			
Approval Description:			
Other Approvals/Permits:			
PDF URL:	https://www.accessenvironment.ene.gov.on.ca/instruments/1994-AW7JS8-14.pdf		
PDF Site Location:			

Appendix: Database Descriptions

Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. ***Note:*** *Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory: Provincial AAGR

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory: Provincial AGR

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System: Provincial AMIS

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites: Private ANDR

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks: Provincial AST

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies: Private AUWR

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2024

Borehole: Provincial BORE

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval: Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities: Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2022

Commercial Fuel Oil Tanks: Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.
Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors: Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register: Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2024

Compressed Natural Gas Stations: Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -May 2024

Inventory of Coal Gasification Plants and Coal Tar Sites: Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions: Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Oct 2024

Certificates of Property Use: Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Nov 30, 2024

Drill Hole Database: Provincial DRL

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024

Delisted Fuel Tanks: Provincial DTNK

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023

Environmental Activity and Sector Registry: Provincial EASR

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval), Please see our ECA database.

Government Publication Date: Oct 2011-Oct 31, 2024

Environmental Registry: Provincial EBR

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Nov 30, 2024

Environmental Compliance Approval: Provincial ECA

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Oct 31, 2024

Environmental Effects Monitoring: Federal EEM

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches: Private EHS

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024

Environmental Issues Inventory System: Federal EIIS

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event: Provincial EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report: Provincial EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2023

List of Expired Fuels Safety Facilities: Provincial EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.
Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions: Federal FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land: Federal FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Sep 2024

Fisheries & Oceans Fuel Tanks: Federal FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS): Federal FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank: Provincial FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.
Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic: Provincial FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary: Provincial GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Nov 30, 2022

Greenhouse Gas Emissions from Large Facilities: Federal GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO2 eq).

Government Publication Date: 2013-Dec 2022

TSSA Historic Incidents: Provincial HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks: Federal IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks: Provincial INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing in a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario: Provincial LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations: Private MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences: Provincial MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2024

National Analysis of Trends in Emergencies System (NATES): Federal NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports: Provincial NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2022

National Defense & Canadian Forces Fuel Tanks: Federal NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills: Federal NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites: Federal NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents: Federal NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells: Federal NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES): Federal NEES

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003*

National PCB Inventory: Federal NPCB

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008*

National Pollutant Release Inventory: Federal NPR2

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024

National Pollutant Release Inventory - Historic: Federal NPRI

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017

Oil and Gas Wells: Private OGWE

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-May 31, 2024

Ontario Oil and Gas Wells: Provincial OOGW

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024

Inventory of PCB Storage Sites: Provincial OPCB

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013

Orders: Provincial ORD

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Nov 30, 2024

Canadian Pulp and Paper: Private PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks: Federal PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register: Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011-Oct 31, 2024

Ontario PFAS Spills: Provincial PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Mar 2024; May 2024

NPRI Reporters - PFAS Substances: Federal PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI: Federal PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents: Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing in an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR: Provincial PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks: Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water: Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Nov 30, 2024

Ontario Regulation 347 Waste Receivers Summary: Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition: Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-Nov 2024

Retail Fuel Storage Tanks: Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2024

Scott's Manufacturing Directory: Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills: Provincial SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct 2024

Wastewater Discharger Registration Database: Provincial SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks: Private TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks: Federal TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks: Provincial VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.
Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory: Provincial WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Oct 31, 2024

Waste Disposal Sites - MOE 1991 Historical Approval Inventory: Provincial WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System: Provincial WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS

PATERSON GROUP
solution oriented engineering

Kuldeep Panchal
Junior Environmental Scientist

Kuldeep Panchal is a Junior Environmental Scientist with Paterson Group in Ottawa, Ontario. Kuldeep received his Bachelor of Civil Engineering in 2017, Charotar University of Sciences & Technology. In 2019 He earned his Master's in Environmental Engineering, from the University of Ottawa. In his time at Paterson with Environmental Division, Kuldeep has been involved in primarily residential and commercial development projects predominantly within the National Capital Region, where he conducted Phase I Environmental Site Assessments (ESAs) to MECP and CSA standards and conducted environmental and geotechnical subsurface investigations. His current scope of work consists of environmental investigation, reporting, field inspections, soil and groundwater sampling, supervising the remediation of contaminated sites, and ensuring compliance with applicable regulatory standards.

EDUCATION

Master's Environmental Engineering, 2019
University of Ottawa, Ottawa, ON

Bachelor of Civil Engineering, 2017
Charotar University of Sciences & Technology, Gujarat, India

LICENCE/PROFFESIONAL AFFILIATIONS

E.I.T. (Engineer in Training) with PEO
CCIL (Canadian Council of Independent Laboratories) – Type QF
TDG (Transportation of Dangerous Goods) – Type A Packages

YEARS OF EXPERIENCE

With Paterson: 3

Other Firms: 1.5

OFFICE LOCATION

9 Auriga Drive
Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- CSA Phase I Environmental Site Assessments (ESAs) – Various Sites, Ottawa, ON
- Mattamy Homes – Fairwinds Phase 8 – Environmental subsurface investigation – Ottawa, ON
- Soil and Groundwater sampling – Various Sites, Ottawa, ON
- CECCE – 205 Scholastic – Micro Piling – Ottawa, ON
- Minto – Quinn's Pointe – Stage 4 – Site Servicing and Soil Inspections – Ottawa, ON
- W.H. MacSweyn – Prepared Compaction Plan and Road Works – Ottawa, ON
- Minto – Brookline – Site Servicing – Ottawa, ON
- Various High Rise and Commercial Projects – Material Testing – Ottawa, ON
- Proposal Preparation for Material Testing – Various Projects

PROFESSIONAL EXPERIENCE

March 2024 to present – **Junior Environmental Scientist, Environmental Division, Paterson Group,** Ottawa, Ontario

- Conduct Phase I – Environmental Site Assessments (ESAs) to CSA and O.Reg. 153/04 Standards.
- Responsible for the application of environmental, hydrological, and/or geotechnical principles and practices in the identification and delineation of soil and groundwater contamination plumes while ensuring compliance with federal, provincial, and/or municipal legal and regulatory requirements.
- Presenting analytical test results, interpretations, assessments, recommendations and/or conclusions in a final technical report.
- Field experience in the supervision of drilling and excavation contractors, inspection of aboveground and underground fuel storage tanks, soil and rock classification, and soil and groundwater field sampling.
- Coordination of contractors while directly reporting to intermediate and senior management to ensure completion of project on schedule and within budget.

July 2023 to February 2024 – **Project Coordinator, Materials Testing, Paterson Group,** Ottawa, Ontario

- Prepares technical reports for existing clients, such as geotechnical summaries, and foundation assessments.
- Compiles proposals for various private and government-based tenders.
- Aids with project-related procurements.
- Prepares and reviews training and Standard Operating Procedures (SOP's) documents for the Materials Testing Department.
- Works closely with Director or Project Managers within the Materials Testing Department to ensure reports are completed on time.
- Actively takes part in extra training and the training of field staff.
- Assists the Director or Project Manager and field staff with various site inspections.

May 2021 to July 2023 – **Field Technologist, Materials Testing – Paterson Group,** Ottawa, ON

- Geotechnical investigations include test pitting programs for various types of subsurface soils investigations.
- Prepares geotechnical investigation reports and slope stability analysis with accompanying recommendations.
- Field inspections and material testing include but not limited to compaction, proof rolling, concrete testing, mortar/grout testing, subgrade reviews, bearing medium evaluations, bearing surface inspections, rebar inspections, both footings and walls, and asphalt sampling.
- Specialty testing such as, cover meter inspections, Piling and Micro Piling, excavation reviews, thermocouple installation and readings, Schmidt hammer testing, granular sampling, light weight fill, and crack monitoring.

June 2017 to June 2018 – **Site Engineer, Sheth Enterprise –** Surat, Gujarat, India

- Used theoretical knowledge of construction work in practical scenarios.
- Was responsible for handling multiple residential construction sites in Surat area.
- Performed duties such as site inspections, supervision of workers and the coordination between contactors and design engineers.
- Trained civil engineering graduates during their internships on the construction sites.

February 2017 to April 2017 – **Environmental Laboratory Trainee – Detox Corporation Pvt. Ltd. –** Surat, Gujarat, India

- Performed analysis of environmental samples which were collected on a regular basis adhering to the safely regulations.
- Understood the design plans of water and wastewater treatment plants.
- Implemented various regulations and limits of parameters in water and wastewater discharge.
- Performed analysis of samples using apparatus such as a Bomb Calorimeter and a Spectrophotometer.
- Conducted a variety of tests on water and wastewater using methods such as Biochemical Oxygen Demand (BOD) and Chemical Oxygen Demand (COD) tests.
- Learned how to formulate environmental impact assessment reports.
- Authored professional reports listing the characteristics of tested waste and hazardous waste.
- Gathered and prepared reports on Quality Assurance (QA) of environmental waste.

PATERSON GROUP
solution oriented engineering

Michael Beaudoin, P.Eng., QP$_{ESA}$
Senior Project Manager

Michael received his Bachelor of Engineering from Carleton University in 2010 in Environmental Engineering. Michael joined the Paterson Group in the Environmental Division. Michael has worked for Paterson for approximately 14 years and has accrued extensive field and office experience. Michael's experience working in the field ranges from Phase I site reviews, Phase II investigations, remediation site inspections and designated substance surveys. Through his years of field experience, Michael has obtained invaluable knowledge on contractor relationships, budgets, time management, consultant/owner relation, quality data and information, and working with a variety of different personnel and situations. Michael has moved into a more senior role by becoming a qualified person for environmental assessments, overseeing small to large scale environmental projects, which include, Phase I and II reports, Record of Site Conditions and Brownfield Applications. Michael has assisted with Mark D'Arcy in the development of young staff and continuous improvement of Paterson internal systems.

EDUCATION
B.Eng. 2010, Environmental Engineering
Carleton University
Ottawa, ON

LICENCE/ PROFESSIONAL AFFILIATIONS
Professional Engineers of Ontario

YEARS OF EXPERIENCE
With Paterson: 14

OFFICE LOCATION
9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS
- Rideau Street Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Main Street Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Woodroffe Avenue Reconstruction, Ottawa, ON Phase I ESA, Phase II ESA, (Field Manager)
- Westboro Connection Development, Ottawa ON, Phase II ESA, Remediation Supervision (Field Manager)
- Riverview Development – Kingston, ON, Phase I ESA, Phase II ESA, and filing of multiple RSCs in the MECP Environmental Site Registry (Project Manager)
- West Village Development – Kingston, ON, Phase I ESA, Phase II ESA, and filing of multiple RSCS in the MECP Environmental Site Registry (Project Manager)
- Moon Development – 245 Rideau Street, Ottawa, ON, Phase I ESA, Phase II ESA, and RSC Filing (Project Manager)
- ESAP Project, Ottawa, ON
- Record of Site Condition Filings – Residential and Commercial Development Properties, Various Sites, Ottawa, Kingston ON.
- Designated Substance Surveys, Ottawa, ON
- Phase I and Phase II Investigations in accordance with CSA standards and O.Reg 153/04

PROFESSIONAL EXPERIENCE

November 2010 to present**, Environmental Engineer, Paterson Group**, Ottawa, Ontario

- Provide on-site environmental expertise for various soil and groundwater remediation projects including but not limited to the following: Riverview Development, West Village, Westboro Connection, ESAP Project, and 405 Terminal Avenue.
- Oversee Phase I and Phase II Investigations in accordance with CSA standards and O.Reg 153/04 on a variety of residential and commercial developments.
- Responsible for filing Records of Site Condition with the MECP Environmental Site Registry.
- Completing Designated Substance Surveys (including Air Quality Testing)
- Problem solving to help advance or maintain project schedules.
- Complete environmental reports with recommendations for environmental concerns.
- Liaising with contractors, consultants and government officials.
- Provide cost estimates for environment field programs and construction costs.
- Review RFI's, submittals, monthly progress reports and other various construction related work.