

Geotechnical Investigation

Proposed Mixed-Use Development

5970 and 6083 Ottawa Street Ottawa, Ontario

Prepared for Tamarack (Richmond) Corporation

Report PG4216-1 Revision 6 dated October 3, 2025



Table of Contents

1.0	Introduction	PAGE
2.0	Proposed Development	
3.0	Method of Investigation	
3.1	Field Investigation	
3.2	-	
3.3		
3.4	Analytical Testing	
3.5	•	
4.0	Observations	
4.1	Surface Conditions	
4.2		
4.3		
4.5	Hydraulic Conductivity Testing Results	16
5.0	Discussion	
5.1	Geotechnical Assessment	
5.2	Site Grading and Preparation	17
5.3		
5.4	Design for Earthquakes	26
5.5	Basement Slab/Slab on Grade Construction	27
5.6	Pavement Structure	28
5.7	Stormwater Management Facilities	31
6.0	Design and Construction Precautions	32
6.1	Foundation Drainage and Backfill	
6.2	Protection of Footings Against Frost Action	33
6.3	Excavation Side Slopes	34
6.4	Pipe Bedding and Backfill	35
6.5	Groundwater Control	37
6.6	Winter Construction	38
6.7	•	
6.8	1 3	
6.9	Slope Stability Analysis	40
7.0	Recommendations	41
8 N	Statement of Limitations	42



Appendices

Appendix 1 Soil Profile and Test Data Sheets

Symbols and Terms

Atterberg Limit Testing Results

Grain-Size Distribution and Hydrometer Testing Results

Consolidation Testing Results Analytical Testing Results Hydraulic Conductivity Results

Appendix 2 Figure 1 - Key Plan

Groundwater Monitoring Levels

Drawing PG4216-2 – Test Hole Location Plan

Drawing PG4216-3 – Permissible Grade Raise Plan

Drawing PG4216-4 - Bedrock Contour Plan

Drawing PG4216-5 – Designated Silty Clay Areas



1.0 Introduction

Paterson Group (Paterson) was commissioned by Tamarack (Richmond) Corporation to conduct a geotechnical investigation for the proposed mixed-use development to be located at 5970 and 6038 Ottawa Street in the Village of Richmond, Ontario (reference should be made to Figure 1 - Key Plan presented in Appendix 2).

The objectives of the investigations were to:

determine the subsoil and groundwa	iter conditions	pased or	i available
subsoil information and borehole inves	tigation.		

provide geotechnical recommendations pertaining to the design of the proposed development including construction considerations which may affect the design.

The following report has been prepared specifically and solely for the aforementioned project which is described herein. Investigating the presence or potential presence of contamination on the proposed development was not part of the scope of work. Therefore, the present report does not address environmental issues.

2.0 Proposed Development

Paterson understands that the proposed development will consist of a series of single and townhouse style residential dwellings with basement levels. Commercial and school buildings of slab-on-grade construction, a park and a communal well are also expected to be part of the proposed development. Paterson anticipates a portion of the buildings located throughout the proposed development will have basements equipped with sump pumps.

Associated access lanes, roadways, landscaped areas, and a stormwater management facility are also anticipated as part of the development. It is also understood that the proposed development will be municipally serviced.



3.0 Method of Investigation

3.1 Field Investigation

Field Program

A field investigation program was completed at the subject site by Paterson on December 13, 2018. At that time, a total of ten (10) boreholes were advanced to a maximum depth of 9.7 m or auger refusal. Supplemental investigations were completed by this firm on February 27, 2019 and on March 19, 22 and 23, 2021. The supplemental investigations consisted of eleven (11) test pits and eleven (11) boreholes advanced to a maximum depth of 3.8 below existing grade, respectively. A bedrock delineation program was also carried out on April 20 and December 1, 2020, consisting of a total of 87 probe holes to the bedrock surface.

A field program for groundwater monitoring was conducted from March 19 to March 23, 2021 and consisted of fifteen (15) boreholes, advanced to a maximum depth of 3.7 m below existing grade. All boreholes were equipped with monitoring wells. The most recent field investigation was completed by this firm on December 16 to December 19, 2024 and March 6 to March 7, 2025, and consisted of advancing twenty (20) boreholes and thirteen (13) test pits to maximum depths of 6.8 and 3.0 m, respectively. Seven (7) supplemental hand-auger holes were undertaken on August 21, 2025 to a maximum depth of 1.1 m below ground surface.

The test holes were distributed in a manner to provide general coverage of the subject site taking into considerations site features. The test hole locations are shown on Drawing PG4216-2 – Test Hole Location Plan included in Appendix 2.

The boreholes were completed using a track mounted auger drill rig operated by a two-person crew while the test pits were excavated using a hydraulic shovel. The bedrock probe holes were advanced using a track-mounted, pneumatic drill rig. All fieldwork was conducted under the full-time supervision of personnel from our geotechnical division under the direction of a senior engineer. The drilling procedure consisted of augering and coring to the required depths at the selected locations and sampling the overburden, while the test pits procedure consisted of excavating to the required depth at the selected location and sampling the overburden.



Sampling and In Situ Testing

Soil samples collected from the boreholes were either recovered directly from the auger flights (AU), collected using a 50 mm diameter split-spoon (SS) sampler, using core recovery barrels, or 73 mm diameter thing walled (TW) Shelby tubes in conjunction with a piston sampler. Grab samples (G) were collected from the test pits at selected intervals. Rock cores were obtained using 47.6 mm inside diameter coring equipment.

All samples were visually inspected and classified on site. The auger, split-spoon and grab samples were placed in sealed plastic bags. Shelby tubes were sealed at both ends on site and protected from disturbances over the entire process. Rock cores were placed in cardboard boxes. All samples were transported to our laboratory for examination and classification. The depths at which the auger, split-spoon samples, Shelby tube samples, rock core samples, and grab samples were recovered from the test holes are shown as AU, SS, TW, RC, and G, respectively, on the Soil Profile and Test Data sheets presented in Appendix 1.

The Standard Penetration Test (SPT) was conducted in conjunction with the recovery of the split-spoon samples. The SPT results are recorded as "N" values on the Soil Profile and Test Data sheets. The "N" value is the number of blows required to drive the split-spoon sampler 300 mm into the soil after a 150 mm initial penetration using a 63.5 kg hammer falling from a height of 760 mm.

Undrained shear strength testing, using a vane apparatus, was carried out at regular intervals of depth in cohesive soils.

Overburden thickness was evaluated by a dynamic cone penetration testing (DCPT) completed at BH9. The DCPT consists of driving a steel drill rod, equipped with a 50 mm diameter cone at the tip, using a 63.5 kg hammer falling from a height of 760 mm. The number of blows required to drive the cone into the soil is recorded for each 300 mm increment.

The thickness of the overburden was also evaluated by the use of probeholes at several test hole locations. This technique consisted of advancing augers until refusal to augering was reached by the drill rig.

Rock samples were recovered from boreholes BH 9-24 using a core barrel and diamond drilling techniques. The recovery value and Rock Quality Designation (RQD) value were calculated for each drilled section of bedrock and are presented on the borehole log. The recovery value is the length of the bedrock sample recovered over the length of the drilled section.



The RQD value is the total length of intact rock pieces longer than 100 mm over the length of the core run. The values indicate the bedrock quality.

The subsurface conditions observed at the test hole locations were recorded in detail in the field. Our findings are presented in the Soil Profile and Test Data sheets in Appendix 1.

Groundwater Monitoring

Monitoring wells were installed at boreholes BH 1-21 to BH 11-21 and BH 9-24 to BH 12-24. Flexible polyethylene standpipes were installed at boreholes BH 1 to BH 4 and BH 6 to BH 10. Monitoring wells and standpipes were installed to permit monitoring of the groundwater levels subsequent to the completion of the sampling program. Groundwater level observations are discussed in Subsection 4.3 and presented in the Soil Profile and Test Data sheets in Appendix 1.

Monitoring Well Installation

Typical monitoring well construction details are described below:

_ _	Slotted PVC screen at the base of each borehole. 32 or 51 mm diameter PVC riser pipe from the top of the screen to the
	ground surface.
_	No.3 silica sand backfill within annular space around screen.
_	Bentonite hole plug placed directly above PVC slotted screen.
	Clean backfill from top of bentonite plug to the ground surface.

Refer to the Soil Profile and Test Data sheets in Appendix 1 for specific well construction details.

3.2 Field Survey

The test hole locations were selected by Paterson to provide general coverage of the proposed development, taking into consideration the existing site features and underground utilities. The location and ground surface elevation at each borehole and test pit location were provided by Stantec Geomatics Ltd during the initial investigation, and by Paterson for the supplemental investigations.

The test hole locations and ground surface elevations at each test hole location are referenced to a geodetic datum. The location of the test holes and ground surface elevations at each test hole location are presented on Drawing PG4216-2 - Test Hole Location Plan in Appendix 2.



3.3 Laboratory Testing

Soil and bedrock samples were collected from the subject site during the investigations and were visually examined in our laboratory to review the results of the field logging. A total of twelve (12) soil samples were submitted for grain size distribution and hydrometer analysis, twenty-three (23) soil samples were submitted for Atterberg Limits testing, three (3) samples submitted for consolidation testing and two (2) soil samples were submitted for linear shrinkage testing. All recovered samples during the latest field investigation were submitted for moisture testing.

The results of our testing are presented in Subsection 4.2 and on the associated testing sheets presented in Appendix 1.

Sample Storage

All samples procured from the 2024 and 2025 field investigations will be stored in the laboratory for a period of one (1) month after the issuance of this report. They will then be discarded unless we are otherwise directed.

3.4 Analytical Testing

One (1) soil sample was submitted for analytical testing to assess the corrosion potential for exposed ferrous metals and the potential of sulphate attacks against subsurface concrete structures. The sample was submitted to determine the concentration of sulphate and chloride, the resistivity and the pH of the sample. The results are presented in Appendix 1 and are discussed further in Subsection 6.7.

3.5 Hydraulic Conductivity (Slug) Testing

Hydraulic conductivity (slug) testing was conducted at the monitoring wells located within the proposed stormwater management facility (SWMF) footprint to evaluate the hydraulic properties of the overburden material and bedrock within the area of interest at the subject site.

The analysis was carried out using AQTESOLV Pro Version 4.5 aquifer analysis developed by HydroSOLVE Inc, which processes the data using the method developed by Hyorslev (1951).



Assumptions inherent to the Hvorslev method include a homogeneous and isotropic aquifer of infinite extent with zero-storage assumption, and a screen length significantly greater than the monitoring well diameter. The assumption regarding aquifer storage is considered to be appropriate for groundwater inflow through the overburden aquifer. The assumption regarding screen length and well diameter is considered to be met based on a screen length of 1.5 m and a diameter of 0.03 to 0.05 m.

While the idealized assumptions regarding aquifer extent, homogeneity, and isotropy are not strictly met in this case (or in any real-world situation), it has been our experience that the Hvorslev method produces effective point estimates of hydraulic conductivity in conditions similar to those encountered at the subject site.

The Hvorslev analysis is based on the line of best fit through the field data (hydraulic head recovery vs. time), plotted on a semi-logarithmic scale. The results of testing are further discussed in Subsection 4.5.



4.0 Observations

4.1 Surface Conditions

The subject site generally consists of agricultural lands in the east portion and undeveloped and vacant lands in its west portion. Marlborough Creek is also observed to meander along the northern boundary of the property. The Canadian National Railway Corridor is located beyond the creek following the general direction of the watercourse.

The ground surface across the subject site is generally flat, with a gradual upward slope towards its southwest portion. The site is approximately up to 600 mm lower than the neighboring roads and the adjacent properties. The northern portion of the site is bordered by a shallow (up to 2 m high) downward slope toward Marlborough Creek.

4.2 Subsurface Profile

Generally, the subsurface profile encountered at the test hole locations consisted of topsoil underlain by a compact to dense glacial till deposit and by a deposit of silty clay and further by glacial till throughout the east portion of the subject site.

The silty clay deposit, where encountered, generally consisted of very stiff to stiff brown silty clay with depths ranging between 2 and 5 m below the existing ground surface. The brown silty clay was observed to be underlain by firm grey silty clay at the location of boreholes BH 4-24, BH 11-24, BH 3A-21, BH 11-21, BH 10, and test pits TP 2 to TP 8.

Estimation of clay sensitivity (ratio of in-situ undisturbed to remoulded shear strength) was completed based on the information obtained during the field investigations undertaken throughout the subject site. The undrained shear strength of the silty clay ranges between 48 and exceeding 250 kPa (beyond range of employed shear vanes) while the remoulded shear strength was observed to range between 10 and 109 kPa, the sensitivity was estimated to range between 1.4 and 11.2.

The glacial till deposit was generally observed to consist of compact to dense silty sand and/or silty clay with gravel, cobbles and boulders. Practical refusal to drill and excavation was encountered at multiple locations throughout the subject site. Bedrock surface elevations are presented in Drawing PG4216-4 - Bedrock Contour Plan in Appendix 2.



Reference should be made to the Soil Profile and Test Data sheets in Appendix 1 for specific details of the soil profiles encountered at each test hole location.

Atterberg Limits

Atterberg Limits testing was completed on twenty-three (23) recovered fine-grained samples at selected locations throughout the subject site. The results of the Atterberg Limits testing are presented in Table 1, Table 2 and Appendix 1 and classified in accordance with the Unified Soil Classification System (USCS).

Table 1A –	Table 1A – Summary of Atterberg Limits										
Test Hole	Sample	Depth (m)	LL (%)	PL (%)	PI (%)	WC (%)	Classification				
BH 4-24	SS4	2.3-2.9	65	29	36	57.0	СН				
BH 12-24	SS2	1.5-2.1	54	25	29	53.5	СН				
BH 14-24	SS1	2.3-2.9	32	22	10	36.4	CL				
BH 3A-21	SS2	3.1-3.6	48	22	26	44.5	CL				
BH 2	SS2	0.6-1.2	35	21	14	37.1	CL				
BH 3	SS3	1.4-2.0	29	19	10	20.0	CL				
BH 8	SS2	0.8-1.4	29	19	10	20.7	CL				
TP 2	G3	1.8-2.0	33	21	12	28.5	CL				
TP 3	G4	2.2-2.4	33	21	12	33.0	CL				
TP 4	G6	3.0-3.2	52	21	31	38.5	СН				
TP 5	G6	3.0-3.2	51	23	28	40.7	СН				
TP 6	G5	2.5-2.7	36	19	17	29.5	CL				
TP 7	G6	3.0-3.2	27	21	6	25.4	CL-ML				
TP 8	G5	2.5-2.7	54	16	29	43.1	СН				

Notes: LL: Liquid Limit; PL: Plastic Limit; PI: Plasticity Index; WC: Water Content;

CH: Inorganic Clay of High Plasticity CL: Inorganic Clay of Low Plasticity

CL-ML: Inorganic Silt with Some Clay with Low Plasticity



Table 1B –	Table 1B – Summary of Atterberg Limits										
Test Hole	Sample	Depth (m)	LL (%)	PL (%)	PI (%)	WC (%)	Classification				
BH 3-25	SS2	1.5-2.1	30	18	12	-	CL				
BH 11-24	SS4	3.8-4.4	29	18	11	47	CL				
HA 1-25	G1	0.8-0.9	59	28	31	-	СН				
HA 2-25	G1	0.75-0.85	64	29	35	-	СН				
HA 3-25	G1	1.0-1.1	60	30	30	-	СН				
HA 4-25	G1	0.55-0.65	62	28	34	-	СН				
HA 5-25	G1	0.75-0.85	62	31	31	-	СН				
HA 6-25	G1	0.75-0.85	65	32	33	-	СН				
HA 7-25	G1	0.8-0.9	63	30	33	-	СН				

Notes: LL: Liquid Limit; PL: Plastic Limit; PI: Plasticity Index; WC: Water Content;

CH: Inorganic Clay of High Plasticity CL: Inorganic Clay of Low Plasticity

CL-ML: Inorganic Silt with Some Clay with Low Plasticity

Shrinkage Testing

Linear shrinkage testing was completed on two (2) selected samples. The results are summarized in Table 2.

Table 2 – Linear Shrinkage Results								
Borehole	Sample	Depth (m)	Shrinkage Limit	Shrinkage Ratio				
TP 6	G5	2.5-2.7	20.0	1.93				
BH 3A-21	SS1	2.3-2.9	22.2	17.36				

The results of the shrinkage limit testing are consistent with clay soils Paterson has encountered and tested on other sites in the Ottawa area.

Consolidation Testing

Generally, the post-construction settlement of a clay deposit is evaluated based on its compressibility characteristics. A method to evaluate these characteristics is by completing unidimensional consolidation tests on satisfactorily undisturbed soil samples collected from thin-walled Shelby tubes. A total of four (3) consolidation tests were completed from the Shelby tubes collected during the current investigation. The results of the consolidation testing are presented on the Consolidation Test sheets in Appendix 1 and discussed in Section 5.3.



A total of three (3) consolidation tests were completed from the Shelby tubes collected during the current investigation. The results of the consolidation tests are presented in Table 3 and in Appendix 1.

Value p'c is the preconsolidation pressure of the sample and p'o is the effective overburden pressure of the test sample. The values C_{cr} and C_c are the recompression and compression indices, respectively. These soil parameters are a measure of the compressibility of the soil due to stress increases below and above the preconsolidation pressures.

Table 3 – Consolidation Test Results									
Borehole	Sample	Depth (m)	p'c (kPa)	p'o (kPa)	C _{cr}	Cc			
BH 3B-21	TW1	3.38	300.0	56.7	0.009	0.687			
	TW2	4.06	176.4	60.5	0.006	0.247			
BH 12A-24	TW2	4.27	146.0	54.8	0.012	0.420			

Notes: p'_c: Preconsolidation pressure; p'_o: Effective overburden pressure; C_c: Recompression indice; C_c: Compression indice.

The values of p'c, p'o, Ccr and Cc are determined using standard engineering testing procedures and are estimates only given the natural variations o the in-situ soils and limited sample size.

Reference should be made to Consolidation Test data sheets provided in Appendix 1 of this report.

Grain Size Distribution and Hydrometer Testing

Grain size distribution (sieve and hydrometer analysis) testing was completed on twelve (12) selected soil samples. The results of the grain size analysis are summarized in Table 4 and presented on the Grain-Size Distribution and Hydrometer Testing Results Sheets in Appendix 1.

Table 4 – S	Table 4 – Summary of Grain Size Distribution Analysis										
Test Hole	Sample	Depth (m)	Gravel (%)	Sand (%)	Silt (%)	Clay (%)	MC (%)				
BH 5-24	SS3	3.1-3.7	17.9	47.8	34.3	0.0	9.3				
BH 11-24	SS4	3.8-4.4	18.0	43.6	28.9	9.5	12.8				
BH 12-24	SS6	6.8-6.9	1.8	69.0	27.5	1.7	13.0				
BH 14-24	SS3	3.8-4.4	23.8	47.2	23.0	6.0	8.9				
TP 4	G6	3.0-3.2	0.0	0.9	59.6	39.5	30.3				

Report: PG4216-1 Revision 6 October 3, 2025



Table 4 – Summary of Grain Size Distribution Analysis										
Test Hole	Sample	Depth (m)	Gravel (%)	Sand (%)	Silt (%)	Clay (%)	MC (%)			
TP 6	G5	2.5-2.7	0.0	0.2	84.8	15.0	21.6			
TP 8	G5	2.5-2.7	0.0	6.1	54.4	39.5	29.9			
TP 9	G1	1.2-1.6	15.9	42.5	41.6		-			
TP 11	G4	2.5-2.7	6.5	64.5	29	9.0	-			
BH 1D	SS3	1.5-2.1	0.3	13.8	73.5	12.4	22.5			
BH 5D	SS3	1.5-2.1	0.0	1.5	76.0	22.5	33.9			
BH 10D	SS3	1.5-2.1	0.0	3.3	46.2	50.5	46.8			
Notes: MC	: Moisture 0	Content			•					

Bedrock

Bedrock was cored in BH 9-24 with an average RQD value ranging from 92 to 74 %. The recovery values ranged between 100 and 83% at the selected borehole. The bedrock is therefore considered to range between excellent and very good quality.

Based on available geological mapping, the bedrock in the subject area consists of dolomite of the Oxford Formation with an overburden drift thickness of 1 to 10 m depth.

Reference should be made to Drawing PG4216-4 – Bedrock Contour Plan in Appendix 2 for the test hole locations and depth where bedrock was encountered and/or where refusal to augering had been encountered.

4.3 Groundwater

Groundwater levels were measured on December 28, 2018, February 27, 2019, March 31, 2021, and January 19, 2025 within the installed monitoring wells and piezometers. Depths of sidewall groundwater infiltration, as observed during the test pit investigation were also recorded. The majority of the test pits were dry upon completion with the exception of some minor infiltration noted where test pits were carried out below the long-term groundwater table. The measured groundwater levels and observed groundwater infiltration are presented in Table 5 below. However, it is important to note that groundwater readings can be influenced by surface water perched within the borehole backfill material.



1 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	Table 5 – Summary of Groundwater Levels Surface Measured Groundwater									
Test Hole	Observation	Elev.	L L E		Date Recorded					
restriole	Method	(m)	Depth (m)	Elevation	Date Necolded					
2018 Invocti	gation (Boreholes	with Diozom		(m)	<u>l</u>					
	· ·	I	· · ·	00.70	1					
BH1	Piezometer	93.37	0.61	92.76						
BH2	Piezometer	94.23	0.77	93.46						
BH3	Piezometer	94.76	0.62	94.14						
BH4	Piezometer	97.71	1.10	96.61						
BH5	Piezometer	97.45	-	-	December 28,					
BH6	Piezometer	94.70	0.73	93.97	2018					
BH7	Piezometer	94.88	0.83	94.05						
BH8	Piezometer	94.03	1.28	92.75						
BH9	Piezometer	93.78	0.70	93.08						
BH10	Piezometer	93.37	0.48	92.89						
2019 Investi	gation (Test Pits)									
TP1	Test Pit Sidewalls	94.63	3.5	91.1						
TP2	Test Pit Sidewalls	94.42	Dry to 3.7	•						
TP3	Test Pit Sidewalls	94.48	3.5	91.0						
TP4	Test Pit Sidewalls	93.63	1.0	92.6						
TP5	Test Pit Sidewalls	94.28	1.2	93.1						
TP6	Test Pit Sidewalls	94.03	1.8	92.2	February 27,					
TP7	Test Pit Sidewalls	94.46	1.8	92.7	2019					
TP8	Test Pit Sidewalls	94.53	1.9	92.6						
TP9	Test Pit Sidewalls	97.18	Dry to 1.8	-						
TP9A	Test Pit Sidewalls	97.48	Dry to 2.4	-						
TP10	Test Pit Sidewalls	95.63	Dry to 0.9	-						
TP11	Test Pit Sidewalls	94.45	Dry to 2.8	-						



	Observation	Surface		Froundwater evel					
Test Hole	Method	Elev. (m)	Depth (m)	Elevation (m)	Date Recorded				
2021 Investigation (boreholes with monitoring wells)									
BH1D-21	Monitoring Well	94.24	0.15	94.09	March 31, 2021				
D111D-21	Worldoning Well	94.24	1.82	92.42	June 7, 2021				
BH1S-21	Monitoring Well	94.24	0.16	94.08	March 31, 2021				
D1110-21	Worldoning Well	34.24	1.80	92.44	June 7, 2021				
BH2-21	Monitoring Well	93.91	0.32	93.59	March 31, 2021				
DI 12-2 1	Worldoning Well	95.91	1.08	92.83	June 7, 2021				
BH3-21	Monitoring Well	93.91	-	-	-				
BH4D-21	Monitoring Well	94.51	0.29	94.22	March 31, 2021				
DH4D-21	wormoning weil	94.51	1.09	93.42	June 7, 2021				
BH4S-21	Monitoring Well	94.51	0.30	94.21	March 31, 2021				
DI 143-21	wormoring wen	94.51	1.05	93.46	June 7, 2021				
BH5-21	Monitoring Well	94.21	0.30	93.91	March 31, 2021				
DI 13-2 I	wormoring wen		1.03	93.18	June 7, 2021				
BH6-21	Monitoring Well	94.04	0.26	93.78	March 31, 2021				
DI 10-2 1	Worldoning Well	94.04	1.09	92.95	June 7, 2021				
BH7D-21	Monitoring Well	93.62	-	-	-				
BITT B-Z I	Worldoning Well	33.02	1.15	92.49	June 7, 2021				
BH7S-21	Monitoring Well	93.62	-	-	-				
B117 G-21	Worldoning Well	33.02	1.01	92.61	June 7, 2021				
BH8-21	Monitoring Well	94.05	0.49	93.56	March 31, 2021				
B110 21	Worldoning Well	04.00	0.80	93.25	June 7, 2021				
BH9-21	Monitoring Well	94.21	0.68	93.53	March 31, 2021				
B110 21	Worldoning Well	04.21	1.23	92.98	June 7, 2021				
BH10D-21	Monitoring Well	94.08	0.72	93.36	March 31, 2021				
511105 21	ormornig 1701	0 1.00	2.96	91.12	June 7, 2021				
BH10S-21	Monitoring Well	94.08	0.49	93.59	March 31, 2021				
200 21	o.m.o.mg ***on	0 1.00	1.54	92.54	June 7, 2021				
BH11-21	Monitoring Well	93.92	0.13	92.81	March 31, 2021				
5,,,,,,	wormoring weil	93.92	1.22	91.72	June 7, 2021				

Table 4B – Summary of Groundwater Levels									
Test Hole	Observation	Surface Level Date	Date Recorded						
Test Hole	Method	(m)	Depth (m)	Elevation (m)	Date Recorded				
2024 Investi	gation (Boreholes v	with Monitor	ing Wells)						
BH 9-24	Monitoring Well	94.18	0.92	93.26	January 9, 2025				
BH 10-24	Monitoring Well	94.18	0.94	93.24	January 9, 2025				
BH 11-24	Monitoring Well	93.82	1.98	91.84	January 9, 2025				
BH 12-24	Monitoring Well	93.93	1.08	92.85	January 9, 2025				



Groundwater levels are subject to seasonal fluctuations and therefore could vary during the time of construction. The groundwater conditions observed at the borehole and test pits were recorded in detail in the field. Our groundwater observations are also presented in the Soil Profile and Test Data sheets in Appendix 1.

Groundwater Monitoring Program (Silty Clay Area)

In addition to the groundwater readings noted above, the results of the groundwater fluctuations and correlated precipitation events for each monitoring well location between April 8, 2021 and April 21, 2023 have been summarized in Figure 1 through Figure 11 attached to Appendix 2 of this report. The boreholes were distributed in a manner to provide general coverage within the areas where silty clay was encountered.

4.5 Hydraulic Conductivity Testing Results

Hydraulic conductivity (slug) tests were conducted at five (5) monitoring well locations on January 9, 2025, to evaluate the hydraulic properties of the overburden material and bedrock at the test locations. The hydraulic conductivity results are shown in Table 6 below and summarized in Appendix 1.

Table 6 – Summary Of Hydraulic Conductivity Testing Results							
Test Hole	Ground Elev. (m)	Testing Depth (m)	Testing Elevation (m)	K (m/sec)	Test Type	Material at Testing Depth	
BH 9-24	94.18	5.5-6.0	88.68-88.18	5.18x10 ⁻⁴	Falling Head	Dodrook	
				5.07x10 ⁻⁴	Rising Head	Bedrock	
BH10-24	94.18	1.5-2.9	92.68-91.28	1.27x10 ⁻⁷	Falling Head	Silty Sand/ Glacial Till	
DU 44 04	1-24 93.82 5.0-6.5 88.82-87.32	5 O 6 5	00 00 07 22	5.30x10 ⁻⁶	Falling Head	Clasial Till	
DП 11-24		5.69x10 ⁻⁶	Rising Head	- Glacial Till			
BH 12-24	93.93	5.4-6.8	88.53-87.13	3.28x10 ⁻⁶	Falling Head	Glacial Till	
				2.91x10 ⁻⁶	Rising Head		
BH 10D-21	94.08	2.2-3.6	91.88-90.48	9.25x10 ⁻⁶	Falling Head	Glacial Till	
				1.00x10 ⁻⁵	Rising Head		

The measured hydraulic conductivity (K) values of the bedrock and glacial till ranged between approximately 5.07×10^{-4} to 5.18×10^{-4} m/sec and 1.27×10^{-7} to 1.00×10^{-5} m/sec, respectively. The results are consistent with similar materials Paterson has encountered on other sites and typical published values for bedrock and glacial till.



5.0 Discussion

5.1 Geotechnical Assessment

From a geotechnical perspective, the subject site is considered suitable for the proposed development. It is expected that the proposed buildings will be founded on conventional shallow footings placed on undisturbed, very stiff silty clay, compact to dense silty sand, compact to dense glacial till, clean, surface sounded bedrock bearing and an approved engineered fill layer over one of the aforementioned surfaces.

Where a deposit of silty clay is present below services and foundations of proposed buildings, a grade raise restriction will apply to grading throughout that area of the subject site. Permissible grade raise recommendations are discussed in Subsection 5.3. If higher than permissible grade raises are required, preloading with or without a surcharge, lightweight fill and/or other measures will be advised by Paterson to reduce the risks of unacceptable long-term post-construction total and differential settlements. Reference should be made to Drawing PG4216-5 - Designated Silty Clay Areas for the location of the clay deposit.

Depending on the extent of the proposed basement level and depths of services, bedrock might be encountered during excavation and construction. All contractors should be prepared for bedrock removal, and handling and removing boulders and oversized boulders throughout the subject site.

The above and other considerations are further discussed in the following sections.

5.2 Site Grading and Preparation

Stripping Depth

Topsoil and deleterious fill, such as those containing organic materials, should be stripped from under any buildings, paved areas, pipe bedding, and other settlement sensitive structures. Care should be taken not to disturb adequate bearing soils below the founding level during site preparation activities. Disturbance of the subgrade may result in having to sub-excavate the disturbed material and the placement of additional suitable fill material. Due to the relatively shallow depth of the bedrock surface within the southwest portion of the site, bedrock removal will be required to accommodate site services and building foundations.



Bedrock Removal

Bedrock removal can be accomplished by hoe ramming where only a small quantity of the bedrock needs to be removed. Sound bedrock may be removed by line drilling and controlled blasting and/or hoe ramming.

Prior to considering blasting operations, the blasting effects on the existing services, buildings and other structures should be addressed. A pre-blast or preconstruction survey of the existing structures located in proximity to the blasting operations should be completed prior to commencing site activities. The extent of the survey should be determined by the blasting consultant and should be sufficient to respond to any inquiries/claims related to the blasting operations.

As a general guideline, peak particle velocities (measured at the structures) should not exceed 25 mm/s during the blasting program to reduce the risks of damage to the existing structures.

The blasting operations should be planned and conducted under the supervision of a licensed professional engineer who is also an experienced blasting consultant.

Vibration Considerations

Construction operations are the cause of vibrations, and possibly, sources of nuisance to the community. Therefore, means to reduce the vibration levels as much as possible should be incorporated in the construction operations to maintain, as much as possible, a cooperative environment with the residents.

The following construction equipment could be the source of vibrations: hoe ram, compactor, dozer, crane, truck traffic, etc. Vibrations, whether caused by blasting operations or by construction operations, could be the source of detrimental vibrations on the nearby buildings and structures. Therefore, all vibrations are recommended to be limited.

Two parameters are used to determine the permissible vibrations, namely, the maximum peak particle velocity and the frequency. For low frequency vibrations, the maximum allowable peak particle velocity is less than that for high frequency vibrations. As a guideline, the peak particle velocity should be less than 15 mm/s between frequencies of 4 to 12 Hz, and 50 mm/s above a frequency of 40 Hz (interpolate between 12 and 40 Hz). The guidelines are for current construction standards.



Considering that these guidelines are above perceptible human level and, in some cases, could be very disturbing to some people, a pre-construction survey is recommended to be completed to minimize the risks of claims during or following the construction of the proposed buildings.

Noise vibration monitoring could be conducted during construction activities to monitor that vibrations are within the permissible parameters. If vibrations were encountered to be above permissible limits, recommendations should be provided at that time to minimize or limit the vibrations produced by the activities at the subject site.

It should be noted that if vibrations were a concern for the subject site, a preconstruction survey would be recommended to be completed to minimize the risks of claims during or following the construction of the proposed building.

Overbreak in Bedrock

Sedimentary bedrock formation, such as limestone, dolomite and shale, contain bedding planes, joints and fractures, and mud seams which create natural planes of weakness within the rock mass. Although several factors of a blast may be controlled to reduce backbreak and overbreak, upon blasting, the rock mass will tend to break along natural planes of weakness that may be present beyond the designed blast profile.

However, estimating the exact amount of backbreak and overbreak that may occur is not possible with conventional construction drill and blast methods. Backbreak should be expected to occur along the perimeter of the building excavation footprint with conventional drill and blast bedrock removal methods. Further, overbreak is expected to occur throughout the lowest lifts of blasting due to the variable bedding planes and planes of weakness in the in-situ bedrock.

It is very difficult to mitigate significant overblasting given the constraints posed by footing geometry and spacing with respect to the zone of influence of blasts and the bedrocks in-situ characteristics. Depending on the methodology undertaken by the contractor, efforts taken to minimize backbreak and overbreak may add significant time and costs to the excavation operations and is not guaranteed to completely eliminate the potential for backbreak and overbreak. Overbreak below footings should be in-filled with lean-concrete and approved by Paterson prior to placing concrete.

Report: PG4216-1 Revision 6 October 3, 2025



As such, volume estimates of bedrock to be removed may not be reflective of the actual volume of bedrock that may be required to be removed at the time of construction. This may result in additional materials, such as imported fill and concrete, required to make up for additional rock loss. It is recommended that the blasting operations be planned and conducted under the supervision of a licensed professional engineer who is an experienced blasting consultant.

Fill Placement

Fill used for grading beneath the building areas should consist, unless otherwise specified, of clean imported granular fill, such as Ontario Provincial Standard Specifications (OPSS) Granular A or Granular B Type II material, or blast rock fill approved by the geotechnical consultant. This material should be tested and approved prior to delivery to the site. The fill should be placed in lifts no greater than 300 mm thick and compacted using suitable compaction equipment for the lift thickness. Fill placed beneath the buildings should be compacted to at least 98% of its standard Proctor maximum dry density (SPMDD).

Non-specified existing fill along with site-excavated soil could be placed as general landscaping fill where settlement of the ground surface is of minor concern. These materials should be spread in lifts with a maximum thickness of 300 mm and compacted by the tracks of the spreading equipment to minimize voids. If these materials are to be used to build up the subgrade level for areas to be paved, they should be compacted in thin lifts to a minimum density of 95% of the SPMDD.

Non-specified existing fill and site-excavated soils are not suitable for use as backfill against foundation walls unless used in conjunction with a composite drainage membrane connected to a perimeter drainage system.

Consideration could be given to re-using site-generated soils for fill to build-up the subgrade for structures such as the proposed buildings and subgrade for service trenches. From a geotechnical perspective, site-generated workable soil fill free of organic debris (topsoil, logs, stumps, etc.), inorganic material and/or stones/cobbles larger than 200 mm in their longest dimension meeting the aforementioned conditions are considered suitable for re-use throughout the subject site. Wet site-generated fill, such as grey silty clay or grey glacial till soils will be saturated and expected to be difficult to re-use as the high-water contents make compacting impractical without an extensive drying period. Therefore, those soils are not anticipated to be suitable for this purpose.



Prior to considering site-generated soil for the above-noted purposes, Paterson field personnel must review, test (i.e., grain-size and proctor testing) and confirm the fill is in accordance with the above-noted recommendations. Once reviewed and approved by Paterson personnel, care should be taken during storage, placement and compaction of the site-generated fill to maintain the material in an unfrozen state and at a moisture content which is suitable for compaction.

Soils intended for re-use which become frozen and/or which have excessive moisture content will not be considered suitable for re-use at the subject site. Precautions must be taken if placement of this material is completed during winter months. The introduction of frozen material is expected to result in poor performing areas that will require repairs due to long-term thawing and higher than tolerable amounts of settlement. Paterson personnel should complete periodic inspections during fill placement to ensure that snow and ice quantities are minimized.

Provided the fill is considered acceptable for placement by Paterson personnel at the time of construction, the approved soil fill may be placed in maximum 300 mm thick loose lifts, compacted using a suitably sized vibratory sheepsfoot roller to a minimum of 98% of the materials SPMDD, in dry and above-freezing conditions.

Consideration may also be given to re-using the site-generated cobbles, boulders and bedrock for re-use if crushed to meet suitable gradation requirements. If considered, it is recommended to crush these materials to produce a well-graded crushed stone fill material matching the envelope of an OPSS Granular B Type I or Type II with a maximum particle size of 50 mm.

Testing and approval by Paterson during the crushing stages would be required to verify the adequacy of the material being produced for re-use. If the site-crushed material does not yield sufficiently well-graded material, Paterson may advise combining the material with sand, OPSS Granular A or other material to improve the material gradation. This fill is advised to be placed in loose lifts no greater than 300 mm thick and compacted to a minimum of 98% of the materials SMPDD using a suitably sized smooth-drum compactor.

The placement of site-generated fill should be reviewed and approved by Paterson field personnel at the time of construction. Where this fill layer is placed below building footprints, it would be recommended to be capped with a minimum 300 mm thick layer of OPSS Granular A crushed stone compacted to a minimum of 98% of the materials SPMDD.



Frozen material may not be considered for the above-noted purposes. This process should be reviewed and approved by Paterson field personnel upon completion of each lift and who are experienced in reviewing the placement of soil fill in this manner.

In-Filling Existing Ditches and Stormwater Management Ponds

If in-filling of existing ditches and pond was required, it is recommended that in-filling operations be completed in a stepped fashion within the lateral support of the proposed buildings. The fill should consist of clean imported granular fill, such as OPSS Granular A or OPSS Granular B Type II material. The steps should have a minimum horizontal length of 1.5 m and minimum vertical height of 500 mm and should be compacted using suitable compaction equipment to a minimum 98% of the material's SPMDD.

Alternatively, the backfill material can consist of dry, workable brown silty clay placed in maximum 300 mm thick lifts and compact each layer using a suitably sized sheepsfoot roller making several passes. The placement of the silty clay backfill should be completed in dry conditions and above freezing temperatures, reviewed and approved by Paterson at the time of placement. The fill layers are recommended to be capped with a minimum 300 mm thick layer of OPSS Granular A crushed stone compacted to a minimum of 985 of the materials SPMDD and directly below the design footing elevation for overlying structures.

5.3 Foundation Design

Bearing Resistance Values

It is expected that the proposed buildings will be founded on conventional spread footings placed on undisturbed, very stiff silty clay, compact to dense silty sand, compact to dense glacial till, clean, surface sounded bedrock bearing and an approved engineered fill layer over one of the aforementioned surfaces. Using continuously applied loads, footings for the proposed buildings can be designed using the bearing resistance values presented in Table 6.

A geotechnical resistance factor of 0.5 was applied to the bearing resistance values at ULS. The bearing resistance values are provided on the assumption that the footings will be placed on undisturbed soil bearing surfaces. An undisturbed soil bearing surface consists of one from which all topsoil and deleterious materials, such as loose, frozen or disturbed soil, whether in situ or not, have been removed, in the dry, prior to the placement of concrete for footings.



Where sandy subgrade is observed to be in a loose state of compactness, it is recommended to be proof-rolled under dry conditions and above freezing temperatures by an adequately sized roller making several passes to achieve optimum compaction levels. The compaction program should be reviewed and approved by Paterson field personnel.

Bearing resistance values for footing design should be confirmed on a per lot basis by Paterson field personnel at the time of construction.

The bearing resistance values at SLS for shallow footing bearing on the above noted soils will be subjected to potential post-construction total and differential settlements of 25 and 15 mm, respectively.

A clean, surface-sounded bedrock bearing surface should be free of loose materials, and have no near surface seams, voids, fissures or open joints which can be detected from surface sounding with a rock hammer. Footings bearing on an acceptable bedrock bearing surface and designed using the bearing resistance values provided herein will be subjected to negligible potential post-construction total and differential settlements. Overbreak in bedrock located directly below footings should be in-filled with lean-concrete and approved by Paterson prior to placing concrete.

Table 7 – Bearing Resistance Values				
Bearing Surface	Bearing Resistance Value at SLS (kPa)	Factored Bearing Resistance Value at ULS (kPa)		
Compact to Dense Silty Sand	100	150		
Very Stiff Silty Clay/Clayey Silt	150	225		
Compact to Dense Glacial Till	150	225		
Engineered Fill Over Acceptable Soils	150	225		
Clean, Surface Sounded Bedrock	-	500		

Note: Pad footings, up to 5 m wide, and strip footings, up to 3 m wide, can be designed using the above-noted bearing resistance values placed over an undisturbed, very stiff silty clay bearing surface. These values are considered standard limitations for the types of buildings being considered throughout the subject site and are not expected to limit design or construction of the proposed foundations.



Lateral Support

The bearing medium under footing-supported structures is required to be provided with adequate lateral support with respect to excavations and different foundation levels.

Adequate lateral support is provided to a soil bearing medium when a plane extending down and out from the bottom edge of the footing at a minimum of 1.5H:1V, passes only through in situ soil or engineered fill of the same or higher capacity as the soil.

Adequate lateral support is provided to bedrock bearing medium when a plane extending down and out from the bottom edges of the footing at a minimum of 1H:6V (or flatter) passes only through sound bedrock or a material of the same or higher capacity as the bedrock, such as concrete. A heavily fractured, weathered bedrock and/or overburden bearing medium will require a lateral support zone of 1.5H:1V (or flatter).

Bedrock/Soil Transition

Where a building is founded partly on bedrock and partly on soil, it is recommended to decrease the soil bearing resistance value by 25% for the footings placed on soil bearing medium to reduce the potential long-term total and differential settlements associated with the compressibility of the two bearing mediums.

It is recommended that the upper 0.5 m of the bedrock at the bedrock/soil transition area be removed for a minimum length of 2 m on the bedrock side and replaced with compacted OPSS Granular A or Granular B Type II material. The fill layer should be placed in maximum 300 mm thick loose lifts and compacted to 98% of the materials SPMDD.

The width of the sub-excavation should be at least the proposed footing width plus an additional 500 mm across the footing footprint. Additional steel reinforcement, if not already considered as part of the design, should extend at least 3 m beyond both sides of the 2 m long transition and placed in the top part of the footings and foundation walls.

Paterson will identify where this condition may arise during the detailed design and grading plan review stage once detailed design details are available for this assessment.



Permissible Grade Raise Restrictions

Discussion of Consolidation Testing and Assessment of Grading Restrictions

Paterson has undertaken field testing to measure in-situ stiffness of clay subsoils and laboratory testing to ascertain the deposits consolidation characteristics. The information yielded from the field and laboratory testing programs was used to complete settlement analysis based on existing in-situ conditions and potential long-term loading conditions in accordance with the City of Ottawa's Geotechnical Investigation and Reporting Guidelines for Development Applications in the City of Ottawa. The preconsolidation pressure measured within the unweathered portion of the deposit ranged between approximately 146 and 176 kPa.

Our analysis considered the effective stress resulting by the in-situ overburden, a reduction in the submergence of the unweathered grey clay layer by 0.5 m (i.e., increase in effective stress across this portion of this layer) to account for potential long-term dewatering, approximately 80% of the estimated available preconsolidation pressures and continuously applied foundation wall loads.

Footing loading is not considered when assessing grade raise restrictions throughout the roadways, such that the restriction recommended for structures may be increased slightly to accommodate an adjusted design condition and associated loading. The estimated restriction is then reduced by a factor of safety to provide a reasonable and appropriate restriction for grading throughout the subject site that mitigates overstressing the underlying clay deposit.

Permissible Grade Riase Recommendations

Where a deposit of silty clay is present below settlement sensitive structures and infrastructure, a grade raise restriction of **2 m** is recommended for residential structures provided with basements and founded upon either in-situ native subsoils or Paterson-reviewed and -approved soil fill capped with a maximum 300 mm thick layer of OPSS Granular A.

This value would reduce for areas of slab-on-grade structures where the ground surface is expected to be raised using crushed stone fill, as opposed to soil fill which is lighter in density. For this scenario, it is recommended that a grade raise restriction of **1.7 m** be considered for planning purposes and until further review of detailed grading of structure-specific grading is complete by Paterson at a detailed design stage.



The grade raise restriction for planning right-of-ways throughout the clay deposit is recommended to be up to **2.3 m** provided grading is accomplished using soil fill to raise the subgrade levels and crushed stone is provided as indicated in Section 5.6 of this report.

For buildings, the restriction would be measured at the limits of the grading surrounding the structure (i.e., the peaks in grading against a structure and at the interface between the driveway and garage for structures outfitted with garages).

If higher grade raises than the permissible grade raises identified herein are identified during the detailed design stage, preloading with or without a surcharge, lightweight fill and/or other measures would be advised upon by Paterson to mitigate the potential for unacceptable long-term post-construction total and differential settlements.

5.4 Design for Earthquakes

Seismic Site Designation and Earthquake Design of Structures

The seismic site designation for the design of structures supported by foundations founded upon a native, undisturbed compact to dense glacial till or sound bedrock bearing medium should be taken as a seismic **Site Designation X**c in accordance with the 2024 Ontario Building Code (OBC 2024).

The seismic site designation for the design of structures supported by foundations founded upon a native, undisturbed very stiff to stiff silty clay bearing medium should be taken as a seismic **Site Designation X**_D in accordance with OBC 2024.

Reference should be made to the latest revision of the Ontario Building Code for a full discussion of the earthquake design requirements.

Liquefaction and Cyclic Softening Assessment

Based on Paterson's review of the in-situ soils compactness and stiffness for non-cohesive and cohesive soils, the subsoils underlying the subject site are not considered susceptible to liquefaction or cyclic softening, respectively. This considers all laboratory testing results identified in Section 4.2 of this report, subsurface information identified on the Soil Profile and Test Data Sheets and current methodologies identified in the 5th editions of the Canadian Foundation Engineering Manual (CFEM).



Liquefaction of coarse-grained/sand-like soils was assessed using the stress-based simplified procedure identified in Section 18.6.3.2. and Section 18.6.3.5.2. of the current CFEM and per Idriss and Boulanger (2014). Cyclic softening of clay-like soils (considered as plasticity index greater than 7) has been assessed using the methodology identified in Section 18.6.3.7.3. of the current CFEM and per Idriss and Boulanger (2007, 2008).

In all cases, the factor of safety, defined as the ratio between the cyclic resistance ratio (CRR) and the cyclic stress ratio (CSR) is greater than 1.5. This considers proposed conceptual grading, the seasonal fluctuations in water levels identified in the current groundwater monitoring program and available seismic peakground acceleration data available by the National Building Code of Canada 2020 (NBCC 2020) for the subject site.

In conclusion, the subject site is not considered susceptible to liquefaction for cyclic softening from a geotechnical perspective.

5.5 Basement Slab/Slab on Grade Construction

With the removal of all topsoil and fill, containing deleterious or organic materials, the native soil or engineered fill specified by Paterson field personnel will be considered to be an acceptable subgrade surface on which to commence backfilling for basement floor slab or slab on grade construction.

Where the subgrade consists of silty sand in a loose state of compaction a suitably-sized vibratory drum roller should complete several passes over the subgrade surface as a proof-rolling program, reviewed and approved by Paterson at the time of construction. Any poor performing areas under proof rolling or soft areas should be removed and reinstated with an engineered fill, such as OPSS Granular A or Granular B Type II placed in maximum 300 mm thick loose lifts and compacted to a minimum of 98% of the material's SPMDD.

Any soft areas identified during the construction phase should be removed as based on Paterson field personnel's recommendations and backfilled with appropriate backfill material. OPSS Granular A or Granular B Type II are recommended for backfilling below floor slabs.

For structures of slab-on-grade construction, the upper 200 mm of sub-floor fill is recommended to consist of OPSS Granular A crushed stone. For structures with basement slabs, the upper 200 mm of sub-floor fill may consist of 19 mm clear crushed stone.



All backfill material within the footprint of the proposed buildings should be placed in maximum 300 mm thick loose layers and compacted to a minimum of 98% of the materials SPMDD. All grade raise fill used to raise the subgrade to the underside of the slab-on-grade should be placed in maximum 300 mm thick loose lifts. Soil fill reviewed and approved by Paterson during the construction phase would be advised to be compacted using a suitably sized vibratory sheepsfoot roller and as advised in Subsection 5.2 of this report.

5.6 Pavement Structure

For design purposes, the pavement structure presented in the following tables could be used for the design of car-only parking areas, local roadways and arterial roadways with bus traffic, if required.

Table 8 – Recommended Pavement Structure – Car Only Parking Areas/Driveways				
Thickness (mm)	Material Description			
50	Wear Course - HL-3 or Superpave 12.5 Asphaltic Concrete			
150	BASE - OPSS Granular A Crushed Stone			
300	SUBBASE - OPSS Granular B Type II			

SUBGRADE – Either in situ soils or OPSS Granular B Type I or II material placed over in situ soil.

Table 9 - Recommended Pavement Structure - Local Roadways

Material Description			
Wear Course - HL-3 or Superpave 12.5 Asphaltic Concrete			
Binder Course - HL-8 or Superpave 19.0 Asphaltic Concrete			
BASE - OPSS Granular A Crushed Stone			
SUBBASE - OPSS Granular B Type II			

SUBGRADE - Either in situ soils or OPSS Granular B Type I or II material placed over in situ soil



Table 10 - Recommended Pavement Structure – Collector Roadway with Bus Traffic				
Thickness (mm)	Material Description			
40	Wear Course - HL-3 or Superpave 12.5 Asphaltic Concrete			
50	Upper Binder Course - HL-8 or Superpave 19.0 Asphaltic Concrete			
50	Lower Binder Course - HL-8 or Superpave 19.0 Asphaltic Concrete			
150	BASE - OPSS Granular A Crushed Stone			
550	SUBBASE - OPSS Granular B Type II			
SUBGRADE - Either in situ soils or OPSS Granular B Type I or II material placed over in situ soil				

Minimum Performance Graded (PG) 58-34 asphalt cement should be used for local roadways and parking areas. Minimum Performance Graded (PG) 64-34 asphalt cement should be used for arterial roadways with bus traffic. The pavement granular base and subbase should be placed in maximum 300 mm thick lifts and compacted to a minimum of 100% of the material's SPMDD using suitable vibratory equipment.

If soft spots develop in the subgrade during compaction or due to construction traffic, the affected areas should be excavated and replaced with OPSS Granular B Type I or II material.

If bedrock is encountered at the subgrade level, the total thickness of the pavement granular materials (base and subbase) could be reduced to 300 mm. The upper 300 mm of the bedrock surface should be reviewed and approved by Paterson field personnel prior to placing the base and subbase materials. Care should be exercised to ensure that the bedrock subgrade does not have depressions that will trap water which would be subject to heaving and thawing due to freezing below the finished pavement structure.

Temporary Access Roads and Construction Traffic

Paterson anticipates that the earthworks contractor will require several haul roads, staging areas and other temporary access lanes to facilitate construction traffic. Paterson also anticipates construction traffic will be directed over unpaved access paths constructed using the base and subbase layers identified in the above-noted tables and will be used throughout the duration of the construction phase.



Omitting the asphalt layer, the above-noted pavement designs are not considered suitable to support temporary construction traffic without requiring additional measures to remediate the proposed base and subbase layers to accommodate the placement of asphalt to complete the pavement design.

Therefore, provisions should be carried to either reinstate temporary construction access and haul roads prior to placing asphalt or improve the durability of the temporary unpaved construction access and haul roads to minimize additional efforts for preparing the base course for the placement of asphalt once construction traffic would no longer be required. Examples of scenarios that would require these provisions would consist of areas which construction traffic results in rutting and compromising subgrade soils, placement of subbase layers directly over subgrade shortly following periods of spring thaw, snowmelt and rainfall events or over service trenches that may consist of poorly compacted backfill.

For planning purposes, temporary construction haul roads and working pads should be planned to be 600 mm of crushed stone consisting of a 500 mm of a combination of OPSS Granular B Type I or Type II crushed stone and/or blast-rock covered with a minimum 50 to 100 mm thick layer of OPSS Granular B Type II or OPSS Granular A crushed stone (to provide suitable surface for vehicle tires) over a Paterson-reviewed and -approved subgrade. These types of roads should also be underlain by a non-woven geotextile layer, such as Terraifx 200R, where they would be integrated into the final pavement structure and accommodate the placement of asphalt to minimize pumping of fines into the subbase layer. Cowpathing site-generated soil may also be considered to provide suitable haul and access roads.

Temporary access roads that will not support heavy truck traffic (i.e., conventional light-duty vehicles only) may be prepared using a minimum of 150 mm of OPSS Granular A and 400 mm of OPSS Granular B Type II crushed stone. However, provisions should be carried to provide a non-woven geotextile separation layer, such as Terrafix 200R, over the subgrade soils to lessen the amount of fines that migrate into the subbase layers in response to a combination of construction traffic and seasonal fluctuations in the subgrades performance. Provisions should also be carried to scarify and replace the upper 100 to 150 mm of these areas with clean OPSS Granular A crushed stone prior to placing asphalt.

Provisions should also be carried by the earthworks contractor to suitably compact trench backfill placed over services when reinstating servicing trenches below areas proposed to support paved areas.



Since it is anticipated this material would consist of workable brown silty clay, silty sand or glacial till fill (and not wet, non-workable grey silty clay or saturated materials) it is recommended to place this material in maximum 400 mm thick loose lifts compacted using a suitably sized vibratory sheepsfoot roller making several passes under the supervision of Paterson field personnel. The subgrade surface is also recommended to be provided with a layer of bi-axial geogrid, such as Terrafix TBX2500, to improve the stiffness of the reinstated trench backfill subgrade for supporting the final pavement structures.

These efforts would be reviewed, approved and advised upon by Paterson field staff during the construction program. Further, Paterson should review design, tender and construction documents associated with temporary and permanent pavement design throughout those phases of the project.

Pavement Structure Drainage

Satisfactory performance of the pavement structure is largely dependent on the contact zone between the subgrade material and the base stone in a dry condition. Failure to provide adequate drainage under conditions of heavy wheel loading can result in the fine subgrade soil being pumped into the voids in the stone subbase, thereby reducing load carrying capacity.

Where silty clay is anticipated at the pavement subgrade level, consideration should be given to installing subdrains during pavement construction. The subdrain inverts should be approximately 300 mm below subgrade level, and the subgrade surface should be crowned to promote water flow to the drainage lines.

5.7 Stormwater Management Facilities

It is expected stormwater management facilities (SWMF), such as ponds and associated infrastructure, will be considered as part of the proposed development. Design details for those facilities are not currently known at the time of preparing this report. However, these facilities are considered feasible throughout the subject site. Design details associated with these facilities should be reviewed and assessed by Paterson during the preliminary and detailed design stages when details are available at that time.

Report: PG4216-1 Revision 6 October 3, 2025



6.0 Design and Construction Precautions

6.1 Foundation Drainage and Backfill

Basement and Partial Basement Structures

Foundation Drainage

It is recommended that a perimeter foundation drainage system be provided for the proposed structures provided with a basement level. The system should consist of a 100 to 150 mm diameter perforated corrugated plastic pipe, surrounded on all sides by 150 mm of 19 mm clear crushed stone, placed at the footing level around the exterior perimeter of the structure. The clear stone should be wrapped in a non-woven geotextile. The pipe should have a positive outlet, such as a gravity connection to the storm sewer or sump pit. The foundation walls are recommended to be covered with a drainage geocomposite, such as CCW Miradrain 2000 or Delta-Teraxx, connected to the perimeter foundation drainage system.

Foundation Backfill - Non-Sump Gravity Foundation Drain

Backfill against the exterior sides of the foundation walls should consist of free draining non frost susceptible granular materials, such as clean sand or OPSS Granular B Type I granular material, or site generated workable soils placed in maximum 400 mm thick loose lifts and compacted using suitably sized compaction equipment. If consideration is given to backfilling the structures with crushed stone, Paterson should be advised of this during the tender process to review and advise on impacts to grade raise restrictions.

Foundation Backfill – Basements Equipped with Sump Pump Systems

Backfill against the exterior sides of the foundation walls should consist of workable, brown silty clay extending a minimum of 1.5 m away from and along the perimeter of the foundations and in accordance with recommendations provided in Subsection 5.2 of this report. The clay backfill must be implemented in conjunction with a drainage geocomposite and foundation drainage system connected to a dedicated sump pump system. Imported granular materials, such as clean sand or OPSS Granular B Type I granular material, <u>are not</u> recommended to be used for this purpose where sump pump systems are considered.

Report: PG4216-1 Revision 6 October 3, 2025



Slab-On-Grade Structures

Foundation Drainage

The perimeter foundation drainage system identified for basement structures is considered optional for slab-on-grade structures. Consideration should be given to implementing it below areas supporting hardscaping/settlement sensitive structures (i.e., driveways and pathways) to maintain the service life of these surfaces where the supporting subsoils consist of silty clay. Where implemented, the system should consist of a 100 to 150 mm diameter perforated corrugated plastic pipe wrapped in a geosock and surrounded by 150 mm of 19 mm clear crushed stone. The clear stone should be wrapped in a non-woven geotextile. The pipe should have a positive outlet, such as a gravity connection to the storm sewer.

The perimeter drainage pipe may be placed against the structure and with the invert placed a minimum of 600 mm below the subgrade of the overlying hardscaping and upon Paterson-reviewed and-approved compacted soil backfill to ensure adequate drainage of the overlying granular fill layer is provided from precipitation events and/or spring meltwater.

In this configuration, provided the backfill overlying the pipe consists of crushed stone fill associated with the hardscaping, a composite foundation drainage board will not be required. The installation of the perimeter drainage system should be reviewed by Paterson personnel at the time of construction.

Foundation Backfill

Backfill against the exterior sides of the foundation walls should consist of free draining non-frost susceptible granular materials (such as clean sand or OPSS Granular B Type I granular material) or site-generated workable soils placed in maximum 400 mm thick loose lifts and compacted using suitably sized compaction equipment. If consideration is given to backfilling the structures with crushed stone, Paterson should be advised of this during the tendering stage to review and advise on impacts to grade raise restrictions.

6.2 Protection of Footings Against Frost Action

Perimeter footings of heated structures are required to be insulated against the deleterious effect of frost action. A minimum of 1.5 m thick soil cover (or equivalent) should be provided in this regard.



Exterior unheated footings, such as those for isolated exterior piers, are more prone to deleterious movement associated with frost action than the exterior walls of the structure proper and require additional protection, such as soil cover of 2.1 m or a combination of soil cover and foundation insulation.

Foundations which are founded directly on clean, surface-sounded bedrock with no cracks or fissures, and which is approved by Paterson at the time of construction, is not considered frost susceptible and does not require soil cover. Where the bedrock is considered frost susceptible (i.e., weathered bedrock with soil in-filled fractures), foundation insulation will need to be provided if located within the depth of frost penetration, or, the frost susceptible bedrock will need to be removed and replaced with lean concrete (minimum 17 MPa 28-day strength).

6.3 Excavation Side Slopes

The side slopes of excavations in the overburden materials should either be cut back at acceptable slopes or should be retained by shoring systems from the start of the excavation until the structure is backfilled. It is assumed that sufficient room will be available for the greater part of the excavations to be undertaken by opencut methods (i.e. unsupported excavations).

Unsupported Side Slopes

The excavation side slopes above the groundwater level extending to a maximum depth of 3 m should be cut back at 1H:1V or flatter. The flatter slope is required for excavation below groundwater level. The slope cross-sections recommended are for temporary slopes.

The subsoil at this site is considered to be mainly a Type 2 and 3 soil according to the Occupational Health and Safety Act and Regulations for Construction Projects.

Excavated soil should not be stockpiled directly at the top of excavations and heavy equipment should be kept away from the excavation sides.

Slopes in excess of 3 m in height should be periodically inspected by the geotechnical consultant in order to detect if the slopes are exhibiting signs of distress. Excavation side slopes should also be protected from erosion by surface water and rainfall events by the use of tarpaulins or other means of erosion protection along their footprint in conjunction with dry conditions at the slope toes.



Excavation side slopes in sound bedrock can be completed with almost vertical side walls. A minimum of 1 m horizontal ledge should be left between the bottom of the overburden and the top of the sound bedrock surface to provide an area for potential sloughing.

It is recommended that a trench box be used at all times to protect personnel working in trenches with steep or vertical sides. It is expected that services will be installed by "cut and cover" methods and excavations will not be left open for extended periods of time.

6.4 Pipe Bedding and Backfill

Bedding and backfill materials should be in accordance with the most recent Material Specifications and Standard Detail Drawings from the Department of Public Works and Services, Infrastructure Services Branch of the City of Ottawa.

The pipe bedding for the sewer and water pipes should consist of at least 150 mm of OPSS Granular A crushed stone. However, when the bedding is located within firm, grey silty clay or upon bedrock subgrade, a minimum of 300 mm of OPSS Granular A should be placed for bedding for sewer or water pipes. The material should be placed in a maximum 225 mm thick loose lifts and compacted to a minimum of 99% of its SPMDD. The bedding material should extend at least to the spring line of the pipe.

The cover material, which should consist of OPSS Granular A, should extend from the spring line of the pipe to at least 300 mm above the obvert of the pipe. The material should be placed in maximum 225 mm thick lifts and compacted to a minimum of 99% of its SPMDD.

It should generally be possible to re-use the moist (not wet) site-generated fill above the cover material if the excavation and filling operations are carried out in dry weather conditions (and as described in Subsection 5.2 and Subsection 5.6 of this report). Wet site-generated fill will be difficult to re-use, as the high-water contents make compacting impractical without an extensive drying period and is not expected to be able to re-used readily.

Any stones greater than 200 mm in their longest dimension should be removed from these materials prior to placement. Well fractured bedrock should be acceptable as backfill for the lower portion of the trenches when the excavation is within bedrock provided the rock fill is placed only from at least 300 mm above the top of the service pipe and that all stones are 300 mm or smaller in their longest dimension.



Where hard surface areas are considered above the trench backfill, the trench backfill material within the frost zone (about 1.8 m below finished grade) should match the soils exposed at the trench walls to minimize differential frost heaving. The trench backfill should be placed in maximum 300 mm thick loose lifts and compacted to a minimum of 95% of the material's SPMDD.

Bedrock/Soil Transitions

In areas where the service subgrade transitions from soil to bedrock, it is recommended that the founding medium be inspected in the field to determine how steeply the bedrock surface, where encountered, drops off. A transition treatment is generally recommended to be provided where the bedrock slopes steeper than 3H:1V. At these locations, the bedrock should be excavated, and a minimum 500 mm thick layer of bedding, such as OPSS Granular A crushed stone, be placed to provide a 3H:1V transition from the bedrock subgrade toward the soil subgrade. This treatment will reduce the propensity for bending stresses to occur in the service pipe alignments.

It is recommended that this condition be reviewed in the field by Paterson personnel at the time of excavation and construction of site services. Paterson field personnel may advise on appropriate treatments where pipe subgrade transition between soil and bedrock surfaces.

Glacial Till to Clay Deposit Transitions

In areas where site servicing trenches advance across transitions between relatively shallow deposits of glacial till (shallow relative to bedrock surface) and deeper deposits of clay, glacial till soils consisting of predominantly fine-grained fines matrixes and high in-situ moisture levels will be difficult to place bedding materials upon. It is expected these soils will be in a relatively loose state of compactness and be readily disturbed by vibrations induced by compaction equipment. It would be expected that satisfactory dewatering efforts would be undertaken ahead of the trenching works to ensure efforts may be undertaken in the dry.

It is recommended that provisions be carried to provide localized bedding layers that may exceed 150 to 300 mm (i.e., in the range of 500 mm to 1 m and potentially higher) to place the bedding material upon compact to dense glacial till soils that would underlie the shallower looser material. Thickened bedding layers would be recommended to consist of OPSS Granular B Type I or II crushed stone and/or suitably-fragmented and -sized blast rock, if available. During the detailed design phase, Paterson will review all site servicing drawings to identify areas where the above-noted transition zone treatment would be expected to be considered.



Backfilling Within Trench Boxes

When the bedding and cover material is placed within the confines of a trench box and steel plates, it is recommended that the trench box be placed tightly against the outside of the trench walls and remains approximately 300 mm above the obvert level of the service pipe.

The vertical excavation sidewalls within the lower portion of the trench (below the obvert level of the pipe) can be supported using steel plates extended down to the bottom of the trench. The steel plates can be extended below the base of the excavation to prevent basal heave, in conjunction with adequate dewatering measures when located below the groundwater table.

To minimize the potential for disturbance of the bedding and cover material and subsequent settlement of the service pipe during the removal of the steel plates, it is recommended that the bedding layer be re-compacted tightly against the trench sidewalls upon removal/lifting of the steel plate up to the top of the bedding layer and prior to placing the pipe. This is recommended to mitigate settlement of the pipe that would results from removing the plates without re-compacting the fill that would be left unconfined to the sides of the trench. This procedure would be repeated for the springling and cover layers until the steel plates are removed.

It is generally recommended that this procedure be reviewed by Paterson field personnel at the time of construction.

6.5 Groundwater Control

Groundwater Control for Building Construction

It is anticipated that groundwater infiltration into the excavations through the clayey overburden materials should be low to moderate and controllable using open sumps. Higher infiltration rates are anticipated to be encountered within the glacial till and below the bedrock surface. It is recommended that dewatering in support of site services and excavations undertaken below the groundwater table throughout the glacial till deposit and bedrock formations be assessed by a professional hydrogeologist during the detailed design stage.

The contractor should be prepared to direct water away from all bearing surfaces and subgrades, regardless of the source, to prevent disturbance to the founding medium.



Permit to Take Water

A temporary Ministry of the Environment, Conservation and Parks (MECP) permit to take water (PTTW) may be required for this project if more than 400,000 L/day of ground and/or surface water is to be pumped during the construction phase. A minimum 4 to 5 months should be allowed for completion of the PTTW application package and issuance of the permit by the MECP.

For typical ground or surface water volumes being pumped during the construction phase, typically between 50,000 to 400,000 L/day, it is required to register on the Environmental Activity and Sector Registry (EASR). A minimum of two to four weeks should be allotted for completion of the EASR registration and the Water Taking and Discharge Plan to be prepared by a Qualified Person as stipulated under O.Reg. 63/16.

6.6 Winter Construction

Precautions must be taken if winter construction is considered for this project.

The subsoil conditions at this site consist of frost susceptible materials. In the presence of water and freezing conditions, ice could form within the soil mass. Heaving and settlement upon thawing could occur.

In the event of construction during below zero temperatures, the founding stratum should be protected from freezing temperatures by the use of straw, propane heaters and tarpaulins or other suitable means. In this regard, the base of the excavations should be insulated from sub-zero temperatures immediately upon exposure and until such time as heat is adequately supplied to the building and the footings are protected with sufficient soil cover to prevent freezing at founding level.

Trench excavations and pavement construction are also difficult activities to complete during freezing conditions without introducing frost in the subgrade or in the excavation walls and bottoms. Precautions should be taken if such activities are to be carried out during freezing conditions. Under winter conditions, if snow and ice is present within the blast rock or other fill below future basement slabs, then settlement of the fill should be expected and support of a future basement slab and/or temporary supports for slab pours will be negatively impacted and could undergo settlement during spring and summer time conditions. The geotechnical consultant should complete periodic inspections during fill placement to ensure that snow and ice quantities are minimized in settlement-sensitive areas.

Report: PG4216-1 Revision 6 October 3, 2025



6.7 Corrosion Potential and Sulphate

The results of analytical testing show that the sulphate content is less than 0.1%. These results are indicative that Type 10 Portland cement (normal cement) would be appropriate for this site. The results of the chloride content, pH and resistivity indicate the presence of a non-aggressive to slightly aggressive environment for exposed ferrous metals at this site. No further requirements are needed to be considered for this item.

6.8 Landscaping Considerations

Tree Planting Restrictions

Paterson completed a soils review of the site to determine applicable tree planting setbacks, in accordance with the City of Ottawa Tree Planting in Sensitive Marine Clay Soils (2017 Guidelines) for trees planted within a public right-of-way (ROW). Atterberg limits testing was completed for recovered silty clay samples at selected locations throughout the subject site. Grain size distribution and hydrometer testing was also completed on selected soil samples. The above-noted test results were completed on samples taken at depths between the anticipated underside of footing elevation and a 3.5 m depth below finished grade. The results of our testing are presented in Tables 1 and 2 in Subsection 4.2 and in Appendix 1.

Based on the results of the Atterberg limit testing mentioned above, the plasticity index was found to be less than 40% in all the tested clay samples. In addition, based on the clay content found in the clay samples from the grain size distribution test results, moisture levels and consistency, the silty clay across the subject site is considered low to medium potential for soil volume change.

The following tree planting setbacks are recommended throughout the subject site where silty clay was encountered, and as depicted in Drawing PG4216-3 - Permissible Grade Raise Plan. Large trees (mature height over 14 m) can be planted within these areas provided a tree to foundation setback equal to the full mature height of the tree can be provided (e.g. in a park or other green space). Tree planting setback limits may be reduced to **4.5 m** for small (mature height up to 7.5 m) and medium size trees (mature tree height 7.5 to 14 m), provided that the conditions noted below are met:

The underside of footing (USF) is 2.1 m or greater below the lowest finished grade must be satisfied for footings within 10 m from the tree, as measured from the centre of the tree trunk and verified by means of the Grading Plan as indicated procedural changes below.



A small tree must be provided with a minimum of 25 m ³ of available soil
volume while a medium tree must be provided with a minimum of 30 m ³ of
available soil volume, as determined by the Landscape Architect. The
developer is to ensure that the soil is generally un-compacted when
backfilling in street tree planting locations.
The tree species must be small (mature tree height up to 7.5 m) to medium size (mature tree height 7.5 m to 14 m) as confirmed by the Landscape
Architect.
The foundation walls are to be reinforced at least nominally (minimum of
two upper and two lower 15M bars in the foundation wall).
Grading surround the tree must promote drainage to the tree root zone (in
such a manner as not to be detrimental to the tree)

It is well documented in the literature, and is our experience, that fast-growing trees located near buildings founded on cohesive soils that shrink on drying can result in long-term differential settlements of the structures. Tree varieties that have the most pronounced effect on foundations are seen to consist of poplars, willows and some maples (i.e. Manitoba Maples) and, as such, they should not be considered in the landscaping design.

6.9 Slope Stability Analysis

Due to the presence of Marlborough Creek along the northern property line, a slope stability assessment was completed for the slope located along the north property line of the subject site. Based on the existing topographic information, the creek's south side slope ranges in height between 1.5 to 2.5 m. The bottom of the water course was found to be at an elevation of 92 m while the average top of slope was found at an elevation of 94 m. The horizontal length of the slope face including the flood plain was estimated to range between 16.5 and 65.5 m. It is our understanding that the proposed development is expected to raise the overall site grade between 1 to 1.5 m above existing grade.

The subsurface profile across the subject slope face is expected to consist of brown silty clay along the east portion of the site overlying glacial till and bedrock. The slope along the west portion of the site is expected to consist of glacial till overlying bedrock. Based on our assessment of the above information, the existing slope is expected to have an inclination between 6H:1V and 26H:1V. The slope inclination may be increased upon the completion of the proposed development with slopes ranging between 4.5H:1V and 16.5H:1V. Therefore, the subject slope is considered stable and acceptable from a geotechnical perspective with no restrictions/setbacks required to protect the slope as result of developing the subject site.



7.0 Recommendations

It is a requirement for the foundation design data provided herein to be applicable that a material testing and observation services program including the following aspects be performed by the geotechnical consultant.

Grading plan review from a geotechnical perspective, once the final grading plan is available.
Observation of all bearing surfaces prior to the placement of concrete.
Sampling and testing of the concrete and fill materials.
Periodic observation of the condition of unsupported excavation side slopes in excess of 3 m in height, if applicable.
Observation of all subgrades prior to backfilling.
Field density tests to determine the level of compaction achieved.
Sampling and testing of the bituminous concrete including mix design reviews.
Review and installation of the foundation drainage system.

A report confirming that these works have been conducted in general accordance with Paterson's recommendations could be issued upon the completion of a satisfactory material testing and observation program by the geotechnical consultant.

All excess soil must be handled as per *Ontario Regulation 406/19: On-Site and Excess Soil Management*.



8.0 Statement of Limitations

The recommendations made in this report are in accordance with Paterson's present understanding of the project. Paterson requests permission to review the grading plan once available. Paterson's recommendations should be reviewed when the drawings and specifications are complete.

The client should be aware that any information pertaining to soils and the test hole log are furnished as a matter of general information only. Test hole descriptions or logs are not to be interpreted as descriptive of conditions at locations other than those of the test holes.

A soils investigation is a limited sampling of a site. Should any conditions at the site be encountered which differ from those at the test locations, Paterson requests to be notified immediately to permit reassessment of the recommendations.

The present report applies only to the project described in this document. Use of this report for purposes other than those described herein or by person(s) other than Tamarack (Richmond) Corporation, or their agent(s), is not authorized without review by Paterson for the applicability of our recommendations to the alternative use of the report.

Paterson Group Inc.

Drew Petahtegoose, P.Eng.

October 3, 2025 D. J. PETAHTEGOOSE TO 100568013

Faisal I. Abou-Seido, P.Eng.

Report Distribution:

- ☐ Tamarack (Richmond) Corporation (email copy)
- ☐ Paterson Group (1 copy)



APPENDIX 1

SOIL PROFILE AND TEST DATA SHEETS

SYMBOLS AND TERMS

ATTERBERG LIMITS TESTING RESULTS

GRAIN SIZE DISTRIBUTION AND HYDROMETER TESTING RESULTS

CONSOLIDATION TESTING RESULTS

ANALYTICAL TESTING RESULTS

HYDRUALIC CONDUCTIVITY RESULTS



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

ELEVATION: 95.31 COORD. SYS.: UTM ZONE 18 **EASTING:** 435369.03 **NORTHING:** 5003654.34

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:					DATE: N	larch 6	, 202	25		HOLE	NO. :	BH 1-25	5	
				S	AMPLE				EN. RES	0mm DI	A. CONE)		
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	Rad	WATER CONTENT (%)	Δ		40 ULDED S AINED S	HEAR S		80 TH (kPa) FH (kPa) 80	MONITORING WELL CONSTRUCTION	ELEVATION (m)
	TRAI	DEPTH (m)	, YE	ECO	N OR RQD	VATE		PL (%)	WATE	R CONT	ENT (%)	LL (%)	MONIT	EV
GROUND SURFACE TOPSOIL 0.28m [95.03m]	05		 -	12		>			40)	60	80 '	20	
GLACIAL TILL: Brown silty clay, some gravel and	A A A A	-	X \{											95
sand ,cobbles and boulders 0.61m [94.70m]/	A A A A	-												}
GLACIAL TILL: Compact, brown silty sand, trace	A A A A	1-	SS 2	64	2-8-50-/ 58/0.2								1.03 m 202	4 25-03-12 -
clay and gravel ,cobbles and boulders		=												94
BEDROCK: Good to excellent quality limestone		-	RC 1	100	DOD 70									
		2-	M M	100	RQD 78									
		-												93
		-												
		3-											3	.05m
		-	RC 2	100	RQD 95									92
		-										· · · · · · · · · · · · · · · · · · ·		
		4-												
		- -	RC 3	100	RQD 100									91
4.57m [90.75m]		=	, ř	100	1100									.57m
End of Borehole		_												
GWL at 1.03 m depth - March 12, 2025)		5-												
0 V L at 1.00 III dopai - Maioii 12, 2020)		-												90
		=												
		6-												
		-												89
		=												
		7-												
		=												88
		=											•	
		8-												
		-												87
		=]											
		9_												
		9-	1							-				00
		=	1											86
		40												
		10 -	OF DATE					: :	<u> </u>		<u> </u>	<u> </u>		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435568.93 **NORTHING:** 5003478.60 **ELEVATION:** 96.60

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Track Mounted Drill Rig

EMARKS:					DATE: M	10110	, 202			ST. (BLOWS	: BH 2-2		Т
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	AMPLE	R CONTENT (%)	Δ.	20 REMO	DCPT (50 40 ULDED SH AINED SH	60 HEAR STRE	NGTH (kPa)	MONITORING WELL CONSTRUCTION	E VATION (m)
	RATA	DEPTH (m)	PE A	SO	N OR RQD	WATER (%)		20 PL (%)	40 WATER	60 CONTENT	80 (%) LL (%)	- NSTA	1
GROUND SURFACE	ST	<u> </u>	₽	쀭	ž	≸		20	40	60	80	₹8	Ū
OPSOIL 0.28m [96.32m]		. =											8
LL: Brown silt, with gravel, with gravel, trace clay,		=	₹										≬ _
and and crushed stone 0.69m [95.91m]	<u>/</u>	=	RC 1	400	DOD 50								9
EDROCK: Fair to good quality limestone		1-	RC	100	RQD 53							1.21 m▼ 202	.] 25-03-
Good quality below 2.6 m depth	井井	=											9
zoou quam, zoon <u>z</u> io iii aopiii	苗	=	RC 2	86	RQD 36								
		2-											
		=											1
		=											9
		3-										<u> </u>	
	井井	=	RC 3	100	RQD 76								
		Ξ	2	100	RQD 70							3.	.43m
		=											
		4											
		=	4										
	井井	=	RC 4	97	RQD 83								(
4.95m [91.65m]	井井	5—											.95m
nd of Borehole		J _											
		=						i i					
WL at 1.21 m depth - March 12, 2025)		=											
		6											
		=											
		=											9
		_ =											
		7-											
		=											
		=											1
		8-											
		=											
		=											8
		_ =											
		9-											
		=					l						
		_						:				``	8

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Track Mounted Drill Rig

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 17:51 Paterson_Template

REMARKS: DATE: March 6, 2025 HOLE NO.: BH 3-25

REMARKS:					DATE: N	1arch 6	5, 2025	HOLE NO.: BH 3-25	5
				s	AMPLE			SIST. (BLOWS/0.3m) 50mm DIA. CONE)	
			Ġ.			Ë	20 40	0 60 80	NELL (
SAMPLE DESCRIPTION	STRATA PLOT	Ê	TYPE AND NO.	RECOVERY (%)	٩	WATER CONTENT (%)	△ REMOULDED S ▲ UNDRAINED S	SHEAR STRENGTH (kPa) SHEAR STRENGTH (kPa)	MONITORING WELL CONSTRUCTION ELEVATION (m)
	SATA	DEPTH (m)	≥E AN	COVE	N OR RQD	TER (%	20 40 PL (%) WATE	0 60 80 R CONTENT (%) LL (%)	NSTR NSTR
GROUND SURFACE	ST	冒	E	2	ž	≸	20 40	0 60 80	₩ 8 8 8 E
TOPSOIL and organics 0.25m [95.51m]	· ZXX	. =	, -						
Loose, brown CLAYEY SILT, trace sand		=	¥ ¥						
- Trace gravel by 0.7 m depth		1	SS 2	75	2-2-2-5				95
1.45m[94.31m]		=	\bigvee 88	13	4				
Compact, brown SILTY SAND, trace gravel		-	m ~						94
		2	SS 3	83	5-11-15-17 26				94
2.41m [93.35m]			SS 4	100	50-/-/-/				2.38 m 2025-03-12
BEDROCK: Excellent to fair quality limestone		-			50/0.1				E E 93
		3	-						
		=	RC 1	100	RQD 90				3.35m
		-							92
		4							
		=	RC 2	74	RQD 56				
4.90m [90.86m]		=	"						91 4.88m
End of Borehole		5							4.0011
(GWL at 2.38 m depth - March 12, 2025)		=							
(GWL at 2.36 in deptir - March 12, 2023)		=							90
		6-							
		=							
									89
		7-							
		=							
									88
		8-							
		=							
		9							87
		-							
		=							
		10 -							86

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Track Mounted Drill Rig

DATE: March 6, 2025

HOLE NO.: BH 3A-25

REMARKS:					DATE:	March 6	, 202	25		HOL	.E NO. :	BH 3A-	25	
				S	AMPLE			= F			BLOWS/0.3			
						—		20	DCPT ((50mm 1 40	DIA. CONE 60) 80	∣∃	
			o.	(%)		E	Δ				STRENG		_	E
SAMPLE DESCRIPTION	STRATA PLOT	<u>~</u>	TYPE AND NO.	RECOVERY (%)		WATER CONTENT (%)	_ _				STRENGT		MONITORING WELL CONSTRUCTION	ELEVATION (m)
		DEPTH (m)	¥	Ä	N OR RQD	8 S S		20	4	40	60	80	_ 교통	E
	₹	교	7		용	ATE		PL (%)	WATI	ER CON	TENT (%)	LL (%)	INO	≧
GROUND SURFACE	S	_ <u>=</u>		22	z	≥		20		40	60	80	≥ 5	□
For soil profile refer to BH 3-25		- =												
]] :
		=							:					95-
		1-											0.	89m
		'=							:					-
]												-
		=							:					04
		الله ا											1.88 m 202	5-03-12 -
		2-							:					-
2.41m [93.35m]	-								i				2.	1 41m
End of Borehole									:			: :		93
		3												93-
(GWL at 1.88 m depth - March 12, 2025)		3							:					-
														-
]												00 -
									:					92-
		4 =												-
]												
														91-
		5												91-
									:					
]												-
									:					90-
		6												90 -
									:					
]												-
														89-
		7-												09
		'							:					
]												-
														88
		8-												00
]						ii.		.ii.				-
														87-
		9-												01 -
		"							:					
									:					86
		10							:					00 -

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435611.53 **NORTHING:** 5003727.26 **ELEVATION:** 97.14

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Track Mounted Drill Rig

REMARKS: DATE: March 6, 2025 HOLE NO.: BH 4-25

REMARKS:					DATE: N	1arch 6	, 2025	5		HOLE I	NO. :	BH 4-	25		
				S	AMPLE			= F		SIST. (BLO 50mm DIA				_	
SAMPLE DESCRIPTION	STRATA PLOT	DЕРТН (m)	TYPE AND NO.	RECOVERY (%)	RQD	R CONTENT (%)		UNDR 20	AINED S	SHEAR ST HEAR ST	RENGTI 60	H (kPa) 80		MONITORING WELL CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STRA	DEPT	TYPE	RECO	N OR RQD	WATER (%)	F	PL (%) 20	WATE	R CONTEI	NT (%) 60	LL (%)		MONI	ELEV.
TOPSOIL and organics 0.25m [96.89m], GLACIAL TILL: Compact, brown silty clay, with	V V V V	· -	A X												97 -
gravel, trace sand ,cobbles, boulders		1-	RC 1	85	RQD 85										96-
		2-	RC 2	68	RQD 58										95-
		3-	RC 3	76	RQD 58									3,43	94 -
		4-											3.7	6 m 2025	
5.03m [92.11m]		5	RC 4	100	RQD 54									4.98	
End of Borehole (GWL at 3.76 m depth - March 12, 2025)															92 -
(GWL at 3.70 m doptii - Maion 12, 2023)		6-													91-
		7-													90 -
		8													
															89 –
		9-													88-
		10 -								-					

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Track Mounted Drill Rig

PEMARKS:

DATE: March 7, 2025

HOLE NO.: BH 5-25

REMARKS:					DATE: M	larch 7	, 202).: BH 5	-25	
				S	AMPLE			■ P		IST. (BLOWS 0mm DIA. C			
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	άD	R CONTENT (%)	△		40 ULDED S	60 HEAR STRE	80 ENGTH (kPa) NGTH (kPa) 80	MONITORING WELL CONSTRUCTION	ELEVATION (m)
	TRAT	DEPTH (m)	YPE ,	EC0	N OR RQD	WATER (%		PL (%)	WATER	CONTENT	(%) LL ₍ (%) TINOI	LEVA:
GROUND SURFACE TOPSOIL	· ν		À	~	Z	>	:	20	40	60	80	X X	×
TOFSOIL		. =	₹ 									0.34 m <u>2</u> 20	
0.86m [94.67m]		-											95
GLACIAL TILL: Compact, brown silty sand, some	^ ^ ^ ^ ^	1-	SS 2	67	3-12-17-23								Š
gravel and cobbles, trace clay 1.45m 94.08m	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	=	SS 3 8	0	29 50-/-/-/		:						94
BEDROCK: Excellent quality limestone		=			50/0.03								94
		2	RC 1	100	RQD 100								3
		=					:						=
		=											93
		3	2					<u>.</u>					<u>-</u>
		=	RC 2	100	RQD 100								3 43m
		=											3.4 ^{3m} 92
		4											
		=	RC 3	100	DOD 05								
		=	2	100	RQD 95								91
4.95m [90.58m] End of Borehole		5											4.95m
Lift of Boreffole		=					:						
(GWL at 0.34 m depth - March 12, 2025)		=											90
		6											
		=											
		=											89
		7											
		=											
		-					:					(·····	88
		8											
		=					:						
		=											87
		9											
		1											
]											86
		10							<u>i</u>				

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION: 94.12 EASTING:** 435817.85 **NORTHING:** 5004471.80

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:					DATE: M	larch 7	, 202	25		HOLE	NO. :	BH 6-25		
				s	SAMPLE				DCPT (5	0mm DIA	OWS/0.3)	7	
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	ER CONTENT (%)	Δ	UNDRA 20	AINED S 40	HEAR S	60 TRENGT TRENGT 60	H (kPa) 80	MONITORING WELL	ELEVATION (m)
GROUND SURFACE	STR/	DEP.	TYPE	REC	N O R	WATER (%		PL (%)	WATER 40	R CONTE	ENT (%) 60	LL (%)	MON	EE
TOPSOIL and organics 0.20m [93.92m]	V V V V		—							-				94 –
GLACIAL TILL: Compact, brown silty clay, some	A A A A	=	¥ ¥							<u>:</u> :			0.61 m T 202	5-03-12
sand, trace gravel 0.61m[93.52m]/	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	1—	7		0.47.40.47									
GLACIAL TILL: Dense to very dense, brown sandy silt, with gravel, cobbles and boulders	A A A A	' - -	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	/9	6-17-13-17 30									93-
, ,	\(\times \) \(\t	=	m ه											
0.04., [04.00.,]	^ ^ ^ ^ ^	2	SS 3	46	10-21-34-27 55									00
GLACIAL TILL: Compact, brown silty sand, trace		=												92-
gravel and cobbles , boulders		=	SS 4	75	7-9-11-11 20									-
		3			20	,		: :		<u>.</u>			3.0] ^{)5m} ษ1–
		-	88.5	83	9-12-13-12 25									
- Grey by 3.73 m depth		=			25									
		4-	SS 6	43	3-8-50-/ 58/0.25									90-
4.57m [89.56m]		-											45	57m
End of Borehole		_ =											1.0	
Practical refusal to augering at 4.57 m depth		5— -												89-
		=								<u>:</u>				
(GWL at 0.61 m depth - March 12, 2025)		6												
		- -												88
		=								<u>.</u>				
		7												07
		-												87-
		=											`	
		8 _												86-
		=												
		=												
		9 _												85-
		=											.	
		10 =												
	L DD6-	10 -								: 				

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 ELEVATION: 94.05 **EASTING:** 435895.27 **NORTHING:** 5004286.27

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Hang Auger

REMARKS:				e.	DATE: A	agust 2	- 1, 20		PEN. RES		LE NO. : BLOWS/0.3				Т
SAMPLE DESCRIPTION	STRATA PLOT	1 (m)	TYPE AND NO.	RECOVERY (%)		WATER CONTENT (%)	Δ.	20 REMO	DCPT (4 ULDED	50mm 0 SHEAF	DIA. CONE 60 R STRENG 8 STRENG	E) 80 TH (kPa)		PIEZOMETER CONSTRUCTION	(NO HAVE IN
	TRAT	DEPTH (m)	YE	ECO	N OR RQD	WATER		PL (%)	WATE	R CO	NTENT (%)	LL (%)	IEZOI	1
GROUND	SURFACE			12		>		20	4	0	60	80 '		E 0	9.
	[93.80m]	-													
rown SILTY CLAY] -					:	:	:			:			
] -	-										:		
		_													
0.90m	[93.15m]														
d of Hand Auger Hole		1-	-												
		-	-												
		-													
		-													
] -					:						:		
		2-	1												
		-	-				:					•			
		-	1												
		-					:					:			
			1												
		-	+					<u>.</u>							
		-	1				:					• • •			
		3-	-												
		-													
		-	-												
		-											:		
		-													
		-													
		4-	1						:			:			
		-	-				:								!
													<u>:</u>		
		-	-				:					-			
			1												
		-											<u>.</u>		
		-	1					:					:		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

EASTING: 435840.63 **NORTHING:** 5004193.74 **ELEVATION:** 93.84

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Hang Auger

P:/AutoCAD Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-09-11, 11:18 Paterson_Template

COORD. SYS.: UTM ZONE 18

REMARKS:						DATE: A	August 2		N PES	IST. (BLO)		HA 2-25		
		_		ö		AMPLE	EN .	D	CPT (5 40	0mm DIA.	CONE) 80	NO	
SAMPLE DESCRIPTION		STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	WATER CONTENT (%)	▲ UNDRAI	NED S 40	HEAR STF	RENGT	H (kPa) 80	PIEZOMETER CONSTRUCTION	ELEVATION (m)
(GROUND SURFACE	STR/	DEPI	ĭ₹	REC	N S	WATI	PL (%)	WATEF 40	CONTEN	IT (%) 0	LL (%)	PIEZ	ELE)
OPSOIL														
	0.30m[93.54m]		-											
Brown SILTY CLAY			-											
			_					: :			:			
	0.85m [92.99m]		-	<u>6</u>										
nd of Hand Auger Hole	0.05111 [92.95111]	<u> </u>	-											9
·			1-											
			-											
			-											
			-											
			-								:			
			_											9
			2-											
			_											
			-											
			-											
			_											
			-											
			3-											
			-											
			-											
			_											
			-											
			_											(
			4 —											`
			-									· · · · · · · · · · · · · · · · · · ·		
			_											
			-											
			-								:			
			-											
			5											8

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Hang Auger

REMARKS:						DATE: A	August 2	21, 202				LE NO. :		5-25		
					S	AMPLE			■ F		50mm	BLOWS/0.: DIA. CONI 60				
SAMPLE DESCRIPTION		STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	g;	WATER CONTENT (%)	Δ I	REMO	ULDED:	SHEAF	R STRENG R STRENG 60	TH (kPa)		PIEZOMETER CONSTRUCTION	ELEVATION (m)
		TRAT	DEPTH (m)	YPE ,	ECO\	N OR RQD	ATER	PI	_ (%)	WATE	R COI	NTENT (%)	LL _. (%	6)	IEZON	FVA
GF TOPSOIL	ROUND SURFACE	Ś		<u> </u>	~	z	>	:	20	4	0	60	80		<u> </u>	—
TOFSOIL	_0.25m [93.53m]							:					•			
Brown SILTY CLAY			-													
			-													
								:					-			
			-													93
			1_	<u>6</u>												
= 1.611 1.0	1.10m [92.69m]	<i>[2222]</i>	' -													
End of Hand Auger Hole																
			-					:				: :	:			
			-										:			
																9
			2-													
													:	:		
			-													
			-													
																9
			-										:	:		
			3-													
			-													
			-					:					:			
													:	:		
			-													9
			4													
			-					:					:	:		
			-													
			-					:					• • •			
			-					:		-			· · · · · · · · · · · · · · · · · · ·			
			-													89
								:			:		:	:		0

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/AutoCAD Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-09-11, 11:18 Paterson_Template



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION: 93.88 EASTING:** 435856.94 **NORTHING:** 5004047.50

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216**

ADVANCED BY: Hang Auger

ADVANCED BY: Hang Auger															
REMARKS:						DATE: /	August 2	21, 2	025		HOL	E NO. :	HA 4-25	j	
					S	AMPLE			D	CPT (5	0mm D	LOWS/0. DIA. CON	E)		
SAMPLE DESCRIF	PTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	9	WATER CONTENT (%)	Δ	20 REMOUL	40 DED S	HEAR	60 STRENG	80 GTH (kPa) GTH (kPa) 80	PIEZOMETER CONSTRUCTION	ELEVATION (m)
		RAT	DEPTH (m)	ĨE /	S	N OR RQD	ATER (PL (%)	WATER	CONT	TENT (%) LL (%)	EZON	EVA]
	GROUND SURFACE	S	8		22	z	*		20	40		60	80	_ ₹8	ᆸ
TOPSOIL															
	0.30m[93.58m]		_												
Brown SILTY CLAY			-												
	0.65m [93.22m]		_	<u>6</u>											
End of Hand Auger Hole	0.03111 [93.22111]	VYXZ	-								-				
			_									:			93-
			1—												
			_												
			_												
			-												
			_								:	:			
			-												
			_								-				92
			2-												
			_												
			-								:	:			
			_												
			-												
			_												91
			3-												
			_												
			-												
			_								Ė	:			
			-												
			_												90
			4-												
			_												
			-												
			_												
			_												
			-												
												•			89-
			5						1 1	<u>i i</u>	- 1	1	<u> </u>		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435913.96 **NORTHING:** 5003979.17 **ELEVATION:** 93.79

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Hang Auger

MARKS:					DATE: A	ugust 2	21, 2			: HA 5-25	
				S	AMPLE				N. RESIST. (BLOWS/0 CPT (50mm DIA. CO		
						늘		20	40 60	80 80	
SAMPLE DESCRIPTION	TO		Š.	(%)		N N	Δ	REMOUL	DED SHEAR STREN	GTH (kPa)	K [
5 12 2200M 110M	STRATA PLOT	Œ	TYPE AND NO.	RECOVERY (%)	e	WATER CONTENT (%)	A	UNDRAI	NED SHEAR STREN	GTH (kPa)	PIEZOMETER CONSTRUCTION
	ZATA	DEPTH (m)	Й А	50	N OR RQD	H _		20 PL (%)	40 60 WATER CONTENT (9	80 %) LL _. (%)	ZON
GROUND SURFA	ACE K				O Z	×		20	WATER CONTENT (9	80	불흥
PSOIL											
0.25m [93.5	4m]	-									
wn SILTY CLAY		-									
		-							iiiii	<u> </u>	
		-									
A		1 -	<u></u>					<u>.</u>			
0.85m [92.9 I of Hand Auger Hole	4m] / / //] -									
or riana Auger Flore		1-						<u>.</u>	ļļļļ		
		-									
		-									
		-									
		-]								
		-									
		-	-								
		2-						: : 			
		-									
		-						<u></u>	<u> </u>	<u> </u>	
		-	1								
		-									
		-									
		-]								
		-									
		3-									
		-]								
		-									
		-	j								
		-									
		-									
		-]								
		4-						<u> </u>			
		-									
		-]								
		-									
		-									
		-									
		-									
		5									

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 436026.01 **NORTHING:** 5003971.20 **ELEVATION:** 93.83

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Hang Auger

P:/AutoCAD Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-09-11, 11:18 Paterson_Template

REMARKS:						DATE: /	august 2	۷۱, ۷		PEN. RES		BLOWS/0.3	HA 6-25		
					S	AMPLE	¥		20	DCPT (5	0mm	DIA. CONE	E) 80		
SAMPLE DESCRIPTION		STRATA PLOT	(E)	TYPE AND NO.	RECOVERY (%)	ζΦD	WATER CONTENT (%)	△			HEAR	STRENGT STRENGT 60		PIEZOMETER CONSTRUCTION	EI EVATION (m)
C	GROUND SURFACE	STRAT	DEPTH (m)	TYPE	RECO	N OR RQD	WATE		PL (%)		RCON	ITENT (%) 60		PIEZO	H
TOPSOIL			• -						20	40	:	- 00			
Brown SILTY CLAY	0.25m [93.58m]		-												
			-												
			-	—											
nd of Hand Auger Hole	0.85m [92.98m]		-	0							-		· · · · · · · · · · · · · · · · · · ·		9
Ç			1-												
			-												
			-												
			-												
			-												9
			2-							[]					
			-												
			-												
			-												
			-												
			3-												
			-												
			-												
			-												
			-												9
			4 —										<u>i</u> i		
			-												
			-												
			-												
			-												8
			5	1											

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 436123.11 **NORTHING:** 5003874.87 **ELEVATION:** 94.36

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Hang Auger

P:/AutoCAD Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-09-11, 11:18 Paterson_Template

REMARKS:						DATE: /	August 2	۷۱, ۷		PEN. RFS		BLOWS/0.3	HA 7-2	.5		—
					S	AMPLE	Į.		20	DCPT (5 40	0mm [DIA. CONE	E) 80		_	
SAMPLE DESCRIPTION		STRATA PLOT	(m) +	TYPE AND NO.	RECOVERY (%)	go	WATER CONTENT (%)	△			HEAR	STRENGT STRENGT 60			PIEZOMETER CONSTRUCTION	FI EVATION (m)
G	GROUND SURFACE	STRAT	DEPTH (m)	TYPE	RECO	N OR RQD	WATE		PL (%)		CON	TENT (%) 60			PIEZO CONS	
TOPSOIL									20				- 00			
Brown SILTY CLAY	0.20m[94.16m]		-													
			-													9.
			-													
	0.00 1.00 10 1		-	<u>6</u>												
nd of Hand Auger Hole	0.90m [93.46m]		- 1–													
v																
			-													ç
			-													,
			-								:					
			-													
			2-									()				
			-								:					
			-													(
			-													,
			-								:					
			-													
			3-													
			-													
			-													,
			-													
			-													
			-													
			4 —													
			-													
			-													ç
			-													
			-													
			-													
			5	†					i i		:					

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435747.94 **NORTHING:** 5004424.67 **ELEVATION:** 94.61

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DAIE: D	ecemb	er 16, 2024		BH 1-24		
					S	AMPLE	_	DCPT	ESIST. (BLOWS/0 (50mm DIA. CON	E)		
SAMPLE DESCRIPTION	STRATA PLOT	(m) H		I TPE AND NO.	RECOVERY (%)	RQD	WATER CONTENT (%)	20 △ REMOULDEI ▲ UNDRAINEE 20	40 60 D SHEAR STRENG O SHEAR STRENG 40 60		PIEZOMETER CONSTRUCTION	ELEVATION (m)
	TRA.	DEPTH (m)	5	7	ECO	N OR RQD	VATE	PL (%) WAT	TER CONTENT (%)IEZO	:LEV
GROUND SURFACE TOPSOIL 0.23m [94 38m]	0,		'	_			>	20	40 60	80 '	E 0	ш
GLACIAL TILL: Compact, brown silty sand, with	$ \triangle \triangle \triangle \triangle$	=	X	AU 1			24	0				
gravel, trace clay, cobbles and boulders	\(\times \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta	=		٩								94 –
•	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	1-	V	SS 2	58	P	22	0				
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	=		S								
	\(\lambda \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q	-	7	3								93-
	$\triangle \land \triangle \land \triangle$	2	X	SS	75	5-7-9-8 16	12	0				
	\(\lambda \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \q	-				10						
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	=										92-
	A A A A											02
Dense by 3.0 m depth	\(\lambda \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \q	3-	7	4								
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-	X	SS 4	67	7-13-21-21 34	13	0				
	\(\lambda \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q	=				34						91-
	$\triangle \land \triangle \land \triangle$	4-										
	A A A A A A A A A A A A A A A A A	=										
Grey by 4.6 m depth	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	=	7	5						× · · · · · · · · · · · · · · · · · · ·		90-
	$\triangle \land \triangle \land \triangle$	5-	X	SS	8	6-5-8-20 13	8	0				
	\(\lambda \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \q	-	/_\			10						
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	=										89-
	\(\lambda \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \delta \q \delta \q \delta \q	-										
	$\triangle \land \triangle \land \triangle$	6-	1									
0.74107.001	\(\lambda \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \q	=	X	SS 6	58	8-12-13-6 25	10	Ο				00
6.71m [87.90m] End of Borehole	V V V V	=				20						88-
2.10 01 20101010		7-										
		=										
		=										87 –
		8-								ļ <u>.</u>		
		=										
		=										86-
		9-										
		- -										
		=										85-
		10 -										00

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 94.07 **EASTING:** 435865.23 **NORTHING:** 5004448.81

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: D	ecemb	er 1				OLE NO					Т
					S	AMPLE	E		20	DCPT		. (BLOW) m DIA. C	ONE)	n) 80			
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.		RECOVERY (%)	ζΦD	WATER CONTENT (%)	Δ	REM	DULDEI RAINED) SHE	AR STRI AR STRE	ENGT ENGTI	H (kPa)		PIEZOMETER CONSTRUCTION	
	TRAT	DEPTH (m)	YE		E 0	N OR RQD	ATE		PL (%)	WAT	TER C	ONTENT	(%)	LL (%)	IEZOI ONSI	
GROUND SURFACE	S		 -	·	~	Z	S		20	:	40	60		80		<u> </u>	H
OPSOIL, trace sand and gravel 0.28m[93.79m]	0 0 0 0			AU 1			16		0	:				:			
LACIAL TILL: Compact to dense, brown silty sand, ith gravel, cobbles and boulders	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-		₹									• • • • • • • • • • • • • • • • • • • •				
in graver, cobbies and boulders	\(\times \delta \delta \delta \delta \delta \qu	1-	M	22	58	11-11-11-24	11		0			ļļ		i i			
		=	Δ	SS	50	22	''										
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	=		8													
	\(\times \delta \delta \delta \delta \delta \qu	2	XI	SS	58	9-18-23-20 41	11		0								
		-				41											
	^ ^ ^ ^ ^	=															
2.051.04.001	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	_															
3_05m[91.02m] Compact to dense, brown SILTY SAND , trace gravel		3-		4						[
		-	XI	SS 4	25	16-14-13-13 27	23		C)		<u>.</u>		<u>.</u>			
3.66m[90.41m]	\(\rangle \times \rangle \ran	=				<u></u>				:				:			
obbles and boulders	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	4 –							ļ								
	^ ~ ~ ~ ~	=											:				
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	=		2													
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	5	X	SS	33	6-14-25-21 39	9)					- Ė			
	\(\times \delta \delta \delta \delta \delta \q	=								:				:			
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-									;			· · · · · · · · · · · · · · · · · · ·	:		
	A A A A	6-							<u>j.</u>								
	A A A A A A A A A A A A A A A A A A A	=		9													
6.71m [87.36m]	$\triangle \triangle \triangle \triangle$	=	X	SS	83	9-19-25-24 44	10	'	Э			ļļ.					
and of Borehole	<u> </u>									:				:			
		7-															
		=															
		=															
		8-													:		
		=													<u>.</u>		
		=															
		9							<u>.</u>			ļ					
		=															
		=															
		10 -									:			:	:		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 ELEVATION: 94.06 **EASTING:** 435899.31 **NORTHING:** 5004264.51

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: D	ecemb	per 16, 2024	HOLE NO. :		
				$\overline{}$	SA	MPLE		DCPT (5	SIST. (BLOWS/0.3	:)	
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.		RECOVERY (%)	Rab	WATER CONTENT (%)	A HINDDAINED S	SHEAR STRENG		PIEZOMETER CONSTRUCTION
	TRAI	DEPTH (m)	ΥPE		ECO CO	N OR RQD	VATE	PL (%) WATE	R CONTENT (%)	LL (%)	ONS.
GROUND SURFACE OPSOIL, trace clay 123m [93,83m]	0,			- '	_			20 40		80	шО
ard, brown SILTY CLAY		- -	双	AU 1			39	0			
				_						>250	
		1 <u> </u>	X	SS 1	00	Р	37	0		△80	`
1.45m[92.61m] .ACIAL TILL: Compact, brown silty clay, with	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-									
avel, trace sand, cobbles and boulders	\(\times \) \(\t	2-	Y I	SS 3	50	Р	31	0			
2.29m [91.77m]	A A A A										!
ACIAL TILL: Compact, brown silty sand, with	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	- -	\bigvee	SS 4	58	4-9-7-4	12	0			
avel, trace clay, occasional cobbles	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	3-				16					
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-	M	SS 2	50	8-4-15-19	12	0			
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-	\triangle	σ		19					
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	4-									
	^ ^ ^ ^ ^	- -									
Grey by 4.6 m depth	A A A A	=		စ							
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	5 _		SS 4	42	3-17-4-6 21	11	0			
	^ ^ ^ ^ ^	=									
	^ ^ ^ ^ ^	=									
	^ ^ ^ ^ ^	6-									
	^ ^ ^ ^ ^	- -	X	2 SS	42 1	5-28-13-12 41	14	0			
d of Borehole	\ \ \ \ \ \ \ \	_ =				71					
		7-								· · · · · · · · · · · · · · · · · · ·	
		=									
		Q									
		9-									
		10 -							<u> </u>		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435891.01 **NORTHING:** 5004133.10 **ELEVATION:** 93.78

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS:

DATE: December 19, 2024

HOLE NO.: BH 3A-21

REMARKS: DATE: December 19, 2024 PEN. RESIST. (BLOWS/0.3m) **SAMPLE** DCPT (50mm DIA. CONE) 20 40 **NATER CONTENT** CONSTRUCTION ġ 8 ELEVATION (m) REMOULDED SHEAR STRENGTH (kPa) STRATA PLOT SAMPLE DESCRIPTION RECOVERY UNDRAINED SHEAR STRENGTH (kPa) TYPE AND DEPTH (m) N OR ROD 40 60 PL (%) WATER CONTENT (%) LL (%) 20 **GROUND SURFACE** 40 60 80 For soil profile refer to BH 3-21 92 2.29m [91.49m] >121 Very stiff, brown SILTY CLAY 100 52 >121 100 44 3.73m [90.05m] Firm, grey SILTY CLAY **SS3 △**10 75 42 >121 0 36 4.88m [88.90m] 100 GLACIAL TILL: Dense, grey silty clay, trace sand, 12 0 gravel, cobbles and boulders 94 2-5-27-50 12 O 5.87m [87.91m] End of Borehole 6 87

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

- Coro and Coco Chara Chook, Char

COORD. SYS.: UTM ZONE 18 **EASTING:** 435936.41 **NORTHING:** 5004099.07 **ELEVATION:** 93.87

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: [ecemb	er 1	16, 2024	HOLE NO. :	BH 4-24	
					S	AMPLE				ESIST. (BLOWS/0.3 (50mm DIA. CONE		
SAMPLE DESCRIPTION	STRATA PLOT	DЕРТН (m)	ON OND HOYT		RECOVERY (%)	N OR RQD	WATER CONTENT (%)	Δ.	20 REMOULDED UNDRAINED 20 PL (%) WAT	40 60 SHEAR STRENG SHEAR STRENG 40 60 ER CONTENT (%)	80 TH (kPa) FH (kPa) 80 LL (%)	PIEZOMETER CONSTRUCTION
GROUND SURFACE 10 PSOIL 0.25m [93 62m]				+	<u> </u>		>		20	40 60	80 '	E 0 1
Hard, brown SILTY CLAY		- - -		AU 1			43			0		
		1— 1— - -	X	SS 2	50	Р	36		O		▲80	, 9
		2-	X	SS 3	100	Р	50			A 50	>249	9
Very stiff by 2.3 m depth		- - - - -	X	SS 4	100	Р	57		29	Δ.665	179	
3.50m[90.37m] GLACIAL TILL: Compact, grey silty sand, with clay,	\D \D \D \D \d	3-	X	SS 5		Р	37 44		∆29 C	0	>121	
ravel, cobbles and boulders	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	4-	X	SS 6	100	Р	31	c	0			g
	\(\times \times \	5—	X	SS 7	50	2-6-9-5 15	10		O			8
	A A A A A A A A A A A A A A A A A A A A	6-										8
6.71m [87.16m]	A A A A A A A A A A A A A A A A A A A	- - - -	X	SS 8	67	3-3-3-2 6	14		0			
nd of Borehole		7-										8
		8-										8
												8
		9-										
		10 -										8

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 14:03 Paterson_Template



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

ELEVATION: 93.90 COORD. SYS.: UTM ZONE 18 **EASTING:** 435994.61 **NORTHING:** 5003956.27

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: [ecemb	per 16, 2024	HOLE NO.: BH 5-2	4
				$\overline{}$	S	AMPLE	1.	DCPT (5	SIST. (BLOWS/0.3m) 50mm DIA. CONE)	
SAMPLE DESCRIPTION	STRATA PLOT	H (m)	TVDE AND NO	AND NO.	RECOVERY (%)	RQD	WATER CONTENT (%)	20 40 △ REMOULDED S ▲ UNDRAINED S 20 40	SHEAR STRENGTH (kPa) SHEAR STRENGTH (kPa)	PIEZOMETER CONSTRUCTION ELEVATION (m)
GROUND SURFACE	STRA	DEPTH (m)	2	1	RECO	N OR RQD	WATE	PL (%) WATE	ER CONTENT (%) LL (%)	PIEZO CONS ELEVA
OPSOIL 0.25m [93.65m]	/			_			39	0		
Hard, brown SILTY CLAY		=		AU 1						
		1-							>2 A 89	93 -
			M	SS 2	100	P	52	4 20	0	49 92-
		2-								
		=						▲ 29	>	21
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	3-								91-
ravel, cobbles and boulders	A A A 4	-	X	SS 3	42	4-5-4-6	9	0		
Grey by 3.4 m depth	A A A A A A A A A A A A A A A A A A A	=				9	''			90-
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	4-								
Dense by 4.6 m depth	A A A 4	-								
	A A A A	5-	X	SS 4		5-10-29-24 39	9	0		
5.36m [88.54m]	A A A A									
ind of Borehole		=								
ractical refusal to augering at 5.36 m depth		6-								88 -
		=								
		7-								87-
		=								
		=								
		8-								86-
		=								
		9-								85-
		10		Ш						84-

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 94.24 **EASTING:** 435422.68 **NORTHING:** 5003879.79

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:					DATE: D	ecemb	er 17	, 2024		HOLE	E NO. :	BH 6	-24		
				5	SAMPLE				PEN. RES DCPT (5 40	0mm DI		E)			
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	RQD	R CONTENT (%)	Δ		ULDED S RAINED S 40	HEAR S	STRENG 60	80		PIEZOMETER CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STRA	DEPT	TYPE	RECO	N OR RQD	WATER (%	ı	PL (%)	WATEF 40	CONT	ENT (%)	LL (%)	PIEZC	ELEV.
TOPSOIL, trace clay 0.05m[94.19m] GLACIAL TILL: Compact, brown sandy clay, with silt,	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	. =	₩ 7			39		20	0		00	00			94 -
gravel, cobbles and boulders	A A A A A A A A A A A A A A A A A A A A	1-	SS 2	100	P	30			0						93 -
	A A A A A A A A A A A A A A A A A A A A	2-	SS 3	50	3-3-3-2 6	14		0							92-
	\times \t	3—													
	A A A A A A A A A A A A A A A A A A A A	- - - - - -	SS 4 SS	92	6-8-3-2 11	13		0							91-
4 <u>.</u> 57m[89.67m]	A A A A A A A A A A A A A A A A A A A A	4-													90 -
GLACIAL TILL: Compact grey silty sand, with gravel, cobbles and boulders	A A A A A A A A A A A A A A A A	5-	SS 5	83	8-13-18-19 31	9	0								89-
6 <u>.10m</u> [<u>8</u> 8.14 <u>m</u>]	A A A A A A A A A A A A A A A A A A A	6—													
GLACIAL TILL: Compact, grey sand, with cobbles and boulders 6.71m [87.53m] End of Borehole	\(\rangle \times \rangle \times \ran	- - - -	SS 6	100	2-3-16-43 19	19		0							88-
Lita of Borefloie		7-													87 -
		8-													86 -
		9—													
		- - - -													85-

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435600.21 **NORTHING:** 5004031.42 **ELEVATION:** 93.94

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: D	ecemb	er 1	7, 2	024			HOLI	E NO.	.:	BH 7	'-24		
					S	AMPLE								LOWS		1)			
SAMPLE DESCRIPTION	STRATA PLOT	(m)		ITE AND NO.	RECOVERY (%)	Rab	WATER CONTENT (%)	Δ.		20 EMO l	JLDE	40 D SH	IEAR	60 STRE	NGTH	80 I (kPa) (kPa) 80		PIEZOMETER CONSTRUCTION	ELEVATION (m)
	TRAT	DEPTH (m)	5	ב ב	50	N OR RQD	/ATEF		PL	(%)	WA	TER	CONT	ΓENT ((%)	LL (%	6)	IEZOI ONSI	LEVA
GROUND SURFACE TOPSOIL 0.20m [93.74m]			ŀ	_	~	Z	>		:	20	:	40	-	60	:	80	:	<u> </u>	ш
GLACIAL TILL: Brown silty sand, with gravel, cobbles and boulders	V V V V	-		AU 1			34				0								-
	7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7	1-	X	SS 2	75	13-20-12-8 32	10)										93-
- Increasing clay content by 1.5 m depth	V V V V V V V V V V V V V V V V V V V	2-	X	SS 3	75	4-8-4-4 12	11	(0										92
- Increasing sand content by 3.0 m depth	V V V V	3-																	91
- Grey by 3.5 m depth 3.71m [90.23m]	A A A A A A A A A A A A A A A A	- - - -	X	SS 4	83	1-20-23-16 43	9	c)										-
End of Borehole		4-							: !	i.			. į			i.			90-
Practical refusal to augering at 3.71 m depth		-																	-
		5-																	89
		6-																	88
		- - - -																	-
		7-																	87-
		8- -																	86
		- - - - -																	-
		9-																	85 <u> </u>
		10 -													:	-	:		84

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 ELEVATION: 94.52 **EASTING:** 435672.21 **NORTHING:** 5003946.75

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DAIE: L	ecemb	per 17, 2024		NO.: BH 8-24	<u>, </u>
					S	AMPLE		D	N. RESIST. (BLC CPT (50mm DIA	A. CONE)	
SAMPLE DESCRIPTION	STRATA PLOT	(m)	9	THE AND NO.	RECOVERY (%)	αορ	WATER CONTENT (%)	20 △ REMOUI ▲ UNDRA 20	.DED SHEAR S [*] NED SHEAR ST	60 80 TRENGTH (kPa) TRENGTH (kPa) 60 80	PIEZOMETER
	TRAT	DEPTH (m)	5	7	ECO	N OR RQD	ATEF	PL (%)	WATER CONTE	NT (%) LL (%)	IEZOI
GROUND SURFACE OPSOIL 0.18m [94 34m] /	S		ŀ	_	~	z	S	20	40	60 80	- C O
GLACIAL TILL: Compact, brown silty sand, with clay, ravel, cobbles and boulders	A A A A A A A A A A A A A A A A	-	X	AU 1			22	0			
,	^ ^ ^ ^ 7	1-	X	SS 2	33	4-9-5-3 14	25	0			
	A A A A A A A A A A A A A A A A	2-	X	SS 3	67	6-5-4-6 9	14	o			
	A A A A A A A A A A A A A A A A A A A	 - - -				9					
Increasing sand content by 3.0 m depth	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	3-	X	SS 4		12-50-/-/	11	O			
3.53m [90.99m] and of Borehole	<u> </u>	-		0,		50/0.08					
ractical refusal to augering at 3.53 m depth		4-									
		5-									
		- - - - -									
		6-									
		-									
		7-									
		-									
		8- - - -									
		9-									
		-									

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Track Mounted Drill Rig

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 14:03 Paterson_Template

REMARKS: December 17, 2024 HOLE NO.: BH 9-24

REMARKS:					DATE: [Decemb	er 1	7, 20	24		HO	LE NC) . :	BH 9	9-24		
				s	AMPLE					CPT (50mm	BLOWS DIA. C					
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	ER CONTENT (%)	Δ	REI UN	DRA 20	DED NED	SHEAF 10	60 R STRE STRE	NGTH	80		MONITORING WELL CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STRA	DEPT	TYPE	RECO	N OR	WATER (%)		PL (%	6) 20		R CON	NTENT 60	(%)	LL (%	6)	MON	ELEV
TOPSOIL 0.25m[93.93m], Hard, brown SILTY CLAY		• -	¥ X			31				0			-	:			94-
Tidid, blown die i deni		1-	SS 2 A	58	P	25			0						∆89 A	92 m 2	_ :
1.45m[92.73m] _ Compact, brown SILTY SAND , with clay, gravel,						23			0								93-
cobbles and boulders	A A A A	2	SS3	100	2-5-5-3 10	17		0									92
cobbles and boulders 2.97m [91.21m]	^ ^ ^ ^ ^																92 –
BEDROCK: Excellent to good quality limestone		3-	RC 1	100	RQD 90												91-
		4-						· · · · · · · · · · · · · · · · · · ·									90-
		5-	RC 2	100	RQD 92												4.52m 89 –
6.17m [88.01m]		6	RC 3	83	RQD 74												6.05m
End of Borehole									: : :								88-
(GWL at 0.92 m depth - January 9, 2025)		7-															87 -
		-															
		8-															86-
		9-															
		-															85-
		10						:				:	:	:	:		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435719.68 **NORTHING:** 5004015.59 **ELEVATION:** 94.18

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Track Mounted Drill Rig

REMARKS: DATE: December 18, 2024 HOLE NO.: BH10-24

REMARKS:					DATE: [Decemb	er 18	3, 2024		HOLI	E NO. :	BH10-2	4	
				S	AMPLE			■ P			LOWS/0.3 NA. CONE			
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	WATER CONTENT (%)	Δ.	UNDR 20	4 ULDED AINED \$	SHEAR SHEAR SHEAR	60 STRENG STRENGT 60	80 TH (kPa) TH (kPa) 80	MONITORING WELL CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STR/	Eb.	Τ	REC	N PO	WAT		PL (%)	WATE	R CONT	FENT (%) 60	LL (%)	MON	E.E.
For soil profile refer to BH 9-24		1-						20					0.94 m ¥ 202	94 -
		2-											1.	93 - 45m 92 -
2.97m [91.21m] End of Borehole		3-												92 92 97 97 97 91 91 91 91 91 91 91 91 91 91 91 91 91
Practical refusal to augering at 2.97 m depth		-												
(GWL at 0.94 m depth - January 9, 2025)		4-												90 -
		5-												89
		6-												88 -
		7-												87-
		8-												86-
		9-												85-
		10												

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435692.30 **NORTHING:** 5004138.10 **ELEVATION**: 93.82

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216** ADVANCED BY: Track Mounted Drill Rig

REMARKS:					DATE: [ecemb	er 1	3, 202	24	H	OLE NO	: BH	111-24		
				S	AMPLE				DCF	PT (50m	(BLOWS	ONE)		Ⅎ	
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	ER CONTENT (%)	Δ	UN I	MOULD Draine	ED SHEA 40	60 AR STRE AR STREM	NGTH (kF 80	Pa) Pa)	MONITORING WELL CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STR/	DEP1	TYPE	RECO	N OR	WATER (%)		PL (%	6) W	ATER Co	ONTENT ((%) LL	. (%)	MON	ELEV
TOPSOIL 0.25m [93.57m]		. =				30			0	-10			:		3
/ery stiff, brown SILTY CLAY		-	₹	2		30									3
		- - 1_											180		93-
		' - -													3
		=		,									∆ 89		}
		2	\\ v	100	Р	47				С	1		1.	98 m ⊻ 201	92 - 25-01-09
		-													3
		=						Δ14				▲ 72			2
		3											>121	3 6	91-
Grey by 3.4 m depth		=	X v	75	Р	26 22			0			Δ72			<u>-</u> - -
3.66m[90.16m] LACIAL TILL: Loose to dense, grey silty sand, with	V V V V	=													90 -
ay, gravel, cobbles and boulders	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	4-	V V	67	0-1-1-/	15		0							
	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	-			2									4	.58m
	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	_	\\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\	67	2-3-3-5	12		0							89 -
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	5—			6										
	^ ^ ^ ^ /	=													
	^ ^ ^ ^	6—													88 -
0.50 (0.700)	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	=	٧٧	42	13-21-50-/	11		0	•					6	i.10m
6.53m [87.29m] nd of Borehole	V V V V	-			71/0.23	''		Ŭ							
		7													87-
ractical refusal to augering at 6.53 m depth		=							-	•			•		
GWL at 1.98 m depth - January 9, 2025)		-													86-
		8-													
		=													
		=							-				:		85-
		9-													
		=													
		10 -							:	:			:		84 -

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS: December 18, 2024 HOLE NO.: BH12-24

REMARKS:					DATE: D	ecemb	oer 18	, 2024		HOLE	NO. :	BH12	-24		
				S	AMPLE		■ PEN. RESIST. (BLOWS/0.3m) DCPT (50mm DIA. CONE)								
SAMPLE DESCRIPTION	STRATA PLOT	DЕРТН (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	WATER CONTENT (%)			ULDED AINED	SHEAR ST SHEAR ST	RENGT RENGTI	80 H (kPa)		MONITORING WELL CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	ST	ä	Ĕ	RE	0 2	¥		20		-0 $-$	60	80		<u>8</u> 0 €	H
TOPSOIL O.36m [93.57m] Hard, brown SILTY CLAY		1-	AU1			36			0				239	V 202	93 – 5-01-09
		2-/	SS 2	100	Р	54		2		54 •			199		92 –
- Silt content increasing by 3.0 m depth		3	SS 3	83	Р	29			0	∆40		34	>121 37		91-
GLACIAL TILL: Compact, grey silty clay, with sand, gravel, cobbles and boulders 4.57m [89.36m]	A A A A A A A A A A A A A A A A A A A	4	SS 4	67	9-3-9-9 12	15		0							90-
GLACIAL TILL: Dense, grey silty sand, with gravel, cobbles and boulders, trace clay	A A A A A A A A	5	SS 5	67		18		0						5.3	89 – 34m
	A A A A A A A A A A A A A A A A A A A	6	9		37										88-
End of Borehole	V V V V	7	SS	100	50-/-/-/ 50/0.08	16		0						6.8	^{6m} o7 –
(GWL at 1.08 m depth - January 9, 2025)		8-													86-
		9-													85-
DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS TH	IE DDOD	10	F DATE		NI CDOUD A	ND TU		NT FOR		IT WAS DE		TD TIME	CUEE	TOLIOUI	84-

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Track Mounted Drill Rig

REMARKS:						DATE: D	ecemb	er 1	9, 202	4		HOLE	NO. :	BH1	3-24		
					S	AMPLE							OWS/0.3i A. CONE				EL EVATION (m)
							Ä		20	1	40		60	80		z	
SAMPLE DESCRIPTION	STRATA PLOT	_		TYPE AND NO.	RECOVERY (%)		WATER CONTENT (%)	_ <u>_</u>					TRENGT TRENGT			PIEZOMETER CONSTRUCTION	() N
	ATA	DEPTH (m)		A A	S	N OR RQD	ER C		20		40		60	80		OME	Į
GROUND SURFACE	STR	DEP	}	<u></u>	REC	Ö	WAT		PL (%)		40	$ \sim$	ENT (%) 60	LL (%	(0)	PIEZ	<u> </u>
ard to very stiff, brown SILTY CLAY			V	SS 1	50	4-4-4-3	36			-	0	:					
		-	Λ	Š	30	8	30		<u> </u>		0						
		- - -													100		0.
		1-													109 >249	`	9:
1.45m[92.51m] .ACIAL TILL: Compact, brown silty clay, with sand,	V V V V	-															
avel, cobble sand boulders	A A A A	-	X	SS 2	92	1-2-8-9	14		0								
210, 000000 00.10 000100.0	\(\delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \q \delta \q \delta \q \delta \q \delta \q \delta \q \delta \q \q \delta \q \q \delta \q \d	2-	<u> </u>	,		10				!.							9
	\(\times \q	-	\bigvee	SS 3	400	0.4.4.5	40										
	A A A A	-	\backslash	SS	100	3-4-4-5 8	13		0	-	•	:		-	•		
Silty sand, with clay, gravel, cobbles and boulders	\(\triangle \tr	3-															9
3 3 m denth	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-	X	SS 4	67	5-8-18-16 26	12		0								
and of Borehole	V V V	-	<u>/ \</u>			20											
ia di Barandia		4							ł d								9
		=								:		:		-	:		
		-												-			
		5-							<u> </u>								8
		-															
		-															
		6-							<u> </u>								8
		-								:	:	:		-	:		
		-															
		7-							<u>.</u>								8
		-									:			-			
												<u>.</u>					
		8-										<u>.</u>					8
		-										:		•			
		=															
		9-															8
		9-															"
		-															
		10 -										:		-			8.
		10										-					_ 0

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 14:03 Paterson_Template



P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 14:03 Paterson_Template

SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 436034.93 **NORTHING:** 5004037.45 **ELEVATION:** 93.95

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Track Mounted Drill Rig

REMARKS: December 19, 2024 HOLE NO.: BH14-24

REMARKS:					DATE: D	ecemb	oer 19	9, 2024	Н	DLE NO. :	BH14-24		
				S	SAMPLE			■ F	PEN. RESIST. DCPT (50mr		IE)		
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	WATER CONTENT (%)	Δ		40 ULDED SHEA AINED SHEA 40	AR STRENG	80 80	PIEZOMETER CONSTRUCTION	ELEVATION (m)
	TRA	EPT	YPE	ECO	R	VATE		PL (%)	WATER CO	ONTENT (%	6) LL (%))IEZC	.rev
GROUND SURFACE For soil profile refer to TP 6	<u> </u>			-		>		20	40	60	80		
Tor soil profile refer to 11 o		=											
		=											
		1-											93-
		=											
		2											92-
2.29m [91.66m	- 17/7	1	_							· · · · · · · · · · · · · · · · · · ·	>121		
Very stiff, brown SILTY CLAY, with high silt content		= '	SS 1	83	Р	36		22 -	—¦° 0 △43				
2.97m [90.98m]	3—									· · · · · · · · · · · · · · · · · · ·		91-
GLACIAL TILL: Dense to compact, brown silty clay,	A A A A		SS 2	50	5-12-6-3	11		0		· · · · · · · · · · · · · · · · · · ·	>121		
with sand, gravel, cobbles and boulders	\(\times \q	1	\\\	50	18	''		0		<u></u>			
	A A A A	1											90 -
	\(\rangle \times \rangle \times \rangle \times \rangle \times \rangle \times \rangle \rangle \tag \rangle \ran	4 7	SS 3	33	4-3-2-2 5	10)					
- Silty sand by 4.2 m depth	\(\triangle \tr	7			3								
only cand by the macpan	\(\delta \q \delta \de		SS 4	42	23-26-20-16	12		0					
5.18m [88.77m	I	5-1/	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\		46	· -							89-
End of Borehole										İ			
		6-											88-
									: :				
		7-											87 -
		=											
		8-											86-
											· · · · · · · · · · · · · · · · · · ·		
		9—											85-
		=											
		10											84_

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.237 FILE NO. PG4216

REMARKS: HOLE NO.

BORINGS BY: CME 55 Power Auger					DATE:	2021 [March 19		HOLI	E NO.	BH 1D	-21
SAMPLE DESCRIPTION	PLOT		SAN	IPLE	ı	DEPTH	ELEV.	Pen. Re		Blows Dia. C		3 WELL
GROUND SURFACE	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)			Conter		MONITORING WEL
TOPSOIL	30 \\(\hat{\lambda}\)\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	AU	1			0-	-94.24 -					
Very stiff, brown SILTY CLAY		ss	2	100	7	1-	-93.24					
GLACIAL TILL: Compact silt, some sand and clay, trace gravel	33 \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	SS	3	100	16	2-	92.24					
GLACIAL TILL: Dense, brown silty sand with gravel, cobbles and boulders		ss	4	8	+50		04.04					
- some running sand present by 3.5m depth <u>3</u> .6	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	ss	5	100	34	3-	+91.24 					
End of Borehole (GWL @ 0.15m - March 31, 2021)												
								20 Shea ▲ Undist		60 ength (△ Rei		100

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.237 FILE NO. **PG4216** Geodetic DATUM: **REMARKS:** HOLE NO. **BH 1S-21** BORINGS BY: CME 55 Power Auger DATE: 2021 March 19 MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. • 50 mm Dia. Cone **SAMPLE DESCRIPTION** (m) (m) N VALUE or RQD RECOVERY NUMBER Water Content % **GROUND SURFACE** 80 20 0+94.24**TOPSOIL** 0.30 1+93.24 Very stiff, brown SILTY CLAY GLACIAL TILL: Compact silt, some sand and clay, trace gravel 2 + 92.24<u>2.13</u> End of Borehole (GWL @ 0.16m - March 31, 2021) 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed \triangle Remoulded

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 93.908 FILE NO. PG4216

REMARKS:
BORINGS BY: CME 75 Power Auger

DATE: 2021 March 19

BH 2-21

BORINGS BY: CME 75 Power Aug	ger					DATE:	2021	March 19	ı			В	3H 2-2	<u>:1</u>
SAMPLE DESCRIPTION		PLOT		SAN	/IPLE		DEPTH	ELEV.	Pen. Re ● 50					WELL
GROUND SURFACE		STRATA F	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	○ W		Con			MONITORING WEL
TOPSOIL	0.25	^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^	***				0-	-93.91						
	_ <u> </u>		AU	1										<u> </u>
/ery stiff to stiff, brown SILTY CLAY , trace sand			SS	2	92	4	1-	-92.91						
	_ 2.21		SS	3	100	2	2-	-91.91						
GLACIAL TILL: Brown silty clay come sand, gravel, cobbles and	^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^	^^^^^ ^^^^ ^^^^	ss	4	75	4								
some sand, gravel, cobbles and coulders	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	^^^^ ^^^^ ^^^^					3-	-90.91						
End of Borehole	3.66	^^^^^ ^^^^	SS	5	17	3								
GWL @ 0.32m - March 31, 2021)													
									20	40	6		80 1	100

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 92.787 FILE NO. PG4216

REMARKS: HOLE NO.

BORINGS BY: CME 75 Power Aug	jer				DATE:	2021	March 19)	HOLI	ENO. BH	l 3-21
SAMPLE DESCRIPTION	PLOT		SAN	/PLE	1	DEPTH	ELEV.			Blows / 0.3 Dia. Cone	3m merr
CDOUND SUDEACE	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	0 W		Content %	NITORING
GROUND SURFACE		AU	1	<u> </u>		0-	92.79	20	40	60 80	
Very stiff to stiff brown SILTY		SS	2	100	6	1-	-91.79				
Very stiff to stiff, brown SILTY CLAY		SS	3	50	4	2-	-90.79				
	3.12	ss	4	75	3	3-	-89.79				
Stiff, grey SILTY CLAY	3.66	SS	5	100	2						
End of Borehole								20 Shea ▲ Undist		60 80 ength (kPa)

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.514 FILE NO. PG4216

DATUM: Geodetic HOLE NO.

BORINGS BY: CME 55 Power Auger					DATE:	2021 [March 22	BH 4D-21
SAMPLE DESCRIPTION	PLOT		SAN	//PLE	1	DEPTH	ELEV.	Pen. Resist. Blows / 0.3m ■ 50 mm Dia. Cone
GROUND SURFACE	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	Pen. Resist. Blows / 0.3m ■ 50 mm Dia. Cone ○ Water Content % 20 40 60 80
TOPSOIL <u>0</u> .:	18 \^^^^	AU	1			0-	94.51	
Very stiff to stiff, brown SILTY CLAY , trace sand		ss	2	58	5	1-	-93.51	
2.3	36	SS	3	50	11	2-	-92.51	
GLACIAL TILL: Brown silty clay with sand, gravel, cobbles and boulders	, , , , , , , , , , , , , , , , , , ,	ss	4	58	20	3-	91.51	
<u>3.</u> End of Borehole	38 \^^^^	ss	5	8	+50			
Practical refusal to augering at 3.38m depth								
(GWL @ 0.29m - March 31, 2021)								
								20 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed △ Remoulded

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.514 FILE NO. **PG4216** Geodetic DATUM: **REMARKS:** HOLE NO. **BH 4S-21** BORINGS BY: CME 55 Power Auger DATE: 2021 March 22 MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. • 50 mm Dia. Cone **SAMPLE DESCRIPTION** (m) % RECOVERY (m) N VALUE or RQD NUMBER Water Content % **GROUND SURFACE** 80 20 0+94.51**TOPSOIL** 0.18 Very stiff to stiff, brown SILTY CLÁY, trace sand 1 + 93.512 + 92.51End of Borehole (GWL @ 0.30m - March 31, 2021) 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed \triangle Remoulded

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.212 FILE NO. PG4216

REMARKS: HOLE NO.

REMARKS:
BORINGS BY: CME 55 Power Auger

DATE: 2021 March 22

BH 5-21

BORINGS BY: CME 55 Power Auger					DATE:	2021 N	March 22				BH 5-2	21
SAMPLE DESCRIPTION	PLOT		SAN	/IPLE		DEPTH	ELEV.	Pen. R		Blows Dia. C		WELL
	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	0 W	ater C	Conten	nt %	MONITORING WELL
GROUND SURFACE	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	.* \	_	~			94.21	20	40	60	80	Ž
TOPSOIL 0	0.23	AU	1									
/ery stiff to stiff, brown SILTY CLAY, trace sand		ss	2	58	5	1-	-93.21					
		ss	3	50	5	2-	-92.21					
	2.49	ss	4	100	6							
ELACIAL TILL: Brown silty clay ith sand, gravel, cobbles and oulders		ss	5	42	7	3-	-91.21					
3 nd of Borehole	3. <u>66 \^,^</u> ^	: 1										
GWL @ 0.30m - March 31, 2021)												
								20 Shea ▲ Undist		60 ngth (△ Rer		100

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.044 FILE NO. PG4216

DATUM: Geodetic HOLE NO.

BORINGS BY: CME 55 Power Auge	r				DATE:	2021	March 22		HOLE		BH 6-2	21
SAMPLE DESCRIPTION	PLOT		SAN	/IPLE		DEPTH	ELEV.	Pen. Re ● 50		Blows Dia. Co		3 WELL
GROUND SURFACE	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	0 W		Content	t %	MONITORING WEL
TOPSOIL	0.25	^ ^ X		ı ız			-94.04	20	40	60	80	
Very stiff to stiff, brown SILTY CLAY		AU	2	100	5	1-	93.04					ស្រុកប្រជាជាក្រាស់ស្រួសស្រុកប្រជាជាក្រាស់ស្រុកប្រជាជាក្រាស់ស្រុកប្រជាជាក្រាស់ស្រុកប្រជាជាក្រាស់ស្រុកប្រជាជាក្
	2.21	ss	3	33	1	2-	-92.04					
GLACIAL TILL: Compact to dense, brown silty clay with sand, gravel, cobbles and boulders		ss	4	75	9	3-	-91.04					
	3.66\^^^	ss	5	50	33							
End of Borehole	<u>5.00\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \</u>											
(GWL @ 0.26m - March 31, 2021)								20 Shea ▲ Undistu		60 ength (k △ Rem	(Pa)	100

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation
Proposed Residential Development - Eagleson Road
Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 93.623 FILE NO. PG4216

DATUM: Geodetic

REMARKS: HOLE NO.

BORINGS BY: CME 75 Power Auger					DATE:	2021 [March 23	3	HOLE N	o. BH 7D	-21
SAMPLE DESCRIPTION	PLOT		SAN	/IPLE		DEPTH (m)	ELEV.			ows / 0.3m a. Cone	G WELL
GROUND SURFACE	STRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(111)	(m)	○ W :		ntent %	MONITORING WEL
		AU	1	_		0-	93.62				
		ss	2	33	9	1-	-92.62				
Very stiff to stiff, brown SILTY CLAY		ss	3	17	4	2-	-91.62				
		ss	4	50	6	3-	-90.62				
GLACIAL TILL: Brown silty clay with sand, gravel, cobbles and boulders 3.66	5	ss	5	67	6						
End of Borehole											
								20 Shea ▲ Undistu	r Strenç	60 80 gth (kPa) △ Remoulded	⊣ 100

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

40

▲ Undisturbed

Shear Strength (kPa)

60

80

 \triangle Remoulded

100

Geotechnical Investigation Proposed Residential Development - Eagleson Road

Ottawa, Ontario **EASTING: NORTHING: ELEVATION: 93.623** FILE NO. **PG4216** DATUM: Geodetic **REMARKS:** HOLE NO. **BH 7S-21** BORINGS BY: CME 55 Power Auger DATE: 2021 March 23 MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. **SAMPLE DESCRIPTION** • 50 mm Dia. Cone (m) % RECOVERY (m) N VALUE or RQD NUMBER Water Content % **GROUND SURFACE** 80 20 40 0+93.62Very stiff to stiff, brown **SILTY CLAY** 1 + 92.622+91.62 End of Borehole

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.047 FILE NO. PG4216

REMARKS: HOLE NO.

BH 8-21 BORINGS BY: CME 75 Power Auger 2021 March 23 DATE: MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. **SAMPLE DESCRIPTION** 50 mm Dia. Cone (m) (m) N VALUE or RQD RECOVERY NUMBER Water Content % **GROUND SURFACE** 80 20 0+94.05**TOPSOIL** 0.25 1 Very stiff to stiff, brown SILTY 1+93.05SS 2 100 2 CLÁY SS 3 100 12 2 + 92.052.13 GLACIAL TILL: Compact, brown silty clay with sand, gravel, SS 4 58 23 cobbles and boulders 3 + 91.053.20 **GLACIAL TILL:** Compact, brown SS 5 58 24 silty sand with gravel, clay, cobbles and boulders 3.66 End of Borehole (GWL @ 0.49m - March 31, 2021) 20 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed \triangle Remoulded

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.209 FILE NO. PG4216

REMARKS: HOLE NO.

BH 9-21 BORINGS BY: CME 55 Power Auger DATE: 2021 March 23 MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. **SAMPLE DESCRIPTION** 50 mm Dia. Cone (m) (m) N VALUE or RQD RECOVERY NUMBER Water Content % **GROUND SURFACE** 80 20 40 0 + 94.21**TOPSOIL** 1 1 + 93.21Very stiff to stiff, brown SILTY SS 2 100 2 CLÁY SS 3 75 2 2 + 92.21GLACIAL TILL: Compact, brown SS 4 50 23 silty sand with gravel, clay, cobbles and boulders 3 + 91.213.10 \^^^^ \\ SS 5 8 +50 End of Borehole (GWL @ 0.68m - March 31, 2021) 20 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed \triangle Remoulded

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

Geodetic

NORTHING: ELEVATION: 94.076

FILE NO. PG4216

DATUM:

EASTING:

REMARKS: BORINGS BY: CME 55 Power Auger					DATE:	2021 N	March 23		HOLE NO.	BH10D	-21
SAMPLE DESCRIPTION	РСОТ		SAN	/IPLE	ı	DEPTH	ELEV.		esist. Blows mm Dia. C		3 WELL
	STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)		ater Conte		MONITORING WELI CONSTRUCTION
GROUND SURFACE	ST		N	REC	z°	0-	-94.08	20	40 60	80	MON
TOPSOIL0.23	3	AU	1			0	94.00				
Very stiff to stiff, brown SILTY CLAY		ss	2	75	8	1-	-93.08				
GLACIAL TILL: Clayey silt, some sand, gravel, cobbles and	3	ss	3	100	4	2-	-92.08				
boulders		SS	4	100	6	3-	-91.08				
3.66	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	SS	5	75	7						
End of Borehole (GWL @ 0.72m - March 31, 2021)											
								20 Shea ▲ Undistr	40 60 r Strength urbed △ Re		00

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

EASTING: NORTHING: ELEVATION: 94.076 FILE NO. **PG4216** Geodetic DATUM: **REMARKS:** HOLE NO. BH10S-21 BORINGS BY: CME 55 Power Auger DATE: 2021 March 23 MONITORING WELL CONSTRUCTION STRATA PLOT **SAMPLE** Pen. Resist. Blows / 0.3m **DEPTH** ELEV. • 50 mm Dia. Cone **SAMPLE DESCRIPTION** (m) % RECOVERY (m) N VALUE or RQD NUMBER Water Content % **GROUND SURFACE** 80 20 0 + 94.08**TOPSOIL** 1+93.08Very stiff to stiff, brown SILTY CLÁY 2 + 92.08End of Borehole (GWL @ 0.49m - March 31, 2021) 20 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed \triangle Remoulded

9 Auriga Drive, Ottawa, Ontario K2E 7T9

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Residential Development - Eagleson Road Ottawa, Ontario

▲ Undisturbed

 \triangle Remoulded

EASTING: NORTHING: ELEVATION: 92.938 FILE NO.

PG4216

REMARKS: HOLE NO.

HOLE NO. BH11-21 BORINGS BY: CME 55 Power Auger DATE: 2021 March 23 MONITORING WELL CONSTRUCTION STRATA PLOT SAMPLE Pen. Resist. Blows / 0.3m **DEPTH** ELEV. **SAMPLE DESCRIPTION** • 50 mm Dia. Cone (m) (m) N VALUE or RQD RECOVERY NUMBER Water Content % **GROUND SURFACE** 80 20 40 0 + 92.941 Very stiff to stiff, brown SILTY CLÁY 1 + 91.94SS 2 100 4 SS 3 67 6 2 + 90.94Stiff, grey SILTY CLAY 4 SS 83 3 3 + 89.943.35 SS 5 75 15 GLACIAL TILL: Grey silty clay with sand, gravel, cobbles and boulders 3.66 End of Borehole (GWL @ 0.13m - March 31, 2021) 40 60 80 100 Shear Strength (kPa)

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

EASTING: ELEVATION: 93.96 NORTHING:

Ground surface elevations were referenced to a geodetic datum.

DATUM:


REMARKS:

HOLE NO.

PG4216

FILE NO.

BH 1 BORINGS BY: CME 55 Power Auger DATE: 2018 December 13

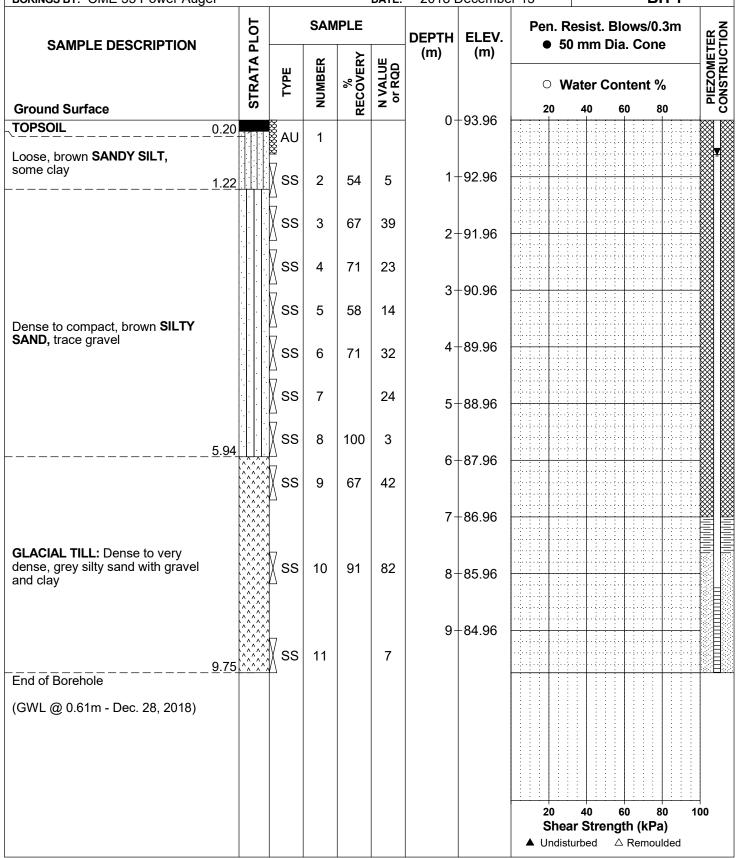

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

ELEVATION: 94.23 NORTHING:

FILE NO. **PG4216**

REMARKS:

EASTING:

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

ORINGS BY: CME 55 Power Au	ıger					DATE:	2018 [Decembe	er 13		BH 2	
SAMPLE DESCRIPTION		PLOT		SAN	IPLE		DEPTH	ELEV.		Resist. Bl 0 mm Dia	ows/0.3m a. Cone	띪
		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	0 W	/ater Co	ntent %	PIEZOMETER
Ground Surface					8	2		94.23	20	40 (80	↓ _
OPSOIL	0.25		¥ AU	1				94.23				
Stiff to very stiff, brown SILTY CLAY some sand			ss	2	92	4	1-	-93.23				
	_ <u>2</u> . <u>13</u>						2-	-92.23				
GLACIAL TILL: Brown silty clay with sand, gravel, cobbles and			∭ ss	3	8	12	3-	-91.23				
oulders			∦ ss	4	42	35	4-	-90.23				
End of Borehole	_ 4.32	\^^^^					4	90.23				
Practical refusal to augering at .32m depth												
GWL @ 0.77m - Dec. 28, 2018)												
									20 Sho:	40 (ar Streng		100

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

ELEVATION: 94.76 **EASTING:** NORTHING:

FILE NO. **PG4216**

Ground surface elevations were referenced to a geodetic datum. DATUM: DEMARKS.

REMARKS:										HOLE NO		
BORINGS BY: CME 55 Power Auge	er					DATE:	2018 [Decembe	er 13		BH 3	1
SAMPLE DESCRIPTION		STRATA PLOT			IPLE ≿	ш	DEPTH (m)	ELEV. (m)		tesist. Blo 0 mm Dia	ows/0.3m i. Cone	PIEZOMETER
		STRAT/	TYPE	NUMBER	% RECOVERY	N VALUE or RQD				/ater Cor		PIEZOM
Ground Surface			~		2	_	0-	94.76	20	40 6	0 80	U XXX XX
	0.15		& AU	1								· ■
Stiff to firm, brown SILTY CLAY			ss 7	2	92	6	1-	-93.76				
	2.13		SS SS	3 4	92	6 50+	2-	92.76				
GLACIAL TILL: Brown sandy silt with clay, gravel, cobbles and	(^^^		∛ ss	5	67	23	3-	91.76				
boulders	4.42		Δ				4-	90.76				
End of Borehole	7.72	<u> </u>										
Practical refusal to augering at 4.42m depth												
(GWL @ 0.62m - Dec. 28, 2018)												
									20 Shea	ar Streng		100

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 97.71 Ground surface elevations were referenced to a geodetic datum.

FILE NO. PG4216

DATUM: REMARKS:

EASTING:

HOLE NO.

REMARKS: BORINGS BY: CME 55 Power Aug	er					DATE:	2018	Decembe	er 13	HOLE	ENO. BH	14
SAMPLE DESCRIPTION		PLOT		SAN	/IPLE		DEPTH (m)	ELEV. (m)			Blows/0.3 Dia. Cone	Sm E
		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(111)	(111)			Content %	∣≣á
Ground Surface	0.00	0,		_	_ ≅	_	0-	97.71	20	40	60 80	
TOPSOIL	0.30	^^^^	& AU	1				00.74				
), , , ,	^^^^ ^^^^^	X ss	2	71	40	1-	-96.71				<u> </u>
CLACIAL TILL. Vew dense			SS V	3	71	68	2-	95.71				
GLACIAL TILL: Very dense, brown silty sand with gravel, cobbles and boulders	(/ //	^,^,^, ^,^,^,	∑ss ∏	4	71	50+	3-	94.71				
		^^^^^ ^^^^^	ss	5	88	73	4	02.74				
	4.85		⊻ ss	6	100	50+	4-	+93.71				
End of Borehole		^_^										
Practical refusal to augering at 4.85m depth												
(GWL @ 1.10m - Dec. 28, 2018)												
									20 Shea ▲ Undis		60 80 ength (kPa) △ Remould	

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 97.45

Ground surface elevations were referenced to a geodetic datum.

FILE NO.

PG4216

DATUM: REMARKS

EASTING:

REMARKS:										HOL	E NO.		
BORINGS BY: CME 55 Power Auge	er					DATE:	2018 [Decembe	er 13	<u></u>		BH	5
SAMPLE DESCRIPTION		PLOT			IPLE -		DEPTH (m)	ELEV. (m)				ws/0.3r Cone	n HER
		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(,	(***)	0 V	Vater	Cont	ent %	PIEZOMETER
Ground Surface		S		Z	8	Z	_	07.45	20	40	60	80	"
TOPSOIL	0.30			1			0-	97.45					
Very stiff, brown CLAYEY SILT	1.01		§ XS ≊ SS	2		50+		00.45					
End of Borehole							1-	-96.45					
Practical refusal to augering at 1.01m depth													
(BH dry upon completion)													
									20 Sho	40 ar Str	60 anath	80 n (kPa)	100
									■ Undis			i (KPa) Remoulde	

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

FILE NO.

9 Auriga Drive, Ottawa, Ontario K2E 7T9

ELEVATION: 94.70 NORTHING:

Ground surface elevations were referenced to a geodetic datum.

DATUM: REMARKS:

EASTING:

PG4216

	\sim		SAL	/IPLE				Don	. Pas	ict DI	ows/0.:	2m	
	STRATA PLOT				4 0	DEPTH (m)	ELEV. (m)	1			a. Cone		PIEZOMETER
	STRA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD						ntent %		PIEZO
0.20				<u>~</u>	_	0-	-94.70	20	0 4	10 6	80 8	0	
		⊗ AU	1										
		ss	2	67	12	1-	-93.70						
1. <u>93</u> _		ss	3	92	5	2-	-92.70						
2.19_		ss	4	88	59	_	020						
		\\ \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	5	71	69	3-	91.70						
			3	'	00	4-	-00.70						
						4-	-90.70						
		ss	6	100	50	5-	-89.70						
<u>5.69</u>	^^^^	× SS	7	100	50+				· · · · · · · · · · · · · · · · · · ·				
								21	n 4	10 4	in 9	n 4	00
	<u>1.93</u> <u>2.19</u>		SS 1.93 2.19 3.3.3.3 SS SS SS SS SS SS SS SS SS S	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	AU 1 1-93.70 SS 2 67 12 1-93.70 SS 4 88 59 SS 5 71 68 4-90.70 SS 6 100 50 SS 7 100 50+ 5-89.70 22 S	AU 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	AU 1		0.30

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.88

PG4216

DATUM: REMARKS:

EASTING:

Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

REMARKS:

.25	STRATA PLOT	ТУРЕ	NUMBER	RECOVERY THE	ш	DEPTH (m)	ELEV. (m)	1			lows/0 a. Con		ER
.25	STRATA	TYPE	UMBER	/ VER	ш	,		1					∷
.25	٠ `^^^^			, S	N VALUE or RQD		, ,) Wat	ter Co	ntent %	6	PIEZOMETER
.25	\^ _^ ^ _^		Z	RE	z	0-	-94.88	2	0 4	40	60 8	80	_
\^ ^		AU	1				94.00						
\^	\^^^^ \^^^^	≋ □											
^	`^^^^	ss	2	67	9	1-	-93.88						
73	\^^^^ \^^^^	⊔ ⊠ SS	3	50	50+								
.,,,	_^ ^												
													oo
										Shear :	Shear Streng	Shear Strength (kPa	Shear Strength (kPa)

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.03

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

EASTING:

DRINGS BY: CME 55 Power Au	uger					DATE:	2018 [Decembe	er 13		BH 8	
SAMPLE DESCRIPTION	I	PLOT			/IPLE		DEPTH (m)	ELEV. (m)			Blows/0.3m Dia. Cone	TER
round Surface		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(,		○ W	ater (Content %	PIEZOMETER
OPSOIL	0.25		X				0-	94.03	20	70		
ery stiff, brown SILTY CLAY			SS	2	79	13	1-	-93.03				
	<u> </u>		ss	3	96	6	2-	-92.03				
LACIAL TILL: Brown silty sand th gravel, cobbles, boulders	I		ss Ss Ss	5	50	36	3-	91.03				
nd of Borehole	<u>4.17</u>		^				4-	-90.03				
ractical refusal to augering at 17m depth												
GWL @ 1.28m - Dec. 28, 2018												

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 93.78

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

EASTING:

BORINGS BY: CME 55 Power Aug		_		CAR	יים יי			Decembe		!-4 -	laves /0.0	
SAMPLE DESCRIPTION		N PLO			IPLE ≿		DEPTH (m)	ELEV. (m)			lows/0.3m a. Cone	ETER
		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD					ntent %	PIEZOMETER
Ground Surface	0.05	<u> </u>	×		≅	_	0-	93.78	20	40	60 80	
TOPSOIL	0.25		⊗ AU	1								
/ery stiff, brown SILTY CLAY			ss	2	96	4	1-	-92.78				
	2.00		ss	3	83	Р	2-	-91.78	Φ			140
Brown SANDY SILT, trace clay	2.29		ss		88	Р						
	3.05		ss	5	46	7	3-	-90.78				
	- - -		ss	6	79	9	4-	-89.78				
oose, brown SILTY SAND with trace clay			ss	7	71	9	5-	-88.78				
	- - -											
	6.10		ss	8	100	26	6-	-87.78				
			Ss	9	62	14	7-	-86.78				
Compact to dense, grey SILTY SAND			∆ √ss	10	62	36	8-	-85.78				
	· - -		∇					00.70				
			ss	11	42	31	9-	-84.78				_
Dynamic Cone Penetration Test commenced at 9.75m depth.	9.75 10.17	<u> </u>	<u> </u>	-			10-	-83.78				
End of Borehole												
Practical DCPT refusal at 10.17m lepth												
GWL @ 0.70m - Dec. 28, 2018)												
									20 Shor		60 80 jth (kPa)	 100

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

ELEVATION: 93.37 **EASTING:** NORTHING:

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

REMARKS:

PG4216

BORINGS BY: CME 55 Power Auger			241	/IPLE	DATE:	2018 [Decembe	
SAMPLE DESCRIPTION	A PLO				 	DEPTH (m)	ELEV. (m)	• 50 mm Dia. Cone
Ground Surface	STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD			Pen. Resist. Blows/0.3m • 50 mm Dia. Cone O Water Content % 20 40 60 80
	30		1			0-	-93.37	20 40 00 30
		∦ √ ss	2	96	6	1-	92.37	
			_					
/ery stiff, brown SILTY CLAY		ss	3	54	Р	2-	91.37	
grey by 2.9m depth		ss	4	100	Р	3-	-90.37	<u>A</u>
		ss	5	58	10	4-	-89.37	Δ
		ss	6	83	37	_	00.07	
<u>5</u> .	41	X ss	7	96	50+	5-	-88.37	
		∭ ss	8	83	75	6-	87.37	
GLACIAL TILL: Very dense, grey ilty sand with gravel, cobbles						7-	-86.37	
and boulders		Ŝ ss	9	92		8-	-85.37	
			10	100	50+	9-	-84.37	
end of Borehole	75 \^^^^							
GWL @ 0.48m - Dec. 28, 2018)								
								20 40 60 80 100 Shear Strength (kPa) ▲ Undisturbed △ Remoulded



P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqiite 2025-03-14, 10:44 Paterson_Template

SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 94.53 **EASTING:** 436079.41 **NORTHING:** 5003734.86

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216 ADVANCED BY:** Excavator

EMARKS:					DATE:	Decemb	er 1	6, 2024	HOLE NO	D.: TP 1-24	
				s	AMPLE			DCF	RESIST. (BLOW PT (50mm DIA. C	ONE)	
	Ŀ		<u>o</u>	(%		TEN	Δ	20 REMOULD	40 60 ED SHEAR STR	80 ENGTH (kPa)	NO .
SAMPLE DESCRIPTION	STRATA PLOT	Œ	TYPE AND NO.	RECOVERY (%)	8	WATER CONTENT (%)	<u> </u>		ED SHEAR STRE 40 60		PIEZOMETER CONSTRUCTION
	RAT/	DEPTH (m)	Ĩ,	8	N OR RQD	ATER (ATER CONTENT		EZON
GROUND SURFACE	S	<u> </u>	F	22	z			20	40 60	80	E ŏ i
PPSOIL 0.20m[94.33m]		· -									
ff, brown SILTY CLAY		-	-								
		_	<u> </u>			34			0		
		-						Δ22		▲ 88	,
		_									
		- 1—									
		'-									
		_									
1.40m[93.12m]		-									
vel, occasional cobbles and boulder	^ ^ ^ ^	-									
	^ ^ ^ ^ ^	-									
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-	-								
2.15m [92.38m]	~ ~ ~ ~ ~ ~	2-	B 22	;		27		0			
l of Test Pit		-									
		-									
t pit terminated on bedrock surface		-									
groundwater infiltration was observed upon		-									
pletion of the test pit		_									
		3-									
		_									
		-									
		-									
		_									
		-									
		4-									
		-									
		-									
		- -									
		-									(
		-									
		5									

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435766.77 **NORTHING:** 5003865.03 **ELEVATION:** 95.89

PROJECT: Proposed Mixed-Use Development FILE NO. : PG4216

ADVANCED BY: Excavator

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template

REMARKS: December 16, 2024 HOLE NO.: TP 2-24

REMARKS:						DATE: [Decemb	er 1	6, 20	24		Н	OLE I	NO. :	IP 2	2-24		
					SA	MPLE								WS/0.3 . CONE				
							F		2	20		40		80	80		_	
SAMPLE DESCRIPTION	6		TYPE AND NO.		8		WATER CONTENT (%)	Δ						RENG			PIEZOMETER CONSTRUCTION	ELEVATION (m)
	STRATA PLOT	DEPTH (m)	N ON O		RECOVERY (%)	N OR RQD	ე გ	•		IDR/ 20		SHE 40		RENGT 30	H (kPa 80)	METE	
	RA	蓝	Ä		ဒ္ဌ	OR F			PL (NT (%)	LL (%)	EZOI	ĕ
GROUND SURFACE	်	<u> </u>	_	-	22	z				20		40	- 6	60	80		≣ ੪	ᇤ
TOPSOIL 0.15m [95.74m]															i			
GLACIAL TILL: Compact to very dense, brown silty	^ ^ ^ ^ /	_							: 	ļ								
sand, some gravel, cobbles and boulders	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-													:			
	A A A A	-		61			9		:)	: :		::		: : :				
	A A A 4	_							:	:	:	:	:		:	:		
	$\triangle \triangle \triangle \triangle$	-																0.5
	^ ^ ^ ^	1—							<u>.</u>	į.,	[. <u>.</u>					95
	A A A A	-													:			
	^ ^ ^ ^ \	_								<u>.</u>								
	A A A 4	-							:	:	:	:	-	: :	i	:		
	A A A 4	-								ļ.								
		_													i			
	A A A A	-																
	^ ^ ^ ^ ^	2-								į.,,,								94
	A A A 4	-											Ė		i	:		
	A A A A	_							<u>:</u>	<u>.</u>	<u>.</u>	<u>.</u>		<u>.</u>				
		-								:								
	\[\triangle \triangle \	-		g 2			11		0									
- Increasing boulder content by 2.7 m depth	^ ^ ^ ^ ^	_										:			:			
	0 0 0 0	-																00
3.00m [92.89m]	A A A 4	3-								į.,	<u>.</u>		. <u>.</u>					93
End of Test Pit		-																
Practical refusal to excavation at 3.00 m depth		_							: :				. [
		-																
Groundwater infiltration was observed the bottom of		-								<u>.</u>								
the test pit		_									1		i		i			
		-							:						:			00
		4 —								i				<u>.</u>				92
		-								:								
		_								ļ			. <u>.</u>					
		-									:					:		
		-							 !	i			. i	:i.				
		-										:						
		-																
		5							<u>:</u>		<u> </u>	<u>:</u>	<u>:</u>			<u>:</u>		91

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

ELEVATION: 97.15 COORD. SYS.: UTM ZONE 18 **EASTING:** 435639.53 **NORTHING:** 5003762.56

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216**

ADVANCED BY: Excavator

EMARKS:					DATE: I	Decemb	er 1	6, 2024		HOLE NO. :	TP 3-24	
				s	AMPLE			DC	PT (50	ST. (BLOWS/0. mm DIA. CON	E)	
SAMPLE DESCRIPTION	PO		9.	(%)		WATER CONTENT (%)	Δ			60 IEAR STRENG		A TION
OAMI LE DESONI HON	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	Rad	(%)	A	20	40	EAR STRENG 60	80	PIEZOMETER CONSTRUCTION
GROUND SURFACE	STRA	DEPT	TYPE	RECC	N OR RQD	WATE		PL (%) W	VATER 40	CONTENT (%) 60) LL (%)	PIEZC
DPSOIL 0.20m [96.95m]		٠ _										9
ACIAL TILL: Compact, brown silty sand, some	^ ^ ^ ^ ^	-										
vel and cobbles, occasional boulders	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-										
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-	၂၂၀			13		0				
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-										
	^ ^ ^ ^ ^	1-										
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-										9
	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	-										
	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	-										
	^ ^ ^ ^ V	-	@5 62			10		0				
1.95m [95.20m]	0 0 0 0	-										
of Test Pit		2-										
t nit terminated on hadrack curface		-						<u> </u>				9
t pit terminated on bedrock surface		-							:			
groundwater infiltration was observed upon		-										
npletion of the test pit		-							<u>.</u>			
		-							:			
		3-										9
		-										
		-										
		-										
		-										
		4-										
		-										(
		-										
		-						<u>.</u>				
		-										
		-										
		5						<u>i i i i</u>	<u> </u>	: : :		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 94.94 **EASTING:** 435453,45 **NORTHING:** 5003767.76

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216**

ADVANCED BY: Excavator

EMARKS:					DATE: I	Decemb	er 1	6, 20	24		HOL	_E NO. :	TP	4-24		
				S	AMPLE	1.				OCPT (5	0mm	BLOWS/0 DIA. CON	IE)			
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	N OR RQD	WATER CONTENT (%)	Δ	REI UN	20 MOU IDRA 20	40 LDED S INED S	SHEAR SHEAR	60 R STRENG STRENG	80 GTH (k GTH (kl	Pa) Pa)	PIEZOMETER CONSTRUCTION	EI EVATION (m)
	TRA	EPT	YE	EC	OR I	ATE		PL (%	%)	WATE	R CON	ITENT (%) LI	L (%)	IEZO ONS	N
GROUND SURFACE	တ		<u> </u>	~	Z	<			20	40)	60	80	<u>) </u>	<u> </u>	<u> </u>
OPSOIL 0.25m (04.60m)																
0_25m [94.69m]		-							1				} · · · · · · · · · · · · · · · · · · ·		•	
, ,		-											: :			
		-	၂			33				0		:		:		
		-						<u>.</u>	<u>.</u>			:				
1 00m [02 04m]		-										:		:		9
1.00m[93.94m] ACIAL TILL: Loose, brown silt, some clay and	7	1-							ļ.,,,, ļ.				} · · · · · · · ·		•	
avel	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	_														
·	7	-														
, and the second se	^	-						<u>.</u>	į. Į							
, and the second	7	-							:			:				
ļ.	7	_	5			00		 !				<u>:</u>		<u>.</u>		
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-	<u>ق</u> 0			26		:	0			i				9
2.05m [92.89m] , and of Test Pit	7 7 7 7	2-												:		
d of restric		-							<u>.</u>	. []			<u>.</u>			
st pit terminated on bedrock surface		_							:			:				
·		-							į.	1			1			
oundwater infiltration was observed at 1.30 m		_						:	1			i				
pth		-														
		3-						<u>.</u>	į							9
		-						:	:	: :	:	:		•		
		_							ļ	. []						
		-														
		_							i							
		-							<u>.</u>							
		_														
		4 —						<u>.</u>	<u>.</u>							(
		-						:						:		
		_						 !	1							
		-														
		-														
		-							<u>.</u>							

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template



P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqiite 2025-03-14, 10:44 Paterson_Template

SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 94.65 **EASTING:** 435320.86 **NORTHING:** 5003704.85

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216 ADVANCED BY:** Excavator

REMARKS:					DATE: I	Decemb	er 1	6, 2024	HOLE NO. :	TP 5-24	
				S	AMPLE			DCPT	SIST. (BLOWS/0.3 (50mm DIA. CONE	E)	
	F		<u>o</u>	(%		EN EN	Δ		40 60 SHEAR STRENG	80 TH (kPa)	NO .
SAMPLE DESCRIPTION	STRATA PLOT	(E)	TYPE AND NO.	RECOVERY (%)	8	WATER CONTENT (%)	<u> </u>	UNDRAINED	SHEAR STRENG		PIEZOMETER CONSTRUCTION
	RAT/	DEPTH (m)	Ή.	8	N OR RQD	ATER (PL (%) WATI	ER CONTENT (%)		EZON
GROUND SURFACE	S	<u> </u>		2	z			20 4	40 60	80	≣8 i
OPSOIL0.20m[94.45m]		٠ -									
ompact, brown SILT , some sand											
		_									
		_	<u> </u>			25		0			9
		_									
		1-									
1.25m [93.40m]		-									
nd of Test Pit		_									
		-									
est pit terminated on bedrock surface											
o groundwater infiltration was observed upon		-									
ompletion of the test pit		2-									
		-									
		-									(
		3-									
		-									
		-									
		-									
		4-									
		-									
		-									
											9
		-									
		5									

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



COORD. SYS.: UTM ZONE 18

SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

ELEVATION: 95.32 **EASTING:** 435449.30 **NORTHING:** 5003642.99

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216**

ADVANCED BY: Excavator

EMARKS:					l	DATE: [Decemb	er 10	6, 2	024		Н	OLE	NO.	: 1	P 6	-24		
					SA	MPLE					DCPT	(50m		.OWS/0	NE)				
	١. ا		_	.			ENT			20		40		60		80			,
SAMPLE DESCRIPTION	STRATA PLOT	Ê	TYPE AND NO		RECOVERY (%)	Ω.	WATER CONTENT (%)	△		INDR	AINED	SHE		STREN		(kPa)		PIEZOMETER CONSTRUCTION	i i
	ATA	DEPTH (m)	á		8	N OR RQD	ER %		DI	20 (%)	١٨/٨٦	40 FED C	ONT	60 ENT /0	/\	80 LL (%	`	SOME	
GROUND SURFACE	STR	品	₽	:	띪	O	WA		FL	20	VVA	40	O	ENT (%	′0)	80	,	필증	:
DPSOIL 0.10m [95.22m]	7000								:						-				
ACIAL TILL: Compact, brown silty sand, with	\(\rangle \times \rangle \rang	-	-						<u>.</u>	. j			. į.						
avel, cobbles and boulders	A A A A	_		_											:	:			9
	A A A A	-		യ			13		0								:		
	A A A A	_							:	Ė		-	-		:				
	~ ~ ~ ~	-	-						:	1		 	· · · · ·		:		:		
405-10407-1	^ ^ ^ ^	- 1_															: 1		
1.05m [94.27m] d of Test Pit	V V V	-															: '''		
4 57 1551 IL		-							<u>:</u>								:		
st pit terminated on bedrock surface		_											-		:		:		
•		-	-						ļ.,,	di.		. j	. j		. j		ļ		
groundwater infiltration was observed upon		-							:	Ė	:	:	:	:	:	:	:		
mpletion of the test pit		-	-														: :		
		-									:				:	:			
		2-																	
		-							. <u>.</u>						. j		<u>:</u>		
		-																	
		-	-						<u>.</u>				i.				ļ		
		-																	
		-	-						 :	1			1		1		: :		
		3-													:				
		-	.									į			:	:	1		
		-	-						<u>.</u>				. i.	;	. ;		:		
		_													į				
		-	-						: :	. <u></u>		. <u>:</u>	. <u></u>				i		
		-							:						-				
		-	-																
		4 —							:										
		-																	
		-							<u>.</u>				. <u>.</u>				;		
		-]						:	:									
		-							.i	1			. j		 :				
		-	1				1		:	:	:	1		:	-	:	: 1		1
		-							:	:	:	:	-	- :	1	-	1		

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template



P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template

SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

oor o and oood ollawa olloot, ollawa,

COORD. SYS.: UTM ZONE 18 **EASTING:** 435565.10 **NORTHING:** 5003574.64 **ELEVATION:** 96.93

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Excavator

FILE NO.: PG4216

PEMARKS: December 16, 2024 HOLE NO.: TP 7-24

REMARKS:					DATE:	Decemb	er 1	6, 2024	1	H	IOLE N	0. :	TP 7-2	24	
					SAMPLE				DCP		T. (BLOV nm DIA.				
	_		o.	3	5	Ē	Δ	20 DEM		40	60 EAR STF		80 H (kBa)	- 8	1
SAMPLE DESCRIPTION	STRATA PLOT	Œ	TYPE AND NO.	RECOVERY (%)		WATER CONTENT (%)	_	UND	RAINE	D SHE	AR STR	ENGT	l (kPa)	PIEZOMETER CONSTRUCTION	FI EVATION (m)
	RATA	DEPTH (m)	PE A		N OR RQD	VIER (°		20 PL (%)		40 TER C	60 CONTEN		80 LL (%)	=ZOM	FVAT
GROUND SURFACE	S		₽	H	Ž	*		20		40	60		80	₩ 8	ū
[OPSOIL0.15m [96.78m]									:			:			
GLACIAL TILL: Compact, brown silty sand, some	\times \t	_						ļ							
ravel and cobbles, occasional boulders	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-													
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-	3	5		17		0				· · · · · · · · · · · · · · · · · · ·			
	∆ ∆ ∆ ∆ ∆ ∆ ∆ √	-													
	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	-										:			
		1—													96
	A A A A	-													
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	_													
	$\triangle \triangle \triangle A$	-							:	:	: :	:			
		_		5		12		0							
	\[\times \qq \qq \qq \qq \qq \qq \qq \qq \qq \q	-										<u>.</u>			
	A A A A	_													
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	2-									4				9
	$\triangle \triangle \triangle A$	-						: :	:	:	: :	:			
		_													
	$ \begin{array}{c c} \triangle & \triangle & \triangle & A \\ \hline \triangle & \triangle & \triangle & \Delta \\ \hline A & \triangle & \triangle & \Delta \\ \end{array} $	-													
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	_		ב פ		12		0							
2.75m [94.18m]		-													
d of Test Pit		_							:	:		:			
		3-													9
st pit terminated on bedrock surface		-						: :	:	:	: :	:			
		_													
		-										:			
		_													
		-	-					ļļ.							
		_						: :	:	:	1 :	:			
		4 —	-					<u></u>							9
		_													
		_													
		-							:			:			
		_													
		-													
		-							:	:		:			
		5						<u>i i</u>	:	:	<u>i i</u>	:	<u> </u>		9

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435618.80 **NORTHING:** 5003684.74 **ELEVATION:** 97.72

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Excavator

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template

REMARKS:						Jecenin	er 16, 2024	HOLE NO. :		
					AMPLE	—		N. RESIST. (BLOWS/0. CPT (50mm DIA. CON 40 60		
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	ę	WATER CONTENT (%)	△ REMOUL	DED SHEAR STRENG NED SHEAR STRENG 40 60	STH (kPa)	PIEZOMETER CONSTRUCTION
	RAT/	DEPTH (m)	PE /	8	N OR RQD	HE)		WATER CONTENT (%		NST
GROUND SURFACE	STI	B	Ł	8	Z	×	20	40 60	80	불용
OPSOIL 0.25m [97.47m]										
LACIAL TILL: Compact, brown silty sand, some	A A A A	-								
ravel, cobbles and boulders	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-	= 5	-		12	0			
	\(\triangle \tr	-								
	A A A A A A A A A A A A A A A A A A	_								
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	1—								
	\(\triangle \tr	_								
	A A A A	-								
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-	= 5	2		11	0			
	\(\triangle \tr	-		9		''				
	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	-								
	\(\times \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \de	2-								
	A A A A									
	\[\triangle	_								
	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	-								
		_		5		10	0			
2.70m [95.02m]	A A A 4	-								
110 of 1000 f R		_								
est pit terminated on bedrock surface		3-								
		-								
lo groundwater infiltration was observed upon		_								
ompletion of the test pit		-								
		_								
		-								
		4-								
		-								
		_								
		-								
		-							,	
		-								
		-								

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435764.56 **NORTHING:** 5003694.37 **ELEVATION:** 95.94

PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Excavator

FILE NO.: PG4216

REMARKS: DATE: December 16, 2024 HOLE NO.: TP 9-24

REMARKS:					DATE:	Decemb	er 16	5, 2024		НО	LE NO. :	TP 9-24		
				S	AMPLE	1.			DCPT	(50mm	BLOWS/0 DIA. CON	IE)		
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	Q0	WATER CONTENT (%)	Δ.		40 60 80 DULDED SHEAR STRENGTH (kPa) RAINED SHEAR STRENGTH (kPa) 40 60 80				PIEZOMETER CONSTRUCTION	ELEVATION (m)
	TRAT	DEPTH (m)	YPE ,	ECO	N OR RQD	MTEF		PL (%)	WAT	ER CO	NTENT (%) LL _(%)	IEZOI	LEVA
GROUND SURFACE TOPSOIL 0.15m [95.79m]	S			<u> </u>	Z	>		20		40	60	80	- B O	ш.
GLACIAL TILL: Compact, brown silty sand, some gravel, cobbles and boulders	\(\times \) \(\t	- - -												-
graver, commes and boulders	A A A A A A A A A A A A A A A A A A A	- -	<u> </u>			11	(o						-
	A A A A A A A A A A A A A A A A A A A	-												-
	\(\times \delta \delta \delta	- 1—												95 –
	\(\times \) \(\t	-												
	A A A A A A A A A A A A A A A A A A A	-												
	\(\times \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \delta \qua	-	8 2			12		0						
	\(\times \) \(\t	-												-
	A A A A A A A A A A A A A A A A	2-												94 –
	A A A A A A A A A A A A A A A A A A A	-												-
2.40m [93.54m]	A A A A	-							:		:			-
End of Test Pit		-												-
Test pit terminated on bedrock surface		-												-
No groundwater infiltration was observed upon		3-												93 –
completion of the test pit		- -										· · · · · · · · · · · · · · · · · · ·		
		- -							:		:			
		- -											• •	
		-												-
		4-												92-
		-												-
		- -												-
		- -												-
		- -												-
		5						:			:			91-

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.



Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 97.38 **EASTING:** 435773.40 **NORTHING:** 5003504.87

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216 ADVANCED BY:** Excavator

EMARKS:					DATE: I	Decemb	per 16, 2024			TP10-24		_
				S	AMPLE	F	- 1		ST. (BLOWS/0 0mm DIA. CON 60			
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.	RECOVERY (%)	(%)	WATER CONTENT (%)	△ REMOU ▲ UNDRA	JLDED S	HEAR STRENG	GTH (kPa)	PIEZOMETER CONSTRUCTION	(m) NOITVA
	RAT	Ë	Ĩ,	000	N OR RQD	ATE.	PL (%)	WATER	CONTENT (%		EZOI	>
GROUND SURFACE	S	<u> </u>	<u></u>	H	z	>	20	40	60	80	≣8	
OPSOIL 0.20m [97.18m]												
LACIAL TILL: Compact, brown silty sand, some	A A A A	_										
avel, cobbles and boulders	A A A A	-	= 2			14	0				!	9
	\(\times \q \times \q \times \q	-	<u></u> თ			14	<u>-</u>					
	A A A A	_						: :				
	A A A A A A A A	-										
	A A A A	- 1—										
	A A A A	· -										
	A A A A	-										
	A A A A	_	5									ç
	A A A A	-	<u> </u>			12	0	. [] .		<u> </u>		
	A A A A	_										
	A A A A A A A A	_										
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-										
	A A A A	2-										
2 20 1 05 00 1	\(\times \q \times \q	-										
2.30m [95.08m] d of Test Pit	7 7 7 7	-										ç
d of leat it		_										٥
st pit terminated on bedrock surface		-										
5. p		_						. [] .		ļ <u>ļ</u>		
groundwater infiltration was observed upon		-										
mpletion of the test pit		3-										
		_										
		-										_
		-										ζ
		_										
		-										
		_						i i				
		4-										
		-										
		_										
		-										Ĝ
		-										
		_										
		-										
		5							: :			

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqiite 2025-03-14, 10:44 Paterson_Template



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION: 94.87 EASTING:** 435928.90 **NORTHING:** 5003701.30

PROJECT: Proposed Mixed-Use Development FILE NO.: **PG4216**

ADVANCED BY: Excavator

EMARKS:					DATE:	Decemb	er 1	6, 2024		HOLE NO.	: TP11-24	
				S	AMPLE			D)CPT (50	ST. (BLOWS/0 0mm DIA. CO	NE)	
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)	g Q	WATER CONTENT (%)	Δ		INED SI	HEAR STREN		PIEZOMETER CONSTRUCTION
	RAT/	DEPTH (m)	PE /	8	N OR RQD	TER)		PL (%)	40 WATER	CONTENT (9		ZON
GROUND SURFACE	STI	吕	₽	쀭	ž	×		20	40	60	80	
OPSOIL .												
0.25m[94.62m]	\[\times \q	-										
ACIAL TILL: Compact, brown silty sand, clay, with		_				40						
vel, some cobbles, boulders and clay	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	-	<u>0</u>	'		13		0				
	\(\times \q	_										
	A A A A	-										
	A A A A	-										9
		1—									13.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.	
	\[\triangle	-										
	\(\times \)	-										
	A A A A	_	2									
	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	-				14		0				
1.80m [93.07m]	$ \begin{picture}(20,0) \put(0,0){\line(1,0){10}} \put(0,$	_						<u></u>				
of Test Pit		_										
		2-						ļģ	. [].			
t pit terminated on bedrock surface		_										
		_						.i			· · · · · · · · · · · · · · · · · · ·	
groundwater infiltration was observed upon		-										
pletion of the test pit		_										
		-										
		-										
		3-							ļ			
		-										
		-						ļ				
		_										
		-										
		-										
		_										
		-										
		4-										
		_										
		-										
		_										
		_										
		-						<u>.</u>				
		-										9
		5						<u> </u>	1 1	1 1	<u> </u>	

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation

FILE NO.:

PG4216

5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **ELEVATION**: 95.92 **EASTING:** 435480.15 **NORTHING:** 5003517.81 PROJECT: Proposed Mixed-Use Development

ADVANCED BY: Excavator

HOLE NO.: TP12-24

REMARKS:					I	DATE: [Decemb	er 1	6, 202	24		HC	LE N	10. :	TP	'12 -	24		
					SA	MPLE	1.			D	CPT (50mm	ı DIA.	VS/0.3 CONE)	•			
SAMPLE DESCRIPTION	STRATA PLOT	DEPTH (m)	TYPE AND NO.		RECOVERY (%)	RQD	WATER CONTENT (%)	Δ		IOUL DRAI	DED	SHEA		RENGT		Pa)		PIEZOMETER CONSTRUCTION	ELEVATION (m)
GROUND SURFACE	STRA'	DEPTI	TYPE	!	RECO	N OR RQD	WATE		PL (%			R CO	NTEN 60		LI	L (%)		PIEZO	ELEV
TOPSOIL					7)	4	U	00	J	80	J			
GLACIAL TILL: Compact to loose, brown silty sand,	A A A A	-																	
some gravel, occasional cobbles and boulders	^ ^ ^ ^ ^	-		G1			14		0										
	^ ^ ^ ^	-	П																
	A A A A	-	1									· · · · · ·							
	^ ^ ^ V	-	+																95-
	^ ^ ^ ^	1-	1																
	A A A A	-	1																
	^ ^ ^ ^ ^	-		G 2			40				()							
- Grey by 1.60 m depth	A A A A	-	$ \ $																
	A A A A	-		G 3			7	0	<u>.</u>										
1.90m [94.02m] End of Test Pit	<u> </u>	2-							<u>.</u>										94 –
		-	-												:				
Test pit terminated on bedrock surface		-	1												<u>.</u>				
Groundwater infiltration was observed at 1.40 m		-	1																
depth		-	1																
		-	-																
		3-	1																93 –
		-	1																
		-	-																
		-	1																
		-	1																
		-												• • • • • • • • • • • • • • • • • • • •					- ما
		4-	-								- - - - · · · · · ·								92 –
		-														:			
		-	1																
		-	$\left \cdot \right $																
		-	1													:			
		-																	-
		5							<u> </u>					1	- :	:			91-

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqlite 2025-03-14, 10:44 Paterson_Template



SOIL PROFILE AND TEST DATA

Supplemental Geotechnical Investigation 5970 and 6038 Ottawa Street, Ottawa, Ontario

COORD. SYS.: UTM ZONE 18 **EASTING:** 435577.21 **NORTHING:** 5003410.85 **ELEVATION:** 96.69

PROJECT: Proposed Mixed-Use Development FILE NO.: PG4216

ADVANCED BY: Excavator

P:/Autocad Drawings/Test Hole Data Files/PG42xx/PG4216/data.sqiite 2025-03-14, 10:44 Paterson_Template

REMARKS:				9	DATE: [1			ST. (BLOWS/	: TP13-24		Т
SAMPLE DESCRIPTION	STRATA PLOT	(m)	TYPE AND NO.	RECOVERY (%)		WATER CONTENT (%)	Δ.	20 REMOUL UNDRAI	CPT (50 40 .DED SI NED SI	90 HEAR STREN	80 IGTH (kPa) GTH (kPa)	PIEZOMETER CONSTRUCTION	
	RATA	DEPTH (m)	PE A	COVE	N OR RQD	ATER (%		20 PL (%)	40 WATER	CONTENT (9	80 %) LL (%)	ZOM	
GROUND SURFACE	S			22	ž	*		20	40	60	80	_ ≣ 8	\downarrow
TOPSOIL													
0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]0.25m[96.44m]	7 7 7 7 V	_	<u></u>										
ravel, occasional cobbles and boulders		-	۳			21		0					
0.40m[96.29m]		_						· · · · · · · · · · · · · · · · · · ·					
/eathered BEDROCK 0.60m [96.09m]		-											
ind of Test Pit		_											
		1—						ļļ	ļ				
Test pit terminated on bedrock surface		-											
		_											
lo groundwater infiltration was observed upon		-											
ompletion of the test pit		_							[· · · · · ·] ·				
		_											
		-											
		2-											
		-											
		_											
		_											
		-											
		_											
		-										• •	
		3-											
		-						<u>.</u>	: : ::		.;;;		
		_											
		-											
		_											
		_							!·····				
		4-											
		-											
		-											
								<u>.</u>	: ::				
		-											

DISCLAIMER: THE DATA PRESENTED IN THIS SHEET IS THE PROPERTY OF PATERSON GROUP AND THE CLIENT FOR WHOM IT WAS PRODUCED. THIS SHEET SHOULD BE READ IN CONJUNCTION WITH ITS CORRESPONDING REPORT. PATERSON GROUP IS NOT RESPONSIBLE FOR THE UNAUTHORIZED USE OF THIS DATA.

PAGE: 1/1

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.63

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

	_											
	PLO		SAN	IPLE .		DEPTH				t. Blows/0 n Dia. Con		TER
	STRATA	TYPE	NUMBER	% ECOVERY	N VALUE or RQD	(111)	(111)					PIEZOMETER
0.30						0-	-94.63					
		– G –	1			1-	-93.63					
		– G –	2			2-	-92.63					
		- G -	3									
		G -	4			3-	-91.63					
<u>3.70</u>		- G -	5									Ż
		3.70 0.02 0.03 0.03 0.03 0.03 0.03 0.03 0.0	0.30 G G G G				0-0.30	0 - 94.63 0 - 94.63 1 - 93.63 1 - 93.63 2 - 92.63 3 - 91.63	G 2 2-92.63 G 4 3-91.63	G 2 G 3 G 4 3-91.63	G 2 G 3 G 4 G 5	G 4 O+94.63

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St.

Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.42

DATUM: Ground surface elevations were referenced to a geodetic datum.

FILE NO.

PG4216

REMARKS: BORINGS BY: Hydraulic Shovel					DATE:	2019 (February	27	HOL	LE NC).	TF	2	
SAMPLE DESCRIPTION	PLOT		SAN	IPLE		DEPTH	ELEV.	Pen. F	lesis 0 mm			s/0.	3m	TER
	STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	0 V	/ater	Cor	nter	nt %	, 0	PIEZOMETER
Ground Surface	ပ်		ž	REC	z°	0-	94.42	20	40	6	60	8	0	Δ.
TOPSOIL0.30)_ 						34.42							
														·130
Very stiff, grey-brown SILTY CLAY		G	1			1-	93.42							130
some rootlets at upper 0.2m depth grey by 1.0m depth		G	2										^	130
<u>2</u> . <u>0</u>) / / / / / / / / / / / / / / / / / / /	G	3			2-	92.42							
GLACIAL TILL: Grey silty clay with sand, gravel, cobbles and	\^^^^ \^^^^ \^^^^	G	4											
boulders		G	5			3-	91.42							
		G	6											
<u>3.70</u> End of Test Pit	o ^^^^^	G	7											
(TP dry upon completion)														
								20 Shea	40 ar Str	eng	50 th (l		1)	100

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

EASTING:


NORTHING: ELEVATION: 94.48

DATUM: Ground surface elevations were referenced to a geodetic datum.

REMARKS: HOL

FILE NO. PG4216

HOLE NO.

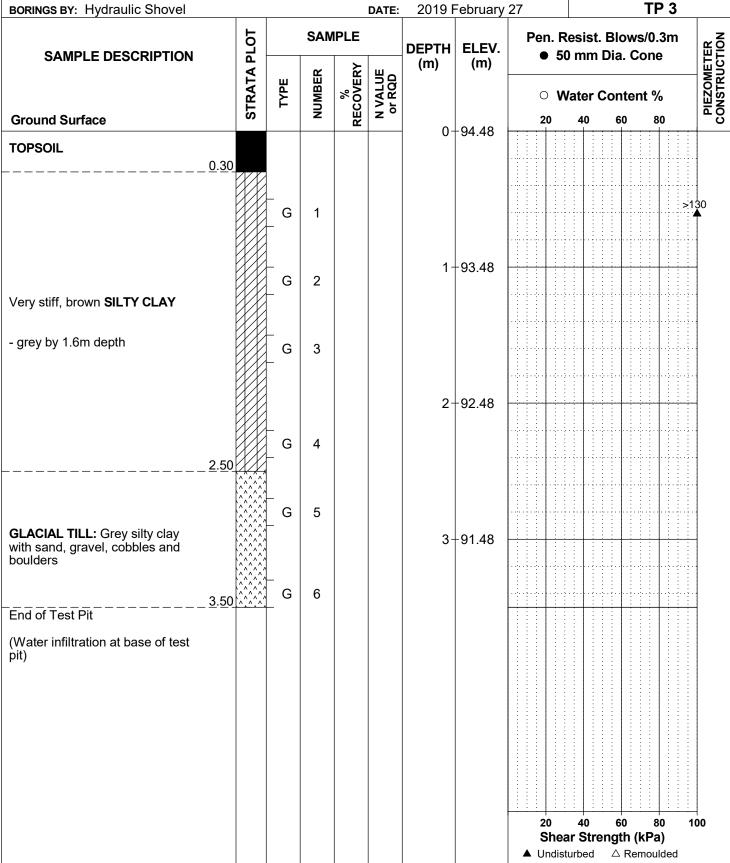

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 93.63


DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

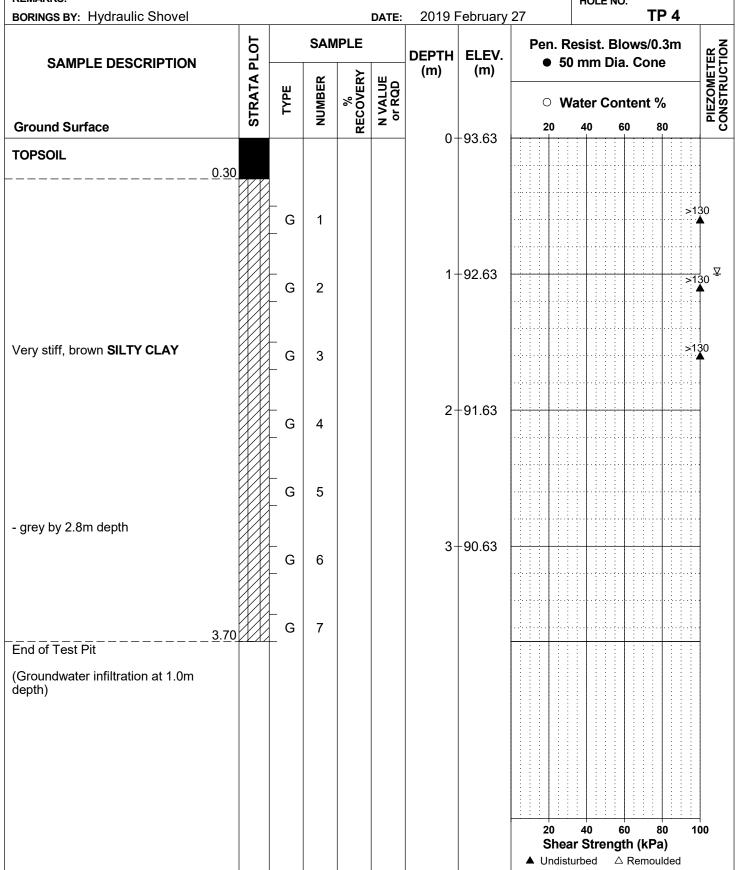

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.28

Ground surface elevations were referenced to a geodetic datum.

HOLE NO.


FILE NO.

PG4216

REMARKS:

EASTING:

DATUM:

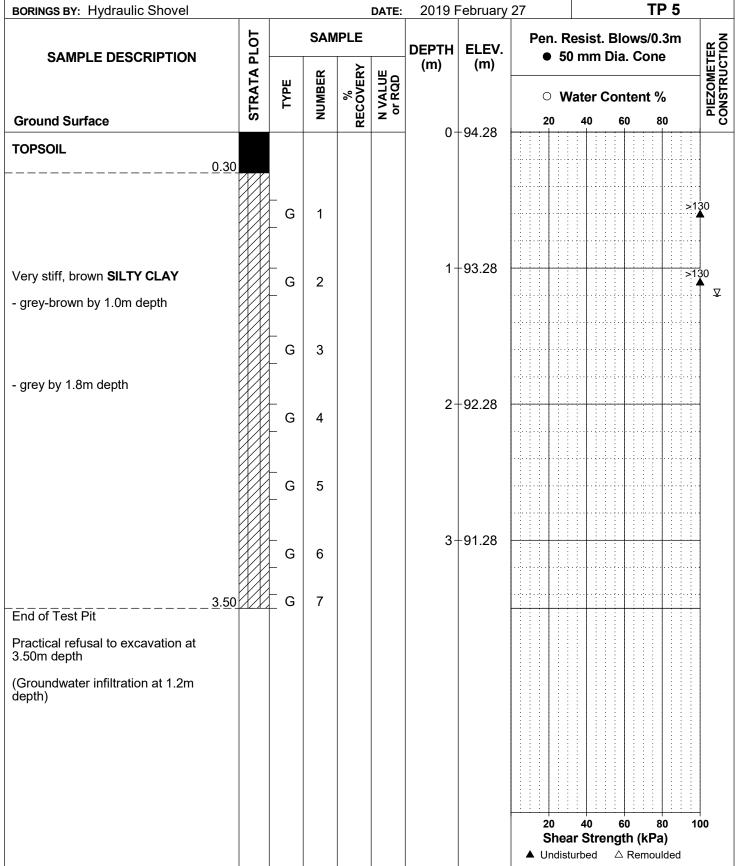

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.03


DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

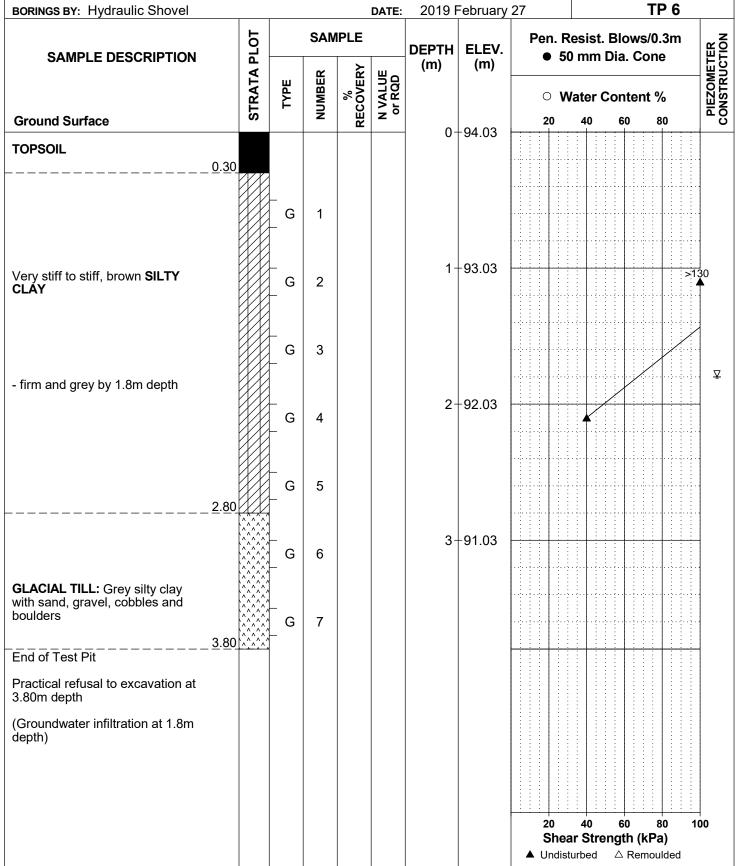

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.46

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

REMARKS: BORINGS BY: Hydraulic Shovel						DATE:	2019 I	February	27	НО	LE NO		TP	7	
SAMPLE DESCRIPTION		PLOT		SAN	IPLE		DEPTH		Pen. R					m	TER
Ground Surface		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)	O W	/ater		nten	t %		PIEZOMETER
TOPSOIL	0.30	// / / /					0-	94.46							
			_ G _	1											
Very stiff, brown SILTY CLAY			_ G _	2			1-	93.46							
			– G –	3											
- grey and with sand by 1.8m depth			_ G _	4			2-	92.46							. <u>\</u>
			_ G _	5											
Grey CLAYEY SILT	3.00 3.20		_ G _	6			3-	91.46							
GLACIAL TILL: Grey silty clay with sand, gravel, cobbles and boulders	<u>3.70</u>		_ G	7											
End of Test Pit Practical refusal to excavation at 3.70m depth			_												
(Groundwater infiltration at 1.8m depth)															
									20 Shea		reng		80 (Pa)		00

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 94.53

Ground surface elevations were referenced to a geodetic datum.

HOLE NO.

FILE NO.

PG4216

REMARKS:

EASTING:

DATUM:

	Ţ					1	1				
	PLC		SAN	IPLE		DEPTH		Pen. R ● 50		. Blow Dia. C	TER
	STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)			Conte	PIEZOMETER
0.30						0-	-94.53				
		_ _ G	1								
		_ G	2			1-	-93.53				-
		- G	3								
		_	3								. <u>Z</u>
		_ G _	4			2-	92.53				
_ 2.80		_ G _	5								
		_ G	6			3-	-91.53				
		_	7								
_ 3.80	\^^^^	-	,								
											100
	_ 2.80_		G G G G G G G G G G G G G G G G G G G	G 1 G 2 G 3 G 5 G 5 A 6 A 7 A 80 G 1 G 2 G 3 G 5 2.80 AAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAA	G 1 G 2 G 3 G 5 2.80 \(\hat{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi}\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi}\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi}\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi_{\chi}\chi_{\chi_{\chi}\}\chi_{\chi_{\chi}\chi_{\chi}\chi_{\chi}\chi_{\chi}\chi_{\chi}\chi_{\chi}\chi}\chi_{\chi}\chi_{\chi}\chi_{\c	G 1 G 2 G 3 G 5 2-80 G 6 3-3-80	G 1 G 2 1-93.53 G 2 1-93.53 G 5 2-92.53 3-91.53	G 1 G 2 1-93.53 G 3 2-92.53 G 6 3-91.53	G 1 G 2 1-93.53 G 3 2-92.53 G 6 3-91.53	 G 1 G 2 1-93.53 G 3 2-92.53 G 6 3-91.53 G 7 3.80 20 40 60 80 Shear Strength (kPa)	

SOIL PROFILE AND TEST DATA

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

NORTHING: ELEVATION: 97.18

DATUM: Ground surface elevations were referenced to a geodetic datum.

HOI E NO

FILE NO.

PG4216

REMARKS: BORINGS BY: Hydraulic Shovel						DATE:	2010 F	- ebruary	27	HOL	E NO.		9	
SAMPLE DESCRIPTION		ГОТ		SAN	IPLE	DAIE:	DEPTH	ELEV.	Pen. F	⊥ Resist 0 mm		ws/0.	3m	띪
SAMPLE DESCRIPTION		STRATA PLOT	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(m)	(m)		Vater				PIEZOMETER
Ground Surface		S	•	ž	REC	z °		07.10	20	40	60	8	0	┫
TOPSOIL Brown SILTY SAND with rootlets	0.30 0.60	^^^^						-97.18						
GLACIAL TILL: Brown silty sand with gravel, cobbles and boulders, some clay							1-	-96.18						
End of Test Pit Practical refusal to excavation at 1.80m depth	1.80		_ G _	1										
(TP dry upon completion)														
										40	60) 8		

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

ELEVATION: 97.48 **EASTING:** NORTHING: DATUM:

FILE NO. **PG4216**

REMARKS:

Ground surface elevations were referenced to a geodetic datum.

REMARKS:						0040			HOLE NO.	TDOA	
BORINGS BY: Hydraulic Shovel					DATE:	2019 (February	27		TP 9A	
SAMPLE DESCRIPTION	STRATA PLOT			IPLE ≿	l	DEPTH (m)	ELEV. (m)		esist. Blows mm Dia. C		ETER
	TRATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD			0 N	later Conter	it %	PIEZOMETER CONSTRUCTION
Ground Surface	ဟ		Z	2	2	0-	97.48	20	40 60	80	-8
TOPSOIL Brown SILTY SAND, trace rootlets							07.10				
0.6	O [. [.] [. ^^^^^ ^^^^^					1-	-96.48				
GLACIAL TILL: Light brown to grey silty sand with clay, gravel, cobbles and boulders	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\					'	90.40				-
cobbles and boulders						2-	95.48				
2.4 End of Test Pit	D \\\^\^\^\\\\										
Practical refusal to excavation at 2.40m depth											
(TP dry upon completion)											
								20 Shea ▲ Undist	40 60 Ar Strength (I		00

SOIL PROFILE AND TEST DATA

Geotechnical Investigation

Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

EASTING: NORTHING: ELEVATION: 95.63 **DATUM:** Ground surface elevations were referenced to a geodetic datum.

FILE NO. PG4216

REMARKS:						0040.5		07	HOL	E NO.		١٨
BORINGS BY: Hydraulic Shovel	 -		CAN	1PLE	DATE:	2019 F	ebruary			. Dia	TP ² ws/0.3	
SAMPLE DESCRIPTION	STRATA PLOT					DEPTH (m)	ELEV. (m)				Cone	PIEZOMETER
	ATA	TYPE	NUMBER	% RECOVERY	N VALUE or RQD	(,	(,		lator	Cont	tent %	ZOME
Ground Surface	STR	۲	N N	RECO	N P			20	40	60		불
TOPSOIL						0-	-95.63					
0.3	5											
/ery stiff, red-brown SILTY CLAY, some sand, trace organics 0.69	- H	G	1									
GLACIAL TILL: Brown silty sand) \^^^^	G	2									
End of Test Pit												
Practical refusal to excavation at 0.90m depth												
TP dry upon completion)												
								20 Short	40 or Str	60		100
								Snea ▲ Undis			h (kPa) Remould	ed

SOIL PROFILE AND TEST DATA

FILE NO.

PG4216

Geotechnical Investigation Proposed Development - Eagleson Road at Ottawa St. Ottawa, Ontario

9 Auriga Drive, Ottawa, Ontario K2E 7T9

EASTING:

DATUM:

ELEVATION: 94.45 **NORTHING:**

Ground surface elevations were referenced to a geodetic datum.

SAMPLE DESCRIPTION round Surface LL: Sand with cobbles	STRATA PLOT	ТҮРЕ	NUMBER	RECOVERY BTA	N VALUE or RQD	DEPTH (m)	ELEV. (m)	Pen. R ● 50 ○ W 20) mm	Dia Con	. Co	ne : %	PIEZOMETER
LL: Sand with cobbles0. ACIAL TILL: Loose to mpact, grey-brown silty sand		TYPE	NUMBER	% RECOVER	N VALUE or RQD								EZOME
LL: Sand with cobbles0. ACIAL TILL: Loose to mpact, grey-brown silty sand			Z	RE	Z			20	40		_	00	=
_ACIAL TILL: Loose to	25					1 ()+	94.45	 			0	80	
mpact, grey-brown silty sand							01.10						
mpact, grey-brown silty sand													
mpact, grey-brown silty sand													
mpact, grey-brown silty sand	\^^^^												
mpact, grey-brown silty sand	\^ _^ ^ _\	_ G	1			1-	93.45						
mpact, grey-brown sity sand th clay, gravel, cobbles and ulders	\^^^^	_											
ulueis	\^^^^	_											
		_ G _	2										
							00.45						
		G	3			2-	-92.45						
	\^^^^^												
	\^^^^^	_ G	4										
<u>2</u> . nd of Test Pit	.80 \^^^^	_											
actical refusal to excavation at													
80m depth													
P dry upon completion)													
								20	40	6	n	80	100

SYMBOLS AND TERMS

SOIL DESCRIPTION

Behavioural properties, such as structure and strength, take precedence over particle gradation in describing soils. Terminology describing soil structure are as follows:

Desiccated	-	having visible signs of weathering by oxidation of clay minerals, shrinkage cracks, etc.
Fissured	-	having cracks, and hence a blocky structure.
Varved	-	composed of regular alternating layers of silt and clay.
Stratified	-	composed of alternating layers of different soil types, e.g. silt and sand or silt and clay.
Well-Graded	-	Having wide range in grain sizes and substantial amounts of all intermediate particle sizes (see Grain Size Distribution).
Uniformly-Graded	-	Predominantly of one grain size (see Grain Size Distribution).

The standard terminology to describe the strength of cohesionless soils is the relative density, usually inferred from the results of the Standard Penetration Test (SPT) 'N' value. The SPT N value is the number of blows of a 63.5 kg hammer, falling 760 mm, required to drive a 51 mm O.D. split spoon sampler 300 mm into the soil after an initial penetration of 150 mm.

Relative Density	'N' Value	Relative Density %
Very Loose	<4	<15
Loose	4-10	15-35
Compact	10-30	35-65
Dense	30-50	65-85
Very Dense	>50	>85

The standard terminology to describe the strength of cohesive soils is the consistency, which is based on the undisturbed undrained shear strength as measured by the in situ or laboratory vane tests, penetrometer tests, unconfined compression tests, or occasionally by Standard Penetration Tests.

Consistency	Undrained Shear Strength (kPa)	'N' Value		
Very Soft	<12	<2		
Soft	12-25	2-4		
Firm	25-50	4-8		
Stiff	50-100	8-15		
Very Stiff	100-200	15-30		
Hard	>200	>30		

SYMBOLS AND TERMS (continued)

SOIL DESCRIPTION (continued)

Cohesive soils can also be classified according to their "sensitivity". The sensitivity is the ratio between the undisturbed undrained shear strength and the remoulded undrained shear strength of the soil.

Terminology used for describing soil strata based upon texture, or the proportion of individual particle sizes present is provided on the Textural Soil Classification Chart at the end of this information package.

ROCK DESCRIPTION

The structural description of the bedrock mass is based on the Rock Quality Designation (RQD).

The RQD classification is based on a modified core recovery percentage in which all pieces of sound core over 100 mm long are counted as recovery. The smaller pieces are considered to be a result of closely-spaced discontinuities (resulting from shearing, jointing, faulting, or weathering) in the rock mass and are not counted. RQD is ideally determined from NXL size core. However, it can be used on smaller core sizes, such as BX, if the bulk of the fractures caused by drilling stresses (called "mechanical breaks") are easily distinguishable from the normal in situ fractures.

RQD %	ROCK QUALITY
90-100	Excellent, intact, very sound
75-90	Good, massive, moderately jointed or sound
50-75	Fair, blocky and seamy, fractured
25-50	Poor, shattered and very seamy or blocky, severely fractured
0-25	Very poor, crushed, very severely fractured

SAMPLE TYPES

SS	-	Split spoon sample (obtained in conjunction with the performing of the Standard Penetration Test (SPT))								
TW	-	Thin wall tube or Shelby tube								
PS	-	Piston sample								
AU	-	Auger sample or bulk sample								
WS	-	Wash sample								
RC	-	Rock core sample (Core bit size AXT, BXL, etc.). Rock core samples are obtained with the use of standard diamond drilling bits.								
Р	-	Split-spoon pushed through sampling interval which was also tested using a vane apparatus and resulted in a obtaining a sample of disturbed material (i.e., blow-counts not reflective of undisturbed, in-situ soils and not considered relevant)								

SYMBOLS AND TERMS (continued)

GRAIN SIZE DISTRIBUTION

MC% - Natural moisture content or water content of sample, %

Liquid Limit, % (water content above which soil behaves as a liquid)
 PL - Plastic limit, % (water content above which soil behaves plastically)

PI - Plasticity index, % (difference between LL and PL)

Dxx - Grain size which xx% of the soil, by weight, is of finer grain sizes

These grain size descriptions are not used below 0.075 mm grain size

D10 - Grain size at which 10% of the soil is finer (effective grain size)

D60 - Grain size at which 60% of the soil is finer

Cc - Concavity coefficient = $(D30)^2 / (D10 \times D60)$

Cu - Uniformity coefficient = D60 / D10

Cc and Cu are used to assess the grading of sands and gravels:

Well-graded gravels have: 1 < Cc < 3 and Cu > 4 Well-graded sands have: 1 < Cc < 3 and Cu > 6

Sands and gravels not meeting the above requirements are poorly-graded or uniformly-graded.

Cc and Cu are not applicable for the description of soils with more than 10% silt and clay

(more than 10% finer than 0.075 mm or the #200 sieve)

CONSOLIDATION TEST

p'₀ - Present effective overburden pressure at sample depth

p'_c - Preconsolidation pressure of (maximum past pressure on) sample

Ccr - Recompression index (in effect at pressures below p'c)
Cc - Compression index (in effect at pressures above p'c)

OC Ratio Overconsolidaton ratio = p'_c/p'_o

Void Ratio Initial sample void ratio = volume of voids / volume of solids


Wo - Initial water content (at start of consolidation test)

PERMEABILITY TEST

Coefficient of permeability or hydraulic conductivity is a measure of the ability of water to flow through the sample. The value of k is measured at a specified unit weight for (remoulded) cohesionless soil samples, because its value will vary with the unit weight or density of the sample during the test.


SYMBOLS AND TERMS (continued)

STRATA PLOT

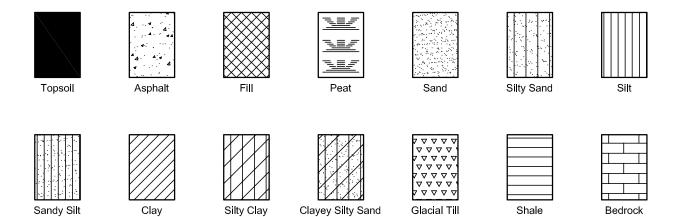

MONITORING WELL AND PIEZOMETER CONSTRUCTION



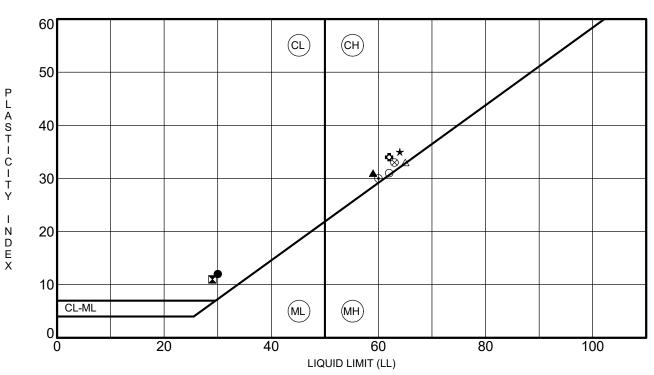

	Specimen Identi	fication	LL	PL	PI	Fines	Classification
•	BH 3-25	SS2	30	18	12		CL - Inorganic clays of low plasticity
×	BH11-24	SS3	29	18	11		CL - Inorganic clays of low plasticity
A	HA 1-25	G1	59	28	31		CH - Inorganic clays of high plasticity
*	HA 2-25	G1	64	29	35		CH - Inorganic clays of high plasticity
•	HA 3-25	G1	60	30	30		CH - Inorganic clays of high plasticity
0	HA 4-25	G1	62	28	34		CH - Inorganic clays of high plasticity
0	HA 5-25	G1	62	31	31		CH - Inorganic clays of high plasticity
Δ	HA 6-25	G1	65	32	33		CH - Inorganic clays of high plasticity
\otimes	HA 7-25	G1	63	30	33		CH - Inorganic clays of high plasticity


CLIENTTaggart InvestmentsFILE NO.PG4216PROJECTGeotechnical Investigation - Proposed Mixed-UseDATE2 Sep 25

Development - 5970 and 6038 Ottawa Street



9 Auriga Drive Ottawa, Ontario K2E 7T9 TEL: (613) 226-7381

ATTERBERG LIMITS'
RESULTS

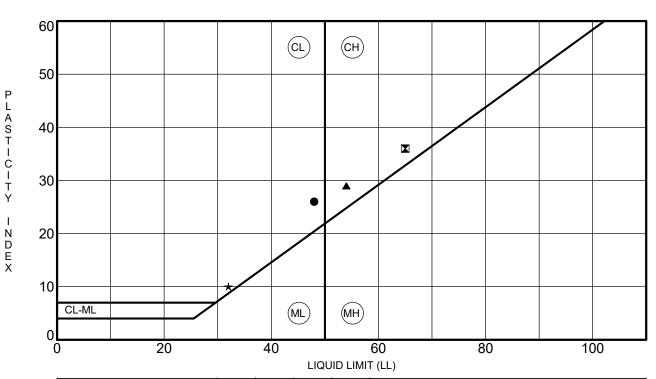

5	Specimen Identification		LL	PL	PI	Fines	Classification
•	BH 3A-21	SS2	48	22	26		CL - Inorganic clays of low plasticity
	BH 4-24	SS4	65	29	36		CH - Inorganic clays of high plasticity
	BH12-24	SS2	54	25	29		CH - Inorganic clays of high plasticity
*	BH14-24	SS1	32	22	10		CL - Inorganic clays of low plasticity

 CLIENT
 Tamarack ("Richmond") Corporation
 FILE NO.
 PG4216


 PROJECT
 Geotechnical Investigation - Proposed Mixed-Use
 DATE
 14 Jan 25

Development - 5970 and 6038 Ottawa Street



9 Auriga Drive Ottawa, Ontario K2E 7T9 TEL: (613) 226-7381

ATTERBERG LIMITS'
RESULTS

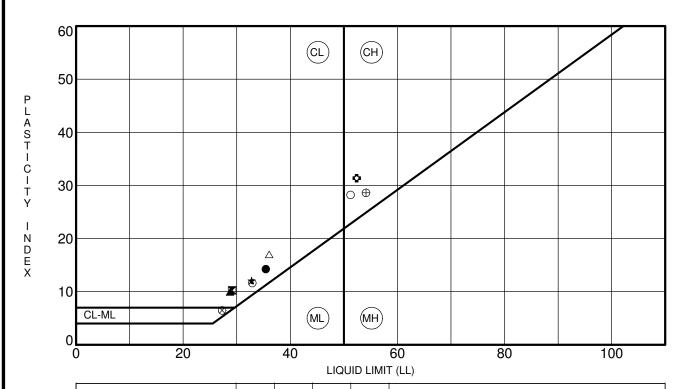

5	Specimen Identif	ication	LL	PL	PI	Fines	Classification		
•	BH 2	SS 2	35	21	14		CL - Inorganic clay with low plasticity		
	BH 3	SS 3	29	19	10		CL - Inorganic clay with low plasticity		
A	BH 8	SS 2	29	19	10		CL - Inorganic clay with low plasticity		
*	TP 2	G 3	33	21	12		CL - Inorganic clay with low plasticity		
•	TP 3	G 4	33	21	12		CL - Inorganic clay with low plasticity		
0	TP 4	G 6	52	21	31		CH - Inorganic clays of high plasticity		
0	TP 5	G 6	51	23	28		CH - Inorganic clays of high plasticity		
Δ	TP 6	G 5	36	19	17		CL - Inorganic clay with low plasticity		
\otimes	TP 7	G 6	27	21	6		CL-ML - Inorganic silt with some clay with low բ	olas	ticity
\oplus	TP 8	G 5	54	26	29		CH - Inorganic clays of high plasticity		


CLIENTTaggart ConstructionFILE NO.PG4216PROJECTGeotechnical Investigation - ProposedDATE27 Feb 19


patersongroup con Engli


Development - Eagleson Road at Ottawa St.


Consulting Engineers ATTERBERG LIMITS'
RESULTS


9 Auriga Drive, Ottawa, Ontario K2E 7T9

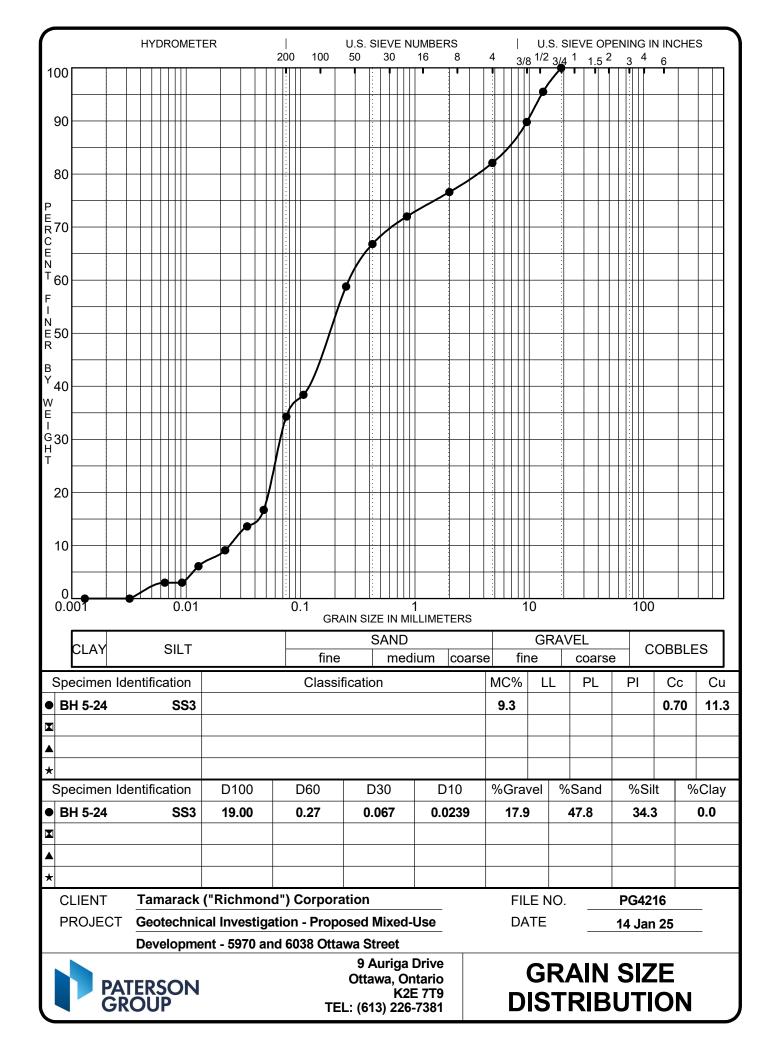


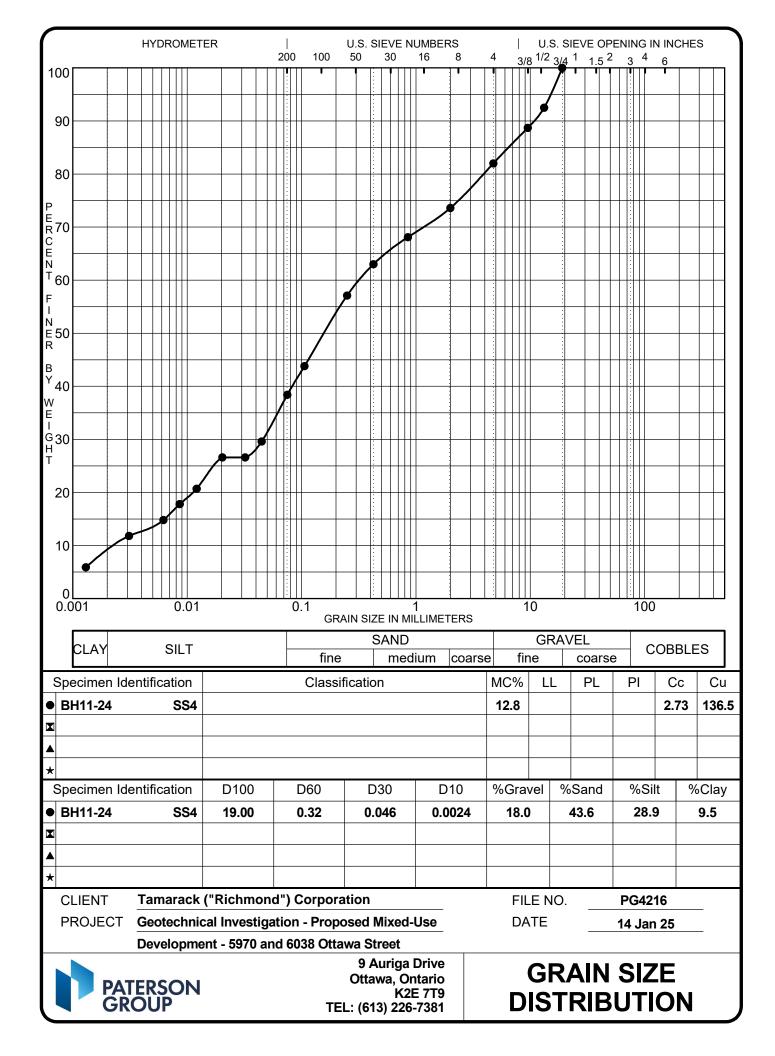


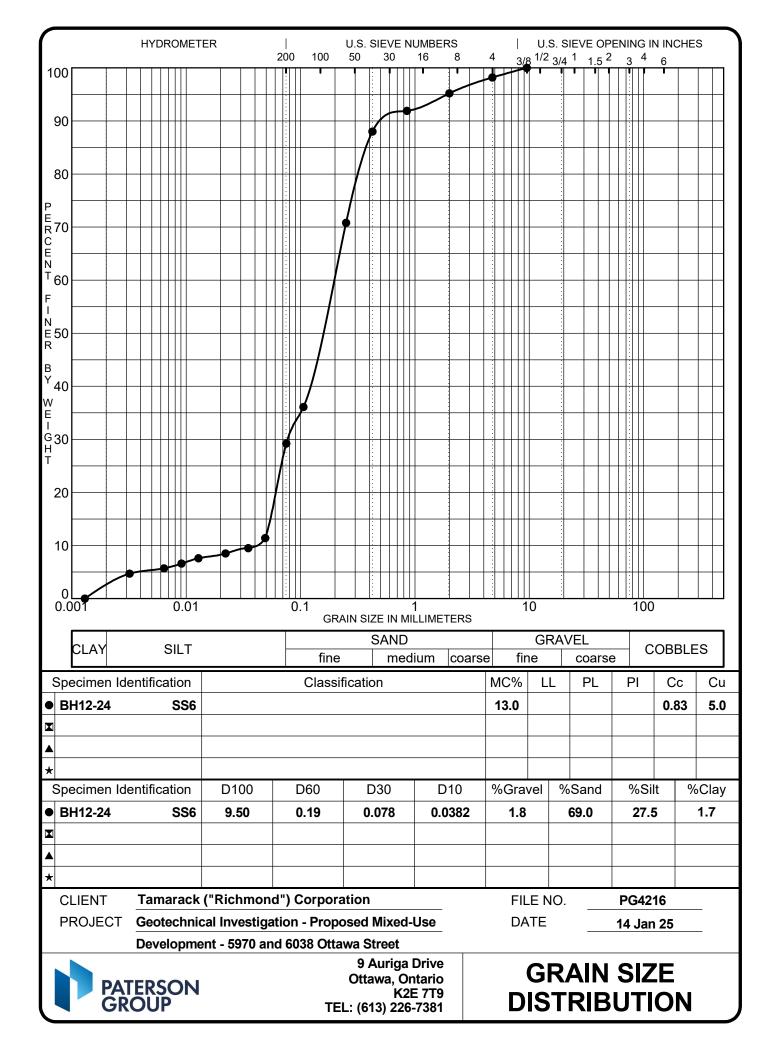


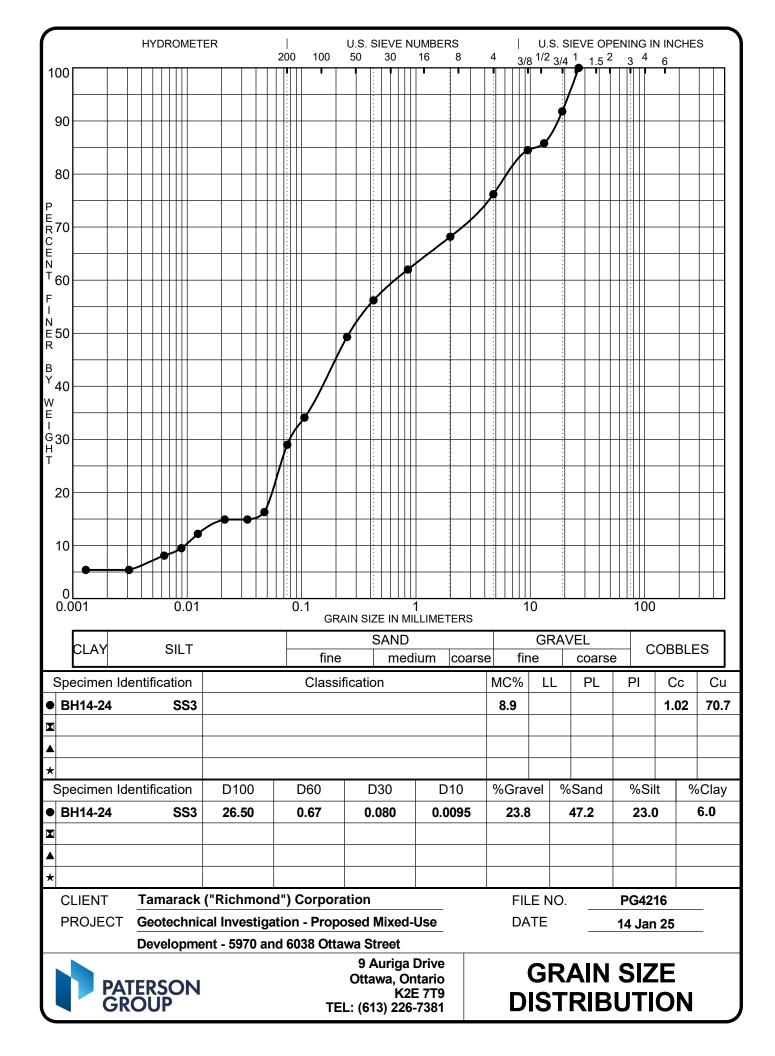


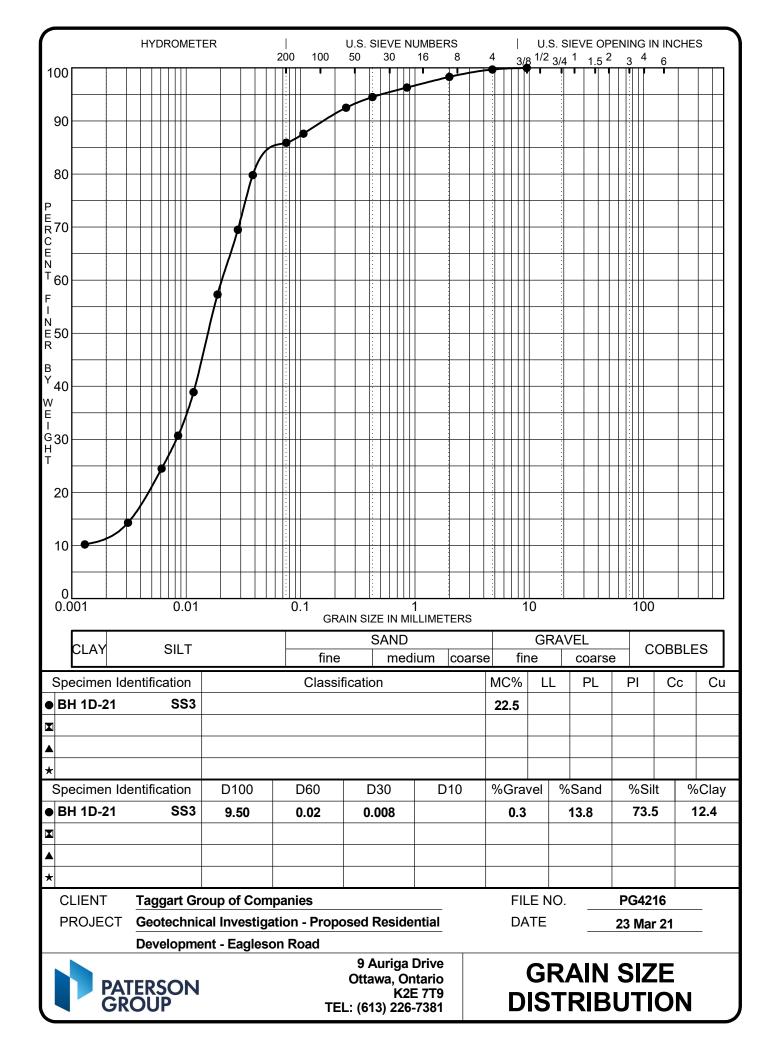


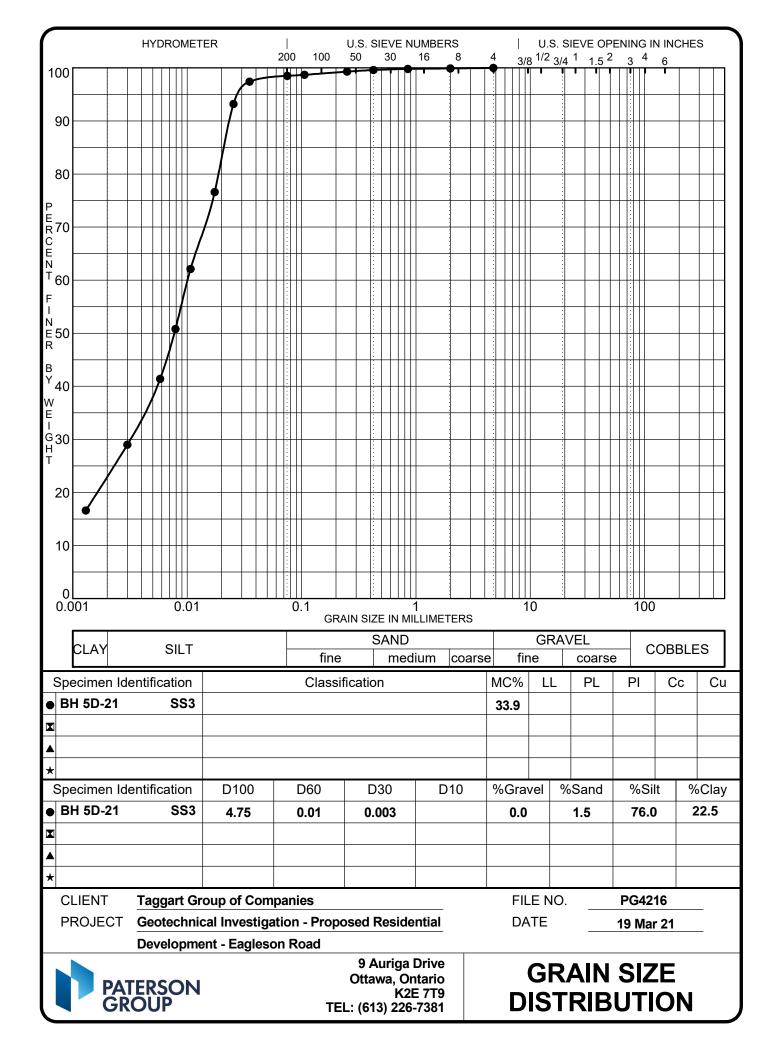


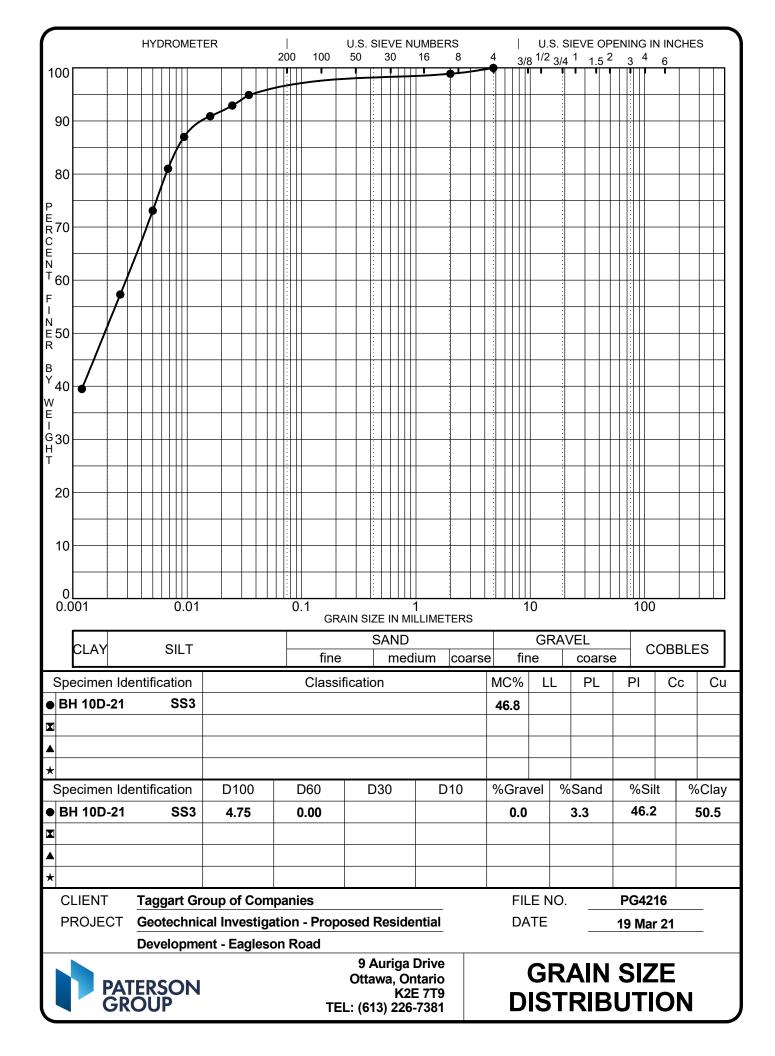


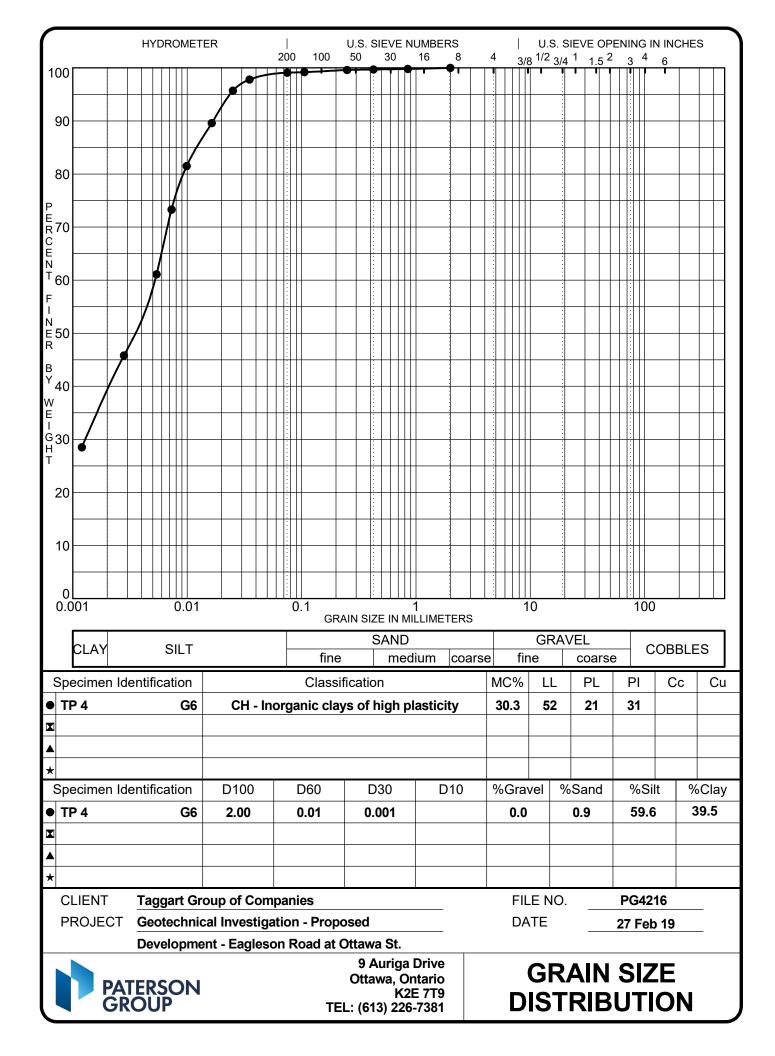


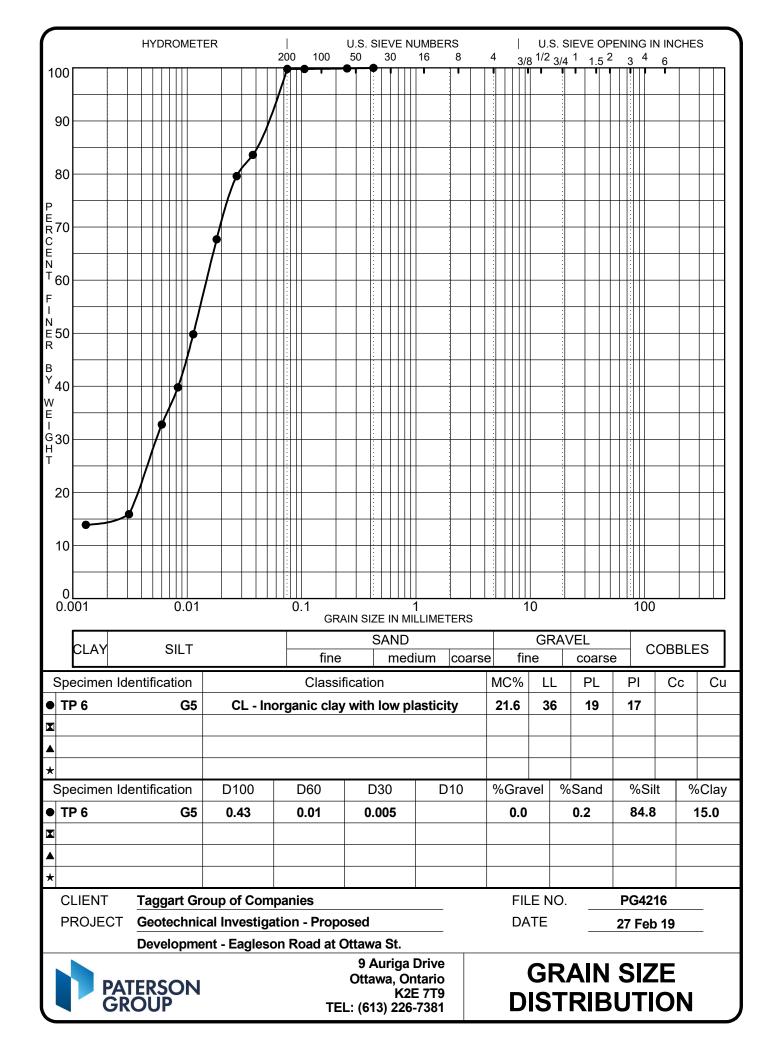

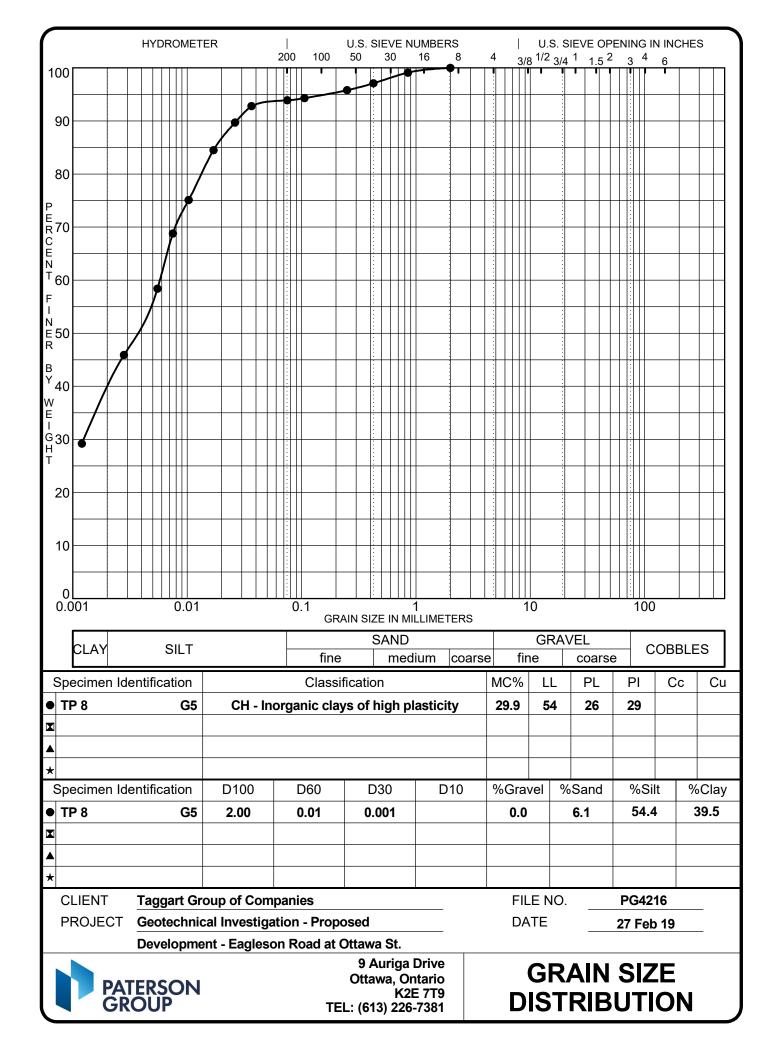

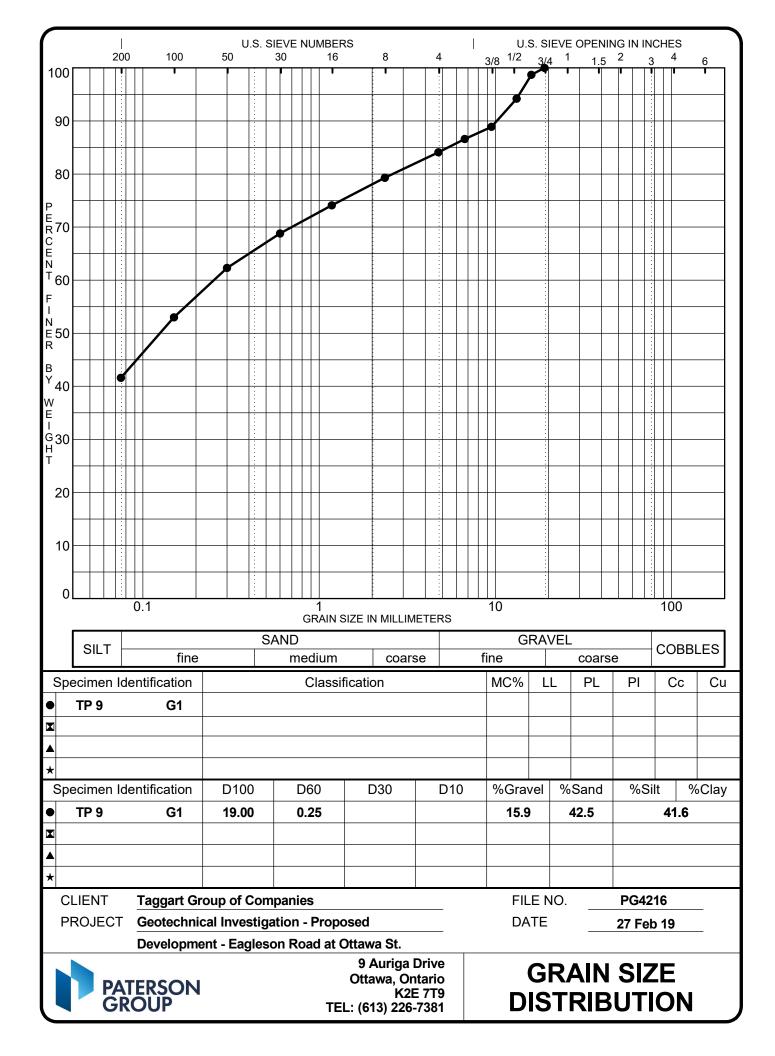

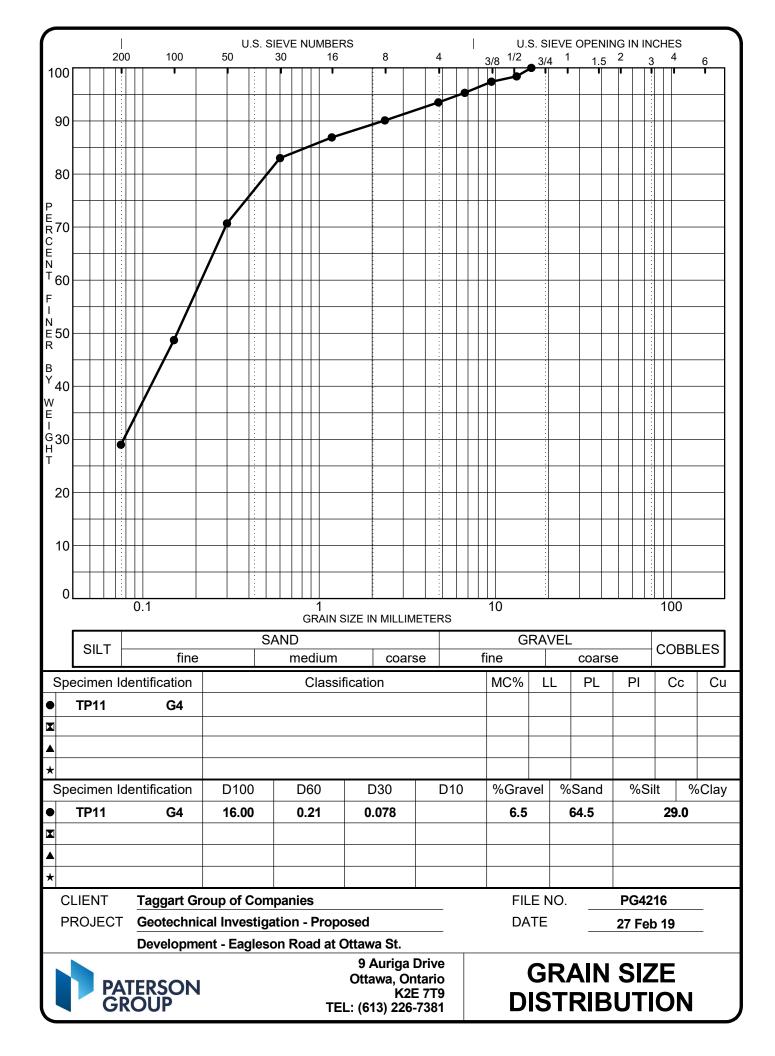

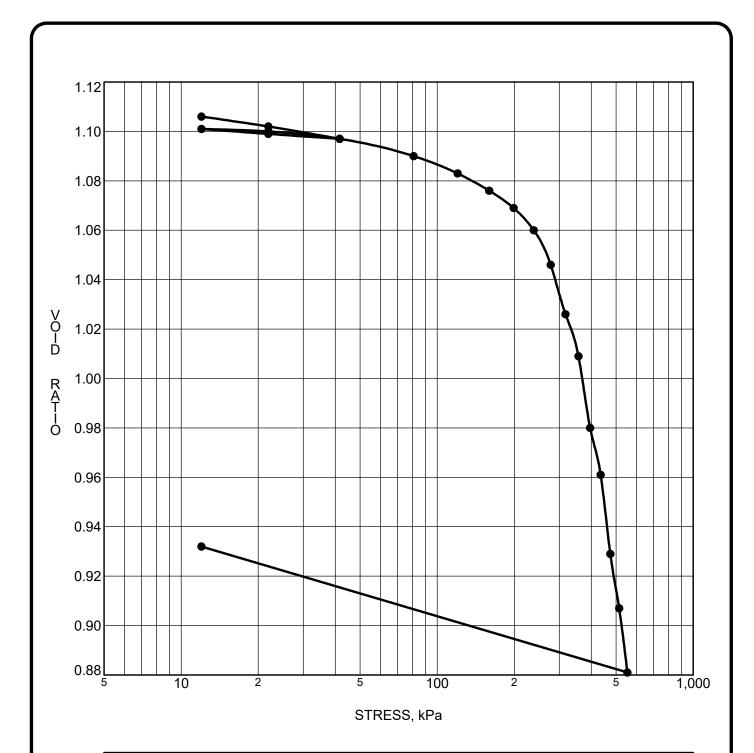

CONSOLIDATION TEST DATA SUMMARY									
Borehole No.	BH 3B-21	p'o	56.76 kPa	Ccr	0.009				
Sample No.	TW1	p'c	300 kPa	Сс	0.687				
Sample Depth	3.38 m	OC Ratio	5.3	Wo	40.4 %				
Sample Elev.	90.40 m	Void Ratio	1.111	Unit Wt.	17.9 kN/m ³				

CLIENT Tamarack ("Richmond") Corporation FILE NO. PG4216


PROJECT Geotechnical Investigation Proposed Mixed-Use DATE 2025-01-20

Development - Eagleson Road

patersongroup

Consulting Engineers CONSOLIDATION TEST

9 Auriga Drive, Ottawa, Ontario K2E 7T9

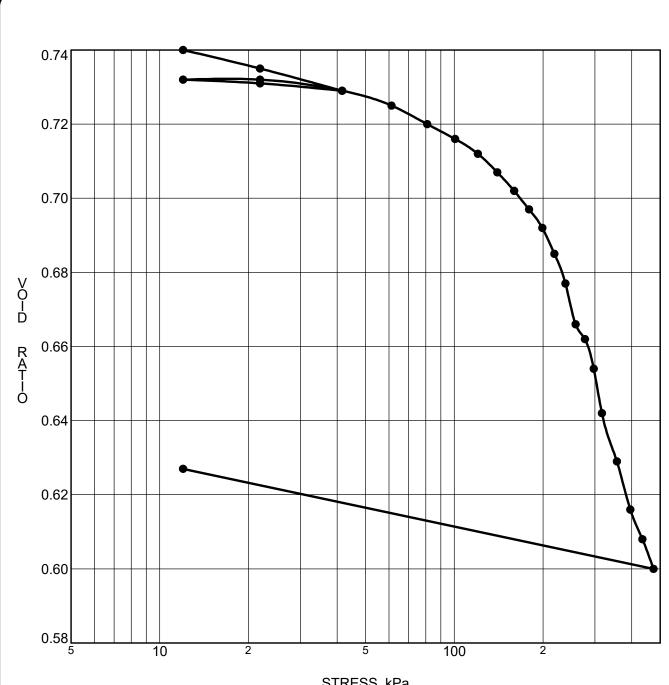

STRESS,	kPa
---------	-----

CONSOLIDATION TEST DATA SUMMARY									
Borehole No.	BH 3B-21	p'o 60.5 8	kPa	Ccr	0.006				
Sample No.	TW2	p'c 176.4 3	kPa	Сс	0.247				
Sample Depth	4.06 m	OC Ratio 2.9)	Wo	27.1 %				
Sample Elev.	89.72 m	Void Ratio 0.7	46	Unit Wt.	19.6 kN/m ³				


CLIENTTamarack ("Richmond") CorporationFILE NO.PG4216PROJECTGeotechnical InvestigationProposed Mixed-UseDATE2025-01-14

Development - Eagleson Road

patersongroup

Consulting Engineers CONSOLIDATION TEST

9 Auriga Drive, Ottawa, Ontario K2E 7T9

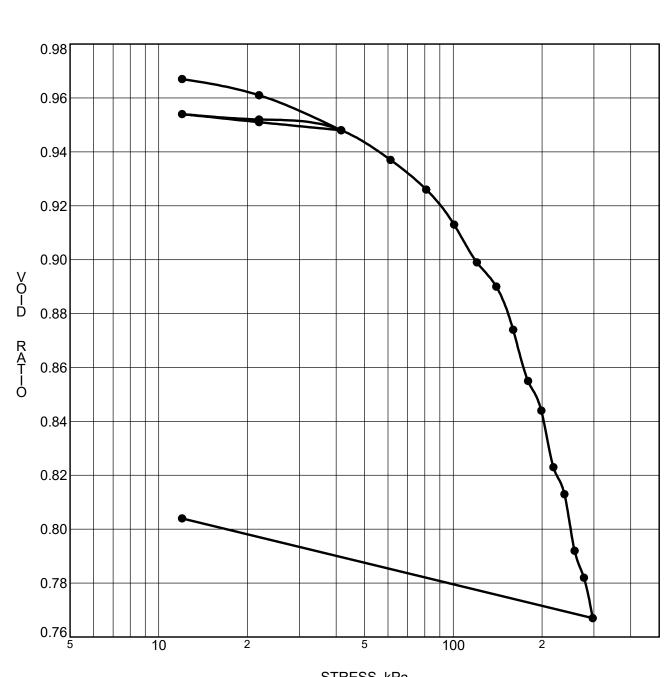

27	RESS.	_k D _Ω
S 1	KESS.	кРа

CONSOLIDATION TEST DATA SUMMARY							
Borehole No.	BH12A-24	p' _o 54.83 kPa	Ccr	0.012			
Sample No.	TW2	p'c 146.01 kPa	Сс	0.420			
Sample Depth	4.27 m	OC Ratio 2.7	Wo	35.5 %			
Sample Elev.	89.24 m	Void Ratio 0.975	Unit Wt.	18.5 kN/m ³			

Tamarack ("Richmond") Corporation **CLIENT** PROJECT Geotechnical Investigation Proposed Mixed-Use FILE NO. PG4216 2025-01-20 DATE

Development - Eagleson Road

patersongroup

Consulting Engineers

CONSOLIDATION TEST

9 Auriga Drive, Ottawa, Ontario K2E 7T9



Order #: 1851341

Certificate of Analysis


Client: Paterson Group Consulting Engineers

Client PO: 25710

Report Date: 27-Dec-2018 Order Date: 19-Dec-2018

Project Description: PG4216

	Client ID:	BH8-SS3	-	-	-
	Sample Date:	12/17/2018 15:00	-	-	-
	Sample ID:	1851341-01	-	-	-
	MDL/Units	Soil	-	-	-
Physical Characteristics					
% Solids	0.1 % by Wt.	89.5	-	-	-
General Inorganics	·				
рН	0.05 pH Units	7.94	-	-	-
Resistivity	0.10 Ohm.m	96.9	-	-	-
Anions					
Chloride	5 ug/g dry	6	-	-	-
Sulphate	5 ug/g dry	<5	-	-	-

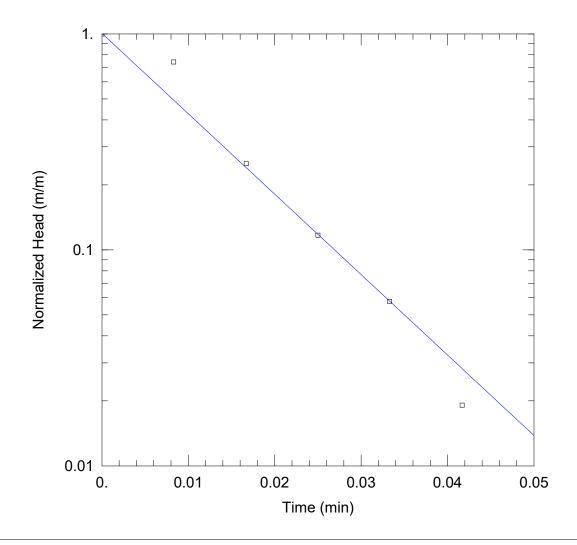

Data Set: P:\...\PG4216 BH9-24 Falling Head 1 of 1.aqt

Date: 02/26/25 Time: 16:14:40

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH9-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 5.135 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH9-24)

Initial Displacement: 0.649 m

Total Well Penetration Depth: 5.135 m

Casing Radius: 0.01588 m

Static Water Column Height: 5.135 m


Screen Length: 1.524 m Well Radius: 0.0381 m

SOLUTION

Aquifer Model: Confined

Solution Method: Hvorslev

K = 0.0005179 m/sec y0 = 0.6533 m

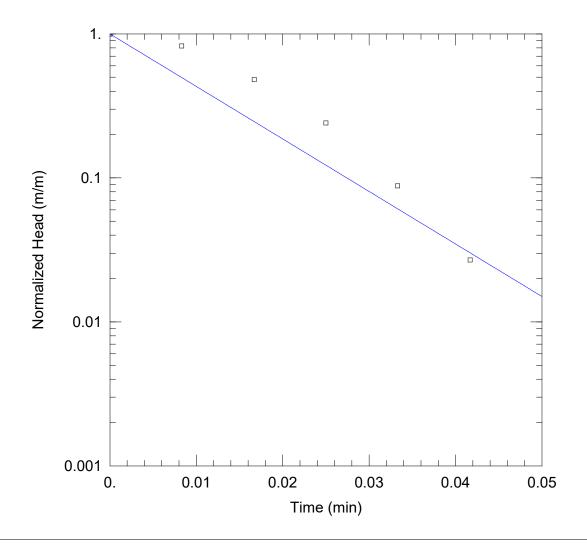

Data Set: P:\...\PG4216 BH9-24 Rising Head 1 of 1 - Copy.agt

Date: 02/26/25 Time: 16:59:59

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH9-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 5.14 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH9-24)

Initial Displacement: 0.325 m

Total Well Penetration Depth: 5.14 m

Casing Radius: 0.01588 m

Static Water Column Height: 5.14 m

Screen Length: 1.524 m Well Radius: 0.0381 m


SOLUTION

Aquifer Model: Confined

Solution Method: Hvorslev

K = 0.0005072 m/sec

y0 = 0.325 m

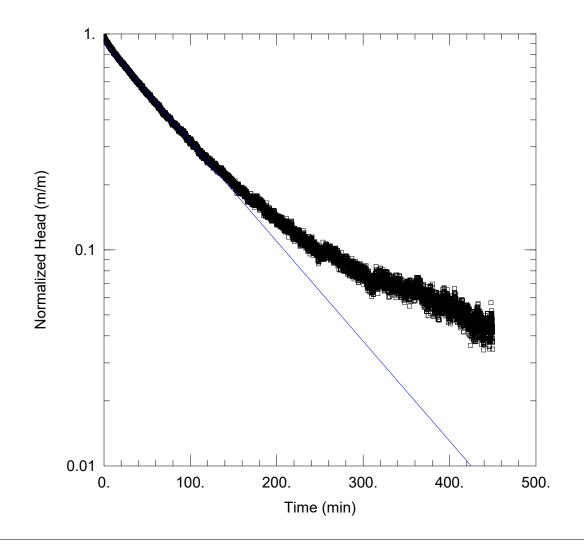

Data Set: P:\...\PG4216 BH10-24 Falling Head 1 of 1.aqt

Date: 02/26/25 Time: 16:18:32

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH10-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 2.11 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH10-24)


Initial Displacement: <u>0.448</u> m Static Water Column Height: <u>2.11</u> m

Total Well Penetration Depth: 2.11 m Screen Length: 1.524 m Casing Radius: 0.0254 m Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 1.265E-7 m/sec y0 = 0.4117 m

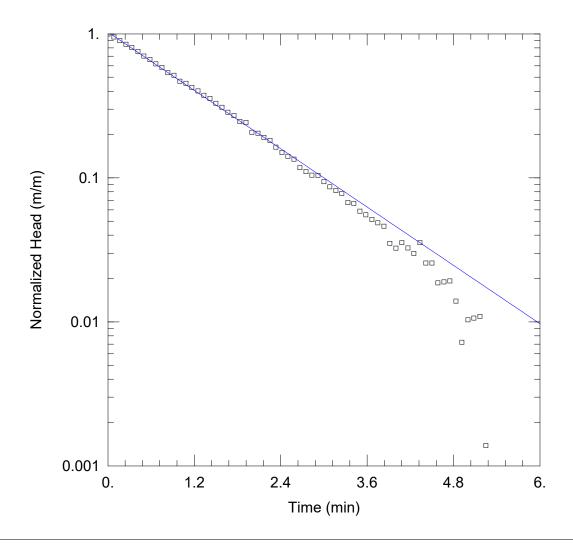

Data Set: P:\...\PG4216 BH10D-21 Falling Head 1 of 1.agt

Date: 02/26/25 Time: 16:20:38

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH10D-21 Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 2.375 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH10D-21)


Initial Displacement: 0.415 m Static Water Column Height: 2.375 m

Total Well Penetration Depth: 2.375 m Screen Length: 1.524 m Casing Radius: 0.0254 m Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 9.245E-6 m/sec y0 = 0.4272 m

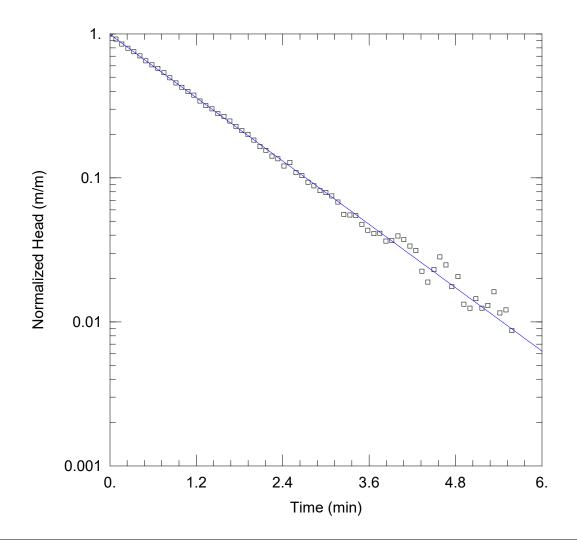

Data Set: P:\...\PG4216 BH10D-21 Rising Head 1 of 1.aqt

Date: 02/26/25 Time: 16:23:01

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH10D-21 Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 2.375 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH10D-21)


Initial Displacement: 0.45 m Static Water Column Height: 2.375 m

Total Well Penetration Depth: 2.375 m Screen Length: 1.524 m Casing Radius: 0.0254 m Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 1.004E-5 m/sec y0 = 0.4468 m

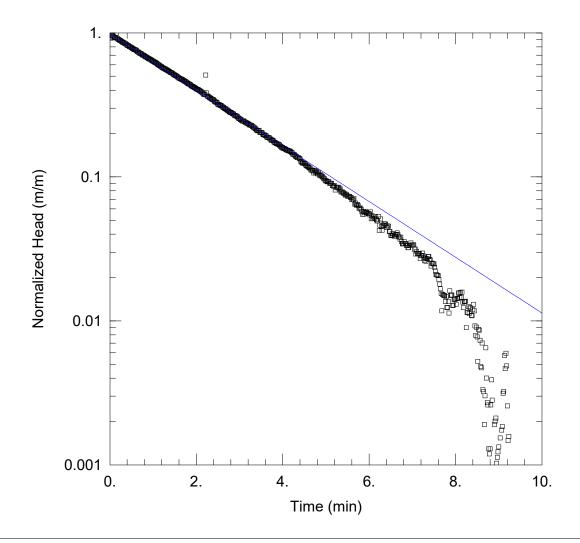

Data Set: P:\...\PG4216 BH11-24 Falling Head 1 of 1.aqt

Date: 02/26/25 Time: 16:24:14

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH11-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 4.585 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH11-24)

Initial Displacement: 0.487 m Static Water Column Height: 4.585 m


Total Well Penetration Depth: 4.585 m Screen Length: 1.524 m Casing Radius: 0.0254 m

Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 5.301E-6 m/secy0 = 0.4764 m

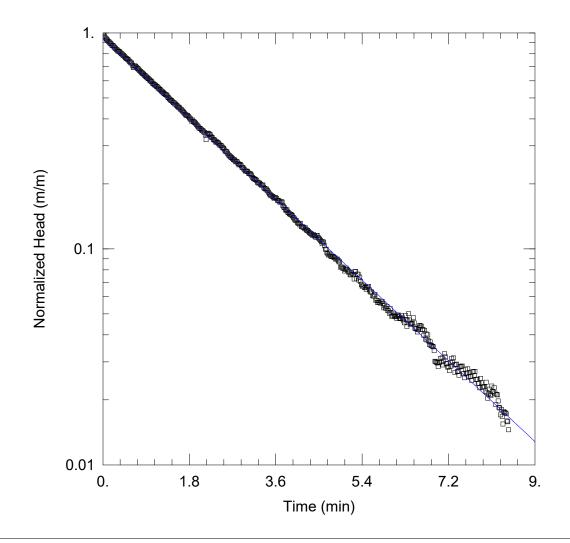

Data Set: P:\...\PG4216 BH11-24 Rising Head 1 of 1.aqt

Date: 02/26/25 Time: 16:25:47

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH11-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 4.58 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH11-24)

Initial Displacement: 0.498 m

Total Well Penetration Depth: 4.58 m

Casing Radius: 0.0254 m


Static Water Column Height: 4.58 m

Screen Length: 1.524 m Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 5.69E-6 m/sec y0 = 0.4732 m

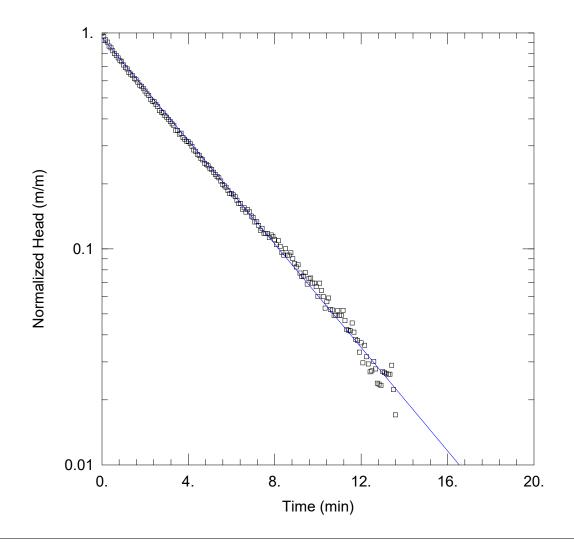

Data Set: P:\...\PG4216 BH12-24 Falling Head 1 of 1.aqt

Date: 02/26/25 Time: 16:26:49

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH12-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 5.855 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH12-24)

Initial Displacement: 0.442 m Static Water Column Height: 5.855 m


Total Well Penetration Depth: 5.855 m Screen Length: 1.524 m Casing Radius: 0.0254 m

Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 3.278E-6 m/secy0 = 0.4223 m

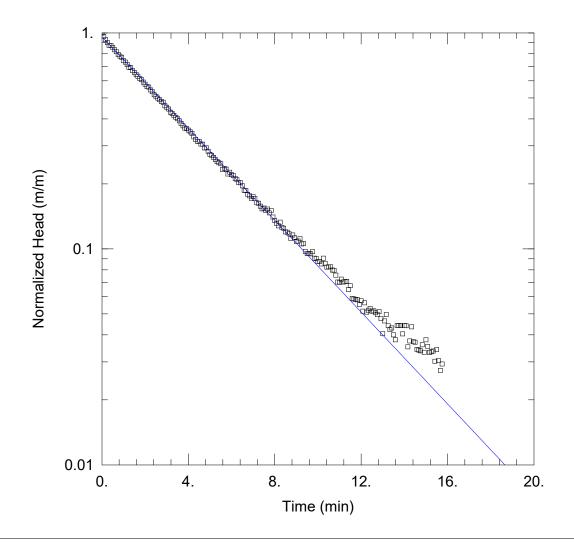

Data Set: P:\...\PG4216 BH12-24 Rising Head 1 of 1.aqt

Date: 02/26/25 Time: 16:29:31

PROJECT INFORMATION

Company: Paterson Group Client: Taggart Investments

Project: PG4216

Location: Eagleson Road at Ottawa Street

Test Well: BH12-24

Test Date: January 9, 2025

AQUIFER DATA

Saturated Thickness: 5.845 m Anisotropy Ratio (Kz/Kr): 1.

WELL DATA (BH12-24)

Initial Displacement: 0.467 m Static Water Column Height: 5.845 m

Total Well Penetration Depth: 5.845 m Screen Length: 1.524 m Casing Radius: 0.0254 m Well Radius: 0.1048 m

SOLUTION

Aquifer Model: Confined Solution Method: Hvorslev

K = 2.912E-6 m/sec y0 = 0.4493 m



APPENDIX 2

FIGURE 1 - KEY PLAN

GROUNDWATER MONITORING LEVELS

DRAWING PG4216-2 - TEST HOLE LOCATION PLAN

DRAWING PG4216-3 - PERMISSIBLE GRADE RAISE PLAN

DRAWING PG4216-4 - BEDROCK CONTOUR PLAN

DRAWING PG4216-5 - DESIGNATED SILTY CLAY AREAS

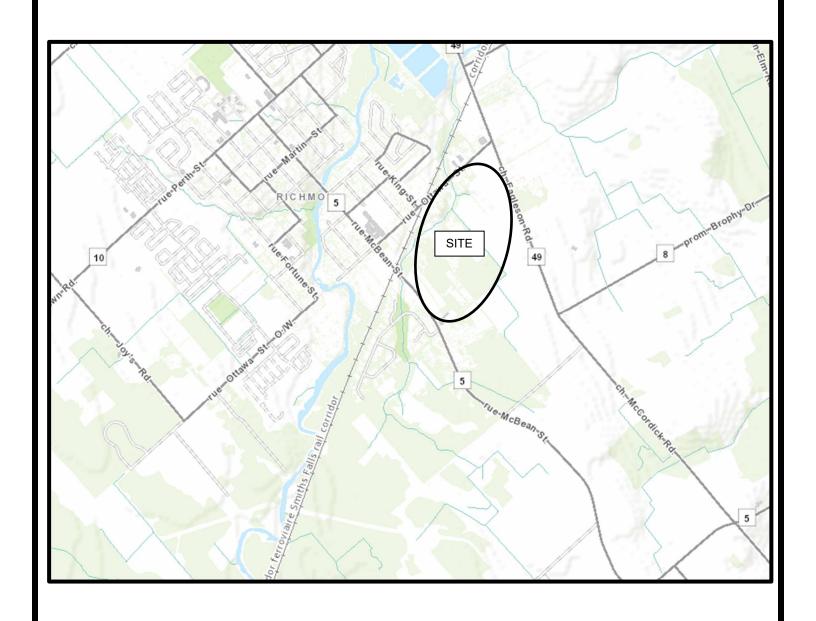


FIGURE 1

KEY PLAN



